



## MINNESOTA ENTERPRISE REAL PROPERTY STANDARDIZED FACILITY CONDITION ASSESSMENT (FCA) PROCESS

### THE ISSUE:

The State's previous method of assessing building conditions varied greatly by agency and in many cases resulted in subjective data. State employee assessors have varying backgrounds and experiences in the field of facilities management. Assessor's opinions often differ when completing a condition assessment, resulting in subjective evaluations of conditions. The State of Minnesota was in need of standard, self-maintained, Facility Condition Assessment (FCA) processes, reports, and measurements that result in consistent, accurate, real time information regarding the condition of real property in the State of Minnesota that can be easily utilized by State staff or contracted consultants.

### THE GOAL:

Specific goals included planning and development of cost effective processes for collecting FCA data including best practices, planning and development of standard data elements and reports, and definition of minimum qualifications for persons performing FCAs. The State of Minnesota utilizes ARCHIBUS software; all processes developed for FCAs had to result in either direct entry of data into Archibus or in a format that is completely compatible for direct upload into the Archibus database.

### THE SOLUTION:

Minnesota Enterprise Real Property (MN-ERP) contracted with Facility Engineering Associates (FEA) to evaluate the State of MN's current Facility Condition Assessment (FCA) process and recommend a new process that supports the goal. FEA recommended the Backlog of Maintenance and Repair (BMAR) FCA process as the best-fit FCA process for MN-ERP.

*"The 'BMAR FCA Process' is named after the process developed by NASA in the 1990s in response to the need to develop a more reliable FCA process with a reasonable level of effort."  
(FEA, 2013)*

### THE BENEFITS:

MN-ERP now has a New Standardized Facility Condition Assessment process based on creditable approaches, processes, and resources such as the BMAR FCA Process and RS-Means construction costs. By enhancing the Enterprise Real

Property ARCHIBUS application to support this new process, the State of MN will eventually have information to objectively determine and compare facility conditions across all state buildings. With this information, MN-ERP will now be able to determine which buildings are in the most critical condition and in need of maintenance, and objectively make decisions regarding maintenance fund distributions. The State will also eventually be able to use this information to help identify building assets at the end of their lifecycle and save on project costs by grouping needed repairs identified by FCAs.

## THE NEW PROCESS:

The MN-ERP New Standardized FCA Process is based on a BMAR FCA Process approach. The BMAR approach requires the following to develop and implement the process:

- **Development of 23 Cost Models;**
- **Standardizing how Current Replacement Value (CRV) will be calculated;**
- **An agreed upon 1-5 scoring method;**
- **Standardizing how Deferred Maintenance (DM) will be calculated;**
- **Standardizing a Facility Condition Index (FCI) calculation and ratings.**

---

### Development of 23 Cost Models:

FEA developed 23 cost models that can be applied to address the majority of the agencies buildings. The cost models are numbered M01 through M23 and each is based on a combination of type of construction and potential uses. The models are designed based on Level 3 UniFormat II building classification systems. RS-Means data was used to apply costs to the cost model's UniFormat classification system ids called cost model matrix ids, or system unit costs. The cost model matrix id costs/system unit costs are used to calculate CRV, DM and FCI.

---

### Standardizing how Current Replacement Value (CRV) will be calculated:

CRV is a calculated dollar amount representing the estimated cost to replace a building. CRV is based on RS-Means costs for basic Labor, Materials and Equipment. A system quantity is needed from the building being assessed and is applied as a multiplying factor to the system unit cost. Example: a system quantity for a building's foundation would be 100,000 square feet which is the building's footprint square footage. CRV is calculated as...

$$\text{BUILDING CRV} = (\text{SUM OF SYSTEMS CRV})$$

$$\text{SYSTEMS CRV} = (\text{SYSTEM UNIT COST} * \text{SYSTEM QUANTITY})$$

---

### **An agreed upon 1-5 scoring method:**

Systems are scored from 5 (best) to 1 (worst). The score is determined from a combination of conditions based on the established deficiency ranges and the rules established in the MN Field Reference Guide.

---

### **Standardizing how Deferred Maintenance (DM) will be calculated:**

Based on the standardization of cost models and the adoption of a rule-based rating system, the DM for a given system is algorithm-based, as required of a 'best practice' FCA process. Applied to each system for a given building, the process yields justifiable, repeatable results. DM is calculated as...

$$\text{BUILDING DM} = (\text{SUM OF SYSTEMS DM})$$

$$\text{SYSTEMS DM} = (\text{SYSTEM CRV} * \%DM)$$

*Condition rating 1 = 100% DM*

*Condition rating 2 = 75% DM*

*Condition rating 3 = 33% DM*

*Condition rating 4 = 10% DM*

*Condition rating 5 = 2% DM*

---

### Standardizing Facility Condition Index (FCI) calculation and ratings:

The industry-standard FCI is the condition metric calculated for each building. The FCI provides an excellent means for maintenance prioritization based on overall building conditions, and provides insight to problem areas, neglected building systems, or where maintenance needs to be applied based on limited funds. FCI is calculated as...

$$\text{BUILDING FCI} = (\text{SUM OF BUILDING DM}) / (\text{SUM OF BUILDING CRV})$$

#### Rating Scale:

**Excellent** = *Building FCI < 0.05*

**Good** = *0.05 < Building FCI < 0.15*

**Average** = *0.15 < Building FCI < 0.30*

**Poor** = *0.30 < Building FCI < 0.50*

**Crisis** = *Building FCI > 0.50*

Agency	Percentage of Completed FCA Square Footage	Totals for agency		Totals for FCAs	
B04-Department of Agriculture	100%	Total Building Count:	1	Total Completed Building FCA Count:	1
		Total Gross Square Footage:	8,304	Total Completed FCA Square Footage:	8,304
B13-Department of Commerce	100%	Total Building Count:	1	Total Completed Building FCA Count:	1
		Total Gross Square Footage:	3,216	Total Completed FCA Square Footage:	3,216
B22-Employment and Economic Development	55%	Total Building Count:	3	Total Completed Building FCA Count:	2
		Total Gross Square Footage:	49,087	Total Completed FCA Square Footage:	27,051
B43-Iron Range Resources	64%	Total Building Count:	70	Total Completed Building FCA Count:	31
		Total Gross Square Footage:	247,104	Total Completed FCA Square Footage:	159,162
B9D-Amateur Sports Commission	100%	Total Building Count:	25	Total Completed Building FCA Count:	25
		Total Gross Square Footage:	809,439	Total Completed FCA Square Footage:	809,439
E25-Perpich Center	100%	Total Building Count:	7	Total Completed Building FCA Count:	5
		Total Gross Square Footage:	176,361	Total Completed FCA Square Footage:	176,361
E40-Historical Society	74%	Total Building Count:	140	Total Completed Building FCA Count:	67
		Total Gross Square Footage:	854,406	Total Completed FCA Square Footage:	632,761
E44-Minnesota State Academies	0%	Total Building Count:	20	Total Completed Building FCA Count:	-
		Total Gross Square Footage:	436,058	Total Completed FCA Square Footage:	-
E77-MN Zoological Garden	100%	Total Building Count:	125	Total Completed Building FCA Count:	127
		Total Gross Square Footage:	648,243	Total Completed FCA Square Footage:	648,982
G02-Department of Administration	100%	Total Building Count:	30	Total Completed Building FCA Count:	30
		Total Gross Square Footage:	5,451,793	Total Completed FCA Square Footage:	5,451,793
G62-MN State Retirement Systems	100%	Total Building Count:	2	Total Completed Building FCA Count:	2
		Total Gross Square Footage:	259,837	Total Completed FCA Square Footage:	259,837
H55-Department of Human Services	18%	Total Building Count:	156	Total Completed Building FCA Count:	6
		Total Gross Square Footage:	3,333,893	Total Completed FCA Square Footage:	600,268
H75-MN Veterans Homes	100%	Total Building Count:	57	Total Completed Building FCA Count:	52
		Total Gross Square Footage:	939,749	Total Completed FCA Square Footage:	939,749
P01-Military Affairs	47%	Total Building Count:	666	Total Completed Building FCA Count:	68
		Total Gross Square Footage:	5,054,124	Total Completed FCA Square Footage:	2,361,561
P07-Department of Public Safety	100%	Total Building Count:	6	Total Completed Building FCA Count:	6
		Total Gross Square Footage:	20,360	Total Completed FCA Square Footage:	20,360
P78-Department of Corrections	100%	Total Building Count:	309	Total Completed Building FCA Count:	314
		Total Gross Square Footage:	5,973,676	Total Completed FCA Square Footage:	5,984,536
R29-Department of Natural Resources	100%	Total Building Count:	2,734	Total Completed Building FCA Count:	2,800
		Total Gross Square Footage:	1,204,972	Total Completed FCA Square Footage:	1,209,668
R32-Pollution Control Agency	100%	Total Building Count:	18	Total Completed Building FCA Count:	18
		Total Gross Square Footage:	-	Total Completed FCA Square Footage:	-
T79-Department of Transportation	100%	Total Building Count:	898	Total Completed Building FCA Count:	884
		Total Gross Square Footage:	6,161,057	Total Completed FCA Square Footage:	6,152,573
Totals	80%	Total Building Count:	5,268	Total Completed Building FCA Count:	4,439
		Total Gross Square Footage:	31,631,675	Total Completed FCA Square Footage:	25,445,619

All totals include buildings in a status of '1 Active-Owned' and '10 Active Under-Construction'.

P01-Military Affairs quantities for completed FCA square footage only includes State supported Armories.

T79-Department of Transportation quantities for completed FCA square footage does not include radio tower equipment facilities.


		FCI Rating Scoreboard					
Agency ID		Total	Crisis	Poor	Average	Good	Excellent
Total	Project - Count	4,439	257	685	1,524	1,519	454
	Exterior Gross SqFt	25,445,619	296,934	3,529,195	9,253,335	9,272,576	3,093,580
	Current Replacement Value	\$ 6,602,927,159	\$ 103,494,103	\$ 977,526,571	\$ 2,458,958,016	\$ 2,307,337,334	\$ 755,611,135
	Deferred Maintenance	\$ 1,226,436,509	\$ 61,630,950	\$ 377,182,190	\$ 539,765,690	\$ 225,519,403	\$ 22,338,276
B04-Department of Agriculture	Project - Count	1			1		
	Exterior Gross SqFt	8,304			8,304		
	Current Replacement Value	\$ 6,842,430			\$ 6,842,430		
	Deferred Maintenance	\$ 1,181,878			\$ 1,181,878		
B13-Department of Commerce	Project - Count	1		1			
	Exterior Gross SqFt	3,216		3,216			
	Current Replacement Value	\$ 749,018		\$ 749,018			
	Deferred Maintenance	\$ 305,693		\$ 305,693			
B22-Employment and Economic Development	Project - Count	2			1	1	
	Exterior Gross SqFt	27,051			20,726	6,325	
	Current Replacement Value	\$ 6,521,356			\$ 4,796,118	\$ 1,725,238	
	Deferred Maintenance	\$ 1,441,429			\$ 1,341,571	\$ 99,857	
B43-Iron Range Resources	Project - Count	31	5	14	7	4	1
	Exterior Gross SqFt	159,162	56,209	46,123	39,143	17,298	389.52
	Current Replacement Value	\$ 26,668,138	\$ 5,498,497	\$ 9,446,189	\$ 9,217,424	\$ 2,454,077	\$ 51,950
	Deferred Maintenance	\$ 9,052,355	\$ 3,665,150	\$ 3,337,100	\$ 1,823,323	\$ 224,258	\$ 2,524
B9D-Amateur Sports Commission	Project - Count	25	1	2	4	16	2
	Exterior Gross SqFt	809,439	2,385	5,447	556,411	222,675	22,521
	Current Replacement Value	\$ 159,056,067	\$ 147,615	\$ 1,150,719	\$ 112,684,389	\$ 40,015,919	\$ 5,057,424
	Deferred Maintenance	\$ 30,695,868	\$ 140,696	\$ 397,255	\$ 26,900,949	\$ 3,155,739	\$ 101,229
E25-Perpich Center	Project - Count	5			3	1	1
	Exterior Gross SqFt	176,361			124,953	46,968	4,440
	Current Replacement Value	\$ 35,544,027			\$ 24,628,423	\$ 10,339,368	\$ 576,237
	Deferred Maintenance	\$ 6,453,461			\$ 5,711,316	\$ 730,621	\$ 11,525
E40-Historical Society	Project - Count	67	2	7	31	20	7
	Exterior Gross SqFt	632,761	0	30,835	73,081	528,845	0
	Current Replacement Value	\$ 144,813,918	\$ 1,898,108	\$ 13,701,338	\$ 25,961,607	\$ 97,792,838	\$ 5,460,027
	Deferred Maintenance	\$ 26,596,779	\$ 1,222,580	\$ 5,822,791	\$ 5,935,538	\$ 13,506,669	\$ 109,201
E44-Minnesota State Academies	Project - Count	0					
	Exterior Gross SqFt	0					
	Current Replacement Value	\$ -					
	Deferred Maintenance	\$ -					
E77-MN Zoological Garden	Project - Count	127	4	5	39	58	21
	Exterior Gross SqFt	648,982	3,960	11,870	340,423	249,957	42,772
	Current Replacement Value	\$ 170,338,091	\$ 1,151,595	\$ 4,123,238	\$ 97,392,663	\$ 59,552,412	\$ 8,118,183
	Deferred Maintenance	\$ 28,756,722	\$ 657,804	\$ 1,318,870	\$ 20,691,870	\$ 5,814,407	\$ 273,771
G02-Department of Administration	Project - Count	30	1	2	8	14	5
	Exterior Gross SqFt	5,451,793	57,143	883,704	996,043	2,025,484	1,489,419
	Current Replacement Value	\$ 1,138,357,404	\$ 13,527,473	\$ 179,632,112	\$ 202,854,280	\$ 445,509,598	\$ 296,833,941
	Deferred Maintenance	\$ 186,760,010	\$ 9,183,619	\$ 84,801,293	\$ 46,362,405	\$ 37,694,037	\$ 8,718,655



Agency ID		Total	Crisis	Poor	Average	Good	Excellent
G62-MN State Retirement Systems	Project - Count	2				2	
	Exterior Gross SqFt	259,837				259,837	
	Current Replacement Value	\$ 43,709,831				\$ 43,709,831	
	Deferred Maintenance	\$ 2,571,643				\$ 2,571,643	
H55-Department of Human Services	Project - Count	6		2	3	1	
	Exterior Gross SqFt	600,268		68,788	440,451	91,029	
	Current Replacement Value	\$ 153,844,488		\$ 14,220,148	\$ 110,029,934	\$ 29,594,406	
	Deferred Maintenance	\$ 29,303,576		\$ 5,129,571	\$ 20,281,613	\$ 3,892,392	
H75-MN Veterans Homes	Project - Count	52	6	4	13	25	4
	Exterior Gross SqFt	939,749	18,374	53,263	390,338	321,498	156,276
	Current Replacement Value	\$ 263,726,912	\$ 4,366,430	\$ 12,579,493	\$ 96,504,521	\$ 82,759,458	\$ 67,517,010
	Deferred Maintenance	\$ 35,676,818	\$ 2,721,108	\$ 4,113,915	\$ 18,332,715	\$ 8,505,015	\$ 2,004,065
P01-Military Affairs	Project - Count	68		28	23	16	1
	Exterior Gross SqFt	2,361,561		961,274	806,699	468,318	125,269
	Current Replacement Value	\$ 581,663,784		\$ 223,267,600	\$ 180,835,315	\$ 143,545,565	\$ 34,015,304
	Deferred Maintenance	\$ 141,965,194		\$ 80,604,885	\$ 45,362,514	\$ 15,055,962	\$ 941,834
P07-Department of Public Safety	Project - Count	6			4	2	
	Exterior Gross SqFt	20,360			19,082	1,277	
	Current Replacement Value	\$ 4,392,060			\$ 4,279,046	\$ 113,014	
	Deferred Maintenance	\$ 909,407			\$ 897,480	\$ 11,927	
P78-Department of Corrections	Project - Count	314	12	46	141	92	23
	Exterior Gross SqFt	5,984,536	97,320	1,165,551	2,595,745	1,757,527	368,393
	Current Replacement Value	\$ 2,105,720,240	\$ 48,776,448	\$ 401,967,769	\$ 930,671,151	\$ 592,281,130	\$ 132,023,743
	Deferred Maintenance	\$ 448,018,708	\$ 26,545,855	\$ 149,879,840	\$ 210,885,030	\$ 56,090,540	\$ 4,617,444
R29-Department of Natural Resources	Project - Count	2,800	205	522	995	822	256
	Exterior Gross SqFt	1,209,668	45,030	194,253	428,913	397,609	143,862
	Current Replacement Value	\$ 577,503,996	\$ 26,530,308	\$ 92,925,098	\$ 196,511,432	\$ 201,012,596	\$ 60,524,563
	Deferred Maintenance	\$ 116,687,975	\$ 16,544,013	\$ 33,352,471	\$ 42,830,629	\$ 22,161,369	\$ 1,799,494
R32-Pollution Control Agency	Project - Count	18			3	14	1
	Exterior Gross SqFt	0			0	0	0
	Current Replacement Value	\$ 2,869,361			\$ 1,079,887	\$ 1,783,632	\$ 5,841
	Deferred Maintenance	\$ 490,905			\$ 270,542	\$ 220,246	\$ 117
T79-Department of Transportation	Project - Count	884	21	52	248	431	132
	Exterior Gross SqFt	6,152,573	16,513	104,872	2,413,021	2,877,931	740,237
	Current Replacement Value	\$ 1,180,606,038	\$ 1,597,627	\$ 23,763,850	\$ 454,669,396	\$ 555,148,253	\$ 145,426,912
	Deferred Maintenance	\$ 159,568,088	\$ 950,124	\$ 8,118,506	\$ 90,956,318	\$ 55,784,721	\$ 3,758,419

This report was created on 9/8/2016.

The Capitol Building is included in FCA totals.

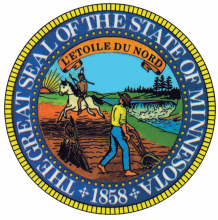

## Facility Condition Assessments (FCA) by Agency

STATE OF MINNESOTA - 9/8/2016

**Report Note:** This report includes all agency facility condition assessment totals for all agencies with assessed buildings. This report is intended to be used for Enterprise FCA reporting. Report is grouped by agency name and ordered by ascending agency code.

### Agency: B04 - Agriculture

FCI Rating: **Average**  
Facility Condition Index: 0.17

Current Replacement Value: \$6,842,430  
Deferred Maintenance: \$1,181,878

Ext. Gross Area: 8,304  
Building Count: 1

### Agency: B13 - Department of Commerce

FCI Rating: **Poor**  
Facility Condition Index: 0.41

Current Replacement Value: \$749,018  
Deferred Maintenance: \$305,693

Ext. Gross Area: 3,216  
Building Count: 1

### Agency: B22 - Department of Employment & Economic Development

FCI Rating: **Average**  
Facility Condition Index: 0.22

Current Replacement Value: \$6,521,356  
Deferred Maintenance: \$1,441,429

Ext. Gross Area: 27,051  
Building Count: 2

### Agency: B43 - Iron Range Resource

FCI Rating: **Poor**  
Facility Condition Index: 0.34

Current Replacement Value: \$26,668,138  
Deferred Maintenance: \$9,052,355

Ext. Gross Area: 159,162  
Building Count: 31

### Agency: B9D - Amateur Sports Commission

FCI Rating: **Average**  
Facility Condition Index: 0.19

Current Replacement Value: \$159,056,067  
Deferred Maintenance: \$30,695,868

Ext. Gross Area: 809,439  
Building Count: 25

### Agency: E25 - Perpich Center

FCI Rating: **Average**  
Facility Condition Index: 0.18

Current Replacement Value: \$35,544,027  
Deferred Maintenance: \$6,453,461

Ext. Gross Area: 176,361  
Building Count: 5

### Agency: E40 - Historical Society

FCI Rating: **Average**  
Facility Condition Index: 0.18

Current Replacement Value: \$144,813,918  
Deferred Maintenance: \$26,596,779

Ext. Gross Area: 632,761  
Building Count: 67

### Agency: E77 - Minnesota Zoological Garden

FCI Rating: **Average**  
Facility Condition Index: 0.17

Current Replacement Value: \$170,338,091  
Deferred Maintenance: \$28,756,722

Ext. Gross Area: 648,982  
Building Count: 127



---

**Agency: G02 - Department of Administration**

FCI Rating: **Average**  
Facility Condition Index: 0.16

Current Replacement Value: \$1,138,357,404  
Deferred Maintenance: \$186,760,010

Ext. Gross Area: 5,451,793  
Building Count: 30

---

**Agency: G62 - MN State Retirement Systems**

FCI Rating: **Good**  
Facility Condition Index: 0.06

Current Replacement Value: \$43,709,831  
Deferred Maintenance: \$2,571,643

Ext. Gross Area: 259,837  
Building Count: 2

---

**Agency: H55 - Department of Human Services**

FCI Rating: **Average**  
Facility Condition Index: 0.19

Current Replacement Value: \$153,844,488  
Deferred Maintenance: \$29,303,576

Ext. Gross Area: 600,268  
Building Count: 6

---

**Agency: H75 - Minnesota Veterans Affairs**

FCI Rating: **Good**  
Facility Condition Index: 0.14

Current Replacement Value: \$263,726,912  
Deferred Maintenance: \$35,676,818

Ext. Gross Area: 939,749  
Building Count: 52

---

**Agency: P01 - Military Affairs**

FCI Rating: **Average**  
Facility Condition Index: 0.24

Current Replacement Value: \$581,663,784  
Deferred Maintenance: \$141,965,194

Ext. Gross Area: 2,361,561  
Building Count: 68

---

**Agency: P07 - Public Safety**

FCI Rating: **Average**  
Facility Condition Index: 0.21

Current Replacement Value: \$4,392,060  
Deferred Maintenance: \$909,407

Ext. Gross Area: 20,360  
Building Count: 6

---

**Agency: P78 - Department of Corrections**

FCI Rating: **Average**  
Facility Condition Index: 0.21

Current Replacement Value: \$2,105,720,240  
Deferred Maintenance: \$448,018,708

Ext. Gross Area: 5,984,536  
Building Count: 314

---

**Agency: R29 - Department of Natural Resources**

FCI Rating: **Average**  
Facility Condition Index: 0.20

Current Replacement Value: \$577,503,996  
Deferred Maintenance: \$116,687,975

Ext. Gross Area: 1,209,668  
Building Count: 2,800

---

**Agency: R32 - Pollution Control Agency**

FCI Rating: **Average**  
Facility Condition Index: 0.17

Current Replacement Value: \$2,869,361  
Deferred Maintenance: \$490,905

Ext. Gross Area: 0  
Building Count: 18

---


**Agency: T79 - Department of Transportation**

FCI Rating: **Good**  
Facility Condition Index: 0.14

Current Replacement Value: \$1,180,606,038  
Deferred Maintenance: \$159,568,088

Ext. Gross Area: 6,152,573  
Building Count: 884

---

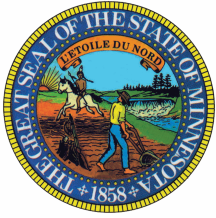

# Facility Condition Assessments (FCA) by Building

STATE OF MINNESOTA - 9/8/2016

**Report Note:** This report includes all agency facility condition assessment totals for each agency and each building assessed. This report is intended to be used for Enterprise FCA reporting. Report is grouped by agency name and site code, and ordered by ascending building code.

**Agency: B04 - Agriculture**

<b>FCI Rating:</b>	Average	<b>Current Replacement Value:</b>	\$6,842,430	<b>Ext. Gross Area:</b>	8,304
<b>Facility Condition Index:</b>	0.17	<b>Deferred Maintenance:</b>	\$1,181,878	<b>Building Count:</b>	1

**Site: B04100 - East Grand Forks**

<b>Building Code:</b>	B0410000312	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$6,842,430
<b>Building Name:</b>	East Grand Forks Potato Inspection	<b>Address:</b>	312 4th Ave NE	<b>Deferred Maintenance:</b>	\$1,181,878
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	8,304

Agency: B13 - Department of Commerce

FCI Rating:	Poor	Current Replacement Value:	\$749,018	Ext. Gross Area:	3,216
Facility Condition Index:	0.41	Deferred Maintenance:	\$305,693	Building Count:	1

Site: B13000 - Master Scale

Building Code:	B1300000001	Cost Model Name:	Single-story Office/Public Access Facility	Current Replacement Value:	\$749,018
Building Name:	Master Scale	Address:	475 Prior Ave	Deferred Maintenance:	\$305,693
Facility Condition Index:	0.41 - Poor	City Code:	ST. PAUL	Ext. Gross Area:	3,216

Agency: B22 - Department of Employment & Economic Development

FCI Rating:	Average	Current Replacement Value:	\$6,521,356	Ext. Gross Area:	27,051
Facility Condition Index:	0.22	Deferred Maintenance:	\$1,441,429	Building Count:	2

Site: B22000 - St. Cloud UI Call Center

Building Code:	B2200000427	Cost Model Name:	Single-story Office/Public Access Facility	Current Replacement Value:	\$1,725,238
Building Name:	Unemployment Call Center	Address:	111 Lincoln Ave	Deferred Maintenance:	\$99,857
Facility Condition Index:	0.06 - Good	City Code:	St. Cloud	Ext. Gross Area:	6,325

Site: B22001 - Minneapolis South WFC

Building Code:	B2200000227	Cost Model Name:	Low-rise Office Building, 2 to 4 story	Current Replacement Value:	\$4,796,118
Building Name:	Mpls South Service Office	Address:	777 East Lake Street	Deferred Maintenance:	\$1,341,571
Facility Condition Index:	0.28 - Average	City Code:	Minneapolis	Ext. Gross Area:	20,726

## Agency: B43 - Iron Range Resource

FCI Rating: **Poor**  
Facility Condition Index: 0.34

Current Replacement Value: \$26,668,138  
Deferred Maintenance: \$9,052,355

Ext. Gross Area: 159,162  
Building Count: 31

### Site: B43000 - Mineland Reclamation & Ironworld

Building Code:	B4300000269	Cost Model Name:	Single-story Office/Public Access Facility	Current Replacement Value:	\$32,000
Building Name:	Fest Park/Grounds	Address:	Hwy 169	Deferred Maintenance:	\$16,040
Facility Condition Index:	0.50 - <b>Crisis</b>	City Code:	Chisholm	Ext. Gross Area:	0
Building Code:	B4300000469	Cost Model Name:	Recreation Center	Current Replacement Value:	\$4,864,492
Building Name:	Amphitheatre	Address:	Hwy 169	Deferred Maintenance:	\$1,607,804
Facility Condition Index:	0.33 - <b>Poor</b>	City Code:	Chisholm	Ext. Gross Area:	23,542
Building Code:	B4300000669	Cost Model Name:	Multi-story Educational Facility	Current Replacement Value:	\$3,530,425
Building Name:	Interp Ctr	Address:	Hwy 169	Deferred Maintenance:	\$2,465,045
Facility Condition Index:	0.70 - <b>Crisis</b>	City Code:	Chisholm	Ext. Gross Area:	41,410
Building Code:	B4300000769	Cost Model Name:	Single-story Office/Public Access Facility	Current Replacement Value:	\$174,955
Building Name:	Geology Wing	Address:	Hwy 169	Deferred Maintenance:	\$85,054
Facility Condition Index:	0.49 - <b>Poor</b>	City Code:	Chisholm	Ext. Gross Area:	0
Building Code:	B4300001069	Cost Model Name:	Single-story Work Facility	Current Replacement Value:	\$863,275
Building Name:	Energy Bldg	Address:	Hwy 169	Deferred Maintenance:	\$218,764
Facility Condition Index:	0.25 - <b>Average</b>	City Code:	Chisholm	Ext. Gross Area:	0
Building Code:	B4300001469	Cost Model Name:	Single-story Work Facility	Current Replacement Value:	\$311,350
Building Name:	Railroad Maint Bldg	Address:	Hwy 169	Deferred Maintenance:	\$129,724
Facility Condition Index:	0.42 - <b>Poor</b>	City Code:	Chisholm	Ext. Gross Area:	0
Building Code:	B4300001569	Cost Model Name:	Low-rise Office Building, 2 to 4 story	Current Replacement Value:	\$890,664
Building Name:	Research Library	Address:	Hwy 169	Deferred Maintenance:	\$514,373
Facility Condition Index:	0.58 - <b>Crisis</b>	City Code:	Chisholm	Ext. Gross Area:	14,798
Building Code:	B4300001669	Cost Model Name:	Single-story Office/Public Access Facility	Current Replacement Value:	\$59,671
Building Name:	CCC Building	Address:	Hwy 169	Deferred Maintenance:	\$21,035
Facility Condition Index:	0.35 - <b>Poor</b>	City Code:	Chisholm	Ext. Gross Area:	0
Building Code:	B4300002069	Cost Model Name:	Single-story Office/Public Access Facility	Current Replacement Value:	\$871,456
Building Name:	Ethnic Arts Center	Address:	Hwy 169	Deferred Maintenance:	\$574,091
Facility Condition Index:	0.66 - <b>Crisis</b>	City Code:	Chisholm	Ext. Gross Area:	0
Building Code:	B4300002169	Cost Model Name:	Butler-style Warehouse Building	Current Replacement Value:	\$213,231
Building Name:	Amph Maint	Address:	Hwy 169	Deferred Maintenance:	\$82,854
Facility Condition Index:	0.39 - <b>Poor</b>	City Code:	Chisholm	Ext. Gross Area:	1,827

<b>Building Code:</b>	B4300002669	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$305,892
<b>Building Name:</b>	Pavilion	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$53,886
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	6,112
<b>Building Code:</b>	B4300002869	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$7,037
<b>Building Name:</b>	Warehouse	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$2,322
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	6,794
<b>Building Code:</b>	B4300003069	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$3,507,959
<b>Building Name:</b>	Mineland Recreation	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$1,295,597
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	8,626
<b>Building Code:</b>	B4300003269	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$173,953
<b>Building Name:</b>	Children Play Area Bldg	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$95,600
<b>Facility Condition Index:</b>	0.55 - Crisis	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	B4300003369	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$47,437
<b>Building Name:</b>	Wilpen Depot	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$15,654
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	B4300003469	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$84,065
<b>Building Name:</b>	Depot Bathrooms	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$37,461
<b>Facility Condition Index:</b>	0.45 - Poor	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	B4300003569	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$88,343
<b>Building Name:</b>	Exhibit Storage	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$29,153
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	4,726
<b>Building Code:</b>	B4300003769	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$73,947
<b>Building Name:</b>	Bunk House	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$15,457
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	433
<b>Building Code:</b>	B4300003869	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$657
<b>Building Name:</b>	Trappers Shack	<b>Address:</b>	Hwy 169	<b>Deferred Maintenance:</b>	\$217
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Chisholm	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	B4300003969	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$2,053
<b>Building Name:</b>	Gazebo	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$678
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CHISHOLM	<b>Ext. Gross Area:</b>	0

**Site: B43001 - Giants Ridge**

<b>Building Code:</b>	B4300100168	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$37,412
<b>Building Name:</b>	Calgary Lift Bldg - Bottom	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$14,953
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	55



<b>Building Code:</b>	B4300101869	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,808,009
<b>Building Name:</b>	Maintenance Bldg	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$399,507
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	8,061
<b>Building Code:</b>	B4300103969	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$113,411
<b>Building Name:</b>	Bunker Bldg.	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$24,130
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	324
<b>Building Code:</b>	B4300104069	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$50,433
<b>Building Name:</b>	Quarry Pump House	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$4,178
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	405
<b>Building Code:</b>	B4300104269	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$47,527
<b>Building Name:</b>	Soil Bin Bldg.	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$14,595
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	554
<b>Building Code:</b>	B4300104369	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$2,141,412
<b>Building Name:</b>	Burnt Onion Maint. Bldg.	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$198,880
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	14,565
<b>Building Code:</b>	B4300104469	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$51,950
<b>Building Name:</b>	Legend Pump House	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$2,524
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	390
<b>Building Code:</b>	B4300105169	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$108,988
<b>Building Name:</b>	Nordic Timing Bldg.	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$10,796
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	1,284
<b>Building Code:</b>	B4300105569	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$153,244
<b>Building Name:</b>	GR Pump House	<b>Address:</b>	Co. Road 138	<b>Deferred Maintenance:</b>	\$10,404
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	Biwabik	<b>Ext. Gross Area:</b>	1,044

**Site: B43002 - Administration**

<b>Building Code:</b>	B4300200169	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$617,540
<b>Building Name:</b>	Morton Storage Bldg	<b>Address:</b>	HWY 53 South	<b>Deferred Maintenance:</b>	\$166,656
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	Eveleth	<b>Ext. Gross Area:</b>	6,247
<b>Building Code:</b>	B4300201169	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$5,435,350
<b>Building Name:</b>	Administration Bldg	<b>Address:</b>	HWY 53 South	<b>Deferred Maintenance:</b>	\$944,923
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	Eveleth	<b>Ext. Gross Area:</b>	17,965

## Agency: B9D - Amateur Sports Commission

**FCI Rating:** Average  
**Facility Condition Index:** 0.19

**Current Replacement Value:** \$159,056,067  
**Deferred Maintenance:** \$30,695,868

**Ext. Gross Area:** 809,439  
**Building Count:** 25

### Site: B9D170 - Amateur Sports Blaine

**Building Code:** B9D17000100  
**Building Name:** Sports Hall  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Recreation Center  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$23,260,268  
**Deferred Maintenance:** \$1,889,053  
**Ext. Gross Area:** 146,884

**Building Code:** B9D17000101  
**Building Name:** Stadium  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Parking Structure  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$4,457,927  
**Deferred Maintenance:** \$968,876  
**Ext. Gross Area:** 40,407

**Building Code:** B9D17000102  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Multi-story Dormitory  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$4,079,782  
**Deferred Maintenance:** \$469,040  
**Ext. Gross Area:** 20,514

**Building Code:** B9D17000103  
**Building Name:** Bike Track  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Open Air Shelter  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$5,443,974  
**Deferred Maintenance:** \$1,211,140  
**Ext. Gross Area:** 23,056

**Building Code:** B9D17000104  
**Building Name:** Maintenance Shed  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$290,964  
**Deferred Maintenance:** \$28,790  
**Ext. Gross Area:** 2,445

**Building Code:** B9D17000105  
**Building Name:** Pump House #1  
**Facility Condition Index:** 0.32 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$19,191  
**Deferred Maintenance:** \$6,071  
**Ext. Gross Area:** 441

**Building Code:** B9D17000107  
**Building Name:** Event Center  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$10,843,695  
**Deferred Maintenance:** \$651,102  
**Ext. Gross Area:** 42,108

**Building Code:** B9D17000108  
**Building Name:** Super Rink  
**Facility Condition Index:** 0.27 - Average

**Cost Model Name:** Recreation Center  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$53,393,582  
**Deferred Maintenance:** \$14,521,624  
**Ext. Gross Area:** 250,000

**Building Code:** B9D17000109  
**Building Name:** Super Rink Addition  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Recreation Center  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$49,388,907  
**Deferred Maintenance:** \$10,199,308  
**Ext. Gross Area:** 242,947

**Building Code:** B9D17000110  
**Building Name:** Club House  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$1,047,407  
**Deferred Maintenance:** \$70,710  
**Ext. Gross Area:** 5,850

<b>Building Code:</b>	B9D17000111	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,131,528
<b>Building Name:</b>	Turf Maintenance	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$391,184
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	5,006
<b>Building Code:</b>	B9D17000112	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$104,765
<b>Building Name:</b>	Pump House #2	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$7,568
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	121
<b>Building Code:</b>	B9D17000113	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$147,686
<b>Building Name:</b>	Club House Concession	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$18,296
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	474
<b>Building Code:</b>	B9D17000114	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$147,615
<b>Building Name:</b>	Turf Maintenance Shed	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$140,696
<b>Facility Condition Index:</b>	0.95 - Crisis	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	2,385
<b>Building Code:</b>	B9D17000115	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,923
<b>Building Name:</b>	Velodrome Concessions	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$399
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	226
<b>Building Code:</b>	B9D17000116	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$46,123
<b>Building Name:</b>	Velodrome Press Box	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$2,555
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	560
<b>Building Code:</b>	B9D17000117	<b>Cost Model Name:</b>	Recreation Center	<b>Current Replacement Value:</b>	\$5,041,501
<b>Building Name:</b>	Event Center Expansion	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$100,830
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	22,296
<b>Building Code:</b>	B9D17000118	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$48,243
<b>Building Name:</b>	Picnic Shelter D	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$6,331
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	1,092
<b>Building Code:</b>	B9D17000119	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$48,243
<b>Building Name:</b>	Picnic Shelter E	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$4,143
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	1,092
<b>Building Code:</b>	B9D17000120	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$16,071
<b>Building Name:</b>	Picnic Shelter H	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$1,351
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	256
<b>Building Code:</b>	B9D17000121	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$16,071
<b>Building Name:</b>	Picnic Shelter I	<b>Address:</b>	1700 105th Ave NE	<b>Deferred Maintenance:</b>	\$1,351
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	BLAINE	<b>Ext. Gross Area:</b>	256

**Building Code:** B9D17000122  
**Building Name:** Picnic Shelter J  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** B9D17000123  
**Building Name:** Picnic Shelter K  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** B9D17000124  
**Building Name:** Picnic Shelter L  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** B9D17000125  
**Building Name:** Picnic Shelter M  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Shelter  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Cost Model Name:** Open Air Shelter  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Cost Model Name:** Open Air Shelter  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Cost Model Name:** Open Air Shelter  
**Address:** 1700 105th Ave NE  
**City Code:** BLAINE

**Current Replacement Value:** \$16,071  
**Deferred Maintenance:** \$1,351  
**Ext. Gross Area:** 256

**Current Replacement Value:** \$16,842  
**Deferred Maintenance:** \$1,366  
**Ext. Gross Area:** 256

**Current Replacement Value:** \$16,842  
**Deferred Maintenance:** \$1,366  
**Ext. Gross Area:** 256

**Current Replacement Value:** \$16,842  
**Deferred Maintenance:** \$1,366  
**Ext. Gross Area:** 256

**Agency: E25 - Perpich Center**

**FCI Rating:** Average  
**Facility Condition Index:** 0.18

**Current Replacement Value:** \$35,544,027  
**Deferred Maintenance:** \$6,453,461

**Ext. Gross Area:** 176,361  
**Building Count:** 5

---

**Site: E25000 - Perpich Center for Arts Education**

**Building Code:** E2500000327  
**Building Name:** Gaia - PDI/RAC  
**Facility Condition Index:** 0.24 - Average

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 6105 Olson Memorial Highway  
**City Code:** Golden Valley

**Current Replacement Value:** \$4,354,508  
**Deferred Maintenance:** \$1,036,392  
**Ext. Gross Area:** 14,771

**Building Code:** E2500000427  
**Building Name:** Delta - Dormitory  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Multi-story Dormitory  
**Address:** 6135 Olson Memorial Highway  
**City Code:** Golden Valley

**Current Replacement Value:** \$8,095,111  
**Deferred Maintenance:** \$2,031,866  
**Ext. Gross Area:** 44,342

**Building Code:** E2500000627  
**Building Name:** Administration-East  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 6125 Olson Memorial Highway  
**City Code:** Golden Valley

**Current Replacement Value:** \$12,178,803  
**Deferred Maintenance:** \$2,643,057  
**Ext. Gross Area:** 65,840

**Building Code:** E2500000727  
**Building Name:** Administration-West  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 6125 Olson Memorial Highway  
**City Code:** Golden Valley

**Current Replacement Value:** \$10,339,368  
**Deferred Maintenance:** \$730,621  
**Ext. Gross Area:** 46,968

**Building Code:** E2500000827  
**Building Name:** Warehouse  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 6153 Olson Memorial Highway  
**City Code:** GOLDEN VALLEY

**Current Replacement Value:** \$576,237  
**Deferred Maintenance:** \$11,525  
**Ext. Gross Area:** 4,440

**Agency: E40 - Historical Society**

**FCI Rating:** Average  
**Facility Condition Index:** 0.18

**Current Replacement Value:** \$144,813,918  
**Deferred Maintenance:** \$26,596,779

**Ext. Gross Area:** 632,761  
**Building Count:** 67

**Site: E40001 - Solomon Comstock House**

**Building Code:** E4000100101  
**Building Name:** Ice House  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 508 8th Street South  
**City Code:** Moorhead

**Current Replacement Value:** \$102,594  
**Deferred Maintenance:** \$13,576  
**Ext. Gross Area:** 0

**Building Code:** E4000100102  
**Building Name:** Comstock House  
**Facility Condition Index:** 0.67 - Crisis

**Cost Model Name:** Single-family Residence  
**Address:** 508 8th Street South  
**City Code:** Moorhead

**Current Replacement Value:** \$1,187,247  
**Deferred Maintenance:** \$800,637  
**Ext. Gross Area:** 0

**Site: E40002 - W. H. Folsom House**

**Building Code:** E4000200201  
**Building Name:** Folsom Garage  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 272 West Government Street  
**City Code:** Taylors Falls

**Current Replacement Value:** \$55,395  
**Deferred Maintenance:** \$11,456  
**Ext. Gross Area:** 0

**Building Code:** E4000200202  
**Building Name:** Folsom House  
**Facility Condition Index:** 0.29 - Average

**Cost Model Name:** Single-family Residence  
**Address:** 272 West Government Street  
**City Code:** Taylors Falls

**Current Replacement Value:** \$831,902  
**Deferred Maintenance:** \$240,051  
**Ext. Gross Area:** 0

**Building Code:** E4000200203  
**Building Name:** Well House  
**Facility Condition Index:** 0.24 - Average

**Cost Model Name:** Open Air Shelter  
**Address:** 272 West Government Street  
**City Code:** Taylors Falls

**Current Replacement Value:** \$7,148  
**Deferred Maintenance:** \$1,750  
**Ext. Gross Area:** 0

**Site: E40004 - Fort Ridgely**

**Building Code:** E4000400401  
**Building Name:** Commissary  
**Facility Condition Index:** 0.18 - Average

**Cost Model Name:** Single-family Residence  
**Address:** Rt. 1, Box 65  
**City Code:** Fairfax

**Current Replacement Value:** \$1,821,463  
**Deferred Maintenance:** \$335,520  
**Ext. Gross Area:** 0

**Building Code:** E4000400402  
**Building Name:** Powder Magazine  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-family Residence  
**Address:** Rt. 1, Box 65  
**City Code:** Fairfax

**Current Replacement Value:** \$56,328  
**Deferred Maintenance:** \$5,633  
**Ext. Gross Area:** 0

**Site: E40005 - Grand Mound**

**Building Code:** E4000500501  
**Building Name:** Visitor Center  
**Facility Condition Index:** 0.59 - Crisis

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 6749 Highway 11  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$710,861  
**Deferred Maintenance:** \$421,943  
**Ext. Gross Area:** 0



**Building Code:** E4000500503  
**Building Name:** Storage Shed  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 6749 Highway 11  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$14,359  
**Deferred Maintenance:** \$3,671  
**Ext. Gross Area:** 0

**Site: E40007 - Harkin Store**

**Building Code:** E4000700701  
**Building Name:** Harkin Store  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** Box 112  
**City Code:** New Ulm

**Current Replacement Value:** \$182,298  
**Deferred Maintenance:** \$34,941  
**Ext. Gross Area:** 0

**Building Code:** E4000700702  
**Building Name:** Harkin Residence  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** Box 112  
**City Code:** New Ulm

**Current Replacement Value:** \$991,313  
**Deferred Maintenance:** \$233,156  
**Ext. Gross Area:** 0

**Site: E40008 - Historic Forestville**

**Building Code:** E4000800801  
**Building Name:** Wagon Barn  
**Facility Condition Index:** 0.23 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** Forestville State Park  
**City Code:** Preston

**Current Replacement Value:** \$61,727  
**Deferred Maintenance:** \$14,388  
**Ext. Gross Area:** 0

**Building Code:** E4000800802  
**Building Name:** Granary  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** Forestville State Park  
**City Code:** Preston

**Current Replacement Value:** \$30,145  
**Deferred Maintenance:** \$5,416  
**Ext. Gross Area:** 0

**Building Code:** E4000800804  
**Building Name:** Barn  
**Facility Condition Index:** 0.30 - *Poor*

**Cost Model Name:** Open Air Storage Structure  
**Address:** Forestville State Park  
**City Code:** Preston

**Current Replacement Value:** \$173,638  
**Deferred Maintenance:** \$52,460  
**Ext. Gross Area:** 0

**Building Code:** E4000800806  
**Building Name:** Outhouse  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Single-story Restroom Facility  
**Address:** Forestville State Park  
**City Code:** Preston

**Current Replacement Value:** \$611  
**Deferred Maintenance:** \$61  
**Ext. Gross Area:** 0

**Building Code:** E4000800807  
**Building Name:** Chicken Coop  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** Forestville State Park  
**City Code:** Preston

**Current Replacement Value:** \$3,266  
**Deferred Maintenance:** \$327  
**Ext. Gross Area:** 0

**Building Code:** E4000800809  
**Building Name:** Weigh House  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Utility Shed  
**Address:** Forestville State Park  
**City Code:** PRESTON

**Current Replacement Value:** \$69,583  
**Deferred Maintenance:** \$4,407  
**Ext. Gross Area:** 0

**Building Code:** E4000800810  
**Building Name:** Lift Station Shanty  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 21899 COUNTY ROAD 118  
**City Code:** PRESTON

**Current Replacement Value:** \$1,767  
**Deferred Maintenance:** \$212  
**Ext. Gross Area:** 0

**Site: E40009 - Historic Fort Snelling**

**Building Code:** E4000900901  
**Building Name:** Round Tower  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Bunker  
**Address:** Historic Fort Snelling  
**City Code:** ST. PAUL

**Current Replacement Value:** \$1,786,399  
**Deferred Maintenance:** \$169,511  
**Ext. Gross Area:** 4,929

**Building Code:** E4000900909  
**Building Name:** History (Visitor) Center  
**Facility Condition Index:** 0.48 - **Poor**

**Cost Model Name:** Multi-story Educational Facility  
**Address:** Historic Fort Snelling  
**City Code:** ST. PAUL

**Current Replacement Value:** \$8,406,763  
**Deferred Maintenance:** \$4,036,106  
**Ext. Gross Area:** 30,835

**Building Code:** E4000900913  
**Building Name:** Guard House  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** Historic Fort Snelling  
**City Code:** ST. PAUL

**Current Replacement Value:** \$408,773  
**Deferred Maintenance:** \$53,376  
**Ext. Gross Area:** 1,949

**Site: E40011 - Jeffers Petroglyphs**

**Building Code:** E4001101105  
**Building Name:** Storage Shed  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** County Road 2  
**City Code:** JEFFERS

**Current Replacement Value:** \$45,026  
**Deferred Maintenance:** \$14,859  
**Ext. Gross Area:** 0

**Site: E40012 - Lac Qui Parle Mission**

**Building Code:** E4001201201  
**Building Name:** Mission Chapel  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 151 Pioneer Dr., Box 303  
**City Code:** Montevideo

**Current Replacement Value:** \$275,791  
**Deferred Maintenance:** \$42,669  
**Ext. Gross Area:** 0

**Site: E40014 - Charles A. Lindbergh House**

**Building Code:** E4001401401  
**Building Name:** Visitor Center  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1200 Lindbergh Drive South  
**City Code:** Little Falls

**Current Replacement Value:** \$2,505,599  
**Deferred Maintenance:** \$327,646  
**Ext. Gross Area:** 0

**Building Code:** E4001401402  
**Building Name:** Lindbergh House  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 1200 Lindbergh Drive South  
**City Code:** Little Falls

**Current Replacement Value:** \$1,377,163  
**Deferred Maintenance:** \$156,017  
**Ext. Gross Area:** 0

**Building Code:** E4001401403  
**Building Name:** Ice House  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 1200 Lindbergh Drive South  
**City Code:** Little Falls

**Current Replacement Value:** \$41,161  
**Deferred Maintenance:** \$7,589  
**Ext. Gross Area:** 0

**Building Code:** E4001401405  
**Building Name:** Storage Shed  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 1200 Lindbergh Drive South  
**City Code:** Little Falls

**Current Replacement Value:** \$17,363  
**Deferred Maintenance:** \$4,826  
**Ext. Gross Area:** 0

**Building Code:** E4001401406  
**Building Name:** WPA Stone Wall Shelter  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 1200 Lindbergh Drive South  
**City Code:** Little Falls

**Current Replacement Value:** \$7,056  
**Deferred Maintenance:** \$141  
**Ext. Gross Area:** 0

**Site: E40015 - Lower Sioux Agency**

**Building Code:** E4001501501  
**Building Name:** Visitor Center  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** Rt. 1, Box 125  
**City Code:** Morton

**Current Replacement Value:** \$775,616  
**Deferred Maintenance:** \$168,285  
**Ext. Gross Area:** 0

**Building Code:** E4001501502  
**Building Name:** Garage  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** Rt. 1, Box 125  
**City Code:** Morton

**Current Replacement Value:** \$95,919  
**Deferred Maintenance:** \$24,828  
**Ext. Gross Area:** 0

**Building Code:** E4001501503  
**Building Name:** Stone Warehouse  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Bunker  
**Address:** Rt. 1, Box 125  
**City Code:** Morton

**Current Replacement Value:** \$825,629  
**Deferred Maintenance:** \$132,462  
**Ext. Gross Area:** 0

**Site: E40016 - Mille Lacs Indian Museum**

**Building Code:** E4001601604  
**Building Name:** Ayer Storage Shed  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 43411 Oodena Drive  
**City Code:** Onamia

**Current Replacement Value:** \$33,549  
**Deferred Maintenance:** \$8,581  
**Ext. Gross Area:** 0

**Building Code:** E4001601605  
**Building Name:** Cabin #1  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 43411 Oodena Drive  
**City Code:** Onamia

**Current Replacement Value:** \$12,576  
**Deferred Maintenance:** \$3,446  
**Ext. Gross Area:** 0

**Building Code:** E4001601606  
**Building Name:** Cabin #2  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 43411 Oodena Drive  
**City Code:** Onamia

**Current Replacement Value:** \$12,576  
**Deferred Maintenance:** \$2,623  
**Ext. Gross Area:** 0

**Building Code:** E4001601607  
**Building Name:** Cabin #3 / Shed  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 43411 Oodena Drive  
**City Code:** Onamia

**Current Replacement Value:** \$12,805  
**Deferred Maintenance:** \$2,229  
**Ext. Gross Area:** 0

**Building Code:** E4001601609  
**Building Name:**  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** UNASSIGNED

**Current Replacement Value:** \$9,805  
**Deferred Maintenance:** \$981  
**Ext. Gross Area:** 0

**Site: E40017 - Minnehaha Depot**

**Building Code:** E4001701701  
**Building Name:** Minnehaha Depot  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** Minnehaha Park  
**City Code:** Minneapolis

**Current Replacement Value:** \$140,655  
**Deferred Maintenance:** \$19,178  
**Ext. Gross Area:** 461

**Site: E40018 - North West Company Fur Post**

**Building Code:** E4001801801  
**Building Name:** Women's Outhouse  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$2,421  
**Deferred Maintenance:** \$799  
**Ext. Gross Area:** 0

**Building Code:** E4001801802  
**Building Name:** Men's Outhouse  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$2,421  
**Deferred Maintenance:** \$799  
**Ext. Gross Area:** 0

**Building Code:** E4001801803  
**Building Name:** Fur Post  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$292,557  
**Deferred Maintenance:** \$40,254  
**Ext. Gross Area:** 1,367

**Building Code:** E4001801804  
**Building Name:** Picnic Shelter  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$109,937  
**Deferred Maintenance:** \$19,852  
**Ext. Gross Area:** 0

**Building Code:** E4001801806  
**Building Name:** Tractor Shed  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$22,547  
**Deferred Maintenance:** \$3,653  
**Ext. Gross Area:** 0

**Building Code:** E4001801807  
**Building Name:** Maintenance Shop  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$98,255  
**Deferred Maintenance:** \$11,275  
**Ext. Gross Area:** 0

**Building Code:** E4001801808  
**Building Name:** Visitor Center  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 12551 Voyageur Lane  
**City Code:** Pine City

**Current Replacement Value:** \$2,521,431  
**Deferred Maintenance:** \$198,885  
**Ext. Gross Area:** 0

**Site: E40019 - Oliver H. Kelley Farm**

**Building Code:** E4001901907  
**Building Name:** Barn  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 15788 Kelley Farm Road  
**City Code:** Elk River

**Current Replacement Value:** \$559,017  
**Deferred Maintenance:** \$51,954  
**Ext. Gross Area:** 2,583

**Building Code:** E4001901909  
**Building Name:** Farm House  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 15788 Kelley Farm Road  
**City Code:** Elk River

**Current Replacement Value:** \$1,207,766  
**Deferred Maintenance:** \$260,055  
**Ext. Gross Area:** 4,809

**Building Code:** E4001901917  
**Building Name:** Multipurpose Building  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 15788 Kelley Farm Road  
**City Code:** ELK RIVER

**Current Replacement Value:** \$372,687  
**Deferred Maintenance:** \$7,454  
**Ext. Gross Area:** 0

**Building Code:** E4001901918  
**Building Name:** Visitor Center  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 15788 Kelley Farm Road  
**City Code:** ELK RIVER

**Current Replacement Value:** \$4,387,572  
**Deferred Maintenance:** \$87,751  
**Ext. Gross Area:** 0

**Building Code:** E4001901919  
**Building Name:** Maintenance Building  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 15788 Kelley Farm Road  
**City Code:** ELK RIVER

**Current Replacement Value:** \$354,464  
**Deferred Maintenance:** \$7,089  
**Ext. Gross Area:** 0

**Building Code:** E4001901920  
**Building Name:** Animal Barn  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 15788 Kelley Farm Road  
**City Code:** ELK RIVER

**Current Replacement Value:** \$224,978  
**Deferred Maintenance:** \$4,500  
**Ext. Gross Area:** 0

**Building Code:** E4001901921  
**Building Name:** Guest Animal Shelter  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 15788 Kelley Farm Road  
**City Code:** ELK RIVER

**Current Replacement Value:** \$62,938  
**Deferred Maintenance:** \$1,259  
**Ext. Gross Area:** 0

**Building Code:** E4001901922  
**Building Name:** Picnic Shelter  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 15788 Kelley Farm Road  
**City Code:** ELK RIVER

**Current Replacement Value:** \$50,332  
**Deferred Maintenance:** \$1,007  
**Ext. Gross Area:** 0

**Site: E40020 - Alexander Ramsey House**

**Building Code:** E4002002001  
**Building Name:** Carriage Barn  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 265 S. Exchange St.  
**City Code:** ST. PAUL

**Current Replacement Value:** \$430,152  
**Deferred Maintenance:** \$159,142  
**Ext. Gross Area:** 0

**Building Code:** E4002002002  
**Building Name:** Ramsey House  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 265 S. Exchange St.  
**City Code:** ST. PAUL

**Current Replacement Value:** \$4,640,918  
**Deferred Maintenance:** \$1,558,627  
**Ext. Gross Area:** 0

**Building Code:** E4002002004  
**Building Name:** Alexander Ramsey House Equip Shed  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 265 S. Exchange St.  
**City Code:** ST. PAUL

**Current Replacement Value:** \$6,188  
**Deferred Maintenance:** \$953  
**Ext. Gross Area:** 0

**Site: E40022 - Upper Sioux Agency**

**Building Code:** E4002202201  
**Building Name:** House/Duplex  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** Rt. 2, Box 92  
**City Code:** Granite Falls

**Current Replacement Value:** \$263,968  
**Deferred Maintenance:** \$53,328  
**Ext. Gross Area:** 0

**Site: E40023 - W. W. Mayo House**

**Building Code:** E4002302301  
**Building Name:** W. W. Mayo House  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Single-family Residence  
**Address:** 118 N. Main Street  
**City Code:** Le Sueur

**Current Replacement Value:** \$570,898  
**Deferred Maintenance:** \$75,285  
**Ext. Gross Area:** 0

**Site: E40024 - Sibley House Historic Site**

**Building Code:** E4002402401  
**Building Name:** DuPuis House  
**Facility Condition Index:** 0.29 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$1,583,355  
**Deferred Maintenance:** \$451,662  
**Ext. Gross Area:** 0

**Building Code:** E4002402402  
**Building Name:** Sibley House  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$2,069,335  
**Deferred Maintenance:** \$411,652  
**Ext. Gross Area:** 0

**Building Code:** E4002402403  
**Building Name:** Faribault House  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-family Residence  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$1,817,317  
**Deferred Maintenance:** \$259,097  
**Ext. Gross Area:** 0

**Building Code:** E4002402404  
**Building Name:** Cold Store  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Bunker  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$179,607  
**Deferred Maintenance:** \$17,633  
**Ext. Gross Area:** 0

**Building Code:** E4002402405  
**Building Name:** Well House  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Bunker  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$112,457  
**Deferred Maintenance:** \$31,771  
**Ext. Gross Area:** 0

**Building Code:** E4002402406  
**Building Name:** Caretaker's Cottage  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$273,719  
**Deferred Maintenance:** \$65,515  
**Ext. Gross Area:** 0

**Building Code:** E4002402407  
**Building Name:** Caretaker's Garage  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$32,983  
**Deferred Maintenance:** \$8,308  
**Ext. Gross Area:** 0

**Building Code:** E4002402409  
**Building Name:** Powderhouse  
**Facility Condition Index:** 0.29 - *Average*

**Cost Model Name:** Bunker  
**Address:** 1357 Sibley Memorial Highway  
**City Code:** Mendota

**Current Replacement Value:** \$28,327  
**Deferred Maintenance:** \$8,346  
**Ext. Gross Area:** 0

**Site: E40026 - 1500 Mississippi Street**

**Building Code:** E4002602601  
**Building Name:** 1500 Mississippi  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1500 Mississippi Street  
**City Code:** ST. PAUL

**Current Replacement Value:** \$14,152,291  
**Deferred Maintenance:** \$3,342,556  
**Ext. Gross Area:** 68,272



**Site: G02310 - Capitol Complex**

**Building Code:** G0231011562  
**Building Name:** History Center  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Mid-rise Office Building, 5 to 10 story  
**Address:** 345 Kellogg Blvd. West  
**City Code:** ST. PAUL

**Current Replacement Value:** \$85,291,212  
**Deferred Maintenance:** \$12,101,361  
**Ext. Gross Area:** 517,555

## Agency: E77 - Minnesota Zoological Garden

**FCI Rating:** Average  
**Facility Condition Index:** 0.17

**Current Replacement Value:** \$170,338,091  
**Deferred Maintenance:** \$28,756,722

**Ext. Gross Area:** 648,982  
**Building Count:** 127

### Site: E77700 - MN ZOO

<b>Building Code:</b>	E7770000220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$525,752
<b>Building Name:</b>	Isolation Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$135,976
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,982
<b>Building Code:</b>	E7770000305	<b>Cost Model Name:</b>	Multi-story Educational Facility	<b>Current Replacement Value:</b>	\$17,957,315
<b>Building Name:</b>	MBC - Section -A-B- Admin-Education	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,671,124
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	80,139
<b>Building Code:</b>	E7770000520	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,732,983
<b>Building Name:</b>	Central Plaza Office - Tiger Hold	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$246,872
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	10,754
<b>Building Code:</b>	E7770000625	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$10,548,518
<b>Building Name:</b>	Bldg A - Animal Health	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$3,098,630
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	18,781
<b>Building Code:</b>	E7770000755	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$159,895
<b>Building Name:</b>	Replay Park Restroom	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$24,305
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	585
<b>Building Code:</b>	E7770000855	<b>Cost Model Name:</b>	Recreation Center	<b>Current Replacement Value:</b>	\$669,650
<b>Building Name:</b>	Conservation Carousel	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$13,393
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	5,236
<b>Building Code:</b>	E7770000865	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$1,013,505
<b>Building Name:</b>	Fire Suppression Building	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$20,270
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	50
<b>Building Code:</b>	E7770000875	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$5,495
<b>Building Name:</b>	Carousel Token Shelter	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$110
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	97
<b>Building Code:</b>	E7770001220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$209,226
<b>Building Name:</b>	Bldg H - Camel Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$38,578
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,683
<b>Building Code:</b>	E7770001625	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$4,425,741
<b>Building Name:</b>	Bldg B - Internal Services	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,282,730
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	16,681

<b>Building Code:</b>	E7770001945	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$522,408
<b>Building Name:</b>	Generator Discovery Bay	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$53,322
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	149
<b>Building Code:</b>	E7770002220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$121,895
<b>Building Name:</b>	Bldg J - Horse Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$18,436
<b>Facility Condition Index:</b>	0.15 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,204
<b>Building Code:</b>	E7770002625	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$865,718
<b>Building Name:</b>	Pole Bldg - Vehicle Maint	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$182,747
<b>Facility Condition Index:</b>	0.21 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	7,172
<b>Building Code:</b>	E7770002725	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$670,401
<b>Building Name:</b>	Bldg C - Vehicle Maint Garage	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$166,730
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,912
<b>Building Code:</b>	E7770003220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$149,429
<b>Building Name:</b>	Bldg K - Camel Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$29,206
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,202
<b>Building Code:</b>	E7770003625	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$413,951
<b>Building Name:</b>	Greenhouse Headhouse	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$104,443
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,890
<b>Building Code:</b>	E7770003725	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,126,047
<b>Building Name:</b>	Greenhouse	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$643,200
<b>Facility Condition Index:</b>	0.57 - <b>Crisis</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	3,666
<b>Building Code:</b>	E7770004220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$179,153
<b>Building Name:</b>	Bldg L - Moose Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$39,461
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,200
<b>Building Code:</b>	E7770004625	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$829,179
<b>Building Name:</b>	Bldg EF - Large Animal Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$241,671
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,735
<b>Building Code:</b>	E7770005230	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,112,597
<b>Building Name:</b>	Bldg M - Monorail Maint	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$259,569
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	7,561
<b>Building Code:</b>	E7770005240	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,122
<b>Building Name:</b>	Monorail Maint Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$6,744
<b>Facility Condition Index:</b>	0.56 - <b>Crisis</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	126

<b>Building Code:</b>	E7770005625	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$554,156
<b>Building Name:</b>	Bldg G - Hay Storage	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$175,610
<b>Facility Condition Index:</b>	0.32 - <b>Poor</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	7,852
<b>Building Code:</b>	E7770005720	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$160,670
<b>Building Name:</b>	Dhole Gazebo	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$15,975
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,102
<b>Building Code:</b>	E7770006230	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$113,540
<b>Building Name:</b>	Bldg N - Monorail Switch Gear	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$12,802
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	236
<b>Building Code:</b>	E7770006310	<b>Cost Model Name:</b>	Recreation Center	<b>Current Replacement Value:</b>	\$61,355,829
<b>Building Name:</b>	MBC - Section -C-D-E-F- Tropics	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$11,876,381
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	192,142
<b>Building Code:</b>	E7770006320	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$311,504
<b>Building Name:</b>	Butterfly Tent	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$12,325
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	4,539
<b>Building Code:</b>	E7770006330	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,147
<b>Building Name:</b>	Butterfly Containment Building	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,497
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	102
<b>Building Code:</b>	E7770006340	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$19,804
<b>Building Name:</b>	Endangered Butterfly Tent	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$4,678
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	336
<b>Building Code:</b>	E7770006635	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$3,495,962
<b>Building Name:</b>	Bldg H - Central Heat Plant	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,117,124
<b>Facility Condition Index:</b>	0.32 - <b>Poor</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	3,165
<b>Building Code:</b>	E7770007240	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$2,306,008
<b>Building Name:</b>	Bison - Pronghorn Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$104,665
<b>Facility Condition Index:</b>	0.05 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	22,229
<b>Building Code:</b>	E7770007320	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$150,399
<b>Building Name:</b>	Bison Garage	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$3,388
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	952
<b>Building Code:</b>	E7770007420	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$147,350
<b>Building Name:</b>	Bison Holding Hay Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$14,604
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	729

<b>Building Code:</b>	E7770007520	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$11,958
<b>Building Name:</b>	Bison Holding Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$5,010
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	220
<b>Building Code:</b>	E7770007625	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,204,584
<b>Building Name:</b>	Warehouse-Maintenance Support	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$287,784
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	11,317
<b>Building Code:</b>	E7770007920	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,543
<b>Building Name:</b>	Dino Pad Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$6,072
<b>Facility Condition Index:</b>	0.58 - Crisis	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	99
<b>Building Code:</b>	E7770007930	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$2,883
<b>Building Name:</b>	Dino Pad Gazebo - Demolished	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,788
<b>Facility Condition Index:</b>	0.62 - Crisis	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	69
<b>Building Code:</b>	E7770008220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$359,605
<b>Building Name:</b>	Caribou Barn A	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$71,559
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,649
<b>Building Code:</b>	E7770008225	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$139,632
<b>Building Name:</b>	Caribou Barn B	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$36,527
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,121
<b>Building Code:</b>	E7770008320	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$58,502
<b>Building Name:</b>	Giraffe Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$4,384
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	517
<b>Building Code:</b>	E7770008420	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$31,418
<b>Building Name:</b>	Zebra Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,311
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	387
<b>Building Code:</b>	E7770008520	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$31,418
<b>Building Name:</b>	Gazelle Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,311
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	387
<b>Building Code:</b>	E7770008620	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$29,712
<b>Building Name:</b>	Oryx Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,141
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	387
<b>Building Code:</b>	E7770008720	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$34,506
<b>Building Name:</b>	Africa Holding Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$12,456
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	346

<b>Building Code:</b>	E7770008820	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$11,958
<b>Building Name:</b>	Africa Holding Hay Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$239
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	220
<b>Building Code:</b>	E7770009220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$338,350
<b>Building Name:</b>	Musk Ox Bldg A	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$82,796
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,608
<b>Building Code:</b>	E7770009225	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$252,194
<b>Building Name:</b>	Musk Ox Bldg B	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$48,159
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,515
<b>Building Code:</b>	E7770009320	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$26,657
<b>Building Name:</b>	Musk Ox Viewing Shelter	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$8,670
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	287
<b>Building Code:</b>	E7770009420	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$18,867
<b>Building Name:</b>	Dinos Ticket Booth	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$898
<b>Facility Condition Index:</b>	0.05 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	50
<b>Building Code:</b>	E7770009430	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$3,858
<b>Building Name:</b>	Dinos Ticket Booth 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$490
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	33
<b>Building Code:</b>	E7770009440	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$37,056
<b>Building Name:</b>	Dinos Gift Tent	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$6,061
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	995
<b>Building Code:</b>	E7770009450	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$73,015
<b>Building Name:</b>	Bug House	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,860
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	721
<b>Building Code:</b>	E7770010510	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$197,958
<b>Building Name:</b>	East Entrance	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$22,922
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	469
<b>Building Code:</b>	E7770011220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$304,259
<b>Building Name:</b>	Bldg V - Takin Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$66,797
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,335
<b>Building Code:</b>	E7770012245	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$819,513
<b>Building Name:</b>	Bird Holding - Galaxie Ave	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$150,225
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,990



<b>Building Code:</b>	E7770013255	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$714,940
<b>Building Name:</b>	Amphitheater Bird Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$145,480
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	3,127
<b>Building Code:</b>	E7770013355	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,700,501
<b>Building Name:</b>	Amphitheater	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$294,919
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	11,980
<b>Building Code:</b>	E7770013365	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$82,933
<b>Building Name:</b>	Lancer Tiger Treats	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$17,299
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	621
<b>Building Code:</b>	E7770013375	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$701,614
<b>Building Name:</b>	Tiger Lair	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$85,651
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,773
<b>Building Code:</b>	E7770013455	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$309,286
<b>Building Name:</b>	Amphitheater Restroom	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$29,783
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,098
<b>Building Code:</b>	E7770013555	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$61,756
<b>Building Name:</b>	Summit - Lancer Vending Booth	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$16,481
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	269
<b>Building Code:</b>	E7770013655	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$115,172
<b>Building Name:</b>	Picnic Tent 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$7,760
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,954
<b>Building Code:</b>	E7770013755	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$115,172
<b>Building Name:</b>	Picnic Tent 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$11,517
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,954
<b>Building Code:</b>	E7770013855	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$33,813
<b>Building Name:</b>	Picnic Tent 3	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,502
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	800
<b>Building Code:</b>	E7770015235	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$67,999
<b>Building Name:</b>	Cement Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$14,492
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	494
<b>Building Code:</b>	E7770015315	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$7,663,478
<b>Building Name:</b>	MBC - Section -G- MN Trail	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,580,559
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	27,265

<b>Building Code:</b>	E7770016150	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$819,028
<b>Building Name:</b>	Black Bear Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$43,231
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,123
<b>Building Code:</b>	E7770017340	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$365,108
<b>Building Name:</b>	Monorail Station	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$33,537
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,824
<b>Building Code:</b>	E7770019640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$3,063,679
<b>Building Name:</b>	Life Support Discovery Bay	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$450,270
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	13,677
<b>Building Code:</b>	E7770019740	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$332,625
<b>Building Name:</b>	Marketing Trailer	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$55,082
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,381
<b>Building Code:</b>	E7770020145	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$1,465,191
<b>Building Name:</b>	Farm House	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$215,922
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	7,264
<b>Building Code:</b>	E7770020245	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$202,398
<b>Building Name:</b>	Goat - Sheep Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$41,889
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,168
<b>Building Code:</b>	E7770020345	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$347,942
<b>Building Name:</b>	Granary	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$38,744
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,149
<b>Building Code:</b>	E7770020445	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$478,299
<b>Building Name:</b>	Grain Elevator	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$45,850
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,524
<b>Building Code:</b>	E7770020545	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$181,913
<b>Building Name:</b>	Machine Shed	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$13,321
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,586
<b>Building Code:</b>	E7770020645	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$86,223
<b>Building Name:</b>	Chicken House	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$8,655
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,499
<b>Building Code:</b>	E7770020745	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$170,313
<b>Building Name:</b>	Swine Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$15,895
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	877

<b>Building Code:</b>	E7770020845	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$766,464
<b>Building Name:</b>	Dairy Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$56,659
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	5,494
<b>Building Code:</b>	E7770020945	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$147,975
<b>Building Name:</b>	Horse Barn	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$23,121
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,267
<b>Building Code:</b>	E7770021015	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$474
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021025	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$474
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021035	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 3	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$474
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021045	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 4	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$474
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021055	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 5	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$893
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021065	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 6	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$893
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021075	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,637
<b>Building Name:</b>	Farm Shelter 7	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$474
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021085	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$7,966
<b>Building Name:</b>	Farm Shelter 8	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$501
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	154
<b>Building Code:</b>	E7770021095	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$4,609
<b>Building Name:</b>	Farm Loading Shelter	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$92
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	127

<b>Building Code:</b>	E7770021105	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$12,600
<b>Building Name:</b>	Pony Shed 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$252
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	185
<b>Building Code:</b>	E7770021115	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$12,600
<b>Building Name:</b>	Pony Shed 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$252
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	185
<b>Building Code:</b>	E7770022145	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$110,775
<b>Building Name:</b>	Concrete - Stave Silo	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$12,158
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	185
<b>Building Code:</b>	E7770022245	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$40,960
<b>Building Name:</b>	Metal Silo	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$5,968
<b>Facility Condition Index:</b>	0.15 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	181
<b>Building Code:</b>	E7770029640	<b>Cost Model Name:</b>	Multi-story Educational Facility	<b>Current Replacement Value:</b>	\$20,855,913
<b>Building Name:</b>	Discovery Bay	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,079,134
<b>Facility Condition Index:</b>	0.05 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	73,585
<b>Building Code:</b>	E7770030050	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$12,756
<b>Building Name:</b>	Lakeside Terrace	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$255
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	355
<b>Building Code:</b>	E7770030150	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,171,477
<b>Building Name:</b>	Bear - Otter Life Support	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$64,767
<b>Facility Condition Index:</b>	0.06 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	4,183
<b>Building Code:</b>	E7770030250	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,034,111
<b>Building Name:</b>	Bear - Otter Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$77,800
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	4,485
<b>Building Code:</b>	E7770030350	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$956,609
<b>Building Name:</b>	Leopard Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$69,746
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,828
<b>Building Code:</b>	E7770030450	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$159,620
<b>Building Name:</b>	Wild Boar Holding	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$12,778
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	734
<b>Building Code:</b>	E7770030550	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$133,698
<b>Building Name:</b>	RGC Log Cabin	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$11,832
<b>Facility Condition Index:</b>	0.09 - <b>Good</b>	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	992

<b>Building Code:</b>	E7770030650	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$809,335
<b>Building Name:</b>	Education Event Center	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$47,182
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,670
<b>Building Code:</b>	E7770030750	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$338,242
<b>Building Name:</b>	Lancer Central Plaza	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$25,079
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,173
<b>Building Code:</b>	E7770030850	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$32,083
<b>Building Name:</b>	SSA Gift Outlet	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,153
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	365
<b>Building Code:</b>	E7770030950	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$128,750
<b>Building Name:</b>	Plaza Restroom Facilities	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$7,589
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	862
<b>Building Code:</b>	E7770031050	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$29,334
<b>Building Name:</b>	Takin Viewing Shelter 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,980
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	268
<b>Building Code:</b>	E7770031150	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$29,334
<b>Building Name:</b>	Takin Viewing Shelter 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$3,666
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	268
<b>Building Code:</b>	E7770031250	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$3,450
<b>Building Name:</b>	Northern Trail Seasonal Shelter	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$438
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	66
<b>Building Code:</b>	E7770031350	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$34,681
<b>Building Name:</b>	Tiger Base Camp	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$4,270
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	406
<b>Building Code:</b>	E7770032050	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$720,308
<b>Building Name:</b>	Leopard Viewing	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$18,836
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	738
<b>Building Code:</b>	E7770032150	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$34,908
<b>Building Name:</b>	Boar Viewing	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$844
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	336
<b>Building Code:</b>	E7770032250	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$614,006
<b>Building Name:</b>	Bear Viewing 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$15,116
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	665

<b>Building Code:</b>	E7770032350	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$970,286
<b>Building Name:</b>	Bear Viewing 2 - Cave	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$109,163
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	3,160
<b>Building Code:</b>	E7770032450	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$168,383
<b>Building Name:</b>	Otter Viewing 1 - Entry	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$8,572
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	677
<b>Building Code:</b>	E7770032550	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$917,415
<b>Building Name:</b>	Otter Viewing 2 - Primary	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$60,784
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,448
<b>Building Code:</b>	E7770032650	<b>Cost Model Name:</b>	Tunnel	<b>Current Replacement Value:</b>	\$80,249
<b>Building Name:</b>	Bear Tunnel	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$4,333
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	531
<b>Building Code:</b>	E7770040050	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$71,241
<b>Building Name:</b>	Lancer Pavilion	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$3,716
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,400
<b>Building Code:</b>	E7770040155	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,492
<b>Building Name:</b>	Tattoo Cabin	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$2,548
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	127
<b>Building Code:</b>	E7770050135	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$439,118
<b>Building Name:</b>	Classroom Unit 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$67,767
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,248
<b>Building Code:</b>	E7770050235	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$439,118
<b>Building Name:</b>	Classroom Unit 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$68,728
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	2,326
<b>Building Code:</b>	E7770050335	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$133,513
<b>Building Name:</b>	Classroom Storage	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$34,471
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	821
<b>Building Code:</b>	E7770070135	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,281,415
<b>Building Name:</b>	Lancer - SSA - Maint Warehouse	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$141,596
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	5,297
<b>Building Code:</b>	E7770070136	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$44,607
<b>Building Name:</b>	Parking Storage Bldg	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$8,889
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	490

<b>Building Code:</b>	E7770075050	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,639
<b>Building Name:</b>	Cars for Courage Booth	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,995
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	63
<b>Building Code:</b>	E7770080135	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$163,326
<b>Building Name:</b>	Water's Edge Picnic Shelter	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$27,038
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,654
<b>Building Code:</b>	E7770080235	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$155,833
<b>Building Name:</b>	Shady Oaks Picnic Shelter 1	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$20,401
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,702
<b>Building Code:</b>	E7770080335	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$148,456
<b>Building Name:</b>	Shady Oaks Picnic Shelter 2	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$40,211
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	1,654
<b>Building Code:</b>	E7770080435	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$40,233
<b>Building Name:</b>	Chrysalis Building	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$1,230
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	231
<b>Building Code:</b>	E7770080535	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$19,843
<b>Building Name:</b>	Hoop House B	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$397
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	337
<b>Building Code:</b>	E7770080635	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$19,726
<b>Building Name:</b>	Hoop House A	<b>Address:</b>	13000 Zoo Boulevard	<b>Deferred Maintenance:</b>	\$395
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	APPLE VALLEY	<b>Ext. Gross Area:</b>	670



## Agency: G02 - Department of Administration

**FCI Rating:** Average  
**Facility Condition Index:** 0.16

**Current Replacement Value:** \$1,138,357,404  
**Deferred Maintenance:** \$186,760,010

**Ext. Gross Area:** 5,451,793  
**Building Count:** 30

### Site: G02310 - Capitol Complex

<b>Building Code:</b>	G0231010062	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$142,821,966
<b>Building Name:</b>	Capitol Building	<b>Address:</b>	75 Rev. Dr Martin Luther King	<b>Deferred Maintenance:</b>	\$70,295,764
<b>Facility Condition Index:</b>	0.49 - Poor	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	378,825
<b>Building Code:</b>	G0231010162	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$18,834,996
<b>Building Name:</b>	Administration Building	<b>Address:</b>	50 Sherburne Avenue	<b>Deferred Maintenance:</b>	\$1,558,417
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	80,100
<b>Building Code:</b>	G0231010362	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$75,126,253
<b>Building Name:</b>	Minnesota Senate Building	<b>Address:</b>	95 University Avenue West	<b>Deferred Maintenance:</b>	\$1,502,525
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	296,589
<b>Building Code:</b>	G0231010462	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$70,997,680
<b>Building Name:</b>	State Office Bldg	<b>Address:</b>	100 Rev. Dr Martin Luther King	<b>Deferred Maintenance:</b>	\$19,004,946
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	290,138
<b>Building Code:</b>	G0231010562	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$62,169,565
<b>Building Name:</b>	Transportation Building	<b>Address:</b>	395 John Ireland Blvd	<b>Deferred Maintenance:</b>	\$6,064,341
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	374,649
<b>Building Code:</b>	G0231010662	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$19,027,521
<b>Building Name:</b>	Veterans Service Building	<b>Address:</b>	20 West 12th Street	<b>Deferred Maintenance:</b>	\$1,489,061
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	87,648
<b>Building Code:</b>	G0231010762	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$77,863,250
<b>Building Name:</b>	Centennial Office Building	<b>Address:</b>	658 Cedar Avenue	<b>Deferred Maintenance:</b>	\$15,607,275
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	317,893
<b>Building Code:</b>	G0231010962	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$5,881,981
<b>Building Name:</b>	Maintenance Building	<b>Address:</b>	691 N. Robert Street	<b>Deferred Maintenance:</b>	\$975,544
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	28,118
<b>Building Code:</b>	G0231011062	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$12,892,220
<b>Building Name:</b>	Capitol Power Plant	<b>Address:</b>	9 East Aurora	<b>Deferred Maintenance:</b>	\$3,311,402
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	22,001
<b>Building Code:</b>	G0231011462	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$13,527,473
<b>Building Name:</b>	Ford Building	<b>Address:</b>	117 University Avenue	<b>Deferred Maintenance:</b>	\$9,183,619
<b>Facility Condition Index:</b>	0.68 - Crisis	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	57,143



<b>Building Code:</b>	G0231011862	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$4,939,937
<b>Building Name:</b>	Governor's Residence	<b>Address:</b>	1006 Summit Avenue	<b>Deferred Maintenance:</b>	\$1,185,748
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	16,935
<b>Building Code:</b>	G0231012462	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$52,380,802
<b>Building Name:</b>	Judicial Center	<b>Address:</b>	25 Rev Dr Martin Luther King Jr Blvd.	<b>Deferred Maintenance:</b>	\$6,210,264
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	252,274
<b>Building Code:</b>	G0231023762	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$10,431,166
<b>Building Name:</b>	321 Grove St. #1	<b>Address:</b>	321 Grove	<b>Deferred Maintenance:</b>	\$2,984,963
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	49,498
<b>Building Code:</b>	G0231023862	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,029,113
<b>Building Name:</b>	321 Grove St. #2	<b>Address:</b>	603 Pine	<b>Deferred Maintenance:</b>	\$92,079
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	7,709
<b>Building Code:</b>	G0231023962	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$101,879,153
<b>Building Name:</b>	Stassen Building	<b>Address:</b>	600 North Robert	<b>Deferred Maintenance:</b>	\$8,813,313
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	470,317
<b>Building Code:</b>	G0231025569	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$4,183,501
<b>Building Name:</b>	Ely Revenue Services Building	<b>Address:</b>	760 East Minor Drive	<b>Deferred Maintenance:</b>	\$358,282
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	Ely	<b>Ext. Gross Area:</b>	15,931
<b>Building Code:</b>	G0231025792	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$5,230,679
<b>Building Name:</b>	BCA Bemidji	<b>Address:</b>	3700 North Norris Court NW	<b>Deferred Maintenance:</b>	\$394,854
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	Bemidji	<b>Ext. Gross Area:</b>	26,854
<b>Building Code:</b>	G0231025862	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$1,453,460
<b>Building Name:</b>	Carriage House	<b>Address:</b>	1006 Summit Avenue	<b>Deferred Maintenance:</b>	\$186,154
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	3,269
<b>Building Code:</b>	G0231026362	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$65,271,514
<b>Building Name:</b>	BCA Maryland	<b>Address:</b>	1430 Maryland Ave East	<b>Deferred Maintenance:</b>	\$3,892,540
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	239,524
<b>Building Code:</b>	G0231026962	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$243,222
<b>Building Name:</b>	Governor's Storage Bldg	<b>Address:</b>	1006 Summit Ave	<b>Deferred Maintenance:</b>	\$42,221
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	1,487
<b>Building Code:</b>	G0231027162	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$80,405,628
<b>Building Name:</b>	MDA/MDH Lab	<b>Address:</b>	601 North Robert Street	<b>Deferred Maintenance:</b>	\$5,340,896
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	181,019

<b>Building Code:</b>	G0231027262	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$77,649,626
<b>Building Name:</b>	Freeman Office Building	<b>Address:</b>	625 North Robert Street	<b>Deferred Maintenance:</b>	\$3,090,317
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	374,746
<b>Building Code:</b>	G0231027362	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$107,554,540
<b>Building Name:</b>	Andersen Office Building	<b>Address:</b>	540 Cedar Street	<b>Deferred Maintenance:</b>	\$3,198,813
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	414,068
<b>Building Code:</b>	G0231028862	<b>Cost Model Name:</b>	Joint Office/Warehouse Facility	<b>Current Replacement Value:</b>	\$8,460,413
<b>Building Name:</b>	Surplus Services Warehouse	<b>Address:</b>	5420 Old Highway 8	<b>Deferred Maintenance:</b>	\$692,277
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	Arden Hills	<b>Ext. Gross Area:</b>	46,395
<b>Building Code:</b>	G0231040262	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$9,137,801
<b>Building Name:</b>	Administration Ramp	<b>Address:</b>	504 Capitol Blvd	<b>Deferred Maintenance:</b>	\$1,294,100
<b>Facility Condition Index:</b>	0.14 - <b>Good</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	98,634
<b>Building Code:</b>	G0231040862	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$36,810,146
<b>Building Name:</b>	Centennial Ramp	<b>Address:</b>	W. Central Pk Pl & Columbus	<b>Deferred Maintenance:</b>	\$14,505,529
<b>Facility Condition Index:</b>	0.39 - <b>Poor</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	504,879
<b>Building Code:</b>	G0231040962	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$14,906,032
<b>Building Name:</b>	Ramp F	<b>Address:</b>	424 Rice Street	<b>Deferred Maintenance:</b>	\$298,121
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	179,126
<b>Building Code:</b>	G0231042562	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$16,045,452
<b>Building Name:</b>	State Office Ramp	<b>Address:</b>	106 Aurora Avenue	<b>Deferred Maintenance:</b>	\$1,307,459
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	141,162
<b>Building Code:</b>	G0231044162	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$19,604,825
<b>Building Name:</b>	14th Street Ramp	<b>Address:</b>	135 East 14th Street	<b>Deferred Maintenance:</b>	\$3,250,306
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	269,974
<b>Building Code:</b>	G0231047462	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$21,597,491
<b>Building Name:</b>	Andersen Ramp	<b>Address:</b>	540 Cedar Street	<b>Deferred Maintenance:</b>	\$628,879
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	224,890

Agency: G62 - MN State Retirement Systems

FCI Rating:	Good	Current Replacement Value:	\$43,709,831	Ext. Gross Area:	259,837
Facility Condition Index:	0.06	Deferred Maintenance:	\$2,571,643	Building Count:	2

Site: G02310 - Capitol Complex

Building Code:	G6231025162	Cost Model Name:	Low-rise Office Building, 2 to 4 story	Current Replacement Value:	\$34,744,547
Building Name:	Retirement Systems	Address:	60 Empire Drive	Deferred Maintenance:	\$2,006,645
Facility Condition Index:	0.06 - Good	City Code:	ST. PAUL	Ext. Gross Area:	145,147
Building Code:	G6231046262	Cost Model Name:	Parking Structure	Current Replacement Value:	\$8,965,284
Building Name:	Retirement Systems Ramp	Address:	60 Empire Drive	Deferred Maintenance:	\$564,998
Facility Condition Index:	0.06 - Good	City Code:	ST. PAUL	Ext. Gross Area:	114,690

**Agency: H55 - Department of Human Services**

**FCI Rating:** Average  
**Facility Condition Index:** 0.19

**Current Replacement Value:** \$153,844,488  
**Deferred Maintenance:** \$29,303,576

**Ext. Gross Area:** 600,268  
**Building Count:** 6

**Site: H55800 - ST PETER RTC**

**Building Code:** H5580000002  
**Building Name:** PEXTON HALL  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 100 FREEMAN DRIVE  
**City Code:** ST. PETER

**Current Replacement Value:** \$29,594,406  
**Deferred Maintenance:** \$3,892,392  
**Ext. Gross Area:** 91,029

**Building Code:** H5580000003  
**Building Name:** BARTLETT HALL  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Multi-story Dormitory  
**Address:** 100 FREEMAN DRIVE  
**City Code:** ST. PETER

**Current Replacement Value:** \$20,995,919  
**Deferred Maintenance:** \$4,527,638  
**Ext. Gross Area:** 88,309

**Building Code:** H5580000004  
**Building Name:** TOMLINSON HALL  
**Facility Condition Index:** 0.30 - Poor

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 100 FREEMAN DRIVE  
**City Code:** ST. PETER

**Current Replacement Value:** \$6,733,715  
**Deferred Maintenance:** \$2,042,360  
**Ext. Gross Area:** 23,255

**Building Code:** H5580000010  
**Building Name:** ADMINISTRATION BLDG-SPRTC  
**Facility Condition Index:** 0.41 - Poor

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 100 FREEMAN DRIVE  
**City Code:** ST. PETER

**Current Replacement Value:** \$7,486,433  
**Deferred Maintenance:** \$3,087,211  
**Ext. Gross Area:** 45,532

**Building Code:** H5580000026  
**Building Name:** SUNRISE  
**Facility Condition Index:** 0.27 - Average

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 100 FREEMAN DRIVE  
**City Code:** ST. PETER

**Current Replacement Value:** \$9,777,121  
**Deferred Maintenance:** \$2,653,336  
**Ext. Gross Area:** 40,294

**Building Code:** H5580000099  
**Building Name:** MINN. SECURITY HOSPITAL  
**Facility Condition Index:** 0.17 - Average

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 100 FREEMAN DRIVE  
**City Code:** ST. PETER

**Current Replacement Value:** \$79,256,893  
**Deferred Maintenance:** \$13,100,639  
**Ext. Gross Area:** 311,849

## Agency: H75 - Minnesota Veterans Affairs

**FCI Rating:** Good  
**Facility Condition Index:** 0.14

**Current Replacement Value:** \$263,726,912  
**Deferred Maintenance:** \$35,676,818

**Ext. Gross Area:** 939,749  
**Building Count:** 52

### Site: H75FVH - Fergus Falls

**Building Code:** H75FVH00001  
**Building Name:** Fergus Vets Home  
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Multi-story Dormitory  
**Address:** 1821 N. Park St.  
**City Code:** Fergus Falls

**Current Replacement Value:** \$26,216,118  
**Deferred Maintenance:** \$2,806,952  
**Ext. Gross Area:** 127,684

**Building Code:** H75FVH00102  
**Building Name:** FVH 102 Bldg. 2  
**Facility Condition Index:** 0.57 - Crisis

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** Fergus Falls

**Current Replacement Value:** \$969,734  
**Deferred Maintenance:** \$554,631  
**Ext. Gross Area:** 4,032

**Building Code:** H75FVH00103  
**Building Name:** FVH 103 Bldg. 3  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** Fergus Falls

**Current Replacement Value:** \$531,927  
**Deferred Maintenance:** \$39,142  
**Ext. Gross Area:** 4,000

### Site: H75HVVH - Hastings

**Building Code:** H75HVVH00018  
**Building Name:** Building 18 - Pavillion  
**Facility Condition Index:** 0.19 - Average

**Cost Model Name:** Open Air Shelter  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$30,843  
**Deferred Maintenance:** \$5,933  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH00019  
**Building Name:** Building 19 - Water Tower  
**Facility Condition Index:** 0.05 - Good

**Cost Model Name:** Bunker  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$9,025,001  
**Deferred Maintenance:** \$479,942  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH10319  
**Building Name:** Building 20  
**Facility Condition Index:** 0.15 - Average

**Cost Model Name:** Multi-story Educational Facility  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$5,284,416  
**Deferred Maintenance:** \$815,494  
**Ext. Gross Area:** 26,276

**Building Code:** H75HVVH10819  
**Building Name:** Building 24  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$2,232,339  
**Deferred Maintenance:** \$180,579  
**Ext. Gross Area:** 9,868

**Building Code:** H75HVVH11019  
**Building Name:** Building 23  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Multi-story Dormitory  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$18,438,084  
**Deferred Maintenance:** \$2,926,501  
**Ext. Gross Area:** 99,348

**Building Code:** H75HVVH11319  
**Building Name:** Building 22 - Park Toilet  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$32,336  
**Deferred Maintenance:** \$3,846  
**Ext. Gross Area:** 248

<b>Building Code:</b>	H75HVVH11519	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$10,215
<b>Building Name:</b>	Building 35 - Tool Shed	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$5,802
<b>Facility Condition Index:</b>	0.57 - <b>Crisis</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	241
<b>Building Code:</b>	H75HVVH11619	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$4,016,969
<b>Building Name:</b>	Building 25	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$1,089,100
<b>Facility Condition Index:</b>	0.27 - <b>Average</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	18,746
<b>Building Code:</b>	H75HVVH11719	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,239,839
<b>Building Name:</b>	Building 33 - Garage	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$172,836
<b>Facility Condition Index:</b>	0.14 - <b>Good</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	5,740
<b>Building Code:</b>	H75HVVH12019	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$6,787,724
<b>Building Name:</b>	Building 30 - Power House	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$1,215,552
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	15,036
<b>Building Code:</b>	H75HVVH12119	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$66,642
<b>Building Name:</b>	Screen House	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$7,185
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	672
<b>Building Code:</b>	H75HVVH12319	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$269,775
<b>Building Name:</b>	Building 36	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$11,454
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	3,213
<b>Building Code:</b>	H75HVVH12419	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$28,889
<b>Building Name:</b>	Bldg 32 - #3 Well	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$1,563
<b>Facility Condition Index:</b>	0.05 - <b>Good</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	198
<b>Building Code:</b>	H75HVVH12619	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$30,746
<b>Building Name:</b>	Tool Shed	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$17,158
<b>Facility Condition Index:</b>	0.56 - <b>Crisis</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	572
<b>Building Code:</b>	H75HVVH12719	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$857,927
<b>Building Name:</b>	Building 34	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$593,083
<b>Facility Condition Index:</b>	0.69 - <b>Crisis</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	8,044
<b>Building Code:</b>	H75HVVH13019	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$3,776,390
<b>Building Name:</b>	Building 1 - Detox	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$986,515
<b>Facility Condition Index:</b>	0.26 - <b>Average</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	21,325
<b>Building Code:</b>	H75HVVH13119	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$3,235,980
<b>Building Name:</b>	Building 2 - Detox	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$1,070,891
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	Hastings	<b>Ext. Gross Area:</b>	19,067

**Building Code:** H75HVVH17A  
**Building Name:** Tunnel A  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$976,459  
**Deferred Maintenance:** \$55,886  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17C1  
**Building Name:** Tunnel C1  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$406,858  
**Deferred Maintenance:** \$46,009  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17C2  
**Building Name:** Tunnel C2  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$542,797  
**Deferred Maintenance:** \$39,729  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17D  
**Building Name:** Tunnel D  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$262,703  
**Deferred Maintenance:** \$18,034  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17E  
**Building Name:** Tunnel E  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$2,255,481  
**Deferred Maintenance:** \$397,844  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17F  
**Building Name:** Tunnel F  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$629,006  
**Deferred Maintenance:** \$43,181  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17G  
**Building Name:** Tunnel G  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$333,003  
**Deferred Maintenance:** \$24,580  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17H  
**Building Name:** Tunnel H  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$118,401  
**Deferred Maintenance:** \$8,128  
**Ext. Gross Area:** 0

**Building Code:** H75HVVH17N  
**Building Name:** Tunnel N  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$160,818  
**Deferred Maintenance:** \$11,191  
**Ext. Gross Area:** 0

**Building Code:** H75HVHHUD  
**Building Name:** HUD House  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:**  
**City Code:** Hastings

**Current Replacement Value:** \$457,015  
**Deferred Maintenance:** \$36,882  
**Ext. Gross Area:** 2,415

**Site: [H75LFC - Little Falls](#)**

**Building Code:** H75CEM00101  
**Building Name:** Admin Building  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:**  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$800,721  
**Deferred Maintenance:** \$80,286  
**Ext. Gross Area:** 4,123

**Building Code:** H75CEM00201  
**Building Name:** Maintenance building  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 15550 Hwy 115  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$1,355,438  
**Deferred Maintenance:** \$174,171  
**Ext. Gross Area:** 6,910

**Site: H75LVH - Luverne**

**Building Code:** H75LVH10167  
**Building Name:** Luverne Vets Home  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Multi-story Dormitory  
**Address:** 1300 N. Kniss  
**City Code:** Luverne

**Current Replacement Value:** \$16,799,588  
**Deferred Maintenance:** \$2,208,447  
**Ext. Gross Area:** 68,226

**Site: H75MVH - Minneapolis**

**Building Code:** H75MVH00127  
**Building Name:** MVH 001 Tunnels between 1,2,4,10,14  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$3,714,046  
**Deferred Maintenance:** \$629,742  
**Ext. Gross Area:** 0

**Building Code:** H75MVH00227  
**Building Name:** MVH 002 Deep tunnel  
**Facility Condition Index:** 0.57 - **Crisis**

**Cost Model Name:** Tunnel  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$1,307,134  
**Deferred Maintenance:** \$747,742  
**Ext. Gross Area:** 0

**Building Code:** H75MVH10127  
**Building Name:** Building 4  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Multi-story Educational Facility  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$3,879,718  
**Deferred Maintenance:** \$392,163  
**Ext. Gross Area:** 16,384

**Building Code:** H75MVH10327  
**Building Name:** Building 18 - Warehouse  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$2,558,804  
**Deferred Maintenance:** \$217,401  
**Ext. Gross Area:** 15,537

**Building Code:** H75MVH10527  
**Building Name:** Building 14-A  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$9,279,853  
**Deferred Maintenance:** \$2,110,021  
**Ext. Gross Area:** 11,779

**Building Code:** H75MVH10627  
**Building Name:** Building 2  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$4,435,812  
**Deferred Maintenance:** \$1,368,002  
**Ext. Gross Area:** 16,894

**Building Code:** H75MVH10727  
**Building Name:** Building 6  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Multi-story Dormitory  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$13,825,267  
**Deferred Maintenance:** \$2,421,005  
**Ext. Gross Area:** 77,479

**Building Code:** H75MVH10827  
**Building Name:** Building 16  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Multi-story Dormitory  
**Address:**  
**City Code:** Minneapolis

**Current Replacement Value:** \$8,354,213  
**Deferred Maintenance:** \$713,279  
**Ext. Gross Area:** 38,540



<b>Building Code:</b>	H75MVH11027	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$4,011,550
<b>Building Name:</b>	Building 15	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$601,100
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	17,468
<b>Building Code:</b>	H75MVH11127	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,120,815
<b>Building Name:</b>	Building 12A	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$284,615
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	5,400
<b>Building Code:</b>	H75MVH11227	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$4,630,755
<b>Building Name:</b>	Building 10	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$1,544,838
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	15,514
<b>Building Code:</b>	H75MVH11527	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,190,674
<b>Building Name:</b>	Building 13	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$802,691
<b>Facility Condition Index:</b>	0.67 - Crisis	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	5,484
<b>Building Code:</b>	H75MVH11827	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$3,525,599
<b>Building Name:</b>	Building 1	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$762,111
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	13,054
<b>Building Code:</b>	H75MVH11927	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,739,276
<b>Building Name:</b>	Building 14 - Powerhouse	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$142,502
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	3,483
<b>Building Code:</b>	H75MVH12007	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$276,945
<b>Building Name:</b>	Building 12	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$130,184
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	1,788
<b>Building Code:</b>	H75MVH19001	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$26,259,475
<b>Building Name:</b>	Building 19	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$1,172,855
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	118,972
<b>Building Code:</b>	H75MVH20001	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,228,929
<b>Building Name:</b>	Building 20	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$24,579
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Minneapolis	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	H75MVH21001	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$39,758,830
<b>Building Name:</b>	Building 21	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$795,177
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	MINNEAPOLIS	<b>Ext. Gross Area:</b>	34,091

**Site: H75SVH - Silver Bay**

<b>Building Code:</b>	H75SVH10139	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$24,449,033
<b>Building Name:</b>	Silver Bay Vets Home	<b>Address:</b>	45 Banks Blvd.	<b>Deferred Maintenance:</b>	\$4,688,280
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	Silver Bay	<b>Ext. Gross Area:</b>	101,895

## Agency: P01 - Military Affairs

**FCI Rating:** Average  
**Facility Condition Index:** 0.24

**Current Replacement Value:** \$581,663,784  
**Deferred Maintenance:** \$141,965,194

**Ext. Gross Area:** 2,361,561  
**Building Count:** 68

---

### Site: P01146 - FARIBAULT AFRC

**Building Code:** P0114620002  
**Building Name:** Faribault TACC  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3000 West Airport Drive  
**City Code:** Faribault

**Current Replacement Value:** \$4,449,586  
**Deferred Maintenance:** \$1,368,839  
**Ext. Gross Area:** 64,482

### Site: P01670 - AHATS

**Building Code:** P0167001002  
**Building Name:** AHATS Hamline Ave RC  
**Facility Condition Index:** 0.09 - Good

**Cost Model Name:** Single-story Educational Facility  
**Address:**  
**City Code:** Arden Hills

**Current Replacement Value:** \$8,745,189  
**Deferred Maintenance:** \$768,719  
**Ext. Gross Area:** 60,413

### Site: P01818 - CAMBRIDGE RC

**Building Code:** P0181816001  
**Building Name:** Cambridge Armory  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Recreation Center  
**Address:** 505 SPIRIT RIVER DRVE  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$17,165,633  
**Deferred Maintenance:** \$1,647,808  
**Ext. Gross Area:** 57,062

### Site: P01A10 - ALBERT LEA

**Building Code:** P01A1023001  
**Building Name:** Albert Lea TACC and MVSB  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 410 Prospect Ave  
**City Code:** Albert Lea

**Current Replacement Value:** \$10,035,854  
**Deferred Maintenance:** \$3,132,039  
**Ext. Gross Area:** 28,791

### Site: P01A15 - ALEXANDRIA

**Building Code:** P01A1502001  
**Building Name:** Alexandria TACC  
**Facility Condition Index:** 0.24 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 310 Broadway  
**City Code:** Alexandria

**Current Replacement Value:** \$5,883,857  
**Deferred Maintenance:** \$1,389,323  
**Ext. Gross Area:** 28,151

### Site: P01A20 - ANOKA

**Building Code:** P01A2001001  
**Building Name:** Anoka TACC  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 408 E Main St  
**City Code:** Anoka

**Current Replacement Value:** \$4,548,434  
**Deferred Maintenance:** \$1,511,544  
**Ext. Gross Area:** 16,419

### Site: P01A25 - APPLETON

**Building Code:** P01A2502001  
**Building Name:** Appleton NG TACC  
**Facility Condition Index:** 0.27 - *Average*

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 25 N Munsterman St  
**City Code:** Appleton

**Current Replacement Value:** \$6,925,210  
**Deferred Maintenance:** \$1,899,889  
**Ext. Gross Area:** 29,292

**Site: P01A35 - AUSTIN**

**Building Code:** P01A3525001  
**Building Name:** Austin Armory  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 800 21st St NE  
**City Code:** Austin

**Current Replacement Value:** \$5,813,883  
**Deferred Maintenance:** \$1,054,696  
**Ext. Gross Area:** 21,878

**Site: P01A40 - BEMIDJI**

**Building Code:** P01A4003001  
**Building Name:** Bemidji TACC  
**Facility Condition Index:** 0.38 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1430 23rd St NW  
**City Code:** Bemidji

**Current Replacement Value:** \$5,222,817  
**Deferred Maintenance:** \$1,988,410  
**Ext. Gross Area:** 21,006

**Site: P01A47 - BLOOMINGTON**

**Building Code:** P01A4707001  
**Building Name:** Bloomington TACC  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 330 W 98th Street  
**City Code:** Bloomington

**Current Replacement Value:** \$9,606,061  
**Deferred Maintenance:** \$2,688,401  
**Ext. Gross Area:** 41,731

**Site: P01A50 - BRAINERD**

**Building Code:** P01A5001001  
**Building Name:** Brainerd TACC  
**Facility Condition Index:** 0.39 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1115 Wright Street  
**City Code:** Brainerd

**Current Replacement Value:** \$8,116,054  
**Deferred Maintenance:** \$3,134,836  
**Ext. Gross Area:** 38,569

**Site: P01A53 - BROOKLYN PARK**

**Building Code:** P01A5302001  
**Building Name:** Brooklyn Park TACC  
**Facility Condition Index:** 0.32 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 5500 85th Ave N  
**City Code:** Brooklyn Park

**Current Replacement Value:** \$9,544,929  
**Deferred Maintenance:** \$3,086,269  
**Ext. Gross Area:** 29,499

**Site: P01A55 - CHISHOLM**

**Building Code:** P01A5504001  
**Building Name:** Chisholm TACC  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 900 W Lake St  
**City Code:** Chisholm

**Current Replacement Value:** \$5,375,590  
**Deferred Maintenance:** \$1,124,497  
**Ext. Gross Area:** 18,166

**Site: P01A60 - CLOQUET**

**Building Code:** P01A6011001  
**Building Name:** Cloquet TACC  
**Facility Condition Index:** 0.27 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 801 Hwy 33 South  
**City Code:** Cloquet TACC

**Current Replacement Value:** \$5,534,233  
**Deferred Maintenance:** \$1,507,204  
**Ext. Gross Area:** 27,244

**Site: P01A63 - COTTAGE GROVE**

**Building Code:** P01A6309001  
**Building Name:** Cottage Grove TACC  
**Facility Condition Index:** 0.42 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 8180 Belden Blvd S  
**City Code:** Cottage Grove

**Current Replacement Value:** \$9,907,893  
**Deferred Maintenance:** \$4,140,631  
**Ext. Gross Area:** 54,428

**Site: P01A65 - CROOKSTON**

**Building Code:** P01A6502001  
**Building Name:** Crookston  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1801 University Av N  
**City Code:** Crookston

**Current Replacement Value:** \$6,883,289  
**Deferred Maintenance:** \$1,434,806  
**Ext. Gross Area:** 21,484

**Site: P01A75 - DETROIT LAKES**

**Building Code:** P01A7507001  
**Building Name:** Detroit Lakes TACC  
**Facility Condition Index:** 0.35 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1220 Rossman Ave  
**City Code:** Detroit Lakes

**Current Replacement Value:** \$4,538,853  
**Deferred Maintenance:** \$1,600,500  
**Ext. Gross Area:** 16,201

**Site: P01A85 - DULUTH**

**Building Code:** P01A8510001  
**Building Name:** Duluth TACC  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4015 Airpark Blvd  
**City Code:** Duluth

**Current Replacement Value:** \$13,513,334  
**Deferred Maintenance:** \$1,878,486  
**Ext. Gross Area:** 42,470

**Site: P01A95 - FAIRMONT**

**Building Code:** P01A9522001  
**Building Name:** Fairmont TACC  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 700 Fairlakes Ave  
**City Code:** Fairmont

**Current Replacement Value:** \$6,325,545  
**Deferred Maintenance:** \$902,200  
**Ext. Gross Area:** 18,948

**Site: P01B05 - FERGUS FALLS**

**Building Code:** P01B0508001  
**Building Name:** Fergus Falls TACC  
**Facility Condition Index:** 0.36 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 321 E Cecil Street  
**City Code:** Fergus Falls

**Current Replacement Value:** \$5,785,277  
**Deferred Maintenance:** \$2,101,017  
**Ext. Gross Area:** 19,925

**Site: P01B10 - GRAND RAPIDS**

**Building Code:** P01B1013001  
**Building Name:** Grand Rapids TACC  
**Facility Condition Index:** 0.36 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 930 NE 1st Ave  
**City Code:** Grand Rapids

**Current Replacement Value:** \$6,007,435  
**Deferred Maintenance:** \$2,182,688  
**Ext. Gross Area:** 20,730

**Site: P01B15 - HASTINGS ARMORY**

**Building Code:** P01B1510001  
**Building Name:** Hastings TACC  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 3050 Hwy 316 S  
**City Code:** Hastings

**Current Replacement Value:** \$4,452,026  
**Deferred Maintenance:** \$348,389  
**Ext. Gross Area:** 18,451

**Site: P01B20 - HIBBING ARMORY AND FMS**

**Building Code:** P01B2005001  
**Building Name:** Hibbing TACC  
**Facility Condition Index:** 0.35 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2310 Brooklyn Drive  
**City Code:** Hibbing

**Current Replacement Value:** \$6,487,649  
**Deferred Maintenance:** \$2,294,328  
**Ext. Gross Area:** 29,352

**Site: P01B25 - HUTCHINSON ARMORY**

**Building Code:** P01B2510001  
**Building Name:** Hutchinson TACC  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1200 Hwy 22 S  
**City Code:** Hutchinson

**Current Replacement Value:** \$5,125,661  
**Deferred Maintenance:** \$803,737  
**Ext. Gross Area:** 17,823

**Site: P01B27 - INVER GOVE HEIGHT ARMORY**

**Building Code:** P01B2714001  
**Building Name:** Inver Grove Hts TACC  
**Facility Condition Index:** 0.26 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 8076 Babcock Trail  
**City Code:** Inver Grove Heig

**Current Replacement Value:** \$11,112,775  
**Deferred Maintenance:** \$2,900,422  
**Ext. Gross Area:** 42,392

**Site: P01B30 - JACKSON ARMORY**

**Building Code:** P01B3014001  
**Building Name:** Jackson TACC  
**Facility Condition Index:** 0.14 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 108 Cty Road 51  
**City Code:** Jackson

**Current Replacement Value:** \$6,320,316  
**Deferred Maintenance:** \$874,720  
**Ext. Gross Area:** 18,893

**Site: P01B35 - LITCHFIELD ARMORY**

**Building Code:** P01B3509001  
**Building Name:** Litchfield TACC  
**Facility Condition Index:** 0.43 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 525 Gillman Ave N  
**City Code:** Litchfield

**Current Replacement Value:** \$4,218,116  
**Deferred Maintenance:** \$1,812,987  
**Ext. Gross Area:** 14,891

**Site: P01B40 - CAMP RIPLEY TRAINING SITE**

**Building Code:** P01B4002002  
**Building Name:** Old School House  
**Facility Condition Index:** 0.35 - **Poor**

**Building Code:** P01B4006078  
**Building Name:** EMTc  
**Facility Condition Index:** 0.08 - **Good**

**Building Code:** P01B4011001  
**Building Name:** Camp Ripley Armory  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 15000 Hwy 115  
**City Code:** Little Falls

**Cost Model Name:** Single-story Educational Facility  
**Address:** 15000 Hwy 115  
**City Code:** Little Falls

**Cost Model Name:** Single-story Educational Facility  
**Address:** 15000 Hwy 115  
**City Code:** Little Falls

**Current Replacement Value:** \$387,743  
**Deferred Maintenance:** \$134,133  
**Ext. Gross Area:** 2,256

**Current Replacement Value:** \$3,570,084  
**Deferred Maintenance:** \$271,544  
**Ext. Gross Area:** 22,306

**Current Replacement Value:** \$16,271,120  
**Deferred Maintenance:** \$4,465,773  
**Ext. Gross Area:** 98,722

**Site: P01B45 - LONG PRAIRIE ARMORY**

**Building Code:** P01B4503002  
**Building Name:** Long Prairie TACC  
**Facility Condition Index:** 0.47 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 701 9th Street NE  
**City Code:** Long Prairie

**Current Replacement Value:** \$2,657,903  
**Deferred Maintenance:** \$1,249,177  
**Ext. Gross Area:** 13,137

**Site: P01B50 - LUVERNE ARMORY**

**Building Code:** P01B5013001  
**Building Name:** Luverne TACC  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 309 S Freeman Ave  
**City Code:** Luverne

**Current Replacement Value:** \$6,059,699  
**Deferred Maintenance:** \$2,101,582  
**Ext. Gross Area:** 29,172

**Site: P01B55 - MADISON ARMORY**

**Building Code:** P01B5503001  
**Building Name:** Madison TACC  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 504 3rd Street  
**City Code:** Madison

**Current Replacement Value:** \$7,318,517  
**Deferred Maintenance:** \$2,011,587  
**Ext. Gross Area:** 37,384

**Site: P01B60 - MANKATO ARMORY**

**Building Code:** P01B6021002  
**Building Name:** Mankato Armory  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 100 Martin Luther King Jr Dr.  
**City Code:** Mankato

**Current Replacement Value:** \$16,294,400  
**Deferred Maintenance:** \$4,578,910  
**Ext. Gross Area:** 46,449

**Site: P01B65 - MARSHAL ARMORY**

**Building Code:** P01B6508001  
**Building Name:** Marshall TACC  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 500 Artillery Drive  
**City Code:** Marshall

**Current Replacement Value:** \$5,068,755  
**Deferred Maintenance:** \$1,578,320  
**Ext. Gross Area:** 16,833

**Site: P01B75 - MINNEAPOLIS ARMORY**

**Building Code:** P01B7503001  
**Building Name:** Minneapolis TACC  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Single-story Educational Facility  
**Address:** 1025 Broadway St NE  
**City Code:** Minneapolis

**Current Replacement Value:** \$5,446,221  
**Deferred Maintenance:** \$1,149,532  
**Ext. Gross Area:** 36,074

**Site: P01B80 - MONTEVIDEO ARMORY**

**Building Code:** P01B8004001  
**Building Name:** Montevideo TACC  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 711 S 17th Street  
**City Code:** Montevideo

**Current Replacement Value:** \$11,254,524  
**Deferred Maintenance:** \$3,186,332  
**Ext. Gross Area:** 38,667

**Site: P01B82 - MONTICELLO**

**Building Code:** P01B8207001  
**Building Name:** Monticello TACC  
**Facility Condition Index:** 0.15 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 505 Walnut St  
**City Code:** Monticello

**Current Replacement Value:** \$1,162,125  
**Deferred Maintenance:** \$177,396  
**Ext. Gross Area:** 0

**Site: P01B85 - MOORHEAD ARMORY**

**Building Code:** P01B8506001  
**Building Name:** Moorhead TACC  
**Facility Condition Index:** 0.32 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1002 15th Ave N  
**City Code:** Moorhead

**Current Replacement Value:** \$8,022,869  
**Deferred Maintenance:** \$2,552,951  
**Ext. Gross Area:** 52,763

**Site: P01B90 - MORRIS ARMORY**

**Building Code:** P01B9005001  
**Building Name:** Morris TACC  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 810 Iowa Ave  
**City Code:** Morris

**Current Replacement Value:** \$6,234,662  
**Deferred Maintenance:** \$1,480,498  
**Ext. Gross Area:** 28,265

**Site: P01C00 - NEW ULM ARMORY**

**Building Code:** P01C0016001  
**Building Name:** New Ulm TACC  
**Facility Condition Index:** 0.35 - *Poor*

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 205 N Broadway  
**City Code:** New Ulm

**Current Replacement Value:** \$7,822,940  
**Deferred Maintenance:** \$2,758,839  
**Ext. Gross Area:** 32,514

**Site: P01C10 - NORTHFIELD ARMORY**

**Building Code:** P01C1018001  
**Building Name:** Northfield TACC  
**Facility Condition Index:** 0.29 - *Average*

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 519 Division Street  
**City Code:** Northfield

**Current Replacement Value:** \$4,294,031  
**Deferred Maintenance:** \$1,225,133  
**Ext. Gross Area:** 19,704

**Site: P01C15 - OLIVIA ARMORY**

**Building Code:** P01C1505001  
**Building Name:** Olivia TACC  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 910 W Lincoln  
**City Code:** Olivia

**Current Replacement Value:** \$5,524,717  
**Deferred Maintenance:** \$1,835,222  
**Ext. Gross Area:** 29,630

**Site: P01C25 - ORTONVILLE ARMORY**

**Building Code:** P01C2501001  
**Building Name:** Ortonville TACC  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 309 Madison Ave  
**City Code:** Ortonville

**Current Replacement Value:** \$8,481,063  
**Deferred Maintenance:** \$1,442,492  
**Ext. Gross Area:** 28,837

**Site: P01C30 - OWATONNA ARMORY**

**Building Code:** P01C3024001  
**Building Name:** Owatonna TACC  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2323 Bridge Street W  
**City Code:** Owatonna

**Current Replacement Value:** \$5,331,506  
**Deferred Maintenance:** \$1,369,993  
**Ext. Gross Area:** 18,939

**Site: P01C40 - PINE CITY ARMORY**

**Building Code:** P01C4012001  
**Building Name:** Pine City TACC  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1305 Main Street S  
**City Code:** Pine City

**Current Replacement Value:** \$4,594,766  
**Deferred Maintenance:** \$483,374  
**Ext. Gross Area:** 15,488

**Site: P01C45 - PIPESTONE ARMORY**

**Building Code:** P01C4512001  
**Building Name:** Pipestone TACC  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 421 2nd Ave SW  
**City Code:** Pipestone

**Current Replacement Value:** \$3,970,632  
**Deferred Maintenance:** \$1,082,801  
**Ext. Gross Area:** 15,091

**Site: P01C55 - RED WING ARMORY**

**Building Code:** P01C5519001  
**Building Name:** Red Wing TACC  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 855 E 7th Street  
**City Code:** Red Wing

**Current Replacement Value:** \$5,709,512  
**Deferred Maintenance:** \$471,994  
**Ext. Gross Area:** 18,527

**Site: P01C60 - REDWOOD FALLS ARMORY**

**Building Code:** P01C6011001  
**Building Name:** Redwood Falls TACC  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 530 Hwy 101 N  
**City Code:** Redwood Falls

**Current Replacement Value:** \$4,225,529  
**Deferred Maintenance:** \$536,423  
**Ext. Gross Area:** 18,730



**Site: P01C65 - ROCHESTER RC and FMS**

**Building Code:** P01C6526001  
**Building Name:** Rochester TACC  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1715 Marion Road  
**City Code:** ROCHESTER

**Current Replacement Value:** \$10,002,475  
**Deferred Maintenance:** \$3,318,708  
**Ext. Gross Area:** 34,180

**Building Code:** P01C6526155  
**Building Name:** OMS #2  
**Facility Condition Index:** 0.14 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1715 Marion Road  
**City Code:** ROCHESTER

**Current Replacement Value:** \$756,349  
**Deferred Maintenance:** \$105,928  
**Ext. Gross Area:** 3,283

**Site: P01C67 - ROSEMOUNT ARMORY**

**Building Code:** P01C6708001  
**Building Name:** Rosemount TACC  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 13865 S Robert Trail  
**City Code:** Rosemount

**Current Replacement Value:** \$42,343,118  
**Deferred Maintenance:** \$14,102,626  
**Ext. Gross Area:** 171,262

**Site: P01C70 - ROSEVILLE ARMORY**

**Building Code:** P01C7006001  
**Building Name:** Roseville TACC  
**Facility Condition Index:** 0.41 - Poor

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 211 N McCarrons Blvd  
**City Code:** Roseville

**Current Replacement Value:** \$22,812,628  
**Deferred Maintenance:** \$9,258,019  
**Ext. Gross Area:** 53,966

**Site: P01C74 - St Cloud AASF**

**Building Code:** P01C7406155  
**Building Name:** St Cloud AASF  
**Facility Condition Index:** 0.03 - Excellent

**Cost Model Name:** Recreation Center  
**Address:**  
**City Code:** ST. CLOUD

**Current Replacement Value:** \$34,015,304  
**Deferred Maintenance:** \$941,834  
**Ext. Gross Area:** 125,269

**Site: P01C75 - ST CLOUD RC**

**Building Code:** P01C7506001  
**Building Name:** St Cloud TACC  
**Facility Condition Index:** 0.46 - Poor

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** ST. CLOUD

**Current Replacement Value:** \$8,679,992  
**Deferred Maintenance:** \$3,995,345  
**Ext. Gross Area:** 54,257

**Site: P01C80 - ST JAMES ARMORY AND MVSB**

**Building Code:** P01C8015001  
**Building Name:** St James TACC  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** ST. JAMES

**Current Replacement Value:** \$4,821,156  
**Deferred Maintenance:** \$603,969  
**Ext. Gross Area:** 16,176

**Site: P01C90 - ST PAUL CEDAR ST ARMORY**

**Building Code:** P01C9004002  
**Building Name:** Cedar Street TACC  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:**  
**City Code:** ST. PAUL

**Current Replacement Value:** \$33,400,210  
**Deferred Maintenance:** \$3,057,762  
**Ext. Gross Area:** 124,567

**Site: P01C95 - ST PAUL AASF**

**Building Code:** P01C9504003  
**Building Name:** AASF And TACC  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Recreation Center  
**Address:**  
**City Code:** ST. PAUL

**Current Replacement Value:** \$21,800,583  
**Deferred Maintenance:** \$6,374,075  
**Ext. Gross Area:** 143,250

**Site: P01D00 - ST PAUL EAST ARMORY**

**Building Code:** P01D0004001  
**Building Name:** East St Paul TACC  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** ST. PAUL

**Current Replacement Value:** \$5,433,331  
**Deferred Maintenance:** \$904,112  
**Ext. Gross Area:** 19,936

**Site: P01D05 - WEST ST PAUL ARMORY**

**Building Code:** P01D0505001  
**Building Name:** W. St Paul TACC  
**Facility Condition Index:** 0.45 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** ST. PAUL

**Current Replacement Value:** \$4,861,824  
**Deferred Maintenance:** \$2,165,117  
**Ext. Gross Area:** 18,148

**Site: P01D10 - ST PETER ARMORY**

**Building Code:** P01D1017001  
**Building Name:** St Peter TACC  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** ST. PETER

**Current Replacement Value:** \$3,808,098  
**Deferred Maintenance:** \$1,334,830  
**Ext. Gross Area:** 16,891

**Site: P01D15 - SAUK CENTRE ARMORY**

**Building Code:** P01D1504001  
**Building Name:** Sauk Centre TACC  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 628 3rd Street  
**City Code:** Sauk Centre

**Current Replacement Value:** \$5,282,039  
**Deferred Maintenance:** \$1,110,904  
**Ext. Gross Area:** 27,221

**Site: P01D20 - STILLWATER ARMORY**

**Building Code:** P01D2011001  
**Building Name:** Stillwater TACC  
**Facility Condition Index:** 0.39 - **Poor**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 107 E Chestnut St  
**City Code:** Stillwater

**Current Replacement Value:** \$7,816,029  
**Deferred Maintenance:** \$3,018,118  
**Ext. Gross Area:** 37,260

**Site: P01D25 - THIEF RIVER FALLS ARMORY**

**Building Code:** P01D2501001  
**Building Name:** Thief River Falls TACC  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 250 West Emil St.  
**City Code:** Thief River Fall

**Current Replacement Value:** \$5,096,980  
**Deferred Maintenance:** \$751,313  
**Ext. Gross Area:** 15,117

**Site: P01D45 - WADENA ARMORY**

**Building Code:** P01D4509001  
**Building Name:** Wadena TACC  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 517 N Jefferson  
**City Code:** Wadena

**Current Replacement Value:** \$5,673,081  
**Deferred Maintenance:** \$1,874,666  
**Ext. Gross Area:** 19,808

**Site: P01D60 - WILLMAR ARMORY AND FMS**

**Building Code:** P01D6007001  
**Building Name:** Willmar TACC  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Single-story Educational Facility  
**Address:** 614 Hwy 71 N  
**City Code:** Willmar

**Current Replacement Value:** \$2,862,829  
**Deferred Maintenance:** \$973,143  
**Ext. Gross Area:** 24,902

**Site: P01D70 - WINONA ARMORY**

**Building Code:** P01D7027001  
**Building Name:** Winona TACC  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1303 Homer Road  
**City Code:** Winona

**Current Replacement Value:** \$5,702,232  
**Deferred Maintenance:** \$833,845  
**Ext. Gross Area:** 17,889

**Agency: P07 - Public Safety**

**FCI Rating:** Average  
**Facility Condition Index:** 0.21

**Current Replacement Value:** \$4,392,060  
**Deferred Maintenance:** \$909,407

**Ext. Gross Area:** 20,360  
**Building Count:** 6

**Site: P07100 - Arden Hills Driver Exam Site**

**Building Code:** P0710000001  
**Building Name:** ARDEN HILLS - DRIVERS LICENSE  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 5400 Old Hwy 8  
**City Code:** Arden Hills

**Current Replacement Value:** \$1,533,279  
**Deferred Maintenance:** \$249,057  
**Ext. Gross Area:** 7,785

**Building Code:** P0710000002  
**Building Name:** ARDEN HILLS - MISC STORAGE  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 5400 Old Hwy 8  
**City Code:** Arden Hills

**Current Replacement Value:** \$57,612  
**Deferred Maintenance:** \$5,956  
**Ext. Gross Area:** 639

**Building Code:** P0710000003  
**Building Name:** ARDEN HILL - MISC STORAGE #2  
**Facility Condition Index:** 0.17 - Average

**Cost Model Name:** Utility Shed  
**Address:** 5400 Old Hwy 8  
**City Code:** Arden Hills

**Current Replacement Value:** \$9,067  
**Deferred Maintenance:** \$1,542  
**Ext. Gross Area:** 150

**Site: P07200 - Eagan Driver Exam Site**

**Building Code:** P0720000001  
**Building Name:** EAGAN - DRIVERS LICENSE  
**Facility Condition Index:** 0.24 - Average

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 2070 Cliff Road  
**City Code:** Eagan

**Current Replacement Value:** \$2,720,670  
**Deferred Maintenance:** \$643,559  
**Ext. Gross Area:** 10,998

**Building Code:** P0720000002  
**Building Name:** EAGAN - MISC STORAGE  
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 2070 Cliff Road  
**City Code:** Eagan

**Current Replacement Value:** \$55,402  
**Deferred Maintenance:** \$5,971  
**Ext. Gross Area:** 638

**Building Code:** P0720000003  
**Building Name:** EAGAN - MISC STORAGE #2  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Utility Shed  
**Address:** 2070 Cliff Road  
**City Code:** Eagan

**Current Replacement Value:** \$16,030  
**Deferred Maintenance:** \$3,321  
**Ext. Gross Area:** 150

## Agency: P78 - Department of Corrections

**FCI Rating:** Average  
**Facility Condition Index:** 0.21

**Current Replacement Value:** \$2,105,720,240  
**Deferred Maintenance:** \$448,018,708

**Ext. Gross Area:** 5,984,536  
**Building Count:** 314

### Site: P78103 - Moose Lake

**Building Code:** P7810300001  
**Building Name:** Unit 1  
**Facility Condition Index:** 0.28 - Average

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$10,279,246  
**Deferred Maintenance:** \$2,885,293  
**Ext. Gross Area:** 28,892

**Building Code:** P7810300002  
**Building Name:** Unit 2  
**Facility Condition Index:** 0.29 - Average

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$8,617,730  
**Deferred Maintenance:** \$2,510,250  
**Ext. Gross Area:** 28,847

**Building Code:** P7810300003  
**Building Name:** Unit 3  
**Facility Condition Index:** 0.28 - Average

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$10,391,906  
**Deferred Maintenance:** \$2,886,203  
**Ext. Gross Area:** 28,847

**Building Code:** P7810300004  
**Building Name:** Unit 4 Segregation/OSI  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$13,088,630  
**Deferred Maintenance:** \$2,762,043  
**Ext. Gross Area:** 28,895

**Building Code:** P7810300005  
**Building Name:** Storage Building D  
**Facility Condition Index:** 0.73 - Crisis

**Cost Model Name:** Single-story Work Facility  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$82,477  
**Deferred Maintenance:** \$60,351  
**Ext. Gross Area:** 1,006

**Building Code:** P7810300006  
**Building Name:** Pump House #1  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Bunker  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$80,910  
**Deferred Maintenance:** \$7,950  
**Ext. Gross Area:** 0

**Building Code:** P7810300007  
**Building Name:** Storage Building A  
**Facility Condition Index:** 0.75 - Crisis

**Cost Model Name:** Single-story Work Facility  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$139,659  
**Deferred Maintenance:** \$104,991  
**Ext. Gross Area:** 1,708

**Building Code:** P7810300008  
**Building Name:** Unit 8  
**Facility Condition Index:** 0.29 - Average

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$13,181,487  
**Deferred Maintenance:** \$3,784,640  
**Ext. Gross Area:** 34,704

**Building Code:** P7810300009  
**Building Name:** Storage Building B  
**Facility Condition Index:** 0.29 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$20,943  
**Deferred Maintenance:** \$6,116  
**Ext. Gross Area:** 288

**Building Code:** P7810300010  
**Building Name:** Unit 10 - ANNEX  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1000 Lake Shore Drive  
**City Code:** Moose Lake

**Current Replacement Value:** \$13,444,544  
**Deferred Maintenance:** \$2,763,560  
**Ext. Gross Area:** 34,714

<b>Building Code:</b>	P7810300011	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,426
<b>Building Name:</b>	Pump House #2	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$209
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	48
<b>Building Code:</b>	P7810300012	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$171,453
<b>Building Name:</b>	Storage Building E	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$137,320
<b>Facility Condition Index:</b>	0.80 - <b>Crisis</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	1,564
<b>Building Code:</b>	P7810300015	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$27,119
<b>Building Name:</b>	Storage Building C	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$8,307
<b>Facility Condition Index:</b>	0.31 - <b>Poor</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	384
<b>Building Code:</b>	P7810300035	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$5,409,760
<b>Building Name:</b>	Unit 35	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$1,283,047
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	18,492
<b>Building Code:</b>	P7810300050	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$9,767,106
<b>Building Name:</b>	Bldg 50 Area H	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$1,796,148
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	33,494
<b>Building Code:</b>	P7810300051	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$12,185,425
<b>Building Name:</b>	Bldg 50 L Wing W Visit	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$2,818,666
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	37,822
<b>Building Code:</b>	P7810300052	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$11,726,501
<b>Building Name:</b>	Bldg 50 K Wing E HS	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$2,729,810
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	37,576
<b>Building Code:</b>	P7810300053	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$14,847,452
<b>Building Name:</b>	Bldg 50 J "S" Wings	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$3,980,099
<b>Facility Condition Index:</b>	0.27 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	41,449
<b>Building Code:</b>	P7810300054	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$13,475,422
<b>Building Name:</b>	Area M	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$3,580,889
<b>Facility Condition Index:</b>	0.27 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	29,674
<b>Building Code:</b>	P7810300060	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$4,899,291
<b>Building Name:</b>	Bldg 60	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$1,354,112
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	13,677
<b>Building Code:</b>	P7810300064	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$12,932,936
<b>Building Name:</b>	Bldg 64	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$2,657,213
<b>Facility Condition Index:</b>	0.21 - <b>Average</b>	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	20,742

<b>Building Code:</b>	P7810300065	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$6,263,832
<b>Building Name:</b>	Bldg 65	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$1,593,529
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	18,715
<b>Building Code:</b>	P7810300070	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$6,380,573
<b>Building Name:</b>	Power Plant	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$1,409,593
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	27,581
<b>Building Code:</b>	P7810300074	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,708,444
<b>Building Name:</b>	Maintenance	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$185,340
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	7,922
<b>Building Code:</b>	P7810300080	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$20,403,919
<b>Building Name:</b>	Industry	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$2,719,932
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	72,955
<b>Building Code:</b>	P7810300081	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$418,071
<b>Building Name:</b>	Training Building	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$138,096
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	1,720
<b>Building Code:</b>	P7810300082	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$87,700
<b>Building Name:</b>	Truck Gate	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$11,748
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	P7810300083	<b>Cost Model Name:</b>	Recreation Center	<b>Current Replacement Value:</b>	\$5,059,637
<b>Building Name:</b>	Gymnasium	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$432,627
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	16,218
<b>Building Code:</b>	P7810300084	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$805,295
<b>Building Name:</b>	Bldg 84	<b>Address:</b>	1000 Lake Shore Drive	<b>Deferred Maintenance:</b>	\$39,165
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	Moose Lake	<b>Ext. Gross Area:</b>	3,600

**Site: P78114 - Rush City**

<b>Building Code:</b>	P7811400001	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$11,287,795
<b>Building Name:</b>	RC_Admin	<b>Address:</b>	7600 525th Street	<b>Deferred Maintenance:</b>	\$564,464
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	Rush City	<b>Ext. Gross Area:</b>	54,710
<b>Building Code:</b>	P7811400002	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$73,499,910
<b>Building Name:</b>	RC_Support	<b>Address:</b>	7600 525th Street	<b>Deferred Maintenance:</b>	\$5,014,041
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	Rush City	<b>Ext. Gross Area:</b>	192,755
<b>Building Code:</b>	P7811400003	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$15,862,503
<b>Building Name:</b>	RC_Complex 1	<b>Address:</b>	7600 525th Street	<b>Deferred Maintenance:</b>	\$661,995
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	Rush City	<b>Ext. Gross Area:</b>	47,497

**Building Code:** P7811400004  
**Building Name:** RC\_Complex 3  
**Facility Condition Index:** 0.03 - **Excellent**

**Building Code:** P7811400007  
**Building Name:** RC\_Complex 4  
**Facility Condition Index:** 0.04 - **Excellent**

**Building Code:** P7811400008  
**Building Name:** RC\_Complex 2  
**Facility Condition Index:** 0.03 - **Excellent**

**Building Code:** P7811400009  
**Building Name:** RC\_Generator Bldg  
**Facility Condition Index:** 0.09 - **Good**

**Building Code:** P7811400020  
**Building Name:** Program Building  
**Facility Condition Index:** 0.10 - **Good**

**Building Code:** P7811400028  
**Building Name:** Garage  
**Facility Condition Index:** 0.14 - **Good**

**Building Code:** P7811400030  
**Building Name:** Groundskeeper  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Cost Model Name:** Single-story Work Facility  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Cost Model Name:** Single-story Educational Facility  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Cost Model Name:** Single-story Work Facility  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7600 525th Street  
**City Code:** Rush City

**Current Replacement Value:** \$15,636,772  
**Deferred Maintenance:** \$533,844  
**Ext. Gross Area:** 46,722

**Current Replacement Value:** \$16,097,188  
**Deferred Maintenance:** \$638,738  
**Ext. Gross Area:** 46,733

**Current Replacement Value:** \$15,855,370  
**Deferred Maintenance:** \$522,049  
**Ext. Gross Area:** 47,475

**Current Replacement Value:** \$2,246,998  
**Deferred Maintenance:** \$197,609  
**Ext. Gross Area:** 2,360

**Current Replacement Value:** \$395,956  
**Deferred Maintenance:** \$38,264  
**Ext. Gross Area:** 2,532

**Current Replacement Value:** \$60,632  
**Deferred Maintenance:** \$8,263  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$361,098  
**Deferred Maintenance:** \$12,120  
**Ext. Gross Area:** 2,881

**Site: P78550 - Lino Lakes**

**Building Code:** P7855000102  
**Building Name:** J-1 Kellogg  
**Facility Condition Index:** 0.11 - **Good**

**Building Code:** P7855000202  
**Building Name:** A Power House  
**Facility Condition Index:** 0.18 - **Average**

**Building Code:** P7855000302  
**Building Name:** M Pump House  
**Facility Condition Index:** 0.21 - **Average**

**Building Code:** P7855000402  
**Building Name:** L-2 Sibley  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Single-story Work Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Utility Shed  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Current Replacement Value:** \$5,006,512  
**Deferred Maintenance:** \$565,871  
**Ext. Gross Area:** 18,757

**Current Replacement Value:** \$12,166,411  
**Deferred Maintenance:** \$2,178,775  
**Ext. Gross Area:** 11,137

**Current Replacement Value:** \$32,293  
**Deferred Maintenance:** \$6,799  
**Ext. Gross Area:** 180

**Current Replacement Value:** \$4,649,621  
**Deferred Maintenance:** \$1,078,496  
**Ext. Gross Area:** 12,032



<b>Building Code:</b>	P7855000502	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$577,809
<b>Building Name:</b>	S Maintenance Garage	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$81,995
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	3,836
<b>Building Code:</b>	P7855000602	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$32,293
<b>Building Name:</b>	N Valve House	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$6,799
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	180
<b>Building Code:</b>	P7855000902	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$5,782,209
<b>Building Name:</b>	J-2 Andrews	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$731,872
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	18,757
<b>Building Code:</b>	P7855001002	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$16,429,058
<b>Building Name:</b>	H Food Service	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$4,486,602
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	27,100
<b>Building Code:</b>	P7855001102	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$913,719
<b>Building Name:</b>	T Building	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$248,683
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	6,028
<b>Building Code:</b>	P7855001202	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$32,614,503
<b>Building Name:</b>	B Building	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$6,879,939
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	88,595
<b>Building Code:</b>	P7855001302	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$640,830
<b>Building Name:</b>	R Control Center	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$132,352
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	2,245
<b>Building Code:</b>	P7855001402	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,223,268
<b>Building Name:</b>	F-2 Administration	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$464,241
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	10,178
<b>Building Code:</b>	P7855001602	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$4,342,026
<b>Building Name:</b>	J-3 Carver	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$521,934
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	18,757
<b>Building Code:</b>	P7855001702	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,388,517
<b>Building Name:</b>	E Building	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$1,235,352
<b>Facility Condition Index:</b>	0.52 - Crisis	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	10,397
<b>Building Code:</b>	P7855001802	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$12,432
<b>Building Name:</b>	Gate Shed	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$740
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	99

<b>Building Code:</b>	P7855002002	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$4,426,859
<b>Building Name:</b>	L-1 Mayo	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$1,072,828
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	12,560
<b>Building Code:</b>	P7855002102	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,229,930
<b>Building Name:</b>	F-1 LRC	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$213,613
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	9,019
<b>Building Code:</b>	P7855002202	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$6,880,641
<b>Building Name:</b>	G Operations	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$1,570,275
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	28,668
<b>Building Code:</b>	P7855002302	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$8,773,355
<b>Building Name:</b>	K-4	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$1,429,991
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	24,175
<b>Building Code:</b>	P7855002401	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$8,732,100
<b>Building Name:</b>	K-3	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$1,429,166
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	24,176
<b>Building Code:</b>	P7855002402	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$9,013,036
<b>Building Name:</b>	C Activities	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$2,920,190
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	35,094
<b>Building Code:</b>	P7855002802	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,067,230
<b>Building Name:</b>	U Building	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$242,102
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	8,875
<b>Building Code:</b>	P7855002901	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$41,175
<b>Building Name:</b>	Maintenance Storage Garage	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$4,010
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	624
<b>Building Code:</b>	P7855003102	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$278,000
<b>Building Name:</b>	Engineer Pole Barn	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$10,563
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	2,911
<b>Building Code:</b>	P7855003202	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$24,053,457
<b>Building Name:</b>	Triad	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$2,035,683
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	59,908
<b>Building Code:</b>	P7855003302	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,556,278
<b>Building Name:</b>	Education	<b>Address:</b>	7525 4th Avenue	<b>Deferred Maintenance:</b>	\$245,710
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Lino Lakes	<b>Ext. Gross Area:</b>	11,138

**Building Code:** P7855003402  
**Building Name:** MCO  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** P7855003502  
**Building Name:** Q Building  
**Facility Condition Index:** 0.24 - *Average*

**Building Code:** P7855003702  
**Building Name:** South Housing  
**Facility Condition Index:** 0.04 - *Excellent*

**Building Code:** P7855003902  
**Building Name:** U Building Annex  
**Facility Condition Index:** 0.30 - *Poor*

**Building Code:** P7855004102  
**Building Name:** Trades Pole Barn  
**Facility Condition Index:** 0.06 - *Good*

**Building Code:** P7855004202  
**Building Name:** Green House  
**Facility Condition Index:** 0.17 - *Average*

**Building Code:** P7855004302  
**Building Name:** Religious Storage  
**Facility Condition Index:** 0.26 - *Average*

**Building Code:** P7855004304  
**Building Name:** East Tunnels  
**Facility Condition Index:** 0.15 - *Good*

**Building Code:** P7855004403  
**Building Name:** West Tunnel  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Single-story Work Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Single-story Work Facility  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Utility Shed  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Tunnel  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Cost Model Name:** Tunnel  
**Address:** 7525 4th Avenue  
**City Code:** Lino Lakes

**Current Replacement Value:** \$23,029  
**Deferred Maintenance:** \$4,760  
**Ext. Gross Area:** 123

**Current Replacement Value:** \$10,368,897  
**Deferred Maintenance:** \$2,514,101  
**Ext. Gross Area:** 31,091

**Current Replacement Value:** \$35,804,342  
**Deferred Maintenance:** \$1,492,714  
**Ext. Gross Area:** 93,397

**Current Replacement Value:** \$91,512  
**Deferred Maintenance:** \$27,862  
**Ext. Gross Area:** 696

**Current Replacement Value:** \$226,396  
**Deferred Maintenance:** \$13,676  
**Ext. Gross Area:** 2,400

**Current Replacement Value:** \$113,174  
**Deferred Maintenance:** \$19,023  
**Ext. Gross Area:** 1,256

**Current Replacement Value:** \$12,556  
**Deferred Maintenance:** \$3,306  
**Ext. Gross Area:** 120

**Current Replacement Value:** \$3,931,267  
**Deferred Maintenance:** \$578,272  
**Ext. Gross Area:** 15,064

**Current Replacement Value:** \$3,613,018  
**Deferred Maintenance:** \$385,613  
**Ext. Gross Area:** 18,149

**Site: P78620 - Stillwater**

**Building Code:** P7862000000  
**Building Name:** Stillwater All Site  
**Facility Condition Index:** 0.07 - *Good*

**Building Code:** P7862000282  
**Building Name:** Power House - #19  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 970 Pickett Street No  
**City Code:** Bayport

**Cost Model Name:** Single-story Work Facility  
**Address:** 970 Pickett Street No  
**City Code:** Bayport

**Current Replacement Value:** \$451,544  
**Deferred Maintenance:** \$29,597  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$44,848,338  
**Deferred Maintenance:** \$8,849,270  
**Ext. Gross Area:** 28,827

<b>Building Code:</b>	P7862000582	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$5,655,482
<b>Building Name:</b>	Health Services #10	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$479,088
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	20,636
<b>Building Code:</b>	P7862000882	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$14,457,412
<b>Building Name:</b>	Cell Hall C #9	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$2,288,010
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	29,171
<b>Building Code:</b>	P7862001282	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$33,826,588
<b>Building Name:</b>	Industry Bldg #18	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$16,873,490
<b>Facility Condition Index:</b>	0.50 - <b>Poor</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	124,776
<b>Building Code:</b>	P7862001382	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$4,901,722
<b>Building Name:</b>	Industry #26	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$1,902,183
<b>Facility Condition Index:</b>	0.39 - <b>Poor</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	18,400
<b>Building Code:</b>	P7862001482	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$285,175
<b>Building Name:</b>	Utility #22	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$74,513
<b>Facility Condition Index:</b>	0.26 - <b>Average</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	1,038
<b>Building Code:</b>	P7862001582	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,155,570
<b>Building Name:</b>	Vehicle Mt Garage #42	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$102,141
<b>Facility Condition Index:</b>	0.09 - <b>Good</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	4,602
<b>Building Code:</b>	P7862001782	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$7,993,777
<b>Building Name:</b>	MN Security Unit #35	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$1,188,709
<b>Facility Condition Index:</b>	0.15 - <b>Good</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	20,638
<b>Building Code:</b>	P7862001882	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,896,305
<b>Building Name:</b>	Bldg Mt Svc #24	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$316,918
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	10,378
<b>Building Code:</b>	P7862001982	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$7,493,611
<b>Building Name:</b>	Kitchen #15	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$1,924,891
<b>Facility Condition Index:</b>	0.26 - <b>Average</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	39,035
<b>Building Code:</b>	P7862002082	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$24,046,102
<b>Building Name:</b>	Industry Bldg #20	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$7,758,762
<b>Facility Condition Index:</b>	0.32 - <b>Poor</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	125,768
<b>Building Code:</b>	P7862002182	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$32,878,768
<b>Building Name:</b>	Cell Hall D #12	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$16,676,039
<b>Facility Condition Index:</b>	0.51 - <b>Crisis</b>	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	62,862

<b>Building Code:</b>	P7862002482	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$4,269,783
<b>Building Name:</b>	Main Corridor #6	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$776,564
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	23,935
<b>Building Code:</b>	P7862002782	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$27,631,193
<b>Building Name:</b>	Industry /Plt Op #25	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,318,786
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	63,288
<b>Building Code:</b>	P7862002882	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$3,609,803
<b>Building Name:</b>	Commissary #49	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$968,163
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	10,430
<b>Building Code:</b>	P7862003082	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$12,551,085
<b>Building Name:</b>	Education #13	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$2,510,001
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	47,069
<b>Building Code:</b>	P7862003182	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,136,494
<b>Building Name:</b>	Chapel #7	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$241,831
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	3,929
<b>Building Code:</b>	P7862003482	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$10,930,516
<b>Building Name:</b>	Dining Room #14	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,749,639
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	16,008
<b>Building Code:</b>	P7862003582	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$20,863,934
<b>Building Name:</b>	Administration #1	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$2,718,967
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	55,006
<b>Building Code:</b>	P7862003782	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$81,849,059
<b>Building Name:</b>	Cell Hall A #5	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$30,961,293
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	154,500
<b>Building Code:</b>	P7862004082	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$953,413
<b>Building Name:</b>	Grainery Storage #50	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$401,509
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	5,046
<b>Building Code:</b>	P7862004182	<b>Cost Model Name:</b>	Recreation Center	<b>Current Replacement Value:</b>	\$6,193,225
<b>Building Name:</b>	Recreation #11	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$2,004,197
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	26,178
<b>Building Code:</b>	P7862004482	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$886,058
<b>Building Name:</b>	Outside Construction #45	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$202,838
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	9,094

<b>Building Code:</b>	P7862004582	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$58,837,320
<b>Building Name:</b>	Cell Hall B #3	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$22,641,423
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	154,684
<b>Building Code:</b>	P7862004782	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$4,629,519
<b>Building Name:</b>	Admin West Annex #4	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$911,009
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	18,265
<b>Building Code:</b>	P7862005282	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$4,291,991
<b>Building Name:</b>	Admin Annex #28	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$439,313
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	10,195
<b>Building Code:</b>	P7862005482	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,532
<b>Building Name:</b>	Scale House #48	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$5,741
<b>Facility Condition Index:</b>	0.46 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	65
<b>Building Code:</b>	P7862005582	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$460,702
<b>Building Name:</b>	Generator #1 Bldg #38	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$44,662
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	1,617
<b>Building Code:</b>	P7862005682	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$26,401,467
<b>Building Name:</b>	Industry Bldg #21	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$4,880,198
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	87,762
<b>Building Code:</b>	P7862005882	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$3,329,164
<b>Building Name:</b>	Control Unit #2	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$690,049
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	10,767
<b>Building Code:</b>	P7862005982	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$108,953
<b>Building Name:</b>	Garage #30	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$12,776
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	999
<b>Building Code:</b>	P7862006282	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,571,971
<b>Building Name:</b>	Discipline #8	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$193,558
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	3,835
<b>Building Code:</b>	P7862006382	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,267,866
<b>Building Name:</b>	Flammable Storage #41	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$234,756
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	4,976
<b>Building Code:</b>	P7862006482	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$8,309,940
<b>Building Name:</b>	West Warehouse # 37	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,490,172
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	58,545

<b>Building Code:</b>	P7862006582	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$7,811,866
<b>Building Name:</b>	East Warehouse #36	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,699,621
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	66,706
<b>Building Code:</b>	P7862006682	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$3,201,077
<b>Building Name:</b>	Root Cellar #40	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$199,712
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	5,492
<b>Building Code:</b>	P7862006882	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$60,240
<b>Building Name:</b>	Residence Garage #29	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$4,514
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	1,056
<b>Building Code:</b>	P7862006882	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$173,425
<b>Building Name:</b>	Residence Garage #29	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$26,508
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	1,056
<b>Building Code:</b>	P7862007182	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$361,783
<b>Building Name:</b>	Butler Building #57	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$39,281
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	3,405
<b>Building Code:</b>	P7862007282	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$635,791
<b>Building Name:</b>	Storage #58	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$95,376
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	6,050
<b>Building Code:</b>	P7862007682	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$160,797
<b>Building Name:</b>	Storage #54	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$50,905
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	1,061
<b>Building Code:</b>	P7862007782	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$419,584
<b>Building Name:</b>	Machine Storage #44	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$62,124
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	4,038
<b>Building Code:</b>	P7862008082	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$291,379
<b>Building Name:</b>	C/O Transporation Garage #43	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$43,598
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	3,072
<b>Building Code:</b>	P7862008084	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$256,733
<b>Building Name:</b>	Sally Port #73	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$95,669
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	163
<b>Building Code:</b>	P7862008084	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$71,265
<b>Building Name:</b>	Sally Port #73	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$9,939
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	163



<b>Building Code:</b>	P7862008085	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$108,851
<b>Building Name:</b>	Green House #74	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$19,080
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	1,771
<b>Building Code:</b>	P7862008086	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$263,736
<b>Building Name:</b>	Green House #75	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$61,495
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	2,195
<b>Building Code:</b>	P7862008088	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$177,771
<b>Building Name:</b>	Guard Tower #1	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,659
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	407
<b>Building Code:</b>	P7862008089	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$187,712
<b>Building Name:</b>	Guard Tower #2	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,856
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	405
<b>Building Code:</b>	P7862008090	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$229,508
<b>Building Name:</b>	Guard Tower #3	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$4,712
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	553
<b>Building Code:</b>	P7862008091	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$204,630
<b>Building Name:</b>	Guard Tower #4	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$4,196
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	411
<b>Building Code:</b>	P7862008092	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$187,873
<b>Building Name:</b>	Guard Tower #5	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,857
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	395
<b>Building Code:</b>	P7862008093	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$214,795
<b>Building Name:</b>	Guard Tower #6	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$4,410
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	452
<b>Building Code:</b>	P7862008094	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$193,505
<b>Building Name:</b>	Guard Tower #7	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$3,973
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	407
<b>Building Code:</b>	P7862008096	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$224,496
<b>Building Name:</b>	Industry Pass Bldg #76	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$32,994
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	768
<b>Building Code:</b>	P7862008097	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$200,922
<b>Building Name:</b>	South Gate Officers Station #77	<b>Address:</b>	970 Pickett Street No	<b>Deferred Maintenance:</b>	\$6,073
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	Bayport	<b>Ext. Gross Area:</b>	480



**Building Code:** P7862008100  
**Building Name:** Segregation Bldg #17  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 970 Pickett Street No  
**City Code:** Bayport

**Current Replacement Value:** \$19,370,255  
**Deferred Maintenance:** \$1,160,756  
**Ext. Gross Area:** 60,977

**Building Code:** P7862008101  
**Building Name:** Water Treatment  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** Bayport

**Current Replacement Value:** \$613,158  
**Deferred Maintenance:** \$12,263  
**Ext. Gross Area:** 3,487

**Site: P78630 - Oak Park Heights**

**Building Code:** P7863000100  
**Building Name:** Complex 1  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$11,835,661  
**Deferred Maintenance:** \$1,243,002  
**Ext. Gross Area:** 30,842

**Building Code:** P7863000200  
**Building Name:** Complex 2  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$9,382,026  
**Deferred Maintenance:** \$1,144,428  
**Ext. Gross Area:** 34,810

**Building Code:** P7863000300  
**Building Name:** Complex 3  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$11,647,384  
**Deferred Maintenance:** \$1,261,618  
**Ext. Gross Area:** 31,629

**Building Code:** P7863000400  
**Building Name:** Complex 4  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$11,747,364  
**Deferred Maintenance:** \$1,256,831  
**Ext. Gross Area:** 30,841

**Building Code:** P7863000500  
**Building Name:** Complex 5  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$11,379,459  
**Deferred Maintenance:** \$1,269,890  
**Ext. Gross Area:** 30,079

**Building Code:** P7863000600  
**Building Name:** Complex 6  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$13,018,057  
**Deferred Maintenance:** \$1,373,576  
**Ext. Gross Area:** 34,199

**Building Code:** P7863000700  
**Building Name:** Complex 7  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$8,729,134  
**Deferred Maintenance:** \$840,345  
**Ext. Gross Area:** 20,086

**Building Code:** P7863000800  
**Building Name:** Complex 8  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$13,986,684  
**Deferred Maintenance:** \$1,202,999  
**Ext. Gross Area:** 42,209

**Building Code:** P7863000900  
**Building Name:** Gym/Chapel  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Mid-rise Office Building, 5 to 10 story  
**Address:** 5329 Osgood Avenue North  
**City Code:** Stillwater

**Current Replacement Value:** \$12,359,745  
**Deferred Maintenance:** \$2,965,186  
**Ext. Gross Area:** 26,849

<b>Building Code:</b>	P7863001000	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$28,371,485
<b>Building Name:</b>	Core Building	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$6,835,583
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	61,932
<b>Building Code:</b>	P7863001100	<b>Cost Model Name:</b>	Mid-rise Office Building, 5 to 10 story	<b>Current Replacement Value:</b>	\$4,778,944
<b>Building Name:</b>	Warehouse/Garage/Range	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$662,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	27,862
<b>Building Code:</b>	P7863001200	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$22,277
<b>Building Name:</b>	Communications Bldg	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$2,430
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	180
<b>Building Code:</b>	P7863001300	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$49,456
<b>Building Name:</b>	Polebarn/Storage	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$1,275
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	2,880
<b>Building Code:</b>	P7863001400	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$164,743
<b>Building Name:</b>	Bridge	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$10,688
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	2,016
<b>Building Code:</b>	P7863001500	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$623,350
<b>Building Name:</b>	Boiler Building	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$13,280
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	799
<b>Building Code:</b>	P7863001600	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$17,976,888
<b>Building Name:</b>	ACU	<b>Address:</b>	5329 Osgood Avenue North	<b>Deferred Maintenance:</b>	\$1,906,149
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	Stillwater	<b>Ext. Gross Area:</b>	46,711

**Site: P78640 - Shakopee**

<b>Building Code:</b>	P7864000001	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$18,473,972
<b>Building Name:</b>	Core	<b>Address:</b>	1010 West 6th Avenue	<b>Deferred Maintenance:</b>	\$4,880,838
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	Shakopee	<b>Ext. Gross Area:</b>	72,934
<b>Building Code:</b>	P7864000002	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$9,904,676
<b>Building Name:</b>	Bldg D Roosevelt	<b>Address:</b>	1010 West 6th Avenue	<b>Deferred Maintenance:</b>	\$2,947,676
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	Shakopee	<b>Ext. Gross Area:</b>	11,786
<b>Building Code:</b>	P7864000003	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$3,240,254
<b>Building Name:</b>	Bldg G Novello	<b>Address:</b>	1010 West 6th Avenue	<b>Deferred Maintenance:</b>	\$694,515
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Shakopee	<b>Ext. Gross Area:</b>	8,695
<b>Building Code:</b>	P7864000004	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$7,673,774
<b>Building Name:</b>	Bldg H Power Plant	<b>Address:</b>	1010 West 6th Avenue	<b>Deferred Maintenance:</b>	\$2,186,265
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	Shakopee	<b>Ext. Gross Area:</b>	4,144

**Building Code:** P7864000005  
**Building Name:** Bldg J Anthony  
**Facility Condition Index:** 0.25 - Average

**Building Code:** P7864000006  
**Building Name:** Bldg K Broker  
**Facility Condition Index:** 0.15 - Average

**Building Code:** P7864000007  
**Building Name:** Bldg L Bethune  
**Facility Condition Index:** 0.15 - Average

**Building Code:** P7864000008  
**Building Name:** Bldg M Mead  
**Facility Condition Index:** 0.17 - Average

**Building Code:** P7864000009  
**Building Name:** Bldg N Parks  
**Facility Condition Index:** 0.11 - Good

**Building Code:** P7864000010  
**Building Name:** Bldg F Higbee  
**Facility Condition Index:** 0.17 - Average

**Building Code:** P7864000012  
**Building Name:** Bldg P Monahan  
**Facility Condition Index:** 0.06 - Good

**Building Code:** P7864000013  
**Building Name:** Greenhouse  
**Facility Condition Index:** 0.08 - Good

**Building Code:** P7864000014  
**Building Name:** Bldg E Tubman  
**Facility Condition Index:** 0.29 - Average

**Building Code:** P7864000015  
**Building Name:** Garage  
**Facility Condition Index:** 0.12 - Good

**Site: P78760 - Red Wing**

**Building Code:** P7876000010  
**Building Name:** Barn #1  
**Facility Condition Index:** 0.47 - Poor

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Fabric Structure  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Single-story Work Facility  
**Address:** 1010 West 6th Avenue  
**City Code:** Shakopee

**Cost Model Name:** Single-story Work Facility  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$3,905,165  
**Deferred Maintenance:** \$982,794  
**Ext. Gross Area:** 11,786

**Current Replacement Value:** \$6,121,085  
**Deferred Maintenance:** \$938,758  
**Ext. Gross Area:** 18,674

**Current Replacement Value:** \$6,121,193  
**Deferred Maintenance:** \$938,765  
**Ext. Gross Area:** 18,676

**Current Replacement Value:** \$3,295,052  
**Deferred Maintenance:** \$576,334  
**Ext. Gross Area:** 5,142

**Current Replacement Value:** \$13,759,902  
**Deferred Maintenance:** \$1,546,677  
**Ext. Gross Area:** 32,470

**Current Replacement Value:** \$2,539,992  
**Deferred Maintenance:** \$441,931  
**Ext. Gross Area:** 10,450

**Current Replacement Value:** \$13,905,653  
**Deferred Maintenance:** \$775,674  
**Ext. Gross Area:** 41,220

**Current Replacement Value:** \$407,280  
**Deferred Maintenance:** \$33,486  
**Ext. Gross Area:** 6,331

**Current Replacement Value:** \$3,444,715  
**Deferred Maintenance:** \$990,954  
**Ext. Gross Area:** 11,790

**Current Replacement Value:** \$498,065  
**Deferred Maintenance:** \$57,795  
**Ext. Gross Area:** 1,781

**Current Replacement Value:** \$519,275  
**Deferred Maintenance:** \$244,557  
**Ext. Gross Area:** 4,630

<b>Building Code:</b>	P7876000030	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$9,490,478
<b>Building Name:</b>	Dayton #30	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$1,002,073
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	20,209
<b>Building Code:</b>	P7876000031	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$79,136
<b>Building Name:</b>	Garage #31	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$3,147
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	611
<b>Building Code:</b>	P7876000032	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$536,308
<b>Building Name:</b>	Garage #32	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$61,892
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	4,201
<b>Building Code:</b>	P7876000033	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$15,652
<b>Building Name:</b>	Gas Metering House	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$1,498
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	142
<b>Building Code:</b>	P7876000125	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$23,844,245
<b>Building Name:</b>	Industrial Building #10	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$6,784,615
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	46,895
<b>Building Code:</b>	P7876000160	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$156,512
<b>Building Name:</b>	Garden Storage #16	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$72,818
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	848
<b>Building Code:</b>	P7876000180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$208,849
<b>Building Name:</b>	Storage Building #18	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$20,807
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	1,950
<b>Building Code:</b>	P7876000325	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$535,895
<b>Building Name:</b>	Garage/State #14	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$80,363
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	2,547
<b>Building Code:</b>	P7876000800	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$47,361
<b>Building Name:</b>	Flammable Storage #8	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$5,983
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	192
<b>Building Code:</b>	P7876000900	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$45,019
<b>Building Name:</b>	Deep Well Pump House #9	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$18,833
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	220
<b>Building Code:</b>	P7876000925	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,200,024
<b>Building Name:</b>	Maintenance Office #6	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$419,866
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	3,655

<b>Building Code:</b>	P7876001125	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$865,378
<b>Building Name:</b>	Green House #11	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$323,549
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	3,540
<b>Building Code:</b>	P7876001321	<b>Cost Model Name:</b>	Parking Structure	<b>Current Replacement Value:</b>	\$417,382
<b>Building Name:</b>	Root Cellar #15	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$42,937
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	3,663
<b>Building Code:</b>	P7876001425	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$2,644,970
<b>Building Name:</b>	Duke #5	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$522,328
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	9,880
<b>Building Code:</b>	P7876001525	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,466,347
<b>Building Name:</b>	Cabinet Shop #12	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$197,069
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	3,959
<b>Building Code:</b>	P7876001625	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$731,659
<b>Building Name:</b>	Welding Shop #7	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$93,793
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	1,528
<b>Building Code:</b>	P7876001925	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$2,582,575
<b>Building Name:</b>	Food Prep #19	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$445,162
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	8,846
<b>Building Code:</b>	P7876002325	<b>Cost Model Name:</b>	Multi-story Educational Facility	<b>Current Replacement Value:</b>	\$10,469,222
<b>Building Name:</b>	School #25	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$1,259,580
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	34,908
<b>Building Code:</b>	P7876002400	<b>Cost Model Name:</b>	Multi-story Educational Facility	<b>Current Replacement Value:</b>	\$14,250,986
<b>Building Name:</b>	Vocational Building	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$337,725
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	24,303
<b>Building Code:</b>	P7876002425	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$5,787,893
<b>Building Name:</b>	Chapel #21	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$1,175,943
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	13,739
<b>Building Code:</b>	P7876002525	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$2,901,898
<b>Building Name:</b>	Volunteer Center #28	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$281,207
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	6,660
<b>Building Code:</b>	P7876002725	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$23,606,772
<b>Building Name:</b>	Admin/Centennial Hall	<b>Address:</b>	1079 Highway 292	<b>Deferred Maintenance:</b>	\$9,295,013
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	Red Wing	<b>Ext. Gross Area:</b>	70,748

**Building Code:** P7876002825  
**Building Name:** Yale #27  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$2,307,613  
**Deferred Maintenance:** \$464,915  
**Ext. Gross Area:** 7,487

**Building Code:** P7876002925  
**Building Name:** Brown #29  
**Facility Condition Index:** 0.09 - *Good*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$3,199,126  
**Deferred Maintenance:** \$291,948  
**Ext. Gross Area:** 7,441

**Building Code:** P7876003425  
**Building Name:** Grinnell #4  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$4,160,185  
**Deferred Maintenance:** \$1,047,938  
**Ext. Gross Area:** 13,368

**Building Code:** P7876003525  
**Building Name:** Knox #20  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$3,033,786  
**Deferred Maintenance:** \$720,013  
**Ext. Gross Area:** 9,830

**Building Code:** P7876003625  
**Building Name:** Stanford #2  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$2,016,306  
**Deferred Maintenance:** \$360,841  
**Ext. Gross Area:** 7,462

**Building Code:** P7876003825  
**Building Name:** Princeton #26  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$2,494,011  
**Deferred Maintenance:** \$435,738  
**Ext. Gross Area:** 7,935

**Building Code:** P7876004125  
**Building Name:** Harvard #3  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$2,253,368  
**Deferred Maintenance:** \$444,862  
**Ext. Gross Area:** 7,534

**Building Code:** P7876006254  
**Building Name:** Laundry #24  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1079 Highway 292  
**City Code:** Red Wing

**Current Replacement Value:** \$466,852  
**Deferred Maintenance:** \$99,245  
**Ext. Gross Area:** 1,977

**Site: P78780 - TOGO**

**Building Code:** P7878010001  
**Building Name:** Barracks #3  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Current Replacement Value:** \$358,525  
**Deferred Maintenance:** \$61,482  
**Ext. Gross Area:** 3,484

**Building Code:** P7878010002  
**Building Name:** Green Storage Building  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Current Replacement Value:** \$105,597  
**Deferred Maintenance:** \$21,360  
**Ext. Gross Area:** 2,020

**Building Code:** P7878010003  
**Building Name:** Challenge  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Current Replacement Value:** \$608,092  
**Deferred Maintenance:** \$201,666  
**Ext. Gross Area:** 3,599

<b>Building Code:</b>	P7878010004	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$1,190,762
<b>Building Name:</b>	Dormitory	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$235,236
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	8,085
<b>Building Code:</b>	P7878010005	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$2,286,213
<b>Building Name:</b>	CD Services/Health Services	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$349,477
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	10,825
<b>Building Code:</b>	P7878010006	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$20,789
<b>Building Name:</b>	Barracks #1	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$5,141
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	187
<b>Building Code:</b>	P7878010007	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$375,048
<b>Building Name:</b>	Education	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$56,744
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	2,223
<b>Building Code:</b>	P7878010008	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$120,795
<b>Building Name:</b>	Industry	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$46,706
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	1,629
<b>Building Code:</b>	P7878010009	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$1,137,065
<b>Building Name:</b>	Gym	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$285,882
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	5,852
<b>Building Code:</b>	P7878010010	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$242,172
<b>Building Name:</b>	Chapel	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$34,827
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	1,244
<b>Building Code:</b>	P7878010011	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$33,566
<b>Building Name:</b>	Ski Chalet	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$28,384
<b>Facility Condition Index:</b>	0.85 - Crisis	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	406
<b>Building Code:</b>	P7878010012	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$24,825
<b>Building Name:</b>	Gym - Water Pump 3	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$2,301
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	217
<b>Building Code:</b>	P7878010013	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,131,039
<b>Building Name:</b>	Maintenance/Receiving	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$155,608
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	4,171
<b>Building Code:</b>	P7878010014	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$853,254
<b>Building Name:</b>	Food Service	<b>Address:</b>	62741 County Road 551	<b>Deferred Maintenance:</b>	\$180,447
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Togo	<b>Ext. Gross Area:</b>	3,270



**Building Code:** P7878010015  
**Building Name:** SQ  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** P7878010016  
**Building Name:** Administration  
**Facility Condition Index:** 0.16 - *Average*

**Building Code:** P7878010017  
**Building Name:** Wash Bay  
**Facility Condition Index:** 0.08 - *Good*

**Building Code:** P7878010018  
**Building Name:** Lumber Storage  
**Facility Condition Index:** 0.25 - *Average*

**Building Code:** P7878010019  
**Building Name:** Barracks #2  
**Facility Condition Index:** 0.22 - *Average*

**Building Code:** P7878010020  
**Building Name:** CIP Offices  
**Facility Condition Index:** 0.23 - *Average*

**Building Code:** P7878010021  
**Building Name:** CIP Property  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Cost Model Name:** Single-story Work Facility  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Cost Model Name:** Single-story Work Facility  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Cost Model Name:** Single-family Residence  
**Address:** 62741 County Road 551  
**City Code:** Togo

**Current Replacement Value:** \$480,595  
**Deferred Maintenance:** \$100,271  
**Ext. Gross Area:** 3,617

**Current Replacement Value:** \$647,557  
**Deferred Maintenance:** \$106,715  
**Ext. Gross Area:** 2,860

**Current Replacement Value:** \$206,185  
**Deferred Maintenance:** \$17,086  
**Ext. Gross Area:** 1,500

**Current Replacement Value:** \$26,825  
**Deferred Maintenance:** \$6,748  
**Ext. Gross Area:** 296

**Current Replacement Value:** \$529,634  
**Deferred Maintenance:** \$117,369  
**Ext. Gross Area:** 5,581

**Current Replacement Value:** \$802,985  
**Deferred Maintenance:** \$184,201  
**Ext. Gross Area:** 6,277

**Current Replacement Value:** \$555,501  
**Deferred Maintenance:** \$147,167  
**Ext. Gross Area:** 3,046

**Site: P78830 - St Cloud**

**Building Code:** P7883000001  
**Building Name:** HR/Finance  
**Facility Condition Index:** 0.15 - *Average*

**Building Code:** P7883000071  
**Building Name:** Truck Gate  
**Facility Condition Index:** 0.13 - *Good*

**Building Code:** P7883001071  
**Building Name:** Guard Tower  
**Facility Condition Index:** 0.20 - *Average*

**Building Code:** P7883001171  
**Building Name:** Education  
**Facility Condition Index:** 0.23 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2305 Minnesota Boulevard S.E.  
**City Code:** St. Cloud

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2305 Minnesota Boulevard S.E.  
**City Code:** St. Cloud

**Cost Model Name:** Bunker  
**Address:** 2305 Minnesota Boulevard S.E.  
**City Code:** St. Cloud

**Cost Model Name:** Multi-story Educational Facility  
**Address:** 2305 Minnesota Boulevard S.E.  
**City Code:** St. Cloud

**Current Replacement Value:** \$1,089,045  
**Deferred Maintenance:** \$166,391  
**Ext. Gross Area:** 3,692

**Current Replacement Value:** \$50,773  
**Deferred Maintenance:** \$6,536  
**Ext. Gross Area:** 704

**Current Replacement Value:** \$92,509  
**Deferred Maintenance:** \$18,516  
**Ext. Gross Area:** 134

**Current Replacement Value:** \$14,197,257  
**Deferred Maintenance:** \$3,247,670  
**Ext. Gross Area:** 57,813



<b>Building Code:</b>	P7883001270	<b>Cost Model Name:</b>	Multi-story Educational Facility	<b>Current Replacement Value:</b>	\$8,909,033
<b>Building Name:</b>	Gymnasium	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$3,028,237
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	45,449
<b>Building Code:</b>	P7883001271	<b>Cost Model Name:</b>	Multi-story Educational Facility	<b>Current Replacement Value:</b>	\$11,688,450
<b>Building Name:</b>	Industries Building	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$2,484,419
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	49,506
<b>Building Code:</b>	P7883001771	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$4,623,604
<b>Building Name:</b>	Sticker Shop	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,237,733
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	8,586
<b>Building Code:</b>	P7883002571	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$29,199,193
<b>Building Name:</b>	B House	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$8,608,269
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	36,159
<b>Building Code:</b>	P7883003671	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$22,224,866
<b>Building Name:</b>	Food Service Laundry	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$5,462,862
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	36,107
<b>Building Code:</b>	P7883004671	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$5,270,522
<b>Building Name:</b>	Health Services	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,367,017
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	6,945
<b>Building Code:</b>	P7883004771	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,759,043
<b>Building Name:</b>	GPPI	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,063,785
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	8,883
<b>Building Code:</b>	P7883004871	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$11,153,631
<b>Building Name:</b>	Reshape/B-Annex/Canteen	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$4,119,134
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	20,073
<b>Building Code:</b>	P7883005171	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$6,725,231
<b>Building Name:</b>	Auto Body/Maint Shop	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$2,356,897
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	14,448
<b>Building Code:</b>	P7883005871	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$3,024,994
<b>Building Name:</b>	License Plant	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,143,419
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	9,556
<b>Building Code:</b>	P7883006171	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$5,286,312
<b>Building Name:</b>	Mason Shop	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,102,122
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	8,815

<b>Building Code:</b>	P7883006571	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$29,432,841
<b>Building Name:</b>	C House	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$4,672,437
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	36,793
<b>Building Code:</b>	P7883006670	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$37,182,084
<b>Building Name:</b>	E House	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$11,638,498
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	46,134
<b>Building Code:</b>	P7883006671	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$4,018,235
<b>Building Name:</b>	Upper/Lower E Complex	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$606,129
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	13,413
<b>Building Code:</b>	P7883007170	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$20,838,372
<b>Building Name:</b>	D House	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$5,624,205
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	24,693
<b>Building Code:</b>	P7883007171	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$26,608,773
<b>Building Name:</b>	Segregation	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$7,646,343
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	34,282
<b>Building Code:</b>	P7883007271	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,686,655
<b>Building Name:</b>	Main Corridors	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$373,076
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	6,571
<b>Building Code:</b>	P7883007370	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$28,986,847
<b>Building Name:</b>	A House	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$8,729,416
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	36,681
<b>Building Code:</b>	P7883007371	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$928,940
<b>Building Name:</b>	Orientation Complex	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$139,992
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	3,516
<b>Building Code:</b>	P7883007471	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$20,294,412
<b>Building Name:</b>	Power Plant	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$3,988,848
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	12,453
<b>Building Code:</b>	P7883007571	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$3,920,599
<b>Building Name:</b>	Plant Operations Office	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,186,019
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	13,726
<b>Building Code:</b>	P7883007671	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$152,129
<b>Building Name:</b>	Pump Station	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$65,234
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	720

<b>Building Code:</b>	P7883007771	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$16,020,246
<b>Building Name:</b>	Administration	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$4,560,511
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	55,138
<b>Building Code:</b>	P7883007871	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$7,000,630
<b>Building Name:</b>	Training Barn	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$728,589
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	8,155
<b>Building Code:</b>	P7883007971	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$397,713
<b>Building Name:</b>	Payload/Snow Plow Build	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$86,312
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	4,323
<b>Building Code:</b>	P7883008171	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$406,736
<b>Building Name:</b>	Steamfitter/Plumbers	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$97,749
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,259
<b>Building Code:</b>	P7883008271	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$560,003
<b>Building Name:</b>	Paint Shop	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$96,049
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,528
<b>Building Code:</b>	P7883008371	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$7,412,426
<b>Building Name:</b>	Dining Rm/Warehouse	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$1,918,314
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	37,647
<b>Building Code:</b>	P7883008571	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$367,146
<b>Building Name:</b>	Cardboard Storage	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$124,538
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	4,000
<b>Building Code:</b>	P7883008771	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$277,933
<b>Building Name:</b>	Clinton Building	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$48,675
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	3,772
<b>Building Code:</b>	P7883008871	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$403,383
<b>Building Name:</b>	South Quonset	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$78,998
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	4,214
<b>Building Code:</b>	P7883008971	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$89,713
<b>Building Name:</b>	Storage Building	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$70,723
<b>Facility Condition Index:</b>	0.79 - Crisis	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	1,222
<b>Building Code:</b>	P7883009071	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$163,694
<b>Building Name:</b>	Outside Grounds	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$34,690
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	P7883009171	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$136,154
<b>Building Name:</b>	Slaughter House	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$109,793
<b>Facility Condition Index:</b>	0.81 - <b>Crisis</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	873
<b>Building Code:</b>	P7883009271	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$302,414
<b>Building Name:</b>	Staff Trip Car Shed	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$29,402
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,640
<b>Building Code:</b>	P7883009371	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$428,573
<b>Building Name:</b>	Inside Grounds	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$126,047
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,551
<b>Building Code:</b>	P7883009471	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,457,108
<b>Building Name:</b>	Industries Building	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$350,095
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	9,793
<b>Building Code:</b>	P7883009571	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,049
<b>Building Name:</b>	Shooting Range Building	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$5,591
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	248
<b>Building Code:</b>	P7883009671	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$158,070
<b>Building Name:</b>	Recreation Building	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$66,840
<b>Facility Condition Index:</b>	0.42 - <b>Poor</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	576
<b>Building Code:</b>	P7883009771	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$770,180
<b>Building Name:</b>	Old Mason Shop	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$319,853
<b>Facility Condition Index:</b>	0.42 - <b>Poor</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,562
<b>Building Code:</b>	P7883009871	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$154,444
<b>Building Name:</b>	Car Wash	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$12,615
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	1,213
<b>Building Code:</b>	P7883009971	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,505,553
<b>Building Name:</b>	Root Cellar	<b>Address:</b>	2305 Minnesota Boulevard S.E.	<b>Deferred Maintenance:</b>	\$559,152
<b>Facility Condition Index:</b>	0.37 - <b>Poor</b>	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	7,452

**Site: P78890 - Willow River**

<b>Building Code:</b>	P7889000001	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$307,455
<b>Building Name:</b>	Pole Building	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$52,215
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	3,341
<b>Building Code:</b>	P7889000002	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$62,976
<b>Building Name:</b>	Storage Shed	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$11,325
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	246

<b>Building Code:</b>	P7889000003	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$150,102
<b>Building Name:</b>	Classroom 4	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$18,549
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	862
<b>Building Code:</b>	P7889000004	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$997,102
<b>Building Name:</b>	Property Building	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$133,961
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	4,524
<b>Building Code:</b>	P7889000006	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$61,246
<b>Building Name:</b>	Storage Garage	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$5,318
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	503
<b>Building Code:</b>	P7889000007	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$364,972
<b>Building Name:</b>	Education Building	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$57,820
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	3,362
<b>Building Code:</b>	P7889000258	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$1,144,402
<b>Building Name:</b>	CD Program Building	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$112,487
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	7,624
<b>Building Code:</b>	P7889000358	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,732,799
<b>Building Name:</b>	Kitchen	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$374,981
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	5,086
<b>Building Code:</b>	P7889001258	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$945,466
<b>Building Name:</b>	Maintenance Building	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$206,052
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	4,592
<b>Building Code:</b>	P7889001458	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,624,955
<b>Building Name:</b>	Administration	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$218,544
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	4,946
<b>Building Code:</b>	P7889001558	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$6,367,470
<b>Building Name:</b>	Barracks Building	<b>Address:</b>	86032 County Highway 61	<b>Deferred Maintenance:</b>	\$324,498
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	Willow River	<b>Ext. Gross Area:</b>	23,564

**Site: P78900 - Faribault**

<b>Building Code:</b>	P7890000000	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$6,921,156
<b>Building Name:</b>	Faribault All Site	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$2,172,600
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	P7890000000	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$6,368,025
<b>Building Name:</b>	Faribault All Site	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$3,437,084
<b>Facility Condition Index:</b>	0.54 - Crisis	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	P7890000002	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$5,636,551
<b>Building Name:</b>	Pine	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,195,821
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	25,282
<b>Building Code:</b>	P7890000003	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$22,834,613
<b>Building Name:</b>	Industry / MINNCOR	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$3,753,110
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	156,152
<b>Building Code:</b>	P7890000004	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$548,315
<b>Building Name:</b>	Master Control	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$46,918
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	2,254
<b>Building Code:</b>	P7890000005	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$154,467
<b>Building Name:</b>	Grounds Building	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$31,262
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	1,258
<b>Building Code:</b>	P7890000007	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,107,332
<b>Building Name:</b>	Walnut	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$208,787
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	6,480
<b>Building Code:</b>	P7890000010	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$166,855
<b>Building Name:</b>	Upholstery Shop	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$63,988
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	1,485
<b>Building Code:</b>	P7890000011	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$16,676,446
<b>Building Name:</b>	Main Warehouse	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$3,328,612
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	56,657
<b>Building Code:</b>	P7890000013	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$484,561
<b>Building Name:</b>	Paint Shop	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$67,953
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	3,008
<b>Building Code:</b>	P7890000014	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$4,066,147
<b>Building Name:</b>	Sycamore	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$800,313
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	18,887
<b>Building Code:</b>	P7890000015	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$19,592,723
<b>Building Name:</b>	Power Plant	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$2,929,088
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	41,468
<b>Building Code:</b>	P7890000016	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$2,177,531
<b>Building Name:</b>	West Cottage	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,681,054
<b>Facility Condition Index:</b>	0.77 - Crisis	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	13,103

<b>Building Code:</b>	P7890000020	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$3,868,131
<b>Building Name:</b>	Pawnee	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$2,645,962
<b>Facility Condition Index:</b>	0.68 - <b>Crisis</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	P7890000021	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$442,454
<b>Building Name:</b>	Mason Shed	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$358,802
<b>Facility Condition Index:</b>	0.81 - <b>Crisis</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	4,180
<b>Building Code:</b>	P7890000023	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$8,447,034
<b>Building Name:</b>	Dakota	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$2,125,338
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	40,717
<b>Building Code:</b>	P7890000026	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$32,529
<b>Building Name:</b>	Pump House #2	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$9,098
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	249
<b>Building Code:</b>	P7890000027	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$31,771
<b>Building Name:</b>	Pump House #1	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$9,444
<b>Facility Condition Index:</b>	0.30 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	264
<b>Building Code:</b>	P7890000030	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$11,211,616
<b>Building Name:</b>	Aspen	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$2,052,097
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	6,939
<b>Building Code:</b>	P7890000038	<b>Cost Model Name:</b>	Recreation Center	<b>Current Replacement Value:</b>	\$10,140,367
<b>Building Name:</b>	Fern	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$4,223,125
<b>Facility Condition Index:</b>	0.42 - <b>Poor</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	46,547
<b>Building Code:</b>	P7890000043	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$5,266,457
<b>Building Name:</b>	Sierra/Holly	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,147,995
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	20,122
<b>Building Code:</b>	P7890000044	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$6,707,754
<b>Building Name:</b>	Willow	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,248,918
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	36,686
<b>Building Code:</b>	P7890000045	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$8,362,899
<b>Building Name:</b>	Birch	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,551,799
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	34,558
<b>Building Code:</b>	P7890000049	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$5,748,914
<b>Building Name:</b>	Laundry	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,345,827
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	37,050



<b>Building Code:</b>	P7890000081	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,585,470
<b>Building Name:</b>	Equip Storage	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$650,319
<b>Facility Condition Index:</b>	0.41 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	11,328
<b>Building Code:</b>	P7890000082	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$288,811
<b>Building Name:</b>	General Storage	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$135,597
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	4,549
<b>Building Code:</b>	P7890000083	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$351,368
<b>Building Name:</b>	Calf Barn	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$81,545
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	P7890000084	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$938,244
<b>Building Name:</b>	Mechanics Shop	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$360,553
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	6,782
<b>Building Code:</b>	P7890000086	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$34,129
<b>Building Name:</b>	Truck Gate-FRB	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$8,289
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	200
<b>Building Code:</b>	P7890000093	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$4,433,718
<b>Building Name:</b>	Segregation	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$511,315
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	14,301
<b>Building Code:</b>	P7890000096	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$94,052
<b>Building Name:</b>	Refrigerator Building	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$34,119
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	760
<b>Building Code:</b>	P7890000097	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,456,854
<b>Building Name:</b>	Root Cellar	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$486,448
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	5,177
<b>Building Code:</b>	P7890000111	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$10,788,356
<b>Building Name:</b>	Food Service Bldg	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$1,446,392
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	37,285
<b>Building Code:</b>	P7890000166	<b>Cost Model Name:</b>	Correctional Facility Housing Unit	<b>Current Replacement Value:</b>	\$8,613,002
<b>Building Name:</b>	Maple	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$2,558,329
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	24,066
<b>Building Code:</b>	P7890000266	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$17,086,157
<b>Building Name:</b>	Linden	<b>Address:</b>	1101 Linden Lane	<b>Deferred Maintenance:</b>	\$3,256,373
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	Faribault	<b>Ext. Gross Area:</b>	50,344



**Building Code:** P7890000666  
**Building Name:** Roger's Memorial Act  
**Facility Condition Index:** 0.23 - Average

**Building Code:** P7890000901  
**Building Name:** K1  
**Facility Condition Index:** 0.06 - Good

**Building Code:** P7890000902  
**Building Name:** K2  
**Facility Condition Index:** 0.06 - Good

**Building Code:** P7890000903  
**Building Name:** K3  
**Facility Condition Index:** 0.08 - Good

**Building Code:** P7890000904  
**Building Name:** K4  
**Facility Condition Index:** 0.06 - Good

**Building Code:** P7890001000  
**Building Name:** Intake and Receiving Building  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Single-story Educational Facility  
**Address:** 1101 Linden Lane  
**City Code:** Faribault

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1101 Linden Lane  
**City Code:** Faribault

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1101 Linden Lane  
**City Code:** Faribault

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1101 Linden Lane  
**City Code:** Faribault

**Cost Model Name:** Correctional Facility Housing Unit  
**Address:** 1101 Linden Lane  
**City Code:** Faribault

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1101 Linden Lane  
**City Code:** Faribault

**Current Replacement Value:** \$9,906,518  
**Deferred Maintenance:** \$2,311,871  
**Ext. Gross Area:** 62,034

**Current Replacement Value:** \$23,086,464  
**Deferred Maintenance:** \$1,362,126  
**Ext. Gross Area:** 85,945

**Current Replacement Value:** \$24,096,264  
**Deferred Maintenance:** \$1,546,444  
**Ext. Gross Area:** 85,945

**Current Replacement Value:** \$22,466,776  
**Deferred Maintenance:** \$1,687,938  
**Ext. Gross Area:** 89,390

**Current Replacement Value:** \$29,944,089  
**Deferred Maintenance:** \$1,750,556  
**Ext. Gross Area:** 44,561

**Current Replacement Value:** \$14,099,949  
**Deferred Maintenance:** \$303,621  
**Ext. Gross Area:** 41,538

## Agency: R29 - Department of Natural Resources

**FCI Rating:** Average  
**Facility Condition Index:** 0.20

**Current Replacement Value:** \$577,503,996  
**Deferred Maintenance:** \$116,687,975

**Ext. Gross Area:** 1,209,668  
**Building Count:** 2,800

### Site: R290001 - Afton State Park

<b>Building Code:</b>	R2900600090	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$54,104
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$16,415
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	637
<b>Building Code:</b>	R2900600100	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$101,012
<b>Building Name:</b>	Sanitation	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$24,662
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	418
<b>Building Code:</b>	R2900601150	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$295,186
<b>Building Name:</b>	Afton SP Shop	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$69,174
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	1,815
<b>Building Code:</b>	R2900601160	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$18,721
<b>Building Name:</b>	Oil House	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$3,725
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	100
<b>Building Code:</b>	R2900601170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$316,836
<b>Building Name:</b>	Afton SP Contact Station	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$43,738
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	1,200
<b>Building Code:</b>	R2900601180	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$861,523
<b>Building Name:</b>	Afton SP Trails Ctr	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$432,348
<b>Facility Condition Index:</b>	0.50 - Crisis	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	3,125
<b>Building Code:</b>	R2900601710	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,444
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$3,248
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	27
<b>Building Code:</b>	R2900601720	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,819
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,985
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	27
<b>Building Code:</b>	R2900601730	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,819
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,201
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	28
<b>Building Code:</b>	R2900601740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,819
<b>Building Name:</b>	DISPOSED - Vault Toilet	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$3,132
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	28

<b>Building Code:</b>	R2900601750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,663
<b>Building Name:</b>	DISPOSED - Vault Toilet	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$1,767
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	31
<b>Building Code:</b>	R2900601760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,663
<b>Building Name:</b>	DISPOSED - Vault Toilet	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$1,653
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	33
<b>Building Code:</b>	R2900601830	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$90,872
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$26,866
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	1,080
<b>Building Code:</b>	R2900602120	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$308,841
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$45,693
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	2,991
<b>Building Code:</b>	R2900602250	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$51,363
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$5,136
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	102
<b>Building Code:</b>	R2900602260	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$8,394
<b>Building Name:</b>	Adirondack	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,770
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	79
<b>Building Code:</b>	R2900602270	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$9,154
<b>Building Name:</b>	Adirondack	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$3,477
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	146
<b>Building Code:</b>	R2900602280	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$8,394
<b>Building Name:</b>	Adirondack	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,986
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	87
<b>Building Code:</b>	R2900602320	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$5,109
<b>Building Name:</b>	Adirondack	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$3,832
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	55
<b>Building Code:</b>	R2900602330	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$5,019
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,027
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	135
<b>Building Code:</b>	R2900602340	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,571
<b>Building Name:</b>	Big Blue Stem Cabin	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$1,700
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	296

<b>Building Code:</b>	R2900602350	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,571
<b>Building Name:</b>	ADA Blue Bird Cabin	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,146
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	296
<b>Building Code:</b>	R2900602360	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,571
<b>Building Name:</b>	ADA White Pine Cabin	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,146
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	296
<b>Building Code:</b>	R2900602370	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,571
<b>Building Name:</b>	Bur Oak Cabin	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$2,085
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	296
<b>Building Code:</b>	R2900602430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,143
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$403
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	47
<b>Building Code:</b>	R2900602440	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,314
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$126
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602450	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$60,752
<b>Building Name:</b>	East Yurt	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$1,215
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602460	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$60,752
<b>Building Name:</b>	West Yurt	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$1,215
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602470	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,143
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$403
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602480	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,682
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$514
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602490	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,682
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$514
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602500	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,682
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	6959 PELLER AVE S	<b>Deferred Maintenance:</b>	\$514
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	HASTINGS	<b>Ext. Gross Area:</b>	0

Site: R290002 - Aitkin

**Building Code:** R2900306230  
**Building Name:** Aitkin Office  
**Facility Condition Index:** 0.13 - **Good**

**Building Code:** R2900306550  
**Building Name:** Boat Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900307130  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1200 MINNESOTA AVE S  
**City Code:** AITKIN

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1200 MINNESOTA AVE S  
**City Code:** AITKIN

**Cost Model Name:** Utility Shed  
**Address:** 1200 MINNESOTA AVE S  
**City Code:** AITKIN

**Current Replacement Value:** \$2,653,476  
**Deferred Maintenance:** \$355,676  
**Ext. Gross Area:** 17,304

**Current Replacement Value:** \$275,710  
**Deferred Maintenance:** \$5,514  
**Ext. Gross Area:** 3,129

**Current Replacement Value:** \$25,871  
**Deferred Maintenance:** \$517  
**Ext. Gross Area:** 229

**Site: R290003 - Appleton**

**Building Code:** R2900403960  
**Building Name:** Pump House  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900404970  
**Building Name:** Appleton Shop  
**Facility Condition Index:** 0.40 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 25 N MUNSTERMAN ST  
**City Code:** APPLETON

**Cost Model Name:** Single-story Work Facility  
**Address:** 25 N MUNSTERMAN ST  
**City Code:** APPLETON

**Current Replacement Value:** \$16,841  
**Deferred Maintenance:** \$337  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$166,523  
**Deferred Maintenance:** \$66,171  
**Ext. Gross Area:** 0

**Site: R290004 - Banning State Park**

**Building Code:** R2900300830  
**Building Name:** Banning SP Shop  
**Facility Condition Index:** 0.34 - **Poor**

**Building Code:** R2900300840  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.26 - **Average**

**Building Code:** R2900300850  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.38 - **Poor**

**Building Code:** R2900303690  
**Building Name:** Banning SP Office  
**Facility Condition Index:** 0.21 - **Average**

**Building Code:** R2900303780  
**Building Name:** Oil House  
**Facility Condition Index:** 0.60 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 61101 BANNING PARK RD  
**City Code:** SANDSTONE

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 61101 BANNING PARK RD  
**City Code:** SANDSTONE

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 61101 BANNING PARK RD  
**City Code:** SANDSTONE

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 61101 BANNING PARK RD  
**City Code:** SANDSTONE

**Cost Model Name:** Utility Shed  
**Address:** 61101 BANNING PARK RD  
**City Code:** SANDSTONE

**Current Replacement Value:** \$208,860  
**Deferred Maintenance:** \$70,460  
**Ext. Gross Area:** 1,531

**Current Replacement Value:** \$241,714  
**Deferred Maintenance:** \$62,226  
**Ext. Gross Area:** 694

**Current Replacement Value:** \$116,724  
**Deferred Maintenance:** \$43,868  
**Ext. Gross Area:** 348

**Current Replacement Value:** \$230,104  
**Deferred Maintenance:** \$47,351  
**Ext. Gross Area:** 979

**Current Replacement Value:** \$3,643  
**Deferred Maintenance:** \$2,195  
**Ext. Gross Area:** 104

<b>Building Code:</b>	R2900303830	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$403,076
<b>Building Name:</b>	Residence	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$124,974
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	3,189
<b>Building Code:</b>	R2900304940	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,956
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$2,222
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900304950	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,865
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$2,448
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	25
<b>Building Code:</b>	R2900304960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,400
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$1,847
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	25
<b>Building Code:</b>	R2900304970	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,865
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$1,860
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	25
<b>Building Code:</b>	R2900305130	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$113,703
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$29,472
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	1,259
<b>Building Code:</b>	R2900306580	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,680
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$2,089
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	39
<b>Building Code:</b>	R2900306990	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$36,444
<b>Building Name:</b>	Cabin	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$3,454
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	196
<b>Building Code:</b>	R2900307290	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,724
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$977
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	48
<b>Building Code:</b>	R2900307300	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,724
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$977
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	48
<b>Building Code:</b>	R2900308420	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$4,262
<b>Building Name:</b>	Recycling Center	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$1,358
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	49

Site: R290005 - Bear Head Lake State Park

<b>Building Code:</b>	R2900201460	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$239,121
<b>Building Name:</b>	Bear Head Lake SP Shop	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$47,400
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201480	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$23,966
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,740
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201520	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$56,412
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$6,174
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201530	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$113,151
<b>Building Name:</b>	Sanitation	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$20,930
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201540	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$136,728
<b>Building Name:</b>	Sanitation	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$30,237
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900203830	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$20,619
<b>Building Name:</b>	Oil House	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,240
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204330	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$515,365
<b>Building Name:</b>	Lodging House	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$50,731
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205290	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,721
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$4,196
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205300	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,721
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$4,196
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205310	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,721
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,901
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205320	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,721
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,901
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900205330	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,721
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,901
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205340	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,003
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 Bear Head State Park Rd	<b>Deferred Maintenance:</b>	\$1,918
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	Ely	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206650	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$33,963
<b>Building Name:</b>	Garage	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$5,290
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207420	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$40,466
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,281
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207430	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$31,632
<b>Building Name:</b>	Spring House	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,878
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207630	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$389,623
<b>Building Name:</b>	Bear Head Lake SP Contact Sta	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$36,044
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207690	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,326
<b>Building Name:</b>	Cabin	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,383
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207880	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$304,724
<b>Building Name:</b>	Sanitation	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$23,729
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208620	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,051
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$519
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208780	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,161
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,079
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,161
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,407
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900208980	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,760
<b>Building Name:</b>	White Cedar Cabin	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,401
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208990	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$38,426
<b>Building Name:</b>	Cabin	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$989
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209000	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$41,981
<b>Building Name:</b>	Red Pine Cabin	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,385
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209010	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$42,760
<b>Building Name:</b>	Quaking Aspen Cabin	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,401
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209270	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$424,399
<b>Building Name:</b>	Trails Center	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$9,805
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210510	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$55,437
<b>Building Name:</b>	Camper Cabin Loop Vault	<b>Address:</b>	9301 BEAR HEAD STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,109
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	ELY	<b>Ext. Gross Area:</b>	0

**Site: R290006 - Beaver Creek Valley State Park**

<b>Building Code:</b>	R2900500720	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$39,873
<b>Building Name:</b>	Sanitation	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$10,040
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	317
<b>Building Code:</b>	R2900500730	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$203,049
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$22,785
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	1,639
<b>Building Code:</b>	R2900500740	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$144,747
<b>Building Name:</b>	Sanitation	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$50,546
<b>Facility Condition Index:</b>	0.35 - <b>Poor</b>	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	554
<b>Building Code:</b>	R2900500750	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$511,136
<b>Building Name:</b>	Beaver Creek Valley SP Cont St	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$51,349
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	992
<b>Building Code:</b>	R2900500760	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$208,931
<b>Building Name:</b>	Beaver Creek Valley SP Shop	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$15,939
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	1,529

**Building Code:** R2900502590  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 15954 CO RD 1  
**City Code:** CALEDONIA

**Current Replacement Value:** \$19,760  
**Deferred Maintenance:** \$4,907  
**Ext. Gross Area:** 0

**Building Code:** R2900503050  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 15954 CO RD 1  
**City Code:** CALEDONIA

**Current Replacement Value:** \$19,760  
**Deferred Maintenance:** \$3,733  
**Ext. Gross Area:** 0

**Building Code:** R2900503060  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.41 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** 15954 CO RD 1  
**City Code:** CALEDONIA

**Current Replacement Value:** \$19,760  
**Deferred Maintenance:** \$8,086  
**Ext. Gross Area:** 0

**Building Code:** R2900504780  
**Building Name:** Cabin  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Single-family Residence  
**Address:** 15954 CO RD 1  
**City Code:** CALEDONIA

**Current Replacement Value:** \$65,215  
**Deferred Maintenance:** \$3,883  
**Ext. Gross Area:** 314

**Building Code:** R2900505030  
**Building Name:** Shed  
**Facility Condition Index:** 0.44 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 15954 CO RD 1  
**City Code:** CALEDONIA

**Current Replacement Value:** \$8,024  
**Deferred Maintenance:** \$3,561  
**Ext. Gross Area:** 100

**Building Code:** R2900505040  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 15954 CO RD 1  
**City Code:** CALEDONIA

**Current Replacement Value:** \$19,760  
**Deferred Maintenance:** \$1,415  
**Ext. Gross Area:** 0

**Site: R290007 - Big Bog SRA**

**Building Code:** R2900100510  
**Building Name:** Pump House  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 55716 HWY 72 NE  
**City Code:** WASKISH

**Current Replacement Value:** \$4,085  
**Deferred Maintenance:** \$1,270  
**Ext. Gross Area:** 0

**Building Code:** R2900103810  
**Building Name:** Big Bog SRA Office  
**Facility Condition Index:** 0.17 - Average

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 55716 HWY 72 NE  
**City Code:** WASKISH

**Current Replacement Value:** \$327,295  
**Deferred Maintenance:** \$56,986  
**Ext. Gross Area:** 0

**Building Code:** R2900106600  
**Building Name:** Older Lakeside Vault  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 55716 HWY 72 NE  
**City Code:** WASKISH

**Current Replacement Value:** \$9,561  
**Deferred Maintenance:** \$2,370  
**Ext. Gross Area:** 0

**Building Code:** R2900106610  
**Building Name:** Changing House  
**Facility Condition Index:** 0.30 - Average

**Cost Model Name:** Utility Shed  
**Address:** 55716 HWY 72 NE  
**City Code:** WASKISH

**Current Replacement Value:** \$3,778  
**Deferred Maintenance:** \$1,130  
**Ext. Gross Area:** 0

**Building Code:** R2900107690  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 55716 HWY 72 NE  
**City Code:** WASKISH

**Current Replacement Value:** \$293,197  
**Deferred Maintenance:** \$28,849  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900107700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$25,116
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$2,512
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107710	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$67,965
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$6,796
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,437
<b>Building Name:</b>	Campground Vault	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$1,544
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,437
<b>Building Name:</b>	Newer Lakeside Vault	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$1,544
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107790	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$36,673
<b>Building Name:</b>	Pump House	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$3,690
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108020	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,542
<b>Building Name:</b>	Camper Cabin 2 Vault	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$1,554
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108030	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$32,671
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$3,267
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108040	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$68,758
<b>Building Name:</b>	Camper Cabin 1	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$6,876
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108050	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$68,758
<b>Building Name:</b>	Camper Cabin #2	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$6,876
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108060	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$68,758
<b>Building Name:</b>	Camper Cabin #3	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$6,876
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108070	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$55,525
<b>Building Name:</b>	Camper Cabin #4	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$9,952
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900108080	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$68,758
<b>Building Name:</b>	Camper Cabin #5	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$7,413
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108090	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$63,269
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$6,327
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108290	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,542
<b>Building Name:</b>	Camper Cabin Vault	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$1,554
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108650	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$871,052
<b>Building Name:</b>	Big Bog SRA Contact Station	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$87,105
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108770	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$930
<b>Building Name:</b>	Interp Unoccupied	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$93
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108790	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$16,642
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	55716 HWY 72 NE	<b>Deferred Maintenance:</b>	\$1,664
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0

**Site: R290008 - Big Stone Lake State Park**

<b>Building Code:</b>	R2900401680	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,539,881
<b>Building Name:</b>	Big Stone Lake SP Ed Center	<b>Address:</b>	35889 MEADOWBROOK STATE PARK	<b>Deferred Maintenance:</b>	\$346,449
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ORTONVILLE	<b>Ext. Gross Area:</b>	4,971
<b>Building Code:</b>	R2900401700	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$348,516
<b>Building Name:</b>	Big Stone Lake SP Contact Sta	<b>Address:</b>	35889 MEADOWBROOK STATE PARK	<b>Deferred Maintenance:</b>	\$75,791
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ORTONVILLE	<b>Ext. Gross Area:</b>	1,588
<b>Building Code:</b>	R2900401710	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$66,800
<b>Building Name:</b>	Big Stone Lake SP Shop	<b>Address:</b>	35889 MEADOWBROOK STATE PARK	<b>Deferred Maintenance:</b>	\$15,930
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	ORTONVILLE	<b>Ext. Gross Area:</b>	768
<b>Building Code:</b>	R2900401720	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$62,625
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	35889 MEADOWBROOK STATE PARK	<b>Deferred Maintenance:</b>	\$12,587
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ORTONVILLE	<b>Ext. Gross Area:</b>	900
<b>Building Code:</b>	R2900403260	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,754
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	35889 MEADOWBROOK STATE PARK	<b>Deferred Maintenance:</b>	\$5,141
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ORTONVILLE	<b>Ext. Gross Area:</b>	32

**Building Code:** R2900403270  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$20,754  
**Deferred Maintenance:** \$5,141  
**Ext. Gross Area:** 32

**Building Code:** R2900404070  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$345,230  
**Deferred Maintenance:** \$89,694  
**Ext. Gross Area:** 933

**Building Code:** R2900404220  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$20,754  
**Deferred Maintenance:** \$2,715  
**Ext. Gross Area:** 47

**Building Code:** R2900404740  
**Building Name:** Shed  
**Facility Condition Index:** 0.55 - *Crisis*

**Cost Model Name:** Utility Shed  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$51,572  
**Deferred Maintenance:** \$28,294  
**Ext. Gross Area:** 84

**Building Code:** R2900404770  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$29,319  
**Deferred Maintenance:** \$1,842  
**Ext. Gross Area:** 48

**Building Code:** R2900404780  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$29,319  
**Deferred Maintenance:** \$2,095  
**Ext. Gross Area:** 48

**Building Code:** R2900404840  
**Building Name:** Pump House  
**Facility Condition Index:** 0.47 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$16,355  
**Deferred Maintenance:** \$7,741  
**Ext. Gross Area:** 38

**Building Code:** R2900404850  
**Building Name:** Shed  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 35889 MEADOWBROOK STATE PARK  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$17,126  
**Deferred Maintenance:** \$3,286  
**Ext. Gross Area:** 123

**Site: R290009 - Blue Mounds State Park**

**Building Code:** R2900400670  
**Building Name:** DISPOSED - Bath House  
**Facility Condition Index:** 0.45 - *Poor*

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$156,143  
**Deferred Maintenance:** \$70,818  
**Ext. Gross Area:** 846

**Building Code:** R2900400680  
**Building Name:** Blue Mounds SP Contact Station  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$407,012  
**Deferred Maintenance:** \$46,083  
**Ext. Gross Area:** 1,216

**Building Code:** R2900400690  
**Building Name:** Garage  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$70,325  
**Deferred Maintenance:** \$23,207  
**Ext. Gross Area:** 768

<b>Building Code:</b>	R2900400700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$94,382
<b>Building Name:</b>	Shed	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$31,146
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	2,808
<b>Building Code:</b>	R2900400710	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$708,850
<b>Building Name:</b>	Blue Mounds SP Interp Center	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$304,499
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	3,916
<b>Building Code:</b>	R2900400730	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$92,331
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$30,469
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	576
<b>Building Code:</b>	R2900400740	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$85,731
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$31,797
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	1,160
<b>Building Code:</b>	R2900400750	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$551,598
<b>Building Name:</b>	Residence	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$212,822
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	2,959
<b>Building Code:</b>	R2900400770	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$189,796
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$62,633
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	596
<b>Building Code:</b>	R2900400780	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$275,541
<b>Building Name:</b>	Blue Mounds SP Shop	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$80,205
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	1,500
<b>Building Code:</b>	R2900402690	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$184,170
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$54,932
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	658
<b>Building Code:</b>	R2900403340	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,147
<b>Building Name:</b>	Oil House	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$2,028
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	68
<b>Building Code:</b>	R2900403830	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,269
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$1,678
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	67
<b>Building Code:</b>	R2900404180	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,105
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1410 161ST ST	<b>Deferred Maintenance:</b>	\$2,022
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LUVERNE	<b>Ext. Gross Area:</b>	36

**Building Code:** R2900404190  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$8,105  
**Deferred Maintenance:** \$2,022  
**Ext. Gross Area:** 36

**Building Code:** R2900404200  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$8,105  
**Deferred Maintenance:** \$2,022  
**Ext. Gross Area:** 38

**Building Code:** R2900404290  
**Building Name:** Pump House  
**Facility Condition Index:** 0.44 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$20,879  
**Deferred Maintenance:** \$9,262  
**Ext. Gross Area:** 0

**Building Code:** R2900404400  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$15,780  
**Deferred Maintenance:** \$3,919  
**Ext. Gross Area:** 38

**Building Code:** R2900404720  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$406,035  
**Deferred Maintenance:** \$9,575  
**Ext. Gross Area:** 1,113

**Building Code:** R2900405020  
**Building Name:** Shed  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Utility Shed  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$3,853  
**Deferred Maintenance:** \$396  
**Ext. Gross Area:** 49

**Building Code:** R2900405070  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.23 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$8,105  
**Deferred Maintenance:** \$1,888  
**Ext. Gross Area:** 0

**Building Code:** R2900405440  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Vault Toilet  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$277,824  
**Deferred Maintenance:** \$5,556  
**Ext. Gross Area:** 0

**Building Code:** R2900405450  
**Building Name:** Teepee  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Fabric Structure  
**Address:** 1410 161ST ST  
**City Code:** LUVERNE

**Current Replacement Value:** \$18,963  
**Deferred Maintenance:** \$1,512  
**Ext. Gross Area:** 174

**Site: R290010 - Buffalo River State Park**

**Building Code:** R2900103150  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 565 155TH ST S, HWY 10  
**City Code:** GLYNDON

**Current Replacement Value:** \$225,473  
**Deferred Maintenance:** \$69,113  
**Ext. Gross Area:** 795

**Building Code:** R2900103160  
**Building Name:** Campground Sanitation  
**Facility Condition Index:** 0.55 - Crisis

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 565 155TH ST S, HWY 10  
**City Code:** GLYNDON

**Current Replacement Value:** \$495,928  
**Deferred Maintenance:** \$271,320  
**Ext. Gross Area:** 1,283



<b>Building Code:</b>	R2900103170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$117,092
<b>Building Name:</b>	Historic Sanation Building	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$25,913
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103180	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$528,871
<b>Building Name:</b>	Beach Sanitation	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$178,882
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103190	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$44,510
<b>Building Name:</b>	Pump House	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$6,274
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	141
<b>Building Code:</b>	R2900103200	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$195,201
<b>Building Name:</b>	Buffalo River SP Shop	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$35,090
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103210	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$73,757
<b>Building Name:</b>	Residence Garage	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$9,318
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103220	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$416,746
<b>Building Name:</b>	Residence	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$84,895
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105370	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$148,800
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$23,525
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	617
<b>Building Code:</b>	R2900105870	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,588
<b>Building Name:</b>	Mens Vault Picnic Area	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$1,524
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	31
<b>Building Code:</b>	R2900105880	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,588
<b>Building Name:</b>	Womens Vault Picnic Area	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$1,524
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	31
<b>Building Code:</b>	R2900106380	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$247,116
<b>Building Name:</b>	Buffalo River SP Contact Sta	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$27,236
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106700	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,021
<b>Building Name:</b>	Prairie View Vault	<b>Address:</b>	565 155TH ST S, HWY 10	<b>Deferred Maintenance:</b>	\$1,620
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	GLYNDON	<b>Ext. Gross Area:</b>	43



**Building Code:** R2900106710  
**Building Name:** Pioneer Camp Vault  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 565 155TH ST S, HWY 10  
**City Code:** GLYNDON

**Current Replacement Value:** \$13,053  
**Deferred Maintenance:** \$1,624  
**Ext. Gross Area:** 0

**Building Code:** R2900107870  
**Building Name:** Pool Water Treatment  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 565 155TH ST S, HWY 10  
**City Code:** GLYNDON

**Current Replacement Value:** \$138,482  
**Deferred Maintenance:** \$29,235  
**Ext. Gross Area:** 0

**Building Code:** R2900107890  
**Building Name:** Group Camp Vault  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 565 155TH ST S, HWY 10  
**City Code:** GLYNDON

**Current Replacement Value:** \$15,197  
**Deferred Maintenance:** \$1,090  
**Ext. Gross Area:** 48

**Site: R290011 - Camden State Park**

**Building Code:** R2900401470  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$106,322  
**Deferred Maintenance:** \$35,624  
**Ext. Gross Area:** 0

**Building Code:** R2900401490  
**Building Name:** Interp Unoccupied  
**Facility Condition Index:** 0.87 - **Crisis**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$45,294  
**Deferred Maintenance:** \$39,567  
**Ext. Gross Area:** 0

**Building Code:** R2900401510  
**Building Name:** Bath House  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$853,651  
**Deferred Maintenance:** \$281,705  
**Ext. Gross Area:** 0

**Building Code:** R2900401530  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$201,477  
**Deferred Maintenance:** \$62,814  
**Ext. Gross Area:** 0

**Building Code:** R2900401540  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Open Air Shelter  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$144,365  
**Deferred Maintenance:** \$48,366  
**Ext. Gross Area:** 0

**Building Code:** R2900401560  
**Building Name:** DISPOSED - Shed  
**Facility Condition Index:** 1.00 - **Crisis**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$14,489  
**Deferred Maintenance:** \$14,489  
**Ext. Gross Area:** 0

**Building Code:** R2900401570  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$186,860  
**Deferred Maintenance:** \$61,664  
**Ext. Gross Area:** 0

**Building Code:** R2900401590  
**Building Name:** Garage  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$340,165  
**Deferred Maintenance:** \$122,293  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900401600	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$538,631
<b>Building Name:</b>	Residence	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$266,683
<b>Facility Condition Index:</b>	0.50 - Poor	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402610	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$493,522
<b>Building Name:</b>	Residence	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$161,277
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402620	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$265,810
<b>Building Name:</b>	Camden SP Shop	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$77,199
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402630	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$452,030
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$91,632
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$81,696
<b>Building Name:</b>	Garage	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$26,960
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402650	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$434,709
<b>Building Name:</b>	Camden SP Contact Station	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$8,694
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402660	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,922
<b>Building Name:</b>	Oil House	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$5,935
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402890	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$108,755
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$31,743
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403030	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$342,442
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$96,165
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403280	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,018
<b>Building Name:</b>	Disposed -Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$2,141
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403290	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,824
<b>Building Name:</b>	Disposed - Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,992
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900403300	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,530
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,896
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403310	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,824
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,992
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,824
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,992
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403450	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,824
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,992
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403460	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,824
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,992
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403470	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,824
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,992
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404080	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$298,506
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$61,604
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404510	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,282
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$5,121
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,371
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$3,430
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405290	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$36,208
<b>Building Name:</b>	Shed	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$3,621
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405300	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$4,590
<b>Building Name:</b>	Pump House	<b>Address:</b>	1897 CAMDEN PARK RD	<b>Deferred Maintenance:</b>	\$1,759
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	LYND	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900405490  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$14,138  
**Deferred Maintenance:** \$1,414  
**Ext. Gross Area:** 0

**Building Code:** R2900405500  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 1897 CAMDEN PARK RD  
**City Code:** LYND

**Current Replacement Value:** \$14,138  
**Deferred Maintenance:** \$1,579  
**Ext. Gross Area:** 0

**Site: R290012 - Cascade River State Park**

**Building Code:** R2900201250  
**Building Name:** Cascade River SP Shop  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$355,712  
**Deferred Maintenance:** \$66,154  
**Ext. Gross Area:** 1,523

**Building Code:** R2900201260  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$12,099  
**Deferred Maintenance:** \$3,731  
**Ext. Gross Area:** 103

**Building Code:** R2900201290  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$38,430  
**Deferred Maintenance:** \$6,220  
**Ext. Gross Area:** 538

**Building Code:** R2900201310  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$181,821  
**Deferred Maintenance:** \$19,187  
**Ext. Gross Area:** 780

**Building Code:** R2900201330  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$324,588  
**Deferred Maintenance:** \$66,809  
**Ext. Gross Area:** 697

**Building Code:** R2900201340  
**Building Name:** Spring House  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$63,574  
**Deferred Maintenance:** \$16,489  
**Ext. Gross Area:** 168

**Building Code:** R2900204250  
**Building Name:** Oil House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$13,324  
**Deferred Maintenance:** \$1,332  
**Ext. Gross Area:** 102

**Building Code:** R2900204380  
**Building Name:** Cascade River SP Office  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$202,812  
**Deferred Maintenance:** \$17,593  
**Ext. Gross Area:** 0

**Building Code:** R2900205380  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 3481 W HWY 61  
**City Code:** LUTSEN

**Current Replacement Value:** \$11,048  
**Deferred Maintenance:** \$2,197  
**Ext. Gross Area:** 33

<b>Building Code:</b>	R2900205390	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,936
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3481 W HWY 61	<b>Deferred Maintenance:</b>	\$2,042
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900205400	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,936
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3481 W HWY 61	<b>Deferred Maintenance:</b>	\$2,042
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	31
<b>Building Code:</b>	R2900207460	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,179
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3550 W HWY 61	<b>Deferred Maintenance:</b>	\$3,281
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	31
<b>Building Code:</b>	R2900208660	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,991
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3481 W HWY 61	<b>Deferred Maintenance:</b>	\$1,209
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,991
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3481 W HWY 61	<b>Deferred Maintenance:</b>	\$1,209
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	50
<b>Building Code:</b>	R2900208680	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,991
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3481 W HWY 61	<b>Deferred Maintenance:</b>	\$1,209
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	49
<b>Building Code:</b>	R2900208830	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$93,221
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$10,554
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208840	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$290,948
<b>Building Name:</b>	Dormitory	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$34,874
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210020	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$11,397
<b>Building Name:</b>	Adirondack	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$312
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210030	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$1,700
<b>Building Name:</b>	Pit Toilet	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$34
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210040	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$7,822
<b>Building Name:</b>	Adirondack	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$720
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900210050	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$1,700
<b>Building Name:</b>	Pit Toilet	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$34
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210060	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$7,822
<b>Building Name:</b>	Adirondack	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$679
<b>Facility Condition Index:</b>	0.09 - <b>Good</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210070	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$1,700
<b>Building Name:</b>	Pit Toilet	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$34
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210080	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$7,307
<b>Building Name:</b>	Adirondack	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$637
<b>Facility Condition Index:</b>	0.09 - <b>Good</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210090	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$1,700
<b>Building Name:</b>	Pit Toilet	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$34
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210100	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$14,215
<b>Building Name:</b>	Adirondack	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$1,222
<b>Facility Condition Index:</b>	0.09 - <b>Good</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210110	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$1,700
<b>Building Name:</b>	Pit Toilet	<b>Address:</b>	3997 W HWY 61	<b>Deferred Maintenance:</b>	\$34
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	LUTSEN	<b>Ext. Gross Area:</b>	0

**Site: R290013 - Charles A Lindbergh State Park**

<b>Building Code:</b>	R2900301020	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$149,863
<b>Building Name:</b>	Charles A Lindbergh SP Cnt Sta	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$19,674
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301030	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$116,740
<b>Building Name:</b>	Tenant Farmhouse	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$116,740
<b>Facility Condition Index:</b>	1.00 - <b>Crisis</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301040	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$46,536
<b>Building Name:</b>	Garage	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$18,712
<b>Facility Condition Index:</b>	0.40 - <b>Poor</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301050	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$263,987
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$54,209
<b>Facility Condition Index:</b>	0.21 - <b>Average</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	1,278

<b>Building Code:</b>	R2900301060	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$201,854
<b>Building Name:</b>	Pump House	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$70,919
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301070	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$139,574
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$21,809
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	678
<b>Building Code:</b>	R2900301080	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$132,931
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$32,107
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	336
<b>Building Code:</b>	R2900303770	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$44,222
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$18,170
<b>Facility Condition Index:</b>	0.41 - Poor	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304120	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$273,002
<b>Building Name:</b>	Charles A Lindbergh SP Shop	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$70,557
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304220	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,520
<b>Building Name:</b>	Oil House	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$792
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,437
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$2,242
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	34
<b>Building Code:</b>	R2900304760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,475
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$2,347
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	34
<b>Building Code:</b>	R2900306730	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,680
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1615 LINDBERGH DR S	<b>Deferred Maintenance:</b>	\$1,786
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	41
<b>Building Code:</b>	R2900306980	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$49,875
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	17912 GROUSE RD	<b>Deferred Maintenance:</b>	\$7,510
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0

**Site: R290014 - Crow Wing State Park**

<b>Building Code:</b>	R2900300860	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$35,376
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,112
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900300870	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$446,023
<b>Building Name:</b>	Sanitation	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$86,899
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300880	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$227,785
<b>Building Name:</b>	Sanitation	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$39,294
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300890	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$433,777
<b>Building Name:</b>	Residence	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$64,979
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300900	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$98,468
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$45,217
<b>Facility Condition Index:</b>	0.46 - Poor	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300910	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$311,395
<b>Building Name:</b>	Crow Wing SP Shop	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$66,247
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300920	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$90,837
<b>Building Name:</b>	Crow Wing SP Office	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$23,435
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300930	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$179,370
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$86,696
<b>Facility Condition Index:</b>	0.48 - Poor	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303590	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,069
<b>Building Name:</b>	Oil House	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$809
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304590	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,015
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,975
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304600	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,015
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,522
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305140	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,013
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,837
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900305170	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$188,550
<b>Building Name:</b>	Crow Wing SP Interp Center	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$25,632
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,148
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,877
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306810	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,148
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,590
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306820	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$43,480
<b>Building Name:</b>	Cabin	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,099
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307110	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$99,768
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$9,117
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307270	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,116
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,004
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307370	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$4,438
<b>Building Name:</b>	Spring House	<b>Address:</b>	3124 STATE PARK RD	<b>Deferred Maintenance:</b>	\$281
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	0

**Site: R290015 - Cuyuna Country SRA**

<b>Building Code:</b>	R2900209040	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$240,044
<b>Building Name:</b>	Sanitation	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$136,971
<b>Facility Condition Index:</b>	0.57 - Crisis	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209340	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$26,079
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	17951 COUNTY RD 30	<b>Deferred Maintenance:</b>	\$522
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CROSBY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209350	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$26,079
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	19406 NORTH RD	<b>Deferred Maintenance:</b>	\$522
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209360	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$26,079
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	20141 SAGAMORE RD	<b>Deferred Maintenance:</b>	\$522
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900209370	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,452
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$8,452
<b>Facility Condition Index:</b>	1.00 - <b>Crisis</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209380	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$52,157
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$1,043
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209950	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$59,106
<b>Building Name:</b>	Yurt #1	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$1,182
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209960	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$17,477
<b>Building Name:</b>	Picnic 1	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$350
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209970	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$59,106
<b>Building Name:</b>	Yurt #2	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$1,182
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209980	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$17,477
<b>Building Name:</b>	Picnic 2	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$350
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209990	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$101,458
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$2,029
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210000	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$59,106
<b>Building Name:</b>	Yurt #3	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$1,182
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210010	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$17,477
<b>Building Name:</b>	Picnic 3	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$350
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306060	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$266,620
<b>Building Name:</b>	Cuyuna Country SRA Office	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$60,446
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306430	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$186,711
<b>Building Name:</b>	Sanitation	<b>Address:</b>	307 3RD ST	<b>Deferred Maintenance:</b>	\$12,555
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	IRONTON	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900306440  
**Building Name:** Concession  
**Facility Condition Index:** 0.16 - *Average*

**Building Code:** R2900306450  
**Building Name:** Office  
**Facility Condition Index:** 0.23 - *Average*

**Building Code:** R2900306460  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Building Code:** R2900306470  
**Building Name:** Crosby House  
**Facility Condition Index:** 0.42 - *Poor*

**Building Code:** R2900306480  
**Building Name:** Residence  
**Facility Condition Index:** 0.69 - *Crisis*

**Building Code:** R2900306490  
**Building Name:** Office  
**Facility Condition Index:** 0.09 - *Good*

**Building Code:** R2900306500  
**Building Name:** Interp Occupied  
**Facility Condition Index:** 0.03 - *Excellent*

**Building Code:** R2900306510  
**Building Name:** Interp Occupied  
**Facility Condition Index:** 0.04 - *Excellent*

**Building Code:** R2900306520  
**Building Name:** Office  
**Facility Condition Index:** 0.16 - *Average*

**Building Code:** R2900306530  
**Building Name:** Interp Occupied  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** R2900307280  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Vault Toilet  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-family Residence  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-family Residence  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Cost Model Name:** Vault Toilet  
**Address:** 307 3RD ST  
**City Code:** IRONTON

**Current Replacement Value:** \$6,686  
**Deferred Maintenance:** \$1,044  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$49,714  
**Deferred Maintenance:** \$11,327  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$28,832  
**Deferred Maintenance:** \$7,124  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$60,862  
**Deferred Maintenance:** \$25,456  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,893  
**Deferred Maintenance:** \$8,231  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$30,540  
**Deferred Maintenance:** \$2,666  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$83,653  
**Deferred Maintenance:** \$2,204  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$549,541  
**Deferred Maintenance:** \$24,608  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$27,896  
**Deferred Maintenance:** \$4,469  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$598,813  
**Deferred Maintenance:** \$127,353  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$14,116  
**Deferred Maintenance:** \$1,004  
**Ext. Gross Area:** 0

**Site:** R290016 - Father Hennepin State Park

<b>Building Code:</b>	R2900300940	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$284,840
<b>Building Name:</b>	Father Hennepin SP Shop	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$86,717
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300960	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$345,590
<b>Building Name:</b>	Residence	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$68,072
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300970	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$156,224
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$20,846
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300980	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$146,006
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$38,025
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301000	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$42,389
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$12,042
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301010	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$128,868
<b>Building Name:</b>	Sanitation	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$51,471
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303050	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$78,561
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$17,505
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303400	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$334,597
<b>Building Name:</b>	Sanitation	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$81,923
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303420	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$114,462
<b>Building Name:</b>	Boat House	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$20,259
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304170	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,971
<b>Building Name:</b>	Oil House	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$1,283
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304260	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$204,808
<b>Building Name:</b>	Father Hennepin SP Office	<b>Address:</b>	41294 HENNEPIN PK RD	<b>Deferred Maintenance:</b>	\$37,552
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	ISLE	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900304480  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$363,257  
**Deferred Maintenance:** \$81,608  
**Ext. Gross Area:** 0

**Building Code:** R2900306790  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$12,697  
**Deferred Maintenance:** \$866  
**Ext. Gross Area:** 0

**Building Code:** R2900307160  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$14,149  
**Deferred Maintenance:** \$863  
**Ext. Gross Area:** 0

**Building Code:** R2900307170  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.04 - Excellent

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$14,149  
**Deferred Maintenance:** \$576  
**Ext. Gross Area:** 0

**Building Code:** R2900307180  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$54,154  
**Deferred Maintenance:** \$4,468  
**Ext. Gross Area:** 0

**Building Code:** R2900307190  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.05 - Excellent

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$15,327  
**Deferred Maintenance:** \$744  
**Ext. Gross Area:** 0

**Building Code:** R2900307770  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Open Air Storage Structure  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$25,965  
**Deferred Maintenance:** \$519  
**Ext. Gross Area:** 0

**Building Code:** R2900307780  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$26,451  
**Deferred Maintenance:** \$2,645  
**Ext. Gross Area:** 0

**Building Code:** R2900308280  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Vault Toilet  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$52,903  
**Deferred Maintenance:** \$1,058  
**Ext. Gross Area:** 0

**Site: R290017 - Flandrau State Park**

**Building Code:** R2900400320  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.18 - Average

**Cost Model Name:** Bunker  
**Address:** 1300 SUMMIT AVE  
**City Code:** NEW ULM

**Current Replacement Value:** \$1,025,364  
**Deferred Maintenance:** \$187,380  
**Ext. Gross Area:** 0

**Building Code:** R2900400330  
**Building Name:** Residence  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Single-family Residence  
**Address:** 1300 SUMMIT AVE  
**City Code:** NEW ULM

**Current Replacement Value:** \$1,232,195  
**Deferred Maintenance:** \$266,439  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900400350	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$114,012
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$34,846
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400360	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$142,134
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$44,126
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400370	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$135,525
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$41,945
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400380	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$135,525
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$44,911
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400390	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$92,735
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$28,690
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400400	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$112,938
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$34,954
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400410	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$89,622
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$28,302
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400420	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$135,525
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$50,067
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400430	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$198,152
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$35,003
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400440	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$197,810
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$34,891
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400450	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$664,599
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$149,001
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900400460	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,320,030
<b>Building Name:</b>	Bath House	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$220,818
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400470	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$118,090
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$6,568
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400510	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$744,080
<b>Building Name:</b>	Flandrau SP Shop	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$184,055
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400530	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$327,956
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$126,525
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403100	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$48,941
<b>Building Name:</b>	Pump House	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$7,082
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403120	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,310
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$4,871
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403170	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,410
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$4,813
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403180	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,410
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$4,813
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404020	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$327,381
<b>Building Name:</b>	Flandrau SP Contact Station	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$16,866
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404140	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,521
<b>Building Name:</b>	Oil House	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$1,848
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404550	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,410
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$2,919
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900404560	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$47,735
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$15,753
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404650	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$304,616
<b>Building Name:</b>	Sanitation	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$16,249
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404860	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,410
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$1,680
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405220	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,837
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$517
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405230	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$51,324
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$2,310
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405240	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$51,324
<b>Building Name:</b>	Cabin	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$2,310
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405430	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$428,929
<b>Building Name:</b>	Wood Shed	<b>Address:</b>	1300 SUMMIT AVE	<b>Deferred Maintenance:</b>	\$8,579
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW ULM	<b>Ext. Gross Area:</b>	0

**Site: R290018 - Forestville-Mystery Cave State Park**

<b>Building Code:</b>	R2900501410	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$679,298
<b>Building Name:</b>	Sanitation	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$58,459
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501470	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$38,040
<b>Building Name:</b>	Pump House	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$3,850
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501480	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$197,782
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$50,045
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501860	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$959,898
<b>Building Name:</b>	Sanitation	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$119,861
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900501880	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$235,805
<b>Building Name:</b>	Forestville-Mystery Cave SP FS	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$35,163
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501890	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$19,800
<b>Building Name:</b>	Oil House	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,184
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501950	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$251,160
<b>Building Name:</b>	Forestville-Mystery Cave SP CS	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$32,043
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502080	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$278,344
<b>Building Name:</b>	Residence	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$80,826
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502090	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$101,745
<b>Building Name:</b>	Forestville-Mystery Cave SP Sh	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$10,306
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502150	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$43,967
<b>Building Name:</b>	Cave Entr Bldg	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$4,679
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502870	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$18,063
<b>Building Name:</b>	Wood Shed	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$13,006
<b>Facility Condition Index:</b>	0.72 - Crisis	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502890	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,084
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,725
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502910	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,725
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502920	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,725
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900502930	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,725
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502940	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$3,897
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502950	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,581
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$3,776
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,725
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,736
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504200	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,378
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504210	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,378
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504220	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$2,378
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505020	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,711,670
<b>Building Name:</b>	Forestville-Mystery Cave SP VC	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$109,389
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505180	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,066
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,066
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900505200	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,066
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505250	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$34,332
<b>Building Name:</b>	Forestville-Mystery Cave SP AT	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,162
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505510	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,535
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$511
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505850	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$56,504
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,130
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505860	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$77,967
<b>Building Name:</b>	Pine Camper Cabin	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,487
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505870	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$77,967
<b>Building Name:</b>	Owl Camper Cabin	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,559
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505880	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$91,017
<b>Building Name:</b>	Lily Camper Cabin	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,748
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505890	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$91,017
<b>Building Name:</b>	Mink Camper Cabin	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,820
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505900	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$67,632
<b>Building Name:</b>	Trout Camper Cabin	<b>Address:</b>	21071 CTY 118	<b>Deferred Maintenance:</b>	\$1,353
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PRESTON	<b>Ext. Gross Area:</b>	0

**Site: R290019 - Fort Ridgely State Park**

<b>Building Code:</b>	R2900400790	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$1,452,520
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$477,826
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400800	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$503,537
<b>Building Name:</b>	Trails Center	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$154,055
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900400810	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$819,583
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$267,204
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400820	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$211,631
<b>Building Name:</b>	Fort Ridgely SP Shop	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$75,074
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400830	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$668,908
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$239,628
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400840	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,383,367
<b>Building Name:</b>	Garage	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$452,144
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400860	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$231,482
<b>Building Name:</b>	Sanitation	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$69,642
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400880	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$167,504
<b>Building Name:</b>	Sanitation	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$55,276
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400900	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$732,212
<b>Building Name:</b>	Residence	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$344,444
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402910	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$145,099
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$37,494
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402920	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$115,573
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$38,139
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403490	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,474
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$1,862
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403500	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,119
<b>Building Name:</b>	Oil House	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$3,669
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900403820	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,474
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$1,862
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403930	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$4,576,191
<b>Building Name:</b>	Fort Ridgely SP Contact Sta	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$1,510,143
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404050	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$781,887
<b>Building Name:</b>	Fort Ridgely SP Interp Center	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$258,023
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,474
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$1,862
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,549
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$2,327
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404470	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$104,660
<b>Building Name:</b>	Lodging House	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$22,626
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404480	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$51,792
<b>Building Name:</b>	Shed	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$7,776
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404490	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$21,791
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$2,991
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404500	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$200,392
<b>Building Name:</b>	Sanitation	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$46,466
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,949
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$1,103
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,685
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	72158 CO RD 30	<b>Deferred Maintenance:</b>	\$1,085
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	FAIRFAX	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900405190  
**Building Name:** Pump House  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 72158 CO RD 30  
**City Code:** FAIRFAX

**Current Replacement Value:** \$7,924  
**Deferred Maintenance:** \$161  
**Ext. Gross Area:** 0

**Site: R290020 - Fort Snelling State Park**

**Building Code:** R2900600110  
**Building Name:** Fort Snelling SP Contact Sta  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$491,067  
**Deferred Maintenance:** \$56,962  
**Ext. Gross Area:** 1,967

**Building Code:** R2900600180  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$183,103  
**Deferred Maintenance:** \$27,134  
**Ext. Gross Area:** 501

**Building Code:** R2900600190  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$183,103  
**Deferred Maintenance:** \$35,603  
**Ext. Gross Area:** 501

**Building Code:** R2900600200  
**Building Name:** Chapel  
**Facility Condition Index:** 0.38 - **Poor**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$4,953,688  
**Deferred Maintenance:** \$1,881,485  
**Ext. Gross Area:** 0

**Building Code:** R2900600220  
**Building Name:** Bath House  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$160,642  
**Deferred Maintenance:** \$32,607  
**Ext. Gross Area:** 576

**Building Code:** R2900600230  
**Building Name:** Fort Snelling SP Beach Concess  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$93,128  
**Deferred Maintenance:** \$16,052  
**Ext. Gross Area:** 576

**Building Code:** R2900600240  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$181,524  
**Deferred Maintenance:** \$23,470  
**Ext. Gross Area:** 576

**Building Code:** R2900601110  
**Building Name:** Fort Snelling SP Shop  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$412,125  
**Deferred Maintenance:** \$73,910  
**Ext. Gross Area:** 2,477

**Building Code:** R2900601120  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$183,103  
**Deferred Maintenance:** \$38,460  
**Ext. Gross Area:** 78

**Building Code:** R2900601130  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 101 SNELLING LAKE RD  
**City Code:** ST. PAUL

**Current Replacement Value:** \$210,172  
**Deferred Maintenance:** \$15,635  
**Ext. Gross Area:** 1,887

<b>Building Code:</b>	R2900601960	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$317,331
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$31,733
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	3,927
<b>Building Code:</b>	R2900601970	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,908,578
<b>Building Name:</b>	Fort Snelling SP Interp Center	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$347,994
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	7,022
<b>Building Code:</b>	R2900602000	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$173,386
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$38,005
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	880
<b>Building Code:</b>	R2900602300	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$4,784
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$134
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	65
<b>Building Code:</b>	R2900602310	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,368
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$468
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	80
<b>Building Code:</b>	R2900691750	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$123,921
<b>Building Name:</b>	Clubhouse	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$34,258
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900691780	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$115,671
<b>Building Name:</b>	Golf Course Cold Storage	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$50,139
<b>Facility Condition Index:</b>	0.43 - <b>Poor</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900691820	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$149,811
<b>Building Name:</b>	Golf Course Cold Storage	<b>Address:</b>	101 SNELLING LAKE RD	<b>Deferred Maintenance:</b>	\$63,159
<b>Facility Condition Index:</b>	0.42 - <b>Poor</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	0

**Site: R290021 - Frontenac State Park**

<b>Building Code:</b>	R2900500430	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$19,901
<b>Building Name:</b>	Trails Center	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$1,645
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	152
<b>Building Code:</b>	R2900500460	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,434
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$1,831
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	149
<b>Building Code:</b>	R2900500470	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$246,635
<b>Building Name:</b>	Sanitation	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$15,361
<b>Facility Condition Index:</b>	0.06 - <b>Good</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	979



<b>Building Code:</b>	R2900500480	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$186,736
<b>Building Name:</b>	Sanitation	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$68,495
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	668
<b>Building Code:</b>	R2900500490	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$13,855
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,572
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	209
<b>Building Code:</b>	R2900502070	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$117,120
<b>Building Name:</b>	Shop	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$17,827
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502630	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$6,310
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$8,355
<b>Facility Condition Index:</b>	0.44 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503450	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$6,310
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503460	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$7,419
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503470	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$6,310
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503480	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$6,310
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503490	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,120
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$6,310
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503750	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$295,285
<b>Building Name:</b>	Frontenac SP Contact Station	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$28,286
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	694



<b>Building Code:</b>	R2900504360	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$23,979
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$2,398
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	328
<b>Building Code:</b>	R2900504370	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$477,676
<b>Building Name:</b>	Frontenac SP Main Shop	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$38,008
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504380	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$11,325
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$1,243
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504600	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$10,293
<b>Building Name:</b>	Adirondack	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$2,010
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504620	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$11,382
<b>Building Name:</b>	Adirondack	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$6,835
<b>Facility Condition Index:</b>	0.60 - Crisis	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505390	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$12,001
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$303
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0

**Site: R290022 - Glacial Lakes State Park**

<b>Building Code:</b>	R2900102210	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$142,194
<b>Building Name:</b>	Picnic Shelter Group Camp	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$14,219
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102220	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$124,397
<b>Building Name:</b>	Swimming Area Sanitation	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$58,570
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102230	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$174,142
<b>Building Name:</b>	Campground Sanitation	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$84,579
<b>Facility Condition Index:</b>	0.49 - Poor	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102270	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,118
<b>Building Name:</b>	Group Camp Pump House	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$4,404
<b>Facility Condition Index:</b>	0.44 - Poor	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102280	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$32,225
<b>Building Name:</b>	Campground Pump House	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$8,107
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900102290	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$160,727
<b>Building Name:</b>	Glacial Lakes SP Shop	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$41,070
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	240
<b>Building Code:</b>	R2900105770	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,615
<b>Building Name:</b>	Mens Vault	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$962
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105780	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,615
<b>Building Name:</b>	Womens Vault	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$962
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,685
<b>Building Name:</b>	SE Picnic Vault	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$1,919
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,685
<b>Building Name:</b>	SE Picnic Vault 2	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$2,761
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106660	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,883
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$1,682
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,657
<b>Building Name:</b>	Oak Ridge Vault	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$1,933
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106680	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,883
<b>Building Name:</b>	Oak Ridge Vault 2	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$2,008
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106690	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,883
<b>Building Name:</b>	Beach Park Vault	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$2,008
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107260	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$407,360
<b>Building Name:</b>	Residence	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$68,780
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107820	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$265,954
<b>Building Name:</b>	Glacial Lakes SP Contact Sta	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$13,631
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900107830	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$128,613
<b>Building Name:</b>	Pole Building at Shop	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$9,555
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107990	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,921
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$1,969
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108250	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$55,060
<b>Building Name:</b>	Coneflower Cabin	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$3,372
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108260	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$19,912
<b>Building Name:</b>	Wood Shed	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$1,882
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108460	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$45,124
<b>Building Name:</b>	Kettle Cabin	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$4,512
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108470	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$65,114
<b>Building Name:</b>	Kame Cabin	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$6,511
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108480	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$67,846
<b>Building Name:</b>	Esker Cabin	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$6,785
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108490	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$67,846
<b>Building Name:</b>	Glacial Erractic	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$6,785
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108540	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$21,732
<b>Building Name:</b>	Upper Campground Vault Concrete	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$435
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108570	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$64,192
<b>Building Name:</b>	Friends Cabin	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$8,767
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109220	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$2,104
<b>Building Name:</b>	Baby Lake Pit	<b>Address:</b>	25022 CO RD 41	<b>Deferred Maintenance:</b>	\$694
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	STARBUCK	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900109230  
**Building Name:** Kettle Lake Pit  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 25022 CO RD 41  
**City Code:** STARBUCK

**Current Replacement Value:** \$2,104  
**Deferred Maintenance:** \$694  
**Ext. Gross Area:** 0

**Building Code:** R2900109240  
**Building Name:** Oak Backpack Pit  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 25022 CO RD 41  
**City Code:** STARBUCK

**Current Replacement Value:** \$2,104  
**Deferred Maintenance:** \$694  
**Ext. Gross Area:** 0

**Site: R290023 - Glendalough State Park**

**Building Code:** R2900105990  
**Building Name:** Carriage House  
**Facility Condition Index:** 0.73 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$118,322  
**Deferred Maintenance:** \$86,060  
**Ext. Gross Area:** 0

**Building Code:** R2900106060  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$556,536  
**Deferred Maintenance:** \$71,581  
**Ext. Gross Area:** 0

**Building Code:** R2900106080  
**Building Name:** Lodge  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$506,673  
**Deferred Maintenance:** \$65,985  
**Ext. Gross Area:** 0

**Building Code:** R2900106090  
**Building Name:** Seed drying building  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$220,381  
**Deferred Maintenance:** \$60,904  
**Ext. Gross Area:** 0

**Building Code:** R2900106100  
**Building Name:** Metal Storage  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$88,246  
**Deferred Maintenance:** \$19,748  
**Ext. Gross Area:** 0

**Building Code:** R2900106120  
**Building Name:** Seed Processing Bldg  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$193,630  
**Deferred Maintenance:** \$35,960  
**Ext. Gross Area:** 0

**Building Code:** R2900106260  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$12,497  
**Deferred Maintenance:** \$1,911  
**Ext. Gross Area:** 0

**Building Code:** R2900106270  
**Building Name:** Cabin #12  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$76,622  
**Deferred Maintenance:** \$7,662  
**Ext. Gross Area:** 0

**Building Code:** R2900106280  
**Building Name:** Cabin #6  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$76,622  
**Deferred Maintenance:** \$7,662  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900106290	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$76,622
<b>Building Name:</b>	Cabin #10	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$7,662
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106300	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$124,674
<b>Building Name:</b>	Sanitation	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$16,064
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106310	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$76,622
<b>Building Name:</b>	Cabin #3	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$7,662
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106320	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$15,724
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$1,572
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	106
<b>Building Code:</b>	R2900106330	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$63,761
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$6,376
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106870	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$41,591
<b>Building Name:</b>	Electric Shed	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$19,424
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106880	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,022
<b>Building Name:</b>	Old Wood Storage	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$4,249
<b>Facility Condition Index:</b>	0.71 - Crisis	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106890	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,497
<b>Building Name:</b>	Picnic Area Vault	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$2,325
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108000	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$1,060
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108390	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$122,513
<b>Building Name:</b>	West Metal Building	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$65,258
<b>Facility Condition Index:</b>	0.53 - Crisis	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108620	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$426,783
<b>Building Name:</b>	Glendalough SP Office	<b>Address:</b>	24869 WHITETAIL LN	<b>Deferred Maintenance:</b>	\$43,347
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BATTLE LAKE	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900108630  
**Building Name:** Info Center  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Shelter  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$153,600  
**Deferred Maintenance:** \$15,360  
**Ext. Gross Area:** 0

**Building Code:** R2900109190  
**Building Name:** Yurt  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$47,256  
**Deferred Maintenance:** \$4,726  
**Ext. Gross Area:** 0

**Building Code:** R2900109200  
**Building Name:** ADA Yurt  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$65,751  
**Deferred Maintenance:** \$6,575  
**Ext. Gross Area:** 0

**Building Code:** R2900109260  
**Building Name:** Fire Wood Storage  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$10,045  
**Deferred Maintenance:** \$1,037  
**Ext. Gross Area:** 0

**Building Code:** R2900109470  
**Building Name:** Picnic Pump House  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 24869 WHITETAIL LN  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$3,568  
**Deferred Maintenance:** \$357  
**Ext. Gross Area:** 0

**Site: [R290024 - Gooseberry Falls State Park](#)**

**Building Code:** R2900202050  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,301,632  
**Deferred Maintenance:** \$134,246  
**Ext. Gross Area:** 3,082

**Building Code:** R2900202060  
**Building Name:** Icehouse  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$63,427  
**Deferred Maintenance:** \$6,424  
**Ext. Gross Area:** 328

**Building Code:** R2900202080  
**Building Name:** Cold H2O Sanitation  
**Facility Condition Index:** 0.55 - [Crisis](#)

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$140,510  
**Deferred Maintenance:** \$77,803  
**Ext. Gross Area:** 394

**Building Code:** R2900202090  
**Building Name:** Recreation Hall  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Bunker  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$943,951  
**Deferred Maintenance:** \$99,224  
**Ext. Gross Area:** 1,679

**Building Code:** R2900202100  
**Building Name:** Lakeview Shelter  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,042,395  
**Deferred Maintenance:** \$81,417  
**Ext. Gross Area:** 0

**Building Code:** R2900202110  
**Building Name:** Pump House  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Bunker  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$111,019  
**Deferred Maintenance:** \$11,102  
**Ext. Gross Area:** 180

<b>Building Code:</b>	R2900202130	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$253,015
<b>Building Name:</b>	Trickle Filter	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$27,677
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	915
<b>Building Code:</b>	R2900202140	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$113,147
<b>Building Name:</b>	Concourse Sanitation	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$6,010
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202160	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$130,010
<b>Building Name:</b>	Well House	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$24,238
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	221
<b>Building Code:</b>	R2900202170	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$698,963
<b>Building Name:</b>	Residence	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$89,345
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$666,778
<b>Building Name:</b>	Gooseberry Falls SP Office Shp	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$84,695
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202200	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,825,641
<b>Building Name:</b>	Old Visitor Center	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$287,225
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202230	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$112,722
<b>Building Name:</b>	Cabin	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$48,360
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	311
<b>Building Code:</b>	R2900202250	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$63,965
<b>Building Name:</b>	GG Stone Shelter	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$18,505
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	228
<b>Building Code:</b>	R2900202260	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$25,559
<b>Building Name:</b>	5th Falls Shelter	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$13,316
<b>Facility Condition Index:</b>	0.52 - Crisis	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	152
<b>Building Code:</b>	R2900202270	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$25,559
<b>Building Name:</b>	GG Log Shelter	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$13,316
<b>Facility Condition Index:</b>	0.52 - Crisis	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	152
<b>Building Code:</b>	R2900202290	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$91,296
<b>Building Name:</b>	Water Tower	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$39,006
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	259



<b>Building Code:</b>	R2900203950	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$21,609
<b>Building Name:</b>	Incinerator	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$15,072
<b>Facility Condition Index:</b>	0.70 - <b>Crisis</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900203990	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$60,401
<b>Building Name:</b>	Residence Garage	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$11,757
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	586
<b>Building Code:</b>	R2900204340	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$502,533
<b>Building Name:</b>	Sanitation	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$46,516
<b>Facility Condition Index:</b>	0.09 - <b>Good</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	1,202
<b>Building Code:</b>	R2900204530	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$662,575
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$78,481
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205450	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	VaultToilet	<b>Address:</b>	3206 Hwy 61	<b>Deferred Maintenance:</b>	\$1,940
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	Two Harbors	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205460	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$2,683
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205470	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,837
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$618
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205490	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,837
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$618
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205550	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$1,940
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207540	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$20,599
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$783
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	259
<b>Building Code:</b>	R2900207580	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$3,506,869
<b>Building Name:</b>	Gooseberry Falls SP Visitor Cr	<b>Address:</b>	3206 HWY 61	<b>Deferred Maintenance:</b>	\$148,251
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	11,779



**Building Code:** R2900207620  
**Building Name:** Gooseberry Falls SP Contct Sta  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$97,496  
**Deferred Maintenance:** \$4,094  
**Ext. Gross Area:** 447

**Building Code:** R2900207900  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$15,837  
**Deferred Maintenance:** \$1,648  
**Ext. Gross Area:** 0

**Building Code:** R2900207910  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$15,837  
**Deferred Maintenance:** \$1,648  
**Ext. Gross Area:** 0

**Building Code:** R2900207920  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$15,837  
**Deferred Maintenance:** \$1,130  
**Ext. Gross Area:** 0

**Building Code:** R2900210340  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 3206 HWY 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$26,411  
**Deferred Maintenance:** \$528  
**Ext. Gross Area:** 0

**Site: R290025 - Grand Portage State Park**

**Building Code:** R2900207480  
**Building Name:** DISPOSED - Garage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$59,469  
**Deferred Maintenance:** \$1,189  
**Ext. Gross Area:** 576

**Building Code:** R2900208140  
**Building Name:** DISPOSED - Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$15,426  
**Deferred Maintenance:** \$1,543  
**Ext. Gross Area:** 41

**Building Code:** R2900208150  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$15,426  
**Deferred Maintenance:** \$3,012  
**Ext. Gross Area:** 41

**Building Code:** R2900209020  
**Building Name:** Grand Portage SP Interp Ctr  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$2,157,594  
**Deferred Maintenance:** \$43,152  
**Ext. Gross Area:** 6,057

**Building Code:** R2900210200  
**Building Name:** Recycle Center  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$19,858  
**Deferred Maintenance:** \$517  
**Ext. Gross Area:** 253

**Building Code:** R2900210210  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$43,148  
**Deferred Maintenance:** \$863  
**Ext. Gross Area:** 415

**Building Code:** R2900210490  
**Building Name:** Garage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9393 E HWY 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$98,396  
**Deferred Maintenance:** \$1,968  
**Ext. Gross Area:** 0

**Site: R290026 - Great River Bluffs State Park**

**Building Code:** R2900500880  
**Building Name:** Pump House  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$15,396  
**Deferred Maintenance:** \$5,397  
**Ext. Gross Area:** 67

**Building Code:** R2900500920  
**Building Name:** Great River Bluffs SP Shop  
**Facility Condition Index:** 0.55 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$104,657  
**Deferred Maintenance:** \$57,850  
**Ext. Gross Area:** 1,166

**Building Code:** R2900502640  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$10,482  
**Deferred Maintenance:** \$2,256  
**Ext. Gross Area:** 0

**Building Code:** R2900502650  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$10,482  
**Deferred Maintenance:** \$2,256  
**Ext. Gross Area:** 0

**Building Code:** R2900502660  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$10,482  
**Deferred Maintenance:** \$2,256  
**Ext. Gross Area:** 0

**Building Code:** R2900503760  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$226,212  
**Deferred Maintenance:** \$73,192  
**Ext. Gross Area:** 749

**Building Code:** R2900505050  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Open Air Shelter  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$7,754  
**Deferred Maintenance:** \$2,559  
**Ext. Gross Area:** 0

**Building Code:** R2900505060  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Open Air Shelter  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$7,754  
**Deferred Maintenance:** \$5,816  
**Ext. Gross Area:** 0

**Building Code:** R2900505070  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$34,128  
**Deferred Maintenance:** \$3,413  
**Ext. Gross Area:** 0

**Building Code:** R2900505280  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$213,169  
**Deferred Maintenance:** \$36,765  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900505410	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$49,090
<b>Building Name:</b>	Info Center	<b>Address:</b>	43605 KIPP DR	<b>Deferred Maintenance:</b>	\$982
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	WINONA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,061
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	43605 KIPP DR	<b>Deferred Maintenance:</b>	\$661
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	WINONA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,061
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	43605 KIPP DR	<b>Deferred Maintenance:</b>	\$661
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	WINONA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,061
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	43605 KIPP DR	<b>Deferred Maintenance:</b>	\$661
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	WINONA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505470	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$704,143
<b>Building Name:</b>	Great River Bluffs SP Office	<b>Address:</b>	43605 KIPP DR	<b>Deferred Maintenance:</b>	\$44,775
<b>Facility Condition Index:</b>	0.06 - <b>Good</b>	<b>City Code:</b>	WINONA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505580	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,664
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	43605 KIPP DR	<b>Deferred Maintenance:</b>	\$373
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	WINONA	<b>Ext. Gross Area:</b>	0

**Site: R290027 - Hayes Lake State Park**

<b>Building Code:</b>	R2900100400	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$2,471
<b>Building Name:</b>	DISPOSED - Bath House	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$1,267
<b>Facility Condition Index:</b>	0.51 - <b>Crisis</b>	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100410	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$2,471
<b>Building Name:</b>	DISPOSED - Bath House	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$1,463
<b>Facility Condition Index:</b>	0.59 - <b>Crisis</b>	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102160	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$368,627
<b>Building Name:</b>	Residence	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$57,739
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102170	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$88,074
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$33,665
<b>Facility Condition Index:</b>	0.38 - <b>Poor</b>	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$95,158
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$19,192
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900102190	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$197,699
<b>Building Name:</b>	Shop	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$54,384
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104330	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$454,155
<b>Building Name:</b>	Sanitation	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$153,589
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104340	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,226
<b>Building Name:</b>	Pump House	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$1,933
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104730	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,069
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$2,476
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,069
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$2,012
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,069
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$2,476
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,069
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$2,012
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105290	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$54,254
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$22,657
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105530	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$13,610
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	RIVER	<b>Deferred Maintenance:</b>	\$10,207
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	WANNASKA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105940	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$47,506
<b>Building Name:</b>	Timber Edge Cabin	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$4,751
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105950	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$44,314
<b>Building Name:</b>	Lakeside Cabin	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$4,431
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900106200	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$65,775
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$6,578
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106440	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$44,481
<b>Building Name:</b>	Garage	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$5,445
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106550	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,888
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$636
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107810	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$204,621
<b>Building Name:</b>	Hayes Lake SP Contact Station	<b>Address:</b>	48990 CTY RD 4	<b>Deferred Maintenance:</b>	\$20,462
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0

**Site: R290028 - Hill Annex Mine State Park**

<b>Building Code:</b>	R2900204750	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,276
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$4,952
<b>Facility Condition Index:</b>	0.68 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204760	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$1,640,731
<b>Building Name:</b>	Hill Annex Mine SP Clubhouse	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$430,900
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204770	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,142
<b>Building Name:</b>	Old Contact Station	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$6,024
<b>Facility Condition Index:</b>	0.98 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204780	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$901,519
<b>Building Name:</b>	Hill Annex Mine SP Office	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$412,715
<b>Facility Condition Index:</b>	0.46 - Poor	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204790	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$713,601
<b>Building Name:</b>	Electric Shop	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$379,644
<b>Facility Condition Index:</b>	0.53 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204800	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$13,717
<b>Building Name:</b>	Pay Master Shed	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$2,821
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204820	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$16,169
<b>Building Name:</b>	Water Tower	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$12,126
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900204850	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,498
<b>Building Name:</b>	Shed	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$6,296
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204860	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$178,494
<b>Building Name:</b>	Garage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$66,632
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204870	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,542
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$4,139
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204880	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,808,599
<b>Building Name:</b>	Garage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$1,176,967
<b>Facility Condition Index:</b>	0.65 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204890	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$2,918,996
<b>Building Name:</b>	Shop	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$2,000,723
<b>Facility Condition Index:</b>	0.69 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204900	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$292,942
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$73,226
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204910	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$917,932
<b>Building Name:</b>	Ore Crush Bldg	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$558,741
<b>Facility Condition Index:</b>	0.61 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204920	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$33,005
<b>Building Name:</b>	Shed	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$27,005
<b>Facility Condition Index:</b>	0.82 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204930	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$29,705
<b>Building Name:</b>	Shed	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$24,527
<b>Facility Condition Index:</b>	0.83 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204940	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$244,817
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$92,788
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204950	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$38,855
<b>Building Name:</b>	Garage	<b>Address:</b>	880 GARY ST	<b>Deferred Maintenance:</b>	\$20,029
<b>Facility Condition Index:</b>	0.52 - Crisis	<b>City Code:</b>	CALUMET	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900204960  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.81 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 880 GARY ST  
**City Code:** CALUMET

**Current Replacement Value:** \$29,134  
**Deferred Maintenance:** \$23,539  
**Ext. Gross Area:** 0

**Building Code:** R2900204980  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 880 GARY ST  
**City Code:** CALUMET

**Current Replacement Value:** \$43,689  
**Deferred Maintenance:** \$16,244  
**Ext. Gross Area:** 0

**Building Code:** R2900204990  
**Building Name:** Office  
**Facility Condition Index:** 0.98 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 880 GARY ST  
**City Code:** CALUMET

**Current Replacement Value:** \$47,630  
**Deferred Maintenance:** \$46,717  
**Ext. Gross Area:** 0

**Site: R290029 - Interstate State Park**

**Building Code:** R2900301260  
**Building Name:** Interstate SP Office  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$155,588  
**Deferred Maintenance:** \$17,551  
**Ext. Gross Area:** 0

**Building Code:** R2900301270  
**Building Name:** Pump House  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$41,160  
**Deferred Maintenance:** \$8,619  
**Ext. Gross Area:** 0

**Building Code:** R2900301280  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Bunker  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$140,281  
**Deferred Maintenance:** \$26,469  
**Ext. Gross Area:** 0

**Building Code:** R2900301340  
**Building Name:** Interstate SP Pothole Concess  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$224,507  
**Deferred Maintenance:** \$46,961  
**Ext. Gross Area:** 0

**Building Code:** R2900301350  
**Building Name:** Interstate SP Interp Center  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$410,602  
**Deferred Maintenance:** \$62,517  
**Ext. Gross Area:** 0

**Building Code:** R2900301440  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$344,617  
**Deferred Maintenance:** \$48,129  
**Ext. Gross Area:** 0

**Building Code:** R2900301450  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$661,718  
**Deferred Maintenance:** \$234,216  
**Ext. Gross Area:** 0

**Building Code:** R2900303250  
**Building Name:** Interstate SP Shop  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 307 MILLTOWN RD  
**City Code:** TAYLORS FALLS

**Current Replacement Value:** \$340,389  
**Deferred Maintenance:** \$99,777  
**Ext. Gross Area:** 0



<b>Building Code:</b>	R2900303460	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$413,355
<b>Building Name:</b>	Sanitation	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$75,332
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303800	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$207,381
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$26,722
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304100	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,666
<b>Building Name:</b>	Oil House	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$2,467
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306280	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$37,990
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$3,268
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306920	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$136,920
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$16,216
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307380	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$51,825
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$5,183
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,861
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$565
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,861
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$565
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308240	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,913
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$518
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308250	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,913
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	307 MILLTOWN RD	<b>Deferred Maintenance:</b>	\$518
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	TAYLORS FALLS	<b>Ext. Gross Area:</b>	0

**Site: R290030 - Itasca State Park**

<b>Building Code:</b>	R2900100150	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,382
<b>Building Name:</b>	Pine Loop Unisex East Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,328
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900100160	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,382
<b>Building Name:</b>	Poplar Loop East Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,328
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100170	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,382
<b>Building Name:</b>	Poplar Loop West Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,328
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100180	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,382
<b>Building Name:</b>	Pine Loop West Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,328
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,382
<b>Building Name:</b>	Bear Paw Near Ice House Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,328
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100210	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,382
<b>Building Name:</b>	Bear Paw Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$3,096
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100250	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$102,913
<b>Building Name:</b>	Log Picnic Shelter	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$12,386
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	867
<b>Building Code:</b>	R2900100270	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,946
<b>Building Name:</b>	Tower Area Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$3,612
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100290	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$4,201
<b>Building Name:</b>	Red Pine and Oza Adirondack	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,386
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	111
<b>Building Code:</b>	R2900100300	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$5,456
<b>Building Name:</b>	Desoto and Eagle Adirondack	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,331
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	111
<b>Building Code:</b>	R2900100310	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$4,201
<b>Building Name:</b>	Deer Park and Alton Adirondack	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$985
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	111
<b>Building Code:</b>	R2900100940	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$3,735
<b>Building Name:</b>	Mckay Lake Adirondack	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,801
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	111

<b>Building Code:</b>	R2900100970	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$14,506
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,451
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101370	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$440,479
<b>Building Name:</b>	Itasca SP Old HQ Office	<b>Address:</b>	27841 FOREST LN	<b>Deferred Maintenance:</b>	\$80,379
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,926
<b>Building Code:</b>	R2900101380	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$73,593
<b>Building Name:</b>	Old HQ Residence Garage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$10,544
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	565
<b>Building Code:</b>	R2900101390	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$618,392
<b>Building Name:</b>	Residence	<b>Address:</b>	27859 FOREST LN	<b>Deferred Maintenance:</b>	\$133,743
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	3,118
<b>Building Code:</b>	R2900101400	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$280,467
<b>Building Name:</b>	Picnic Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$40,832
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	481
<b>Building Code:</b>	R2900101410	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$575,624
<b>Building Name:</b>	Museum	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$82,756
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,887
<b>Building Code:</b>	R2900101430	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$1,495,415
<b>Building Name:</b>	Beach Bath House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$163,690
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	2,516
<b>Building Code:</b>	R2900101450	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$100,229
<b>Building Name:</b>	Boat House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$24,390
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	2,019
<b>Building Code:</b>	R2900101460	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$150,387
<b>Building Name:</b>	Ozawindib Lake Cabin	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$27,527
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	697
<b>Building Code:</b>	R2900101470	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$585,667
<b>Building Name:</b>	Ozawindib Dining Hall	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$68,644
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	2,218
<b>Building Code:</b>	R2900101490	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$258,495
<b>Building Name:</b>	Ozawindib Rental Cabin	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$61,920
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	870

<b>Building Code:</b>	R2900101500	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$3,022
<b>Building Name:</b>	Clubhouse Storage Shed	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$682
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	19
<b>Building Code:</b>	R2900101510	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$26,956
<b>Building Name:</b>	Itasca SP North Contact Stat	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$5,759
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	123
<b>Building Code:</b>	R2900101550	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$1,677,021
<b>Building Name:</b>	Youth Hostel	<b>Address:</b>	27910 FOREST LN	<b>Deferred Maintenance:</b>	\$507,920
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	7,173
<b>Building Code:</b>	R2900101560	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$277,306
<b>Building Name:</b>	Cardboard Recycling Storage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$57,620
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,616
<b>Building Code:</b>	R2900101570	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$98,104
<b>Building Name:</b>	3 Stall Garage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$21,306
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	945
<b>Building Code:</b>	R2900101580	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$74,513
<b>Building Name:</b>	Lumber Shed	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$20,105
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,240
<b>Building Code:</b>	R2900101590	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,164
<b>Building Name:</b>	Bike Rental Pump Shed	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,920
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	37
<b>Building Code:</b>	R2900101600	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,629,965
<b>Building Name:</b>	Itasca SP Shop	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$357,279
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	8,958
<b>Building Code:</b>	R2900101610	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$40,994
<b>Building Name:</b>	Oil House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$14,363
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	216
<b>Building Code:</b>	R2900101620	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$190,900
<b>Building Name:</b>	Plumbers Shop	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$46,071
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,036
<b>Building Code:</b>	R2900101630	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$139,449
<b>Building Name:</b>	CCC Water Tower Shop Yard	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$15,249
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	331

<b>Building Code:</b>	R2900101640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$163,263
<b>Building Name:</b>	5 Stall Garage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$11,627
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,519
<b>Building Code:</b>	R2900101650	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$330,286
<b>Building Name:</b>	Cabin 16	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$53,179
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	880
<b>Building Code:</b>	R2900101660	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$133,092
<b>Building Name:</b>	Itasca SP Campground Cnt Sta	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$39,601
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	342
<b>Building Code:</b>	R2900101670	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$896,113
<b>Building Name:</b>	Bear Paw Old Store	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$53,762
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,921
<b>Building Code:</b>	R2900101680	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$314,442
<b>Building Name:</b>	Bear Paw South Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$91,354
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	443
<b>Building Code:</b>	R2900101690	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$879,783
<b>Building Name:</b>	Bear Paw Shower/Toilet	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$77,933
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,606
<b>Building Code:</b>	R2900101700	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$183,332
<b>Building Name:</b>	Bear Paw North Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$42,738
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	280
<b>Building Code:</b>	R2900101710	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$61,657
<b>Building Name:</b>	Old Log Pump House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$17,307
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	159
<b>Building Code:</b>	R2900101720	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$109,155
<b>Building Name:</b>	Ice House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$26,603
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	830
<b>Building Code:</b>	R2900101730	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$44,935
<b>Building Name:</b>	Bear Paw Fish Cleaning House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$13,796
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	187
<b>Building Code:</b>	R2900101740	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$231,840
<b>Building Name:</b>	Bear Paw Cabin 1	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$55,031
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	362

<b>Building Code:</b>	R2900101750	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$231,840
<b>Building Name:</b>	Bear Paw Cabin 2	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$45,067
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	363
<b>Building Code:</b>	R2900101760	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$231,840
<b>Building Name:</b>	Bear Paw Cabin 3	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$45,067
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	363
<b>Building Code:</b>	R2900101770	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$231,840
<b>Building Name:</b>	Bear Paw Cabin 4	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$53,130
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	363
<b>Building Code:</b>	R2900101780	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$231,840
<b>Building Name:</b>	Bear Paw Cabin 5	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$51,507
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	363
<b>Building Code:</b>	R2900101790	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$231,840
<b>Building Name:</b>	Bear Paw Cabin 6	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$51,507
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	363
<b>Building Code:</b>	R2900101800	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$197,310
<b>Building Name:</b>	Pine Ridge CCC Pump House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$17,969
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	414
<b>Building Code:</b>	R2900101810	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$236,016
<b>Building Name:</b>	Oak Loop Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$66,808
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	670
<b>Building Code:</b>	R2900101830	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$238,504
<b>Building Name:</b>	Maple Loop Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$54,908
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	670
<b>Building Code:</b>	R2900101850	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$46,093
<b>Building Name:</b>	2 Stall Garage Old HQ	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$8,224
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	634
<b>Building Code:</b>	R2900101910	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$2,254,518
<b>Building Name:</b>	Itasca SP Forest Inn	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$170,932
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	6,721
<b>Building Code:</b>	R2900101920	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$265,948
<b>Building Name:</b>	Stone Toilet at Forest Inn	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$49,586
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	422

<b>Building Code:</b>	R2900101930	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$1,957,904
<b>Building Name:</b>	Itasca SP Dormitory	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$941,379
<b>Facility Condition Index:</b>	0.48 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	5,655
<b>Building Code:</b>	R2900101940	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$4,777,108
<b>Building Name:</b>	Itasca SP Douglas Lodge	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$755,536
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	14,548
<b>Building Code:</b>	R2900101950	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$1,275,214
<b>Building Name:</b>	Nicollet Court	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$727,597
<b>Facility Condition Index:</b>	0.57 - Crisis	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101960	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$678,881
<b>Building Name:</b>	Fourplex	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$128,787
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101970	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$1,221,924
<b>Building Name:</b>	Clubhouse	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$127,253
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	2,034
<b>Building Code:</b>	R2900101980	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$291,686
<b>Building Name:</b>	Douglas Lodge Cabin #11	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$65,233
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	769
<b>Building Code:</b>	R2900101990	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$101,856
<b>Building Name:</b>	Douglas Lodge Cabin #1	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$24,241
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102000	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,335
<b>Building Name:</b>	Douglas Lodge Cabin #4	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$38,136
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102010	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$266,484
<b>Building Name:</b>	Douglas Lodge Cabin #5	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$48,984
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102020	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$393,584
<b>Building Name:</b>	Douglas Lodge Cabin #6	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$62,926
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102030	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$347,970
<b>Building Name:</b>	Douglas Lodge Cabin #7	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$79,842
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900102040	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$254,991
<b>Building Name:</b>	Douglas Lodge Cabin #8	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$52,282
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102050	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$321,339
<b>Building Name:</b>	Douglas Lodge Cabin #9	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$51,190
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102060	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$365,275
<b>Building Name:</b>	Douglas Lodge Cabin #10	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$58,327
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102070	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$363,506
<b>Building Name:</b>	Douglas Lodge Cabin #12	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$65,075
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102080	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$101,856
<b>Building Name:</b>	Douglas Lodge Cabin #14	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$22,409
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102090	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$101,856
<b>Building Name:</b>	Douglas Lodge Cabin #15	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$26,113
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102100	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$17,766
<b>Building Name:</b>	Shed Shop Area	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$5,863
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	366
<b>Building Code:</b>	R2900102110	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$139,206
<b>Building Name:</b>	Douglas Lodge Pump House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$30,868
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	178
<b>Building Code:</b>	R2900102120	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$92,520
<b>Building Name:</b>	Old Timers Cabin	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$6,926
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	455
<b>Building Code:</b>	R2900102140	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,542
<b>Building Name:</b>	Boat landing Fish Cleaning House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$7,122
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	167
<b>Building Code:</b>	R2900102150	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$34,074
<b>Building Name:</b>	Registration Wood Storage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$9,322
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	336



<b>Building Code:</b>	R2900103380	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$619,925
<b>Building Name:</b>	Forestry Site Residence	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$77,645
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103390	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$393,924
<b>Building Name:</b>	Three Stall at Forestry Site	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$74,453
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,259
<b>Building Code:</b>	R2900103420	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$27,118
<b>Building Name:</b>	Single Stall Garage Forestry Site	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$8,949
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	267
<b>Building Code:</b>	R2900103440	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$35,458
<b>Building Name:</b>	Pump House at Forestry Site	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$11,701
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	186
<b>Building Code:</b>	R2900103450	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$158,202
<b>Building Name:</b>	4 Stall at Forestry Site	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$30,037
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,561
<b>Building Code:</b>	R2900104390	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$179,313
<b>Building Name:</b>	Pump House Behind Cabins	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$53,349
<b>Facility Condition Index:</b>	0.30 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	292
<b>Building Code:</b>	R2900104400	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,476
<b>Building Name:</b>	Shed at Campground Registration	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,344
<b>Facility Condition Index:</b>	0.31 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	73
<b>Building Code:</b>	R2900104410	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$102,555
<b>Building Name:</b>	Wegmans Store	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$28,630
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	509
<b>Building Code:</b>	R2900104420	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$32,382
<b>Building Name:</b>	Shop Well Pump House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$7,398
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	205
<b>Building Code:</b>	R2900104430	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$136,834
<b>Building Name:</b>	Elk Lake Cabin	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$125,142
<b>Facility Condition Index:</b>	0.91 - <b>Crisis</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	481
<b>Building Code:</b>	R2900104440	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$39,008
<b>Building Name:</b>	Elk Lake Dining Hall	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$12,873
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	533



<b>Building Code:</b>	R2900104450	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$31,706
<b>Building Name:</b>	Pump House on Lake Trail	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$17,898
<b>Facility Condition Index:</b>	0.56 - <b>Crisis</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104770	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$13,694
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$4,519
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	48
<b>Building Code:</b>	R2900104780	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$14,753
<b>Building Name:</b>	Water Tower Near Hostel	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$8,032
<b>Facility Condition Index:</b>	0.54 - <b>Crisis</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104820	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,479
<b>Building Name:</b>	Unisex Vault Boat Tour	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,468
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104830	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,077
<b>Building Name:</b>	Unisex Vault Boat Landing	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,995
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104840	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,547
<b>Building Name:</b>	Mens Vault Near Picnic	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,491
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104850	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,547
<b>Building Name:</b>	Womens Vault Near Picnic	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,491
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104860	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,547
<b>Building Name:</b>	Mens Vault Elk Lake	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,491
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104870	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,547
<b>Building Name:</b>	Womens Vault Elk Lake	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,491
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104880	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$5,470
<b>Building Name:</b>	North Contact Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,819
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106140	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$73,826
<b>Building Name:</b>	Nicolette Cabin	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$17,751
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900106220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$583,398
<b>Building Name:</b>	Itasca SP Gift Warehouse	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$66,071
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,943
<b>Building Code:</b>	R2900106340	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$100,458
<b>Building Name:</b>	Quonset Storage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$29,797
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	974
<b>Building Code:</b>	R2900106530	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,122
<b>Building Name:</b>	Campground Registration Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,671
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106540	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,122
<b>Building Name:</b>	Pine Ridge Maple Loop Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,671
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106620	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$5,022
<b>Building Name:</b>	Fire Tower Cab	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$502
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106630	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$3,336
<b>Building Name:</b>	Lake Cabin Wood Shed	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$404
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106640	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,122
<b>Building Name:</b>	Bison Kill Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,045
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106650	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$3,174
<b>Building Name:</b>	Ozawindib Well House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$840
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106810	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,122
<b>Building Name:</b>	Spruce Loop East Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,045
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106820	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,122
<b>Building Name:</b>	Oak Loop Vault	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,270
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106830	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$33,443
<b>Building Name:</b>	Douglas Lodge Kiosk	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$3,344
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900107150	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$38,652
<b>Building Name:</b>	Ozawindib Group Camp Pump House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$4,077
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	200
<b>Building Code:</b>	R2900107160	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$354,200
<b>Building Name:</b>	Spruce Loop Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$37,831
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,154
<b>Building Code:</b>	R2900107170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$744,898
<b>Building Name:</b>	Itasca SP Admin Office	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$97,625
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	3,947
<b>Building Code:</b>	R2900107180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$52,364
<b>Building Name:</b>	Admin Pump House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$6,150
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	563
<b>Building Code:</b>	R2900107190	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$4,019,214
<b>Building Name:</b>	Itasca SP Jacob Brower Ctr	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$312,521
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	13,489
<b>Building Code:</b>	R2900107270	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$63,041
<b>Building Name:</b>	Itasca SP East Contact Station	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$6,757
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	265
<b>Building Code:</b>	R2900107280	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$354,200
<b>Building Name:</b>	Pine Loop Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$35,420
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,154
<b>Building Code:</b>	R2900107590	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$731,950
<b>Building Name:</b>	Itasca Suites 1	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$98,012
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107600	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$731,950
<b>Building Name:</b>	Itasca Suites 2	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$98,012
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107800	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$358,075
<b>Building Name:</b>	Sanitation	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$35,807
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,121
<b>Building Code:</b>	R2900107840	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$3,142,228
<b>Building Name:</b>	Itasca SP Mary Gibbs Center	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$147,348
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	6,178

<b>Building Code:</b>	R2900107900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,197
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$1,520
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107910	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,197
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,902
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108170	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$24,437
<b>Building Name:</b>	Gibbs Well House	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,444
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108280	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$24,568
<b>Building Name:</b>	Cabin 16 Screen Shelter	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$2,457
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	166
<b>Building Code:</b>	R2900108420	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$41,844
<b>Building Name:</b>	Refrigerated Storage	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$4,184
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	180
<b>Building Code:</b>	R2900207790	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$43,281
<b>Building Name:</b>	Cabin	<b>Address:</b>	36750 MAIN PARK DR	<b>Deferred Maintenance:</b>	\$14,283
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0

**Site: R290031 - Jay Cooke State Park**

<b>Building Code:</b>	R2900200510	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$42,956
<b>Building Name:</b>	Shop Recycling/Wood	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$7,037
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200520	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$365,640
<b>Building Name:</b>	Sanitation	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$118,123
<b>Facility Condition Index:</b>	0.32 - <b>Poor</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	1,229
<b>Building Code:</b>	R2900200570	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,295,089
<b>Building Name:</b>	Jay Cooke SP River Inn Int Ctr	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$183,609
<b>Facility Condition Index:</b>	0.14 - <b>Good</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200580	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$195,321
<b>Building Name:</b>	Sanitation Combo	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$76,468
<b>Facility Condition Index:</b>	0.39 - <b>Poor</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200590	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$350,571
<b>Building Name:</b>	Oldenburg Picnic Shelter	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$103,347
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900200600	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$83,673
<b>Building Name:</b>	Spring House	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$27,612
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200630	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$325,298
<b>Building Name:</b>	Historic Residence	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$185,206
<b>Facility Condition Index:</b>	0.57 - Crisis	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900203710	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$360,267
<b>Building Name:</b>	Jay Cooke SP Shop	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$34,542
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206680	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,178
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$2,275
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,178
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$3,029
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,178
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$3,029
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206770	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,178
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$2,986
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207930	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,018
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$933
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	41
<b>Building Code:</b>	R2900207940	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,018
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$933
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	41
<b>Building Code:</b>	R2900207950	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,018
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$933
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	41
<b>Building Code:</b>	R2900208630	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$1,066
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	51

<b>Building Code:</b>	R2900208640	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,116
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$1,412
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	51
<b>Building Code:</b>	R2900208800	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$725,530
<b>Building Name:</b>	Jay Cooke SP Contact Station	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$14,511
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208810	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$31,650
<b>Building Name:</b>	HQ Wood Shed	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$633
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208940	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$73,370
<b>Building Name:</b>	Slate Cabin	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$3,000
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	335
<b>Building Code:</b>	R2900208950	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$69,672
<b>Building Name:</b>	Agate Cabin	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$2,946
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	335
<b>Building Code:</b>	R2900208960	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$73,370
<b>Building Name:</b>	Gabbro Cabin	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$3,000
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	335
<b>Building Code:</b>	R2900208970	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$97,457
<b>Building Name:</b>	Shale Cabin	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$4,541
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	335
<b>Building Code:</b>	R2900209050	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$81,214
<b>Building Name:</b>	Basalt Cabin	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$3,784
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$52,157
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$5,232
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900210480	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$103,288
<b>Building Name:</b>	Solar Garage	<b>Address:</b>	780 HWY 210	<b>Deferred Maintenance:</b>	\$2,066
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	0

**Site: R290032 - Judge CR Magney State Park**

<b>Building Code:</b>	R2900200820	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$208,771
<b>Building Name:</b>	Judge C R Magney SP Office	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$52,480
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900200830	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$135,504
<b>Building Name:</b>	Judge C R Magney SP Shop	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$32,577
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200850	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$47,346
<b>Building Name:</b>	Judge C R Magney SP Contct Sta	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$4,735
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200870	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$18,882
<b>Building Name:</b>	Spring House	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$4,186
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200880	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$42,733
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$10,475
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204190	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,396
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$8,026
<b>Facility Condition Index:</b>	0.70 - Crisis	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204310	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$52,170
<b>Building Name:</b>	Garage	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$4,032
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205910	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,845
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$1,320
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207410	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$271,782
<b>Building Name:</b>	Sanitation	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$27,178
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207600	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$151,470
<b>Building Name:</b>	Water Tower	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$14,908
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208160	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,426
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$1,919
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208170	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,426
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4051 E HWY 61	<b>Deferred Maintenance:</b>	\$2,421
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	GRAND MARAIS	<b>Ext. Gross Area:</b>	0



**Building Code:** R2900208180  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 4051 E HWY 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$15,426  
**Deferred Maintenance:** \$1,543  
**Ext. Gross Area:** 0

**Building Code:** R2900209510  
**Building Name:** Shed  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 4051 E HWY 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$5,945  
**Deferred Maintenance:** \$119  
**Ext. Gross Area:** 0

**Site: R290033 - Kilen Woods State Park**

**Building Code:** R2900401210  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$93,911  
**Deferred Maintenance:** \$31,501  
**Ext. Gross Area:** 0

**Building Code:** R2900401250  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.38 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$339,558  
**Deferred Maintenance:** \$128,296  
**Ext. Gross Area:** 0

**Building Code:** R2900404350  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$7,240  
**Deferred Maintenance:** \$1,564  
**Ext. Gross Area:** 0

**Building Code:** R2900404680  
**Building Name:** Kilen Woods SP Contact Station  
**Facility Condition Index:** 0.05 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$301,750  
**Deferred Maintenance:** \$15,342  
**Ext. Gross Area:** 0

**Building Code:** R2900404690  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$392,436  
**Deferred Maintenance:** \$8,585  
**Ext. Gross Area:** 0

**Building Code:** R2900404700  
**Building Name:** Kilen Woods SP Shop  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$283,334  
**Deferred Maintenance:** \$5,667  
**Ext. Gross Area:** 0

**Building Code:** R2900405200  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$7,240  
**Deferred Maintenance:** \$1,595  
**Ext. Gross Area:** 0

**Building Code:** R2900405210  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$7,240  
**Deferred Maintenance:** \$1,595  
**Ext. Gross Area:** 0

**Building Code:** R2900405420  
**Building Name:** Firewood Shed  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 50200 860TH ST  
**City Code:** LAKEFIELD

**Current Replacement Value:** \$68,917  
**Deferred Maintenance:** \$3,930  
**Ext. Gross Area:** 0



**Site: R290034 - Lac Qui Parle State Park**

<b>Building Code:</b>	R2900400910	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$143,898
<b>Building Name:</b>	Sanitation	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$71,012
<b>Facility Condition Index:</b>	0.49 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	331
<b>Building Code:</b>	R2900400920	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$381,491
<b>Building Name:</b>	Lac Qui Parle SP Office	<b>Address:</b>	3749 STATE PARK RD	<b>Deferred Maintenance:</b>	\$123,990
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	MONTEVIDEO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400930	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$83,101
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$27,423
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	960
<b>Building Code:</b>	R2900400940	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$286,049
<b>Building Name:</b>	Interp Occupied	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$94,396
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	1,936
<b>Building Code:</b>	R2900400950	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$204,458
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$67,471
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	1,299
<b>Building Code:</b>	R2900400960	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$128,567
<b>Building Name:</b>	Bath House	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$42,427
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	430
<b>Building Code:</b>	R2900400970	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$232,740
<b>Building Name:</b>	Lac Qui Parle SP Shop	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$70,066
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	1,500
<b>Building Code:</b>	R2900400980	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,938
<b>Building Name:</b>	Oil House	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$4,631
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	120
<b>Building Code:</b>	R2900400990	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$104,195
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$43,355
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	837
<b>Building Code:</b>	R2900402880	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$23,374
<b>Building Name:</b>	Contact Station	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$7,713
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	189
<b>Building Code:</b>	R2900403540	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,033
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$2,001
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900403550	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,033
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$2,001
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403640	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,369
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$2,762
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	80
<b>Building Code:</b>	R2900403990	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,890
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$1,959
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404000	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$16,703
<b>Building Name:</b>	Pump House	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$5,512
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	78
<b>Building Code:</b>	R2900404410	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,601
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$3,866
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404670	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$342,446
<b>Building Name:</b>	Sanitation	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$38,055
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	882
<b>Building Code:</b>	R2900404980	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,783
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$2,053
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404990	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,150
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$1,103
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405000	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,783
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$1,166
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405010	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,783
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$1,166
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405140	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$66,962
<b>Building Name:</b>	Cabin	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$6,696
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	310

**Building Code:** R2900405150  
**Building Name:** Cabin  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 14047 20TH ST NW  
**City Code:** WATSON

**Current Replacement Value:** \$53,369  
**Deferred Maintenance:** \$5,389  
**Ext. Gross Area:** 310

**Building Code:** R2900405160  
**Building Name:** Cabin  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 14047 20TH ST NW  
**City Code:** WATSON

**Current Replacement Value:** \$55,974  
**Deferred Maintenance:** \$5,597  
**Ext. Gross Area:** 310

**Building Code:** R2900405260  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 14047 20TH ST NW  
**City Code:** WATSON

**Current Replacement Value:** \$8,402  
**Deferred Maintenance:** \$168  
**Ext. Gross Area:** 96

**Building Code:** R2900405370  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 14047 20TH ST NW  
**City Code:** WATSON

**Current Replacement Value:** \$29,504  
**Deferred Maintenance:** \$590  
**Ext. Gross Area:** 0

**Building Code:** R2900405380  
**Building Name:** Shed  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 14047 20TH ST NW  
**City Code:** WATSON

**Current Replacement Value:** \$8,369  
**Deferred Maintenance:** \$1,285  
**Ext. Gross Area:** 18

**Site: R290035 - Lake Bemidji State Park**

**Building Code:** R2900102330  
**Building Name:** Beach Sanitation and Cabanas  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$276,478  
**Deferred Maintenance:** \$85,348  
**Ext. Gross Area:** 0

**Building Code:** R2900102340  
**Building Name:** Oak Lane Sanitation  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$257,996  
**Deferred Maintenance:** \$91,719  
**Ext. Gross Area:** 0

**Building Code:** R2900102360  
**Building Name:** Lake Bemidji SP Shop  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$342,559  
**Deferred Maintenance:** \$79,224  
**Ext. Gross Area:** 0

**Building Code:** R2900102370  
**Building Name:** Region Office Garage  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$59,484  
**Deferred Maintenance:** \$14,152  
**Ext. Gross Area:** 0

**Building Code:** R2900102380  
**Building Name:** Oil House  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$9,677  
**Deferred Maintenance:** \$1,296  
**Ext. Gross Area:** 0

**Building Code:** R2900102390  
**Building Name:** Trails Storage  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$107,672  
**Deferred Maintenance:** \$13,792  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900102400	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$20,660
<b>Building Name:</b>	Pump House	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$4,585
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102410	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$513,342
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$103,474
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102420	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$445,937
<b>Building Name:</b>	Lake Bemidji SP Office	<b>Address:</b>	3296 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$59,967
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102460	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$129,424
<b>Building Name:</b>	Historic Log Sanitation	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$65,843
<b>Facility Condition Index:</b>	0.51 - Crisis	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102480	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$2,217,734
<b>Building Name:</b>	Beach Picnic Shelter	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$244,877
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104210	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$850,841
<b>Building Name:</b>	Lake Bemidji SP Contact Sta	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$151,847
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104220	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$398,790
<b>Building Name:</b>	Aspen Lane Sanitation	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$94,749
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105230	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,531
<b>Building Name:</b>	Oil House	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$1,607
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105700	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,719
<b>Building Name:</b>	Bass Creek Mens Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,547
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105710	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,719
<b>Building Name:</b>	Bass Creek Womens Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,547
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105720	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,673
<b>Building Name:</b>	Boat Launch Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$3,160
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900105750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,719
<b>Building Name:</b>	Mens Picnic Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,547
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,719
<b>Building Name:</b>	Womens Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,547
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106780	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$19,327
<b>Building Name:</b>	Amphitheater	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$4,554
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107030	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$112,093
<b>Building Name:</b>	Metal Storage at Shop	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$11,209
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107210	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$421,628
<b>Building Name:</b>	Pine Lane Sanitation	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$46,821
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107220	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$24,101
<b>Building Name:</b>	Bass Creek Adirondack	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$7,953
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107230	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,350
<b>Building Name:</b>	Main Parking Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$3,308
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107880	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,542
<b>Building Name:</b>	Campground Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$1,554
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108300	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,542
<b>Building Name:</b>	Bog Walk Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$1,554
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108580	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$23,383
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,338
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109050	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$49,390
<b>Building Name:</b>	Tamarack Cabin	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,033
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900109060	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$49,390
<b>Building Name:</b>	Spruce Cabin	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$1,793
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109070	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$49,390
<b>Building Name:</b>	Balsam Cabin	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$1,793
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109080	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$49,390
<b>Building Name:</b>	Maple Cabin	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$1,793
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109090	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$28,863
<b>Building Name:</b>	Tamarack Concrete Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,886
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109100	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$28,863
<b>Building Name:</b>	Maple Cabin Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,886
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109110	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,808
<b>Building Name:</b>	Aspen Lane Concrete Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$396
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109360	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$28,863
<b>Building Name:</b>	Group Camp W Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$2,886
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109370	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,808
<b>Building Name:</b>	Group Camp E Vault	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$396
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109380	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$2,532
<b>Building Name:</b>	Pump House	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$267
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109390	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$51,893
<b>Building Name:</b>	Group Camp Picnic Shelter 2	<b>Address:</b>	3401 STATE PARK RD NE	<b>Deferred Maintenance:</b>	\$5,189
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0

**Site: R290036 - Lake Bronson State Park**

<b>Building Code:</b>	R2900100060	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,773
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$3,003
<b>Facility Condition Index:</b>	0.31 - <b>Poor</b>	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900102600	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$324,724
<b>Building Name:</b>	Sanitation South Two Rivers	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$85,648
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102610	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$327,768
<b>Building Name:</b>	Sanitation Lakeside	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$108,392
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	119
<b>Building Code:</b>	R2900102630	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$246,947
<b>Building Name:</b>	Lake Bronson SP Contact Sta	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$44,342
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$248,715
<b>Building Name:</b>	Lake Bronson SP Shop	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$43,089
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102650	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$406,186
<b>Building Name:</b>	Residence	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$69,704
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102660	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$290,258
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$38,144
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102670	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$388,927
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$75,187
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102680	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$330,304
<b>Building Name:</b>	Sanitation Picnic Tip Trough	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$103,272
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102690	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$296,237
<b>Building Name:</b>	Sanitation Two Rivers	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$90,598
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$30,512
<b>Building Name:</b>	Wood Storage	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$3,964
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102710	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$206,399
<b>Building Name:</b>	Old Residence Storage	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$48,274
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900102720	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$433,319
<b>Building Name:</b>	Water Tower	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$110,410
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102730	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$500,449
<b>Building Name:</b>	Bath House	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$50,045
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104310	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$90,048
<b>Building Name:</b>	Residence Garage	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$16,010
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105050	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,322
<b>Building Name:</b>	Cold Storage by Contact Station	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$878
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105280	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$59,115
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$10,982
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106230	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,363,157
<b>Building Name:</b>	Lake Bronson SP Visitor Center	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$150,572
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106930	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$24,972
<b>Building Name:</b>	Pump House	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$2,018
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106940	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,647
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$974
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107950	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,436
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$1,094
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,888
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3793 230TH ST	<b>Deferred Maintenance:</b>	\$1,139
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LAKE BRONSON	<b>Ext. Gross Area:</b>	0

**Site: R290037 - Lake Carlos State Park**

<b>Building Code:</b>	R2900102890	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$130,744
<b>Building Name:</b>	HLGC Bunkhouse #1	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$35,913
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900102900	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$134,351
<b>Building Name:</b>	HLGC Bunkhouse #2	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$37,103
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102910	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$316,638
<b>Building Name:</b>	HLGC Craft Building	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$65,319
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102920	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$385,254
<b>Building Name:</b>	Staff Lodging	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$76,746
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102930	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$631,497
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$71,542
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102940	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$238,024
<b>Building Name:</b>	Picnic Area Bathroom	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$60,715
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102950	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$57,328
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$13,800
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102960	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$154,605
<b>Building Name:</b>	Water Tower	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$18,614
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102970	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$429,788
<b>Building Name:</b>	Beach Bath House	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$116,821
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102990	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,814
<b>Building Name:</b>	Pump House	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$2,496
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103010	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$125,096
<b>Building Name:</b>	South Sanitation	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$48,901
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103030	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,662
<b>Building Name:</b>	Pump House	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$3,987
<b>Facility Condition Index:</b>	0.52 - Crisis	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900103050	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$291,814
<b>Building Name:</b>	East Sanitation	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$90,665
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103060	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,360
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$6,670
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103100	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$153,915
<b>Building Name:</b>	Lake Carlos SP Shop	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$50,873
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900103110	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$53,292
<b>Building Name:</b>	Garage at Shop Area	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$10,207
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104480	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$304,185
<b>Building Name:</b>	Residence	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$47,205
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104580	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$374,441
<b>Building Name:</b>	North Sanitation	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$39,343
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104590	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$42,940
<b>Building Name:</b>	Residence Garage	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$5,221
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104600	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$146,337
<b>Building Name:</b>	Metal Cold Storage at Shop	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$24,495
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$485,364
<b>Building Name:</b>	Lake Carlos SP Interpretive Cr	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$103,506
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,156
<b>Building Name:</b>	Lower Campground Vault	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$2,645
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106420	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$234,171
<b>Building Name:</b>	Lake Carlos SP Contact Station	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$34,905
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900106430	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$386,029
<b>Building Name:</b>	West Sanitation	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$42,409
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106520	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Lakeview Picnic Vault	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$2,080
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106970	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$1,941
<b>Building Name:</b>	Contact Station Kiosk	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$194
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106980	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Contact Station Vault	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$1,751
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107000	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Horse Camp Vault	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$3,146
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107010	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Inspiration Peak Vault Toilet	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$5,295
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107410	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$1,751
<b>Building Name:</b>	Trail Kiosk	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$249
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107850	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$326,892
<b>Building Name:</b>	Hidden Lake Group Camp Sanitation	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$44,440
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107860	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$51,131
<b>Building Name:</b>	Pioneer Picnic Shelter	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$5,113
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107920	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Pioneer Vault	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$1,478
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107930	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Pioneer Vault 2	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$1,478
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900108270	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Lakeview Picnic Vault	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$1,478
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108500	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$64,265
<b>Building Name:</b>	Raccoon Cabin	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$7,578
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108510	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$67,218
<b>Building Name:</b>	Frog Cabin	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$7,873
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108520	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$67,218
<b>Building Name:</b>	Eagle Cabin	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$7,873
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108530	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$67,218
<b>Building Name:</b>	Loon Cabin	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$7,873
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108550	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$54,904
<b>Building Name:</b>	Upper Campground Vault Concrete	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$5,490
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$34,538
<b>Building Name:</b>	Wood Storage	<b>Address:</b>	2601 CTY RD 38 NE	<b>Deferred Maintenance:</b>	\$3,454
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CARLOS	<b>Ext. Gross Area:</b>	0

**Site: R290038 - Lake Louise State Park**

<b>Building Code:</b>	R2900500350	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$124,684
<b>Building Name:</b>	Sanitation	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$8,976
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500360	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$38,040
<b>Building Name:</b>	Well House	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$2,390
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502040	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$87,543
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$6,726
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,680
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$2,647
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900503870	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,680
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$2,857
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$236,985
<b>Building Name:</b>	Lake Louise SP Contact Station	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$23,029
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$279,398
<b>Building Name:</b>	Lake Louise SP Shop	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$35,202
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504930	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$19,632
<b>Building Name:</b>	Wood Storage Shed	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$2,746
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505100	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$359,547
<b>Building Name:</b>	Sanitation	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$23,720
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505170	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$1,928
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505210	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$1,533
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505220	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$1,928
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505230	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	12385 766TH AVE	<b>Deferred Maintenance:</b>	\$1,066
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LEROY	<b>Ext. Gross Area:</b>	0

**Site: R290039 - Lake Maria State Park**

<b>Building Code:</b>	R2900301090	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$152,449
<b>Building Name:</b>	Lake Maria SP Office	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$85,158
<b>Facility Condition Index:</b>	0.56 - Crisis	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301100	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$251,619
<b>Building Name:</b>	Lake Maria SP Shop	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$64,630
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900301110	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$32,306
<b>Building Name:</b>	Pump House	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$6,292
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301120	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$363,273
<b>Building Name:</b>	Trails Center	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$110,410
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303210	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$112,226
<b>Building Name:</b>	Lake Maria SP Contact Station	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$33,635
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303680	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$17,258
<b>Building Name:</b>	Oil House	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$1,633
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$20,394
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$4,817
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305250	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,111
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$1,830
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305280	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,111
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$1,100
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305290	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,111
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$895
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307000	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$59,379
<b>Building Name:</b>	Cabin	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$9,009
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307010	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$59,379
<b>Building Name:</b>	Cabin	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$9,009
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307020	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$59,379
<b>Building Name:</b>	Cabin	<b>Address:</b>	11411 CLEMENTA AVE NW	<b>Deferred Maintenance:</b>	\$14,204
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	MONTICELLO	<b>Ext. Gross Area:</b>	0



**Building Code:** R2900307250  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$13,861  
**Deferred Maintenance:** \$1,026  
**Ext. Gross Area:** 0

**Building Code:** R2900308140  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$48,444  
**Deferred Maintenance:** \$6,574  
**Ext. Gross Area:** 0

**Site: R290040 - Lake Shetek State Park**

**Building Code:** R2900401280  
**Building Name:** Recreation Hall  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$299,209  
**Deferred Maintenance:** \$89,927  
**Ext. Gross Area:** 0

**Building Code:** R2900401290  
**Building Name:** Cabin  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$117,343  
**Deferred Maintenance:** \$34,504  
**Ext. Gross Area:** 0

**Building Code:** R2900401300  
**Building Name:** Cabin  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$112,268  
**Deferred Maintenance:** \$35,211  
**Ext. Gross Area:** 0

**Building Code:** R2900401310  
**Building Name:** Cabin  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$117,343  
**Deferred Maintenance:** \$35,718  
**Ext. Gross Area:** 0

**Building Code:** R2900401320  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$224,291  
**Deferred Maintenance:** \$69,545  
**Ext. Gross Area:** 0

**Building Code:** R2900401330  
**Building Name:** Dining Hall  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$904,156  
**Deferred Maintenance:** \$182,567  
**Ext. Gross Area:** 0

**Building Code:** R2900401340  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$71,422  
**Deferred Maintenance:** \$23,368  
**Ext. Gross Area:** 0

**Building Code:** R2900401350  
**Building Name:** Bath House  
**Facility Condition Index:** 0.50 - **Crisis**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$534,646  
**Deferred Maintenance:** \$268,639  
**Ext. Gross Area:** 0

**Building Code:** R2900401360  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Bunker  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$260,653  
**Deferred Maintenance:** \$86,015  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900401370	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$271,179
<b>Building Name:</b>	Lake Shetek SP Shop	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$91,088
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401380	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$89,765
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$36,509
<b>Facility Condition Index:</b>	0.41 - Poor	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401390	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$669,391
<b>Building Name:</b>	Residence	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$200,121
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401410	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$257,893
<b>Building Name:</b>	Sanitation #1	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$77,539
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401420	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$154,130
<b>Building Name:</b>	Lake Shetek SP Interp Center	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$49,445
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401440	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$220,774
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$102,981
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401830	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,113
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$4,128
<b>Facility Condition Index:</b>	0.68 - Crisis	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900401840	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$13,938
<b>Building Name:</b>	Pump House	<b>Address:</b>	175 CTY RD 26	<b>Deferred Maintenance:</b>	\$2,964
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	WINDOM	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402940	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$372,576
<b>Building Name:</b>	Sanitation #2	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$102,246
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402950	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$29,676
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$11,307
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403190	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$128,137
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$18,056
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900403200	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$13,029
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$13,029
<b>Facility Condition Index:</b>	1.00 - <b>Crisis</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403210	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,726
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$10,296
<b>Facility Condition Index:</b>	0.88 - <b>Crisis</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403220	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,600
<b>Building Name:</b>	Oil House	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$6,673
<b>Facility Condition Index:</b>	0.88 - <b>Crisis</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403230	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$31,712
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$9,093
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403240	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$16,267
<b>Building Name:</b>	Pump House	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$4,703
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403760	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$267,380
<b>Building Name:</b>	Lake Shetek SP Contact Station	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$35,090
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404030	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$36,900
<b>Building Name:</b>	Cabin	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$12,289
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404640	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$52,999
<b>Building Name:</b>	Cabin	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$5,300
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404880	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,371
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,106
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404890	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,371
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,106
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,371
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	163 STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,106
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	CURRIE	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900404910  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$15,371  
**Deferred Maintenance:** \$1,106  
**Ext. Gross Area:** 0

**Building Code:** R2900404920  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$15,371  
**Deferred Maintenance:** \$1,106  
**Ext. Gross Area:** 0

**Building Code:** R2900404930  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$15,371  
**Deferred Maintenance:** \$1,106  
**Ext. Gross Area:** 0

**Building Code:** R2900404940  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$15,371  
**Deferred Maintenance:** \$1,106  
**Ext. Gross Area:** 0

**Building Code:** R2900405310  
**Building Name:** Cabin 4  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$54,514  
**Deferred Maintenance:** \$5,451  
**Ext. Gross Area:** 0

**Building Code:** R2900405320  
**Building Name:** Cabin 2  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$54,514  
**Deferred Maintenance:** \$5,451  
**Ext. Gross Area:** 0

**Building Code:** R2900405330  
**Building Name:** Cabin 3  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$32,058  
**Deferred Maintenance:** \$3,308  
**Ext. Gross Area:** 0

**Building Code:** R2900405340  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Vault Toilet  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$60,850  
**Deferred Maintenance:** \$1,217  
**Ext. Gross Area:** 0

**Building Code:** R2900405350  
**Building Name:** East Picnic Shelter 1  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Open Air Shelter  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$182,004  
**Deferred Maintenance:** \$3,640  
**Ext. Gross Area:** 0

**Building Code:** R2900405360  
**Building Name:** West Picnic Shelter 1  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Open Air Shelter  
**Address:** 163 STATE PARK RD  
**City Code:** CURRIE

**Current Replacement Value:** \$182,004  
**Deferred Maintenance:** \$3,640  
**Ext. Gross Area:** 0

**[Site: R290041 - Maplewood State Park](#)**

**Building Code:** R2900102240  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 39721 PARK ENTRANCE RD  
**City Code:** PELICAN RAPIDS

**Current Replacement Value:** \$92,825  
**Deferred Maintenance:** \$16,754  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900102560	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$242,861
<b>Building Name:</b>	Campground Sanitation	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$63,160
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102570	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$209,886
<b>Building Name:</b>	Maplewood SP Shop	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$21,713
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102590	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$86,333
<b>Building Name:</b>	Cold Storage Shop Area	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$20,969
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104280	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$271,115
<b>Building Name:</b>	Beach Sanitation	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$67,463
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104620	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$291,377
<b>Building Name:</b>	Maplewood SP Contact Station	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$74,355
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105100	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$17,928
<b>Building Name:</b>	Campground Lift Station	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$5,731
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105110	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,283
<b>Building Name:</b>	Hollow Campground Mens Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$4,713
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105120	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,283
<b>Building Name:</b>	Hollow Campground Womens Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$4,713
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105130	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,283
<b>Building Name:</b>	Knoll Campground Mens Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$6,949
<b>Facility Condition Index:</b>	0.49 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105140	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,283
<b>Building Name:</b>	Knoll Campground Womens Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$6,306
<b>Facility Condition Index:</b>	0.44 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105150	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,283
<b>Building Name:</b>	Horse Camp Womens Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$6,871
<b>Facility Condition Index:</b>	0.48 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900105160	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,549
<b>Building Name:</b>	Horse Camp Mens Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$7,053
<b>Facility Condition Index:</b>	0.48 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105170	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Lida North Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$4,190
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105430	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$46,379
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$8,846
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106490	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$3,146
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Baker Cabin Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$3,146
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106910	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,697
<b>Building Name:</b>	Lida South Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$1,970
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106920	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$94,024
<b>Building Name:</b>	Knoll Cabin	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$12,087
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107200	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$228,106
<b>Building Name:</b>	Steel Pole Building	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$4,562
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107970	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Beers Lake Boat Access Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$1,060
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107980	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,782
<b>Building Name:</b>	Group Camp Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$1,060
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108380	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$74,556
<b>Building Name:</b>	Baker Cabin	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$17,083
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900108560	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$203,023
<b>Building Name:</b>	Josh Hanson Picnic Shelter	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$5,181
<b>Facility Condition Index:</b>	0.03 - <b>Excellent</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108660	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$4,087
<b>Building Name:</b>	Site 5 Horse Camp Adirondack	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$2,744
<b>Facility Condition Index:</b>	0.67 - <b>Crisis</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108670	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$3,353
<b>Building Name:</b>	Site 9 Horse Camp Adirondack	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$335
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108680	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$3,772
<b>Building Name:</b>	Site 18 Horse Camp Adirondack	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$1,245
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108690	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$4,021
<b>Building Name:</b>	Site 22 Horse Camp Adirondack	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$1,695
<b>Facility Condition Index:</b>	0.42 - <b>Poor</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108700	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$3,353
<b>Building Name:</b>	Adirondack	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$1,107
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108720	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$3,633
<b>Building Name:</b>	Little Grass Backpack Adirondack	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$2,091
<b>Facility Condition Index:</b>	0.58 - <b>Crisis</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108730	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$54,904
<b>Building Name:</b>	Campground Double Concrete Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$5,490
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$54,904
<b>Building Name:</b>	Camper Cabins Concrete Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$5,490
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108780	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$1,176
<b>Building Name:</b>	Office Kiosk	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$118
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108800	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$96,967
<b>Building Name:</b>	Muskie Cabin	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$12,825
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900108810	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$96,967
<b>Building Name:</b>	Crappie Cabin	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$12,825
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108820	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$77,131
<b>Building Name:</b>	Pike Cabin	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$12,429
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109120	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$29,067
<b>Building Name:</b>	Horse Camp Concrete Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$2,907
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109130	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$29,067
<b>Building Name:</b>	Trails Center Concrete Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$2,907
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109140	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$29,067
<b>Building Name:</b>	Lake Lida Concrete Vault	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$2,907
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900109330	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$38,290
<b>Building Name:</b>	Friends Storage	<b>Address:</b>	39721 PARK ENTRANCE RD	<b>Deferred Maintenance:</b>	\$766
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	PELICAN RAPIDS	<b>Ext. Gross Area:</b>	0

**Site: R290042 - McCarthy Beach State Park**

<b>Building Code:</b>	R2900200670	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$14,302
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$3,984
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200750	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$67,397
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$11,960
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200760	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$44,838
<b>Building Name:</b>	Spring House	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$4,750
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200790	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$202,701
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$20,972
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900200800	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$28,331
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$13,977
<b>Facility Condition Index:</b>	0.49 - Poor	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	2,950

<b>Building Code:</b>	R2900203840	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$19,797
<b>Building Name:</b>	Oil House	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$4,429
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204490	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$818,047
<b>Building Name:</b>	McCarthy Beach SP Shop	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$81,805
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205570	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,790
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$2,673
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205580	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,790
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$2,673
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205590	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,072
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,706
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205600	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,072
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,706
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205630	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,298
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$3,202
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205640	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,298
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$3,202
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205650	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,467
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$2,525
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205660	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,467
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$2,525
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207640	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,765
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,169
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900207650	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,765
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,169
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,754
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$913
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207970	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,765
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,580
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207980	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,765
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,617
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208420	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$292,374
<b>Building Name:</b>	McCarthy Beach SP Contact Sta	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$9,546
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208440	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$44,074
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,752
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208850	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$326,256
<b>Building Name:</b>	Bath House	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$9,799
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209880	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$542,904
<b>Building Name:</b>	Sanitation	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$10,858
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209890	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$85,782
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	7622 MCCARTHY BEACH RD	<b>Deferred Maintenance:</b>	\$1,716
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	SIDE LAKE	<b>Ext. Gross Area:</b>	0

**Site: R290043 - Mille Lacs Kathio State Park**

<b>Building Code:</b>	R2900301130	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$265,317
<b>Building Name:</b>	Mille Lacs Kathio SP Shop	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$94,997
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301140	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$129,696
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$30,715
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900301190	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$184,893
<b>Building Name:</b>	Sanitation	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$50,053
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301200	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$533,575
<b>Building Name:</b>	Mille Lacs Kathio SP Trail Ctr	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$130,630
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301220	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$783,262
<b>Building Name:</b>	Mille Lacs Kathio SP Interp Ct	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$156,572
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301240	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$150,169
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$35,182
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301250	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$60,187
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$17,901
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303750	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$246,632
<b>Building Name:</b>	Mille Lacs Kathio SP CS	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$35,837
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304200	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,983
<b>Building Name:</b>	Oil House	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,351
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304780	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,285
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,059
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,081
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,253
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,081
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,253
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304810	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,285
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,059
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900305730	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$9,121
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$6,469
<b>Facility Condition Index:</b>	0.71 - <b>Crisis</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306370	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,661
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,524
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306380	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,661
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,810
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306390	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,661
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,810
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306400	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,661
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,510
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306410	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,661
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,810
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306680	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$31,936
<b>Building Name:</b>	Cabin	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,563
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306690	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$31,936
<b>Building Name:</b>	Cabin	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,563
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306700	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$54,674
<b>Building Name:</b>	Cabin	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$9,337
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306710	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$32,892
<b>Building Name:</b>	Cabin	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,878
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306720	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$31,936
<b>Building Name:</b>	Cabin	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$3,563
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900306830	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$304,670
<b>Building Name:</b>	Sanitation	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$35,704
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306890	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,156
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,059
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,149
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$2,291
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306910	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,432
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,708
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307240	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,149
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$1,840
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$24,377
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$488
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308310	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$33,521
<b>Building Name:</b>	Shed	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$670
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308320	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$9,248
<b>Building Name:</b>	Salt Shed	<b>Address:</b>	15066 KATHIO STATE PARK RD	<b>Deferred Maintenance:</b>	\$336
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	ONAMIA	<b>Ext. Gross Area:</b>	0

**Site: R290044 - Minneopa State Park**

<b>Building Code:</b>	R2900400540	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$299,777
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$49,132
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400550	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,179,025
<b>Building Name:</b>	Pump House	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$859,381
<b>Facility Condition Index:</b>	0.73 - <b>Crisis</b>	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400560	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$230,415
<b>Building Name:</b>	Sanitation	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$57,275
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900400570	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$244,504
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$76,499
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400580	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$43,611
<b>Building Name:</b>	Pump House	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$14,247
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400590	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$138,688
<b>Building Name:</b>	Minneopa SP Interp Center	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$44,768
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400600	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$285,971
<b>Building Name:</b>	Sanitation	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$83,948
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400620	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$256,330
<b>Building Name:</b>	Office	<b>Address:</b>	21009 547TH AVE	<b>Deferred Maintenance:</b>	\$68,986
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400630	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$8,321
<b>Building Name:</b>	Shed	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$6,241
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$309,005
<b>Building Name:</b>	Minneopa SP Shop	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$93,289
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400660	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$95,841
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$28,273
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402740	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$5,559
<b>Building Name:</b>	Oil House	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$1,985
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403350	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,326
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$2,323
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403360	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,326
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	54497 GADWALL RD	<b>Deferred Maintenance:</b>	\$2,323
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	MANKATO	<b>Ext. Gross Area:</b>	0



**Building Code:** R2900403370  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 54497 GADWALL RD  
**City Code:** MANKATO

**Current Replacement Value:** \$9,326  
**Deferred Maintenance:** \$3,318  
**Ext. Gross Area:** 0

**Building Code:** R2900403380  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 54497 GADWALL RD  
**City Code:** MANKATO

**Current Replacement Value:** \$9,093  
**Deferred Maintenance:** \$3,250  
**Ext. Gross Area:** 0

**Building Code:** R2900404310  
**Building Name:** Cabin  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 54497 GADWALL RD  
**City Code:** MANKATO

**Current Replacement Value:** \$61,678  
**Deferred Maintenance:** \$7,173  
**Ext. Gross Area:** 0

**Building Code:** R2900404320  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 54497 GADWALL RD  
**City Code:** MANKATO

**Current Replacement Value:** \$9,326  
**Deferred Maintenance:** \$2,323  
**Ext. Gross Area:** 0

**Building Code:** R2900404380  
**Building Name:** Minneopa SP Contact Station  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 54497 GADWALL RD  
**City Code:** MANKATO

**Current Replacement Value:** \$245,678  
**Deferred Maintenance:** \$23,024  
**Ext. Gross Area:** 0

**Building Code:** R2900405390  
**Building Name:** Quonset  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 54497 GADWALL RD  
**City Code:** MANKATO

**Current Replacement Value:** \$242,389  
**Deferred Maintenance:** \$52,421  
**Ext. Gross Area:** 0

**Site: R290045 - Minnesota Valley SRA**

**Building Code:** R2900600250  
**Building Name:** DISPOSED- MN Valley SRA Office  
**Facility Condition Index:** 0.46 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$509,384  
**Deferred Maintenance:** \$234,603  
**Ext. Gross Area:** 0

**Building Code:** R2900600260  
**Building Name:** DISPOSED - Garage  
**Facility Condition Index:** 0.50 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$23,267  
**Deferred Maintenance:** \$11,668  
**Ext. Gross Area:** 0

**Building Code:** R2900600310  
**Building Name:** DISPOSED - Corbel Residence  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Single-family Residence  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$320,380  
**Deferred Maintenance:** \$240,285  
**Ext. Gross Area:** 0

**Building Code:** R2900600320  
**Building Name:** Strait House  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$424,795  
**Deferred Maintenance:** \$138,213  
**Ext. Gross Area:** 0

**Building Code:** R2900601250  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$134,741  
**Deferred Maintenance:** \$15,285  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900601350	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,394
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$5,652
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601360	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,148
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$2,223
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601370	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,170
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$4,013
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601380	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,170
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$4,725
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601390	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,025
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$2,782
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601400	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,170
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$3,490
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601410	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,148
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$2,025
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,148
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$2,025
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,148
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$2,502
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,788
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$2,144
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601850	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$359,781
<b>Building Name:</b>	Minnesota Valley SRA Shop	<b>Address:</b>	19825 PARK BLVD	<b>Deferred Maintenance:</b>	\$64,312
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	JORDAN	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900601930  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.70 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$8,721  
**Deferred Maintenance:** \$6,143  
**Ext. Gross Area:** 0

**Building Code:** R2900602070  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 19825 PARK BLVD  
**City Code:** JORDAN

**Current Replacement Value:** \$43,140  
**Deferred Maintenance:** \$14,194  
**Ext. Gross Area:** 0

**Site: R290046 - Monson Lake State Park**

**Building Code:** R2900401000  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$226,316  
**Deferred Maintenance:** \$74,672  
**Ext. Gross Area:** 0

**Building Code:** R2900401010  
**Building Name:** Monson Lake SP Contact Station  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$170,098  
**Deferred Maintenance:** \$24,670  
**Ext. Gross Area:** 0

**Building Code:** R2900401020  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Bunker  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$663,519  
**Deferred Maintenance:** \$106,756  
**Ext. Gross Area:** 0

**Building Code:** R2900404360  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.53 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$25,522  
**Deferred Maintenance:** \$13,600  
**Ext. Gross Area:** 0

**Building Code:** R2900404370  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$12,224  
**Deferred Maintenance:** \$3,530  
**Ext. Gross Area:** 0

**Building Code:** R2900404870  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$15,783  
**Deferred Maintenance:** \$1,135  
**Ext. Gross Area:** 0

**Building Code:** R2900405400  
**Building Name:** Shed  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 1690 15TH ST NE  
**City Code:** SUNBURG

**Current Replacement Value:** \$25,457  
**Deferred Maintenance:** \$509  
**Ext. Gross Area:** 0

**Site: R290047 - Moose Lake State Park**

**Building Code:** R2900203690  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.55 - **Crisis**

**Cost Model Name:** Single-family Residence  
**Address:** 4252 CTY RD 137  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$354,385  
**Deferred Maintenance:** \$194,509  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900204320	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,428
<b>Building Name:</b>	Spring House	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$5,291
<b>Facility Condition Index:</b>	0.63 - <b>Crisis</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204360	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$58,091
<b>Building Name:</b>	Moose Lake SP Shop	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$11,080
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205830	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,747
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,899
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205840	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,747
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,990
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205850	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,512
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,423
<b>Facility Condition Index:</b>	0.14 - <b>Good</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205860	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,512
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,423
<b>Facility Condition Index:</b>	0.14 - <b>Good</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205890	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,512
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$2,065
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$7,578
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,763
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205940	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,471
<b>Building Name:</b>	Spring House	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$5,615
<b>Facility Condition Index:</b>	0.49 - <b>Poor</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207400	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$207,253
<b>Building Name:</b>	Sanitation	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$37,647
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207470	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$340,505
<b>Building Name:</b>	HeatColdStorage	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$49,251
<b>Facility Condition Index:</b>	0.14 - <b>Good</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900208030	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$2,431
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,824
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208490	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,294
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$2,760
<b>Facility Condition Index:</b>	0.38 - <b>Poor</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208600	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$956,324
<b>Building Name:</b>	Moose Lake SP Interpretive Ctr	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$76,687
<b>Facility Condition Index:</b>	0.08 - <b>Good</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208650	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,116
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	4252 CTY RD 137	<b>Deferred Maintenance:</b>	\$1,004
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0

**Site: R290048 - Myre-Big Island State Park**

<b>Building Code:</b>	R2900500590	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$329,241
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$34,501
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500600	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$489,166
<b>Building Name:</b>	Interp Unoccupied	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$171,614
<b>Facility Condition Index:</b>	0.35 - <b>Poor</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500610	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$33,953
<b>Building Name:</b>	Pump House	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$2,430
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500640	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$175,272
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$64,002
<b>Facility Condition Index:</b>	0.37 - <b>Poor</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500650	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$238,491
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$79,748
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500660	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$232,668
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$84,300
<b>Facility Condition Index:</b>	0.36 - <b>Poor</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$199,374
<b>Building Name:</b>	HeatColdStorage	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$46,127
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900500710	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$377,127
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$36,148
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501960	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$493,932
<b>Building Name:</b>	Myre-Big Island SP Contact Sta	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$39,253
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502120	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$468,004
<b>Building Name:</b>	DISPOSED - RepShopColdStor	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$69,947
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502480	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,591
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$4,858
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502490	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,898
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$5,520
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502500	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,468
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$8,601
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502520	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$5,603
<b>Building Name:</b>	Shed	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$2,984
<b>Facility Condition Index:</b>	0.53 - Crisis	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503780	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,143
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$2,684
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,591
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$6,020
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,591
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$8,163
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504460	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$19,591
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19499 780TH AVE	<b>Deferred Maintenance:</b>	\$4,221
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ALBERT LEA	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900504470  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$19,591  
**Deferred Maintenance:** \$4,858  
**Ext. Gross Area:** 0

**Building Code:** R2900504490  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$19,591  
**Deferred Maintenance:** \$3,733  
**Ext. Gross Area:** 0

**Building Code:** R2900504510  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$19,591  
**Deferred Maintenance:** \$1,874  
**Ext. Gross Area:** 0

**Building Code:** R2900504520  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$18,445  
**Deferred Maintenance:** \$5,641  
**Ext. Gross Area:** 0

**Building Code:** R2900504530  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.43 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$18,445  
**Deferred Maintenance:** \$8,014  
**Ext. Gross Area:** 0

**Building Code:** R2900504540  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.39 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$18,614  
**Deferred Maintenance:** \$7,304  
**Ext. Gross Area:** 0

**Building Code:** R2900504550  
**Building Name:** Cabin  
**Facility Condition Index:** 0.09 - Good

**Cost Model Name:** Single-family Residence  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$86,339  
**Deferred Maintenance:** \$7,779  
**Ext. Gross Area:** 0

**Building Code:** R2900504720  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Utility Shed  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$33,921  
**Deferred Maintenance:** \$2,651  
**Ext. Gross Area:** 0

**Building Code:** R2900505090  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$456,272  
**Deferred Maintenance:** \$27,577  
**Ext. Gross Area:** 0

**Building Code:** R2900505240  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 19499 780TH AVE  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$14,822  
**Deferred Maintenance:** \$1,066  
**Ext. Gross Area:** 0

**Site: R290049 - Nerstrand Big Woods State Park**

**Building Code:** R2900500520  
**Building Name:** Garage  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 9700 170TH ST E  
**City Code:** NERSTRAND

**Current Replacement Value:** \$38,111  
**Deferred Maintenance:** \$4,594  
**Ext. Gross Area:** 0



<b>Building Code:</b>	R2900500540	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$218,534
<b>Building Name:</b>	Nerstrand Big Woods SP Shop	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$29,387
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500570	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,924
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$9,148
<b>Facility Condition Index:</b>	0.57 - Crisis	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900500580	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$332,316
<b>Building Name:</b>	Sanitation	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$119,264
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502280	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$13,699
<b>Building Name:</b>	Shed	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$3,761
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503860	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$14,023
<b>Building Name:</b>	Shed	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$3,638
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504140	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$651,957
<b>Building Name:</b>	Nerstrand Big Woods SP Cnt St	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$62,860
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505110	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$365,300
<b>Building Name:</b>	Sanitation	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$8,035
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505120	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,218
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$1,023
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505560	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$2,332
<b>Building Name:</b>	Fire Wood Shed	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$47
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,077
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$1,223
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505810	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,077
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	9700 170TH ST E	<b>Deferred Maintenance:</b>	\$821
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	NERSTRAND	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900505820  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 9700 170TH ST E  
**City Code:** NERSTRAND

**Current Replacement Value:** \$13,077  
**Deferred Maintenance:** \$1,308  
**Ext. Gross Area:** 0

**Site: R290050 - Old Mill State Park**

**Building Code:** R2900102760  
**Building Name:** Managers Residence Garage  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$87,570  
**Deferred Maintenance:** \$16,336  
**Ext. Gross Area:** 0

**Building Code:** R2900102770  
**Building Name:** Residence  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 33569 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$244,418  
**Deferred Maintenance:** \$28,390  
**Ext. Gross Area:** 0

**Building Code:** R2900102780  
**Building Name:** Pump House  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$53,560  
**Deferred Maintenance:** \$5,651  
**Ext. Gross Area:** 0

**Building Code:** R2900102790  
**Building Name:** Historic Cabin  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$134,839  
**Deferred Maintenance:** \$41,878  
**Ext. Gross Area:** 0

**Building Code:** R2900102800  
**Building Name:** Historic Flour Mill  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$69,883  
**Deferred Maintenance:** \$18,399  
**Ext. Gross Area:** 0

**Building Code:** R2900102810  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$279,578  
**Deferred Maintenance:** \$103,575  
**Ext. Gross Area:** 0

**Building Code:** R2900102820  
**Building Name:** Picnic Area Sanitation  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$193,220  
**Deferred Maintenance:** \$35,450  
**Ext. Gross Area:** 0

**Building Code:** R2900102830  
**Building Name:** Bath House  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$614,322  
**Deferred Maintenance:** \$69,446  
**Ext. Gross Area:** 0

**Building Code:** R2900102840  
**Building Name:** Water Tower  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Bunker  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$301,977  
**Deferred Maintenance:** \$32,734  
**Ext. Gross Area:** 0

**Building Code:** R2900102850  
**Building Name:** Old Mill SP Shop  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 33489 240TH AVE NW  
**City Code:** ARGYLE

**Current Replacement Value:** \$159,354  
**Deferred Maintenance:** \$23,046  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900104300	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$496,237
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	33489 240TH AVE NW	<b>Deferred Maintenance:</b>	\$83,441
<b>Facility Condition Index:</b>	0.17 - <i>Average</i>	<b>City Code:</b>	ARGYLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105380	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,881
<b>Building Name:</b>	Scout Camp Vault	<b>Address:</b>	33489 240TH AVE NW	<b>Deferred Maintenance:</b>	\$3,205
<b>Facility Condition Index:</b>	0.32 - <i>Poor</i>	<b>City Code:</b>	ARGYLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106450	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$154,924
<b>Building Name:</b>	Old Mill SP Contact Station	<b>Address:</b>	33489 240TH AVE NW	<b>Deferred Maintenance:</b>	\$17,503
<b>Facility Condition Index:</b>	0.11 - <i>Good</i>	<b>City Code:</b>	ARGYLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,826
<b>Building Name:</b>	Campground Vault	<b>Address:</b>	33489 240TH AVE NW	<b>Deferred Maintenance:</b>	\$2,170
<b>Facility Condition Index:</b>	0.16 - <i>Average</i>	<b>City Code:</b>	ARGYLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108010	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,888
<b>Building Name:</b>	Picnic Area Vault	<b>Address:</b>	33489 240TH AVE NW	<b>Deferred Maintenance:</b>	\$1,589
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	ARGYLE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108240	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,604
<b>Building Name:</b>	Wood Shed	<b>Address:</b>	33489 240TH AVE NW	<b>Deferred Maintenance:</b>	\$760
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	ARGYLE	<b>Ext. Gross Area:</b>	0

**Site: R290051 - Red River SRA**

<b>Building Code:</b>	R2900107760	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$119,433
<b>Building Name:</b>	Red River SRA Contact Station	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$13,299
<b>Facility Condition Index:</b>	0.11 - <i>Good</i>	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108100	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$171,413
<b>Building Name:</b>	South Sanitation	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$17,141
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108110	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$171,413
<b>Building Name:</b>	North Sanitation	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$17,141
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108120	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,998
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$2,399
<b>Facility Condition Index:</b>	0.16 - <i>Average</i>	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108130	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,998
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$1,500
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900108320	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$171,413
<b>Building Name:</b>	Bath House	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$17,141
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108330	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$77,311
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$7,731
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108340	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$170,539
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$42,594
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108350	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$162,724
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$47,804
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108360	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$246,834
<b>Building Name:</b>	Sanitation	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$24,683
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108370	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,104
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	515 2ND ST NW	<b>Deferred Maintenance:</b>	\$2,056
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	EAST GRAND FORKS	<b>Ext. Gross Area:</b>	0

**Site: R290052 - Rice Lake State Park**

<b>Building Code:</b>	R2900500780	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$36,525
<b>Building Name:</b>	Pump House	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$4,484
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	114
<b>Building Code:</b>	R2900500790	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$225,243
<b>Building Name:</b>	Sanitation	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$55,493
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	689
<b>Building Code:</b>	R2900500800	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$143,001
<b>Building Name:</b>	Sanitation	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$68,936
<b>Facility Condition Index:</b>	0.48 - Poor	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	307
<b>Building Code:</b>	R2900500810	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$24,143
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$13,293
<b>Facility Condition Index:</b>	0.55 - Crisis	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	182
<b>Building Code:</b>	R2900500820	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$640,649
<b>Building Name:</b>	Rice Lake SP Contact Station	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$161,062
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	2,329

<b>Building Code:</b>	R2900502030	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$84,058
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$6,894
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	845
<b>Building Code:</b>	R2900503140	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,650
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$5,732
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900503150	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,513
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$4,352
<b>Facility Condition Index:</b>	0.41 - Poor	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900504390	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$351,386
<b>Building Name:</b>	Rice Lake SP Shop	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$31,705
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	3,024
<b>Building Code:</b>	R2900504400	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,513
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$1,667
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	39
<b>Building Code:</b>	R2900504410	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,513
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$3,227
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	39
<b>Building Code:</b>	R2900504420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,513
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$2,001
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	39
<b>Building Code:</b>	R2900504430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,650
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$4,617
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900505270	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$1,677
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$113
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	51
<b>Building Code:</b>	R2900505400	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,253
<b>Building Name:</b>	Shed	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$687
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	103
<b>Building Code:</b>	R2900505540	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$243,126
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	8485 ROSE ST	<b>Deferred Maintenance:</b>	\$7,026
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	OWATONNA	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900505590  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 8465 ROSE ST  
**City Code:** OWATONNA

**Current Replacement Value:** \$61,557  
**Deferred Maintenance:** \$1,231  
**Ext. Gross Area:** 0

**Site: R290053 - Sakatah Lake State Park**

**Building Code:** R2900500950  
**Building Name:** Sakatah Lake SP Contact Sta  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$306,921  
**Deferred Maintenance:** \$35,300  
**Ext. Gross Area:** 0

**Building Code:** R2900500970  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$133,365  
**Deferred Maintenance:** \$41,606  
**Ext. Gross Area:** 0

**Building Code:** R2900501000  
**Building Name:** Sakatah Lake SP Wood Shop  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$138,127  
**Deferred Maintenance:** \$22,116  
**Ext. Gross Area:** 0

**Building Code:** R2900501010  
**Building Name:** Sakatah Lake SP Office  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 50507 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$223,350  
**Deferred Maintenance:** \$5,965  
**Ext. Gross Area:** 0

**Building Code:** R2900501020  
**Building Name:** Fish Cleaning House  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$34,613  
**Deferred Maintenance:** \$1,459  
**Ext. Gross Area:** 0

**Building Code:** R2900502400  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$19,243  
**Deferred Maintenance:** \$3,601  
**Ext. Gross Area:** 0

**Building Code:** R2900504020  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$19,243  
**Deferred Maintenance:** \$3,601  
**Ext. Gross Area:** 0

**Building Code:** R2900504030  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$19,243  
**Deferred Maintenance:** \$4,764  
**Ext. Gross Area:** 0

**Building Code:** R2900504160  
**Building Name:** Sakatah Lake SP Shop  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$335,714  
**Deferred Maintenance:** \$37,172  
**Ext. Gross Area:** 0

**Building Code:** R2900504270  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$365,725  
**Deferred Maintenance:** \$30,324  
**Ext. Gross Area:** 0

**Building Code:** R2900504280  
**Building Name:** Cabin  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$43,813  
**Deferred Maintenance:** \$2,799  
**Ext. Gross Area:** 0

**Building Code:** R2900504290  
**Building Name:** Shed  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$51,612  
**Deferred Maintenance:** \$5,161  
**Ext. Gross Area:** 0

**Building Code:** R2900504300  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$19,243  
**Deferred Maintenance:** \$4,133  
**Ext. Gross Area:** 0

**Building Code:** R2900504310  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - [Average](#)

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$19,243  
**Deferred Maintenance:** \$4,764  
**Ext. Gross Area:** 0

**Building Code:** R2900504320  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$19,243  
**Deferred Maintenance:** \$4,133  
**Ext. Gross Area:** 0

**Building Code:** R2900504330  
**Building Name:** Shed  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$29,021  
**Deferred Maintenance:** \$3,402  
**Ext. Gross Area:** 0

**Building Code:** R2900504690  
**Building Name:** Pump House  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$10,927  
**Deferred Maintenance:** \$1,126  
**Ext. Gross Area:** 0

**Building Code:** R2900504800  
**Building Name:** Cabin  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$9,622  
**Deferred Maintenance:** \$962  
**Ext. Gross Area:** 0

**Building Code:** R2900505130  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$12,235  
**Deferred Maintenance:** \$876  
**Ext. Gross Area:** 0

**Building Code:** R2900505140  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 50499 SAKATAH LAKE SP RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$14,685  
**Deferred Maintenance:** \$1,056  
**Ext. Gross Area:** 0

**Site: [R290054 - Savanna Portage State Park](#)**

**Building Code:** R2900305320  
**Building Name:** Savanna Portage SP Office  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$267,508  
**Deferred Maintenance:** \$56,348  
**Ext. Gross Area:** 0



<b>Building Code:</b>	R2900305330	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$688,412
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$293,208
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305340	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$429,246
<b>Building Name:</b>	Residence	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$94,395
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305350	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$630,469
<b>Building Name:</b>	Savanna Portage SP Shop	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$199,295
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305360	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,482
<b>Building Name:</b>	Pump House	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$3,129
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305370	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$256,895
<b>Building Name:</b>	Sanitation	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$37,236
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305390	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$167,800
<b>Building Name:</b>	Sanitation	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$55,374
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305400	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$84,210
<b>Building Name:</b>	Shed	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$24,422
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305410	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$30,008
<b>Building Name:</b>	Shed	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$8,420
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$5,374
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$1,674
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$5,374
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$1,730
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900305440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,869
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	55626 LAKE PLACE	<b>Deferred Maintenance:</b>	\$2,932
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	MCGREGOR	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900305450  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Building Code:** R2900305460  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.32 - *Poor*

**Building Code:** R2900305470  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.32 - *Poor*

**Building Code:** R2900305770  
**Building Name:** Lodging House  
**Facility Condition Index:** 0.28 - *Average*

**Building Code:** R2900305780  
**Building Name:** Shed  
**Facility Condition Index:** 0.23 - *Average*

**Building Code:** R2900305790  
**Building Name:** Garage  
**Facility Condition Index:** 0.24 - *Average*

**Building Code:** R2900305830  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.15 - *Average*

**Building Code:** R2900305840  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.13 - *Good*

**Building Code:** R2900305850  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - *Poor*

**Building Code:** R2900305860  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - *Good*

**Building Code:** R2900305870  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Single-family Residence  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Utility Shed  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Single-story Work Facility  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Utility Shed  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$11,869  
**Deferred Maintenance:** \$2,932  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$1,730  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$1,730  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$126,947  
**Deferred Maintenance:** \$34,968  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$20,585  
**Deferred Maintenance:** \$4,797  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$87,710  
**Deferred Maintenance:** \$20,757  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,869  
**Deferred Maintenance:** \$1,815  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$688  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$2,850  
**Deferred Maintenance:** \$940  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$537  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$537  
**Ext. Gross Area:** 0

**Building Code:** R2900305880  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$11,869  
**Deferred Maintenance:** \$861  
**Ext. Gross Area:** 0

**Building Code:** R2900305890  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$537  
**Ext. Gross Area:** 0

**Building Code:** R2900305900  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$537  
**Ext. Gross Area:** 0

**Building Code:** R2900305910  
**Building Name:** Pit Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$5,374  
**Deferred Maintenance:** \$537  
**Ext. Gross Area:** 0

**Building Code:** R2900306100  
**Building Name:** Cabin  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$44,729  
**Deferred Maintenance:** \$7,644  
**Ext. Gross Area:** 0

**Building Code:** R2900306960  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$245,588  
**Deferred Maintenance:** \$5,976  
**Ext. Gross Area:** 0

**Building Code:** R2900306970  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$16,289  
**Deferred Maintenance:** \$1,163  
**Ext. Gross Area:** 0

**Building Code:** R2900307260  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$13,946  
**Deferred Maintenance:** \$992  
**Ext. Gross Area:** 0

**Building Code:** R2900308430  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Open Air Shelter  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$10,865  
**Deferred Maintenance:** \$3,586  
**Ext. Gross Area:** 0

**Building Code:** R2900308440  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 55626 LAKE PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$3,138  
**Deferred Maintenance:** \$1,035  
**Ext. Gross Area:** 0

**Site: R290055 - Scenic State Park**

**Building Code:** R2900201060  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$271,680  
**Deferred Maintenance:** \$90,127  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900201070	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$48,237
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$9,464
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201080	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$359,609
<b>Building Name:</b>	Scenic SP Contact Station	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$21,294
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201090	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$57,598
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$19,890
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201100	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$164,851
<b>Building Name:</b>	Cabin	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$21,422
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201110	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$255,900
<b>Building Name:</b>	Sanitation	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$25,749
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201120	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$185,537
<b>Building Name:</b>	Water Tower	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$27,023
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201130	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$552,993
<b>Building Name:</b>	Chase Point Lodge	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$87,361
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201140	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$345,121
<b>Building Name:</b>	Sanitation	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$13,705
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201150	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$72,199
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$10,019
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201160	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$62,002
<b>Building Name:</b>	Shed	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$9,145
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201190	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$224,817
<b>Building Name:</b>	Garage	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$41,139
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900201200	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$296,183
<b>Building Name:</b>	Cold Shop	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$75,729
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201210	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$369,308
<b>Building Name:</b>	Scenic SP Shop	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$54,082
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$98,437
<b>Building Name:</b>	Garage	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$16,065
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900201230	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$559,077
<b>Building Name:</b>	Log Office	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$33,680
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900203650	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$42,229
<b>Building Name:</b>	Spring House	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$9,388
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204240	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,266
<b>Building Name:</b>	OilHouse	<b>Address:</b>	56956 Scenic Hwy 7	<b>Deferred Maintenance:</b>	\$7,864
<b>Facility Condition Index:</b>	0.55 - Crisis	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205730	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$6,118
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$947
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$6,118
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$947
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$6,118
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$1,861
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$6,118
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$1,861
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,177
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	56956 SCENIC HWY 7	<b>Deferred Maintenance:</b>	\$2,267
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	BIGFORK	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900205800  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$9,177  
**Deferred Maintenance:** \$2,267  
**Ext. Gross Area:** 0

**Building Code:** R2900205810  
**Building Name:** Shed  
**Facility Condition Index:** 0.23 - Average

**Cost Model Name:** Utility Shed  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$7,689  
**Deferred Maintenance:** \$1,734  
**Ext. Gross Area:** 0

**Building Code:** R2900205820  
**Building Name:** Shed  
**Facility Condition Index:** 0.05 - Excellent

**Cost Model Name:** Utility Shed  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$2,802  
**Deferred Maintenance:** \$132  
**Ext. Gross Area:** 0

**Building Code:** R2900207350  
**Building Name:** FireTower  
**Facility Condition Index:** 0.20 - Average

**Cost Model Name:** Tower  
**Address:** 56956 Scenic Hwy 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$36,544  
**Deferred Maintenance:** \$7,247  
**Ext. Gross Area:** 0

**Building Code:** R2900207840  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$10,878  
**Deferred Maintenance:** \$1,111  
**Ext. Gross Area:** 0

**Building Code:** R2900207850  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$10,878  
**Deferred Maintenance:** \$777  
**Ext. Gross Area:** 0

**Building Code:** R2900207860  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$10,878  
**Deferred Maintenance:** \$924  
**Ext. Gross Area:** 0

**Building Code:** R2900207870  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$10,878  
**Deferred Maintenance:** \$924  
**Ext. Gross Area:** 0

**Building Code:** R2900208550  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$15,094  
**Deferred Maintenance:** \$1,282  
**Ext. Gross Area:** 0

**Building Code:** R2900208730  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$15,094  
**Deferred Maintenance:** \$1,081  
**Ext. Gross Area:** 0

**Building Code:** R2900210220  
**Building Name:** Adirondack 1  
**Facility Condition Index:** 0.47 - Poor

**Cost Model Name:** Open Air Shelter  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$12,501  
**Deferred Maintenance:** \$5,881  
**Ext. Gross Area:** 0

**Building Code:** R2900210230  
**Building Name:** Adirondack 2  
**Facility Condition Index:** 0.31 - **Poor**

**Building Code:** R2900210240  
**Building Name:** Adirondack 3  
**Facility Condition Index:** 0.48 - **Poor**

**Building Code:** R2900210250  
**Building Name:** Adirondack 4  
**Facility Condition Index:** 0.65 - **Crisis**

**Building Code:** R2900210260  
**Building Name:** Adirondack 5  
**Facility Condition Index:** 0.59 - **Crisis**

**Building Code:** R2900210280  
**Building Name:** Adirondack 6  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Cost Model Name:** Open Air Shelter  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Cost Model Name:** Open Air Shelter  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Cost Model Name:** Open Air Shelter  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Cost Model Name:** Open Air Shelter  
**Address:** 56956 SCENIC HWY 7  
**City Code:** BIGFORK

**Current Replacement Value:** \$7,170  
**Deferred Maintenance:** \$2,227  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$12,501  
**Deferred Maintenance:** \$5,955  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,124  
**Deferred Maintenance:** \$7,278  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,675  
**Deferred Maintenance:** \$6,896  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,729  
**Deferred Maintenance:** \$1,105  
**Ext. Gross Area:** 0

**Site: R290056 - Schoolcraft State Park**

**Building Code:** R2900207010  
**Building Name:** Schoolcraft SP Shop  
**Facility Condition Index:** 0.41 - **Poor**

**Building Code:** R2900207030  
**Building Name:** Oil House  
**Facility Condition Index:** 0.19 - **Average**

**Building Code:** R2900208000  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Building Code:** R2900208010  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Building Code:** R2900208020  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9042 SCHOOLCRAFT LN NE  
**City Code:** DEER RIVER

**Cost Model Name:** Utility Shed  
**Address:** 9042 SCHOOLCRAFT LN NE  
**City Code:** DEER RIVER

**Cost Model Name:** Vault Toilet  
**Address:** 9042 SCHOOLCRAFT LN NE  
**City Code:** DEER RIVER

**Cost Model Name:** Vault Toilet  
**Address:** 9042 SCHOOLCRAFT LN NE  
**City Code:** DEER RIVER

**Cost Model Name:** Vault Toilet  
**Address:** 9042 SCHOOLCRAFT LN NE  
**City Code:** DEER RIVER

**Current Replacement Value:** \$96,362  
**Deferred Maintenance:** \$39,165  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,274  
**Deferred Maintenance:** \$2,181  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$15,706  
**Deferred Maintenance:** \$2,459  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$15,706  
**Deferred Maintenance:** \$2,966  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,382  
**Deferred Maintenance:** \$1,464  
**Ext. Gross Area:** 0

**Site: R290057 - Sibley State Park**



<b>Building Code:</b>	R2900400020	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$13,233
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$7,526
<b>Facility Condition Index:</b>	0.57 - <b>Crisis</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400030	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$15,648
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$9,338
<b>Facility Condition Index:</b>	0.60 - <b>Crisis</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400050	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$458,422
<b>Building Name:</b>	Sanitation	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$55,517
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400060	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$923,757
<b>Building Name:</b>	Sanitation	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$113,508
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400070	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$420,968
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$80,379
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400080	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$114,712
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$34,845
<b>Facility Condition Index:</b>	0.30 - <b>Poor</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400090	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$72,817
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$8,094
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400100	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$644,895
<b>Building Name:</b>	Bath House	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$124,362
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400110	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$239,526
<b>Building Name:</b>	Sanitation	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$42,843
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400120	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$231,935
<b>Building Name:</b>	Pump House	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$60,248
<b>Facility Condition Index:</b>	0.26 - <b>Average</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400130	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$697,244
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$168,451
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900400140	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$726,466
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$156,301
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400160	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$22,415
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400170	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin #7	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$21,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400180	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin #6	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$21,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400190	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin #5	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$21,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400200	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin #4	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$21,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400210	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin #3	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$21,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400220	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$152,757
<b>Building Name:</b>	Cabin #2	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$21,023
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400230	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$248,347
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$72,390
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400240	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$399,059
<b>Building Name:</b>	Lodging House	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$94,292
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400250	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$556,760
<b>Building Name:</b>	Residence	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$96,639
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900400260	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$660,985
<b>Building Name:</b>	Sibley SP Office	<b>Address:</b>	398 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$186,212
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	2,187
<b>Building Code:</b>	R2900400270	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$212,821
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$82,834
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400280	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$298,940
<b>Building Name:</b>	Sibley SP Shop	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$70,653
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900400290	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$267,127
<b>Building Name:</b>	Sibley SP Contact Station	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$58,818
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$72,377
<b>Building Name:</b>	Garage	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$24,185
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402710	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$1,023,672
<b>Building Name:</b>	Sibley SP Interpretive Ctr	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$36,627
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402900	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,237
<b>Building Name:</b>	Oil House	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$7,583
<b>Facility Condition Index:</b>	0.53 - Crisis	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900402960	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$386,477
<b>Building Name:</b>	Sanitation	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$39,122
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403000	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$460,018
<b>Building Name:</b>	Sanitation	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$131,692
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403060	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$29,188
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$9,002
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403400	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,746
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900403410	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,746
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403420	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$99,865
<b>Building Name:</b>	Sibley SP Observation Tower	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$25,378
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403650	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$4,768
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403660	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$6,123
<b>Facility Condition Index:</b>	0.50 - Crisis	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$4,034
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403680	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$4,034
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403690	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,879
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403700	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,879
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404230	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,754
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$2,075
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404240	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,754
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$2,075
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404250	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,222
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900404260	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,224
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,222
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404950	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,783
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$643
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405030	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$67,837
<b>Building Name:</b>	Wastewater Control System Bldg	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,357
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405100	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$74,765
<b>Building Name:</b>	Lady Slipper Cabin	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,495
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405110	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$74,765
<b>Building Name:</b>	Loon Cabin	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,495
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405120	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$74,765
<b>Building Name:</b>	Monarch Cabin	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,495
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405130	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$74,765
<b>Building Name:</b>	Walley Cabin	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,495
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405170	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,264
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$2,377
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405180	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$69,422
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	800 SIBLEY PARK RD NE	<b>Deferred Maintenance:</b>	\$1,388
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	NEW LONDON	<b>Ext. Gross Area:</b>	0

**Site: R290058 - Lake Vermilion-Soudan Underground Mine State Park**

<b>Building Code:</b>	R2900202310	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$2,744,938
<b>Building Name:</b>	Pump House	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$688,237
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202320	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,408,655
<b>Building Name:</b>	Lake Vermilion-Soudan SP IC	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$524,345
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900202330	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,426
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$3,195
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202340	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$48,504
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$15,191
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202350	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$9,267
<b>Building Name:</b>	Ore Crush Bldg	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$3,058
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202360	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$251,289
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$155,569
<b>Facility Condition Index:</b>	0.62 - Crisis	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202370	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$16,474
<b>Building Name:</b>	Ore Crush Bldg	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$5,436
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202380	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,769
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$4,570
<b>Facility Condition Index:</b>	0.59 - Crisis	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202390	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$53,761
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$45,350
<b>Facility Condition Index:</b>	0.84 - Crisis	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202400	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,745
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$5,737
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202410	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$25,890
<b>Building Name:</b>	Lake Vermilion-Soudan SP CS	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$6,443
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202420	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$462,942
<b>Building Name:</b>	Residence	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$52,266
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202430	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$335,697
<b>Building Name:</b>	Pay Office	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$67,887
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900202440	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,529,645
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$830,022
<b>Facility Condition Index:</b>	0.54 - <b>Crisis</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202450	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$87,114
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$70,249
<b>Facility Condition Index:</b>	0.81 - <b>Crisis</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202460	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$175,103
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$60,625
<b>Facility Condition Index:</b>	0.35 - <b>Poor</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202470	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$202,745
<b>Building Name:</b>	Garage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$119,918
<b>Facility Condition Index:</b>	0.59 - <b>Crisis</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202480	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,501
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$12,702
<b>Facility Condition Index:</b>	0.82 - <b>Crisis</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900202500	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$129,067
<b>Building Name:</b>	Pump House	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$61,391
<b>Facility Condition Index:</b>	0.48 - <b>Poor</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204000	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$47,768
<b>Building Name:</b>	Garage	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$9,112
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207380	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$693,160
<b>Building Name:</b>	Lake Vermilion-Soudan SP Shop	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$105,918
<b>Facility Condition Index:</b>	0.15 - <b>Average</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209260	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$781,039
<b>Building Name:</b>	Mine Water Filtration	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$17,496
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209520	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$51,352
<b>Building Name:</b>	Upper Vault Toilet	<b>Address:</b>	----- VERMILION PARK RD	<b>Deferred Maintenance:</b>	\$1,027
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900209530	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$82,581
<b>Building Name:</b>	Upper Picnic Shelter	<b>Address:</b>	----- VERMILION PARK RD	<b>Deferred Maintenance:</b>	\$1,652
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0



**Building Code:** R2900209540  
**Building Name:** Lower Picnic Shelter - South  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900209550  
**Building Name:** Lower Picnic Shelter - North  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900209560  
**Building Name:** Lower Vault Toilet  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900209840  
**Building Name:** Bunkhouse  
**Facility Condition Index:** 0.36 - **Poor**

**Building Code:** R2900210270  
**Building Name:** Cabin  
**Facility Condition Index:** 0.09 - **Good**

**Building Code:** R2900210520  
**Building Name:** Storage Shed  
**Facility Condition Index:** 0.10 - **Good**

**Building Code:** R2900210530  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** ----- VERMILION PARK RD  
**City Code:** SOUDAN

**Cost Model Name:** Open Air Shelter  
**Address:** ----- VERMILION PARK RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** ----- VERMILION PARK RD  
**City Code:** SOUDAN

**Cost Model Name:** Single-story Work Facility  
**Address:** Blue Heron Island  
**City Code:** SOUDAN

**Cost Model Name:** Single-family Residence  
**Address:** Blue Heron Island  
**City Code:** SOUDAN

**Cost Model Name:** Single-story Work Facility  
**Address:** Blue Heron Island  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** Blue Heron Island  
**City Code:** SOUDAN

**Current Replacement Value:** \$82,581  
**Deferred Maintenance:** \$1,652  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$82,581  
**Deferred Maintenance:** \$1,652  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$51,352  
**Deferred Maintenance:** \$1,027  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$19,373  
**Deferred Maintenance:** \$6,926  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$308,351  
**Deferred Maintenance:** \$27,958  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$29,207  
**Deferred Maintenance:** \$2,921  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$5,722  
**Deferred Maintenance:** \$1,081  
**Ext. Gross Area:** 0

**Site: R290059 - Split Rock Creek State Park**

**Building Code:** R2900401030  
**Building Name:** Bath House  
**Facility Condition Index:** 0.33 - **Poor**

**Building Code:** R2900401050  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.54 - **Crisis**

**Building Code:** R2900401060  
**Building Name:** Split Rock Creek SP Interp Ctr  
**Facility Condition Index:** 0.20 - **Average**

**Building Code:** R2900401070  
**Building Name:** Split Rock Creek SP Office  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 336 50TH AVE  
**City Code:** JASPER

**Cost Model Name:** Open Air Shelter  
**Address:** 336 50TH AVE  
**City Code:** JASPER

**Cost Model Name:** Bunker  
**Address:** 336 50TH AVE  
**City Code:** JASPER

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 336 50TH AVE  
**City Code:** JASPER

**Current Replacement Value:** \$400,895  
**Deferred Maintenance:** \$132,295  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$157,329  
**Deferred Maintenance:** \$84,937  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$331,021  
**Deferred Maintenance:** \$66,664  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$157,535  
**Deferred Maintenance:** \$51,322  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900401080	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$151,285
<b>Building Name:</b>	Sanitation	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$36,075
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403250	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,351
<b>Building Name:</b>	Oil House	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$2,426
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403770	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$52,047
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$13,389
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403900	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,952
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$3,709
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403910	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,952
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$3,709
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900403920	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,952
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$3,709
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404660	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$26,775
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$8,836
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404710	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$207,670
<b>Building Name:</b>	Split Rock Creek SP Contact St	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$22,096
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900405270	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$4,630
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	336 50TH AVE	<b>Deferred Maintenance:</b>	\$1,528
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	JASPER	<b>Ext. Gross Area:</b>	0

**Site: R290060 - Split Rock Lighthouse State Park**

<b>Building Code:</b>	R2900204350	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$116,623
<b>Building Name:</b>	Split Rock Lighthouse SP Shop	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$11,662
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204370	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,070
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$5,667
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900204450	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$644,457
<b>Building Name:</b>	Trails Center	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$62,897
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204460	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$287,852
<b>Building Name:</b>	Sanitation	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$39,641
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204470	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$49,608
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$992
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205410	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,623
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$3,506
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205420	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,623
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$3,506
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,623
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$3,506
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,623
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$3,506
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206620	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$297,119
<b>Building Name:</b>	Split Rock Lighthouse SP CS	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$28,268
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206630	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,228
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	3755 Split Rock Lighthouse Rd	<b>Deferred Maintenance:</b>	\$2,727
<b>Facility Condition Index:</b>	0.38 - Poor	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207710	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$322,084
<b>Building Name:</b>	Shop	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$34,013
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,338
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3755 SPLIT ROCK LIGHTHOUSE RD	<b>Deferred Maintenance:</b>	\$1,163
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	TWO HARBORS	<b>Ext. Gross Area:</b>	0

Site: R290061 - St Croix State Park

<b>Building Code:</b>	R2900301500	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$725,598
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$224,265
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301510	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$92,157
<b>Building Name:</b>	Garage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$36,397
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301520	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$187,511
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$69,686
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301530	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$96,992
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$30,857
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301540	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$96,992
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$30,857
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301550	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$96,992
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$30,857
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301560	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$93,903
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$27,794
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301570	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$93,903
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$29,838
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301580	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$93,903
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$27,794
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301590	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$32,607
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$15,413
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301600	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$93,903
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$27,794
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900301610	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$93,903
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$29,838
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301620	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$78,252
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$22,569
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301630	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$117,379
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$34,742
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301640	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$127,749
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$40,135
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301650	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$72,962
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$15,229
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301660	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$70,825
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$20,578
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301670	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$110,295
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$26,589
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301680	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$87,710
<b>Building Name:</b>	St Croix SP Head of Rapids Off	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$27,802
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301690	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$99,646
<b>Building Name:</b>	Infirmary	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$29,897
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301700	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$48,759
<b>Building Name:</b>	Cooks Shack	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$15,353
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301710	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$199,054
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$23,340
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900301730	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$608,057
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$185,454
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301750	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$104,451
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$31,509
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301760	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$76,098
<b>Building Name:</b>	CooksShack	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$22,153
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301770	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$169,096
<b>Building Name:</b>	Infirmary	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$49,984
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301780	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$140,523
<b>Building Name:</b>	St Croix SP St John Landing Of	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$44,081
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301790	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$288,087
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$34,220
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301800	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$69,238
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$17,425
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301810	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$42,179
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$11,943
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301820	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,984
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301830	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$7,216
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301840	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,394
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900301850	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,068
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301860	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,505
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301870	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,505
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301880	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,984
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301890	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,192
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301900	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,025
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301910	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,205
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301920	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$3,729
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301930	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,947
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301940	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,025
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900301950	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,947
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0



**Building Code:** R2900301960  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.23 - Average

**Building Code:** R2900301970  
**Building Name:** Recreation Hall  
**Facility Condition Index:** 0.16 - Average

**Building Code:** R2900301980  
**Building Name:** Recreation Hall  
**Facility Condition Index:** 0.09 - Good

**Building Code:** R2900301990  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.50 - Crisis

**Building Code:** R2900302000  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.25 - Average

**Building Code:** R2900302010  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.22 - Average

**Building Code:** R2900302020  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.79 - Crisis

**Building Code:** R2900302030  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.22 - Average

**Building Code:** R2900302040  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.29 - Average

**Building Code:** R2900302050  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.29 - Average

**Building Code:** R2900302060  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$44,635  
**Deferred Maintenance:** \$10,171  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$195,366  
**Deferred Maintenance:** \$31,688  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$195,366  
**Deferred Maintenance:** \$18,298  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$42,179  
**Deferred Maintenance:** \$21,284  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,746  
**Deferred Maintenance:** \$5,952  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,746  
**Deferred Maintenance:** \$5,310  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$17,250  
**Deferred Maintenance:** \$13,603  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,746  
**Deferred Maintenance:** \$5,254  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,746  
**Deferred Maintenance:** \$6,804  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,746  
**Deferred Maintenance:** \$6,804  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,746  
**Deferred Maintenance:** \$5,952  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900302070	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$80,020
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$25,854
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302080	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$195,366
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$21,235
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302090	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$44,635
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,860
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302100	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$6,118
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302110	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,441
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302120	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$23,746
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$5,914
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302130	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$30,891
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,295
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302140	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$30,891
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,863
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302150	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$30,891
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,145
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302160	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$30,891
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,046
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$589,042
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$120,817
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900302180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$168,237
<b>Building Name:</b>	Garage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$61,952
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302190	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$224,089
<b>Building Name:</b>	Infirmary	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$49,881
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302200	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$369,796
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$101,321
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302210	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$97,084
<b>Building Name:</b>	St Croix SP Norway Point Off	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$25,409
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302220	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$40,381
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$11,396
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302230	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$115,851
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$22,710
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302240	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302250	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302260	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302270	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302280	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900302290	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302300	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302310	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$52,352
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,123
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302320	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$115,818
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$30,304
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302330	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302340	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302350	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302360	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302370	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302380	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302390	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,383
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900302400  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.28 - Average

**Building Code:** R2900302410  
**Building Name:** Recreation Hall  
**Facility Condition Index:** 0.29 - Average

**Building Code:** R2900302420  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.26 - Average

**Building Code:** R2900302430  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.26 - Average

**Building Code:** R2900302440  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.26 - Average

**Building Code:** R2900302450  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.24 - Average

**Building Code:** R2900302460  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.24 - Average

**Building Code:** R2900302470  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.30 - Poor

**Building Code:** R2900302480  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.26 - Average

**Building Code:** R2900302490  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.26 - Average

**Building Code:** R2900302500  
**Building Name:** Recreation Hall  
**Facility Condition Index:** 0.26 - Average

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$55,894  
**Deferred Maintenance:** \$15,775  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$115,818  
**Deferred Maintenance:** \$34,009  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$36,088  
**Deferred Maintenance:** \$9,383  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$36,088  
**Deferred Maintenance:** \$9,383  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$36,088  
**Deferred Maintenance:** \$9,383  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$36,088  
**Deferred Maintenance:** \$8,830  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$36,088  
**Deferred Maintenance:** \$8,830  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$33,096  
**Deferred Maintenance:** \$9,935  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$36,088  
**Deferred Maintenance:** \$9,272  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$55,894  
**Deferred Maintenance:** \$14,801  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$131,698  
**Deferred Maintenance:** \$34,608  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900302510	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,830
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302520	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,830
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302530	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,830
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302540	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,830
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302550	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,830
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302560	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$36,088
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,830
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302570	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$35,684
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,663
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302580	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$69,947
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$14,226
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302590	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$314,621
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$23,052
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302600	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$71,117
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$20,019
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302610	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$68,880
<b>Building Name:</b>	Cooks Shack	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$16,002
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900302620	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$78,834
<b>Building Name:</b>	St Croix SP Contact Station	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$13,689
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302640	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,169,837
<b>Building Name:</b>	St Croix SP Interp Center	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$121,114
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302650	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$50,531
<b>Building Name:</b>	Shed	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$11,543
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302660	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$847,384
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$135,342
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302670	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$189,153
<b>Building Name:</b>	Riverview A&B Cabin	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$47,054
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302680	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$292,806
<b>Building Name:</b>	Riverview C,D&E Cabin	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$60,083
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302690	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$46,458
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$9,154
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302700	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$82,406
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$15,887
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302710	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$209,449
<b>Building Name:</b>	Sanitation	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$20,469
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302730	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$129,494
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$22,597
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302740	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$635,623
<b>Building Name:</b>	Residence	<b>Address:</b>	53927 YELLOW BANKS DR	<b>Deferred Maintenance:</b>	\$128,278
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900302750	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$89,372
<b>Building Name:</b>	Garage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$15,196
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302760	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$345,289
<b>Building Name:</b>	Residence	<b>Address:</b>	53848 YELLOW BANKS DRIVE	<b>Deferred Maintenance:</b>	\$70,055
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302770	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$345,289
<b>Building Name:</b>	Residence	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$87,387
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302780	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$131,780
<b>Building Name:</b>	Garage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$52,921
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302790	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$196,424
<b>Building Name:</b>	Dormitory	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$58,069
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302800	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$30,061
<b>Building Name:</b>	Garage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,969
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302810	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$923,585
<b>Building Name:</b>	St Croix SP Mechanic Shop	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$139,405
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302820	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,048,572
<b>Building Name:</b>	St Croix SP Carpenter Shop	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$165,644
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302830	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,250,717
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$178,674
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302840	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$141,496
<b>Building Name:</b>	Oil House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$20,503
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302880	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$476,908
<b>Building Name:</b>	St Croix SP HQ Office	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$50,849
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900302930	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$433,051
<b>Building Name:</b>	Trails Center	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$26,255
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302940	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$195,366
<b>Building Name:</b>	Recreation Hall	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$10,686
<b>Facility Condition Index:</b>	0.05 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302950	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,669
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$10,274
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302960	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$50,075
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$10,950
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302970	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$229,352
<b>Building Name:</b>	Shed	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$24,773
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900302990	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$87,144
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,989
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303010	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$21,334
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$5,488
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303020	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$17,779
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,436
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303030	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$51,451
<b>Building Name:</b>	Adirondack	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$7,163
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303040	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$51,451
<b>Building Name:</b>	Adirondack	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$7,163
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303230	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$279,138
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$35,032
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900303240	<b>Cost Model Name:</b>	Multi-story Dormitory	<b>Current Replacement Value:</b>	\$371,213
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$38,910
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303500	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,400
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$3,550
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303510	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$4,644
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$4,644
<b>Facility Condition Index:</b>	1.00 - Crisis	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303520	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$8,578
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$892
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303530	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$70,904
<b>Building Name:</b>	Pump House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$18,889
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303540	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$91,351
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$14,889
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303570	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$41,316
<b>Building Name:</b>	Lodging House	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$8,181
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304280	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$900,106
<b>Building Name:</b>	St Croix SP Shop	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$88,242
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304290	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$341,347
<b>Building Name:</b>	St Croix SP Concession	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$37,719
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304560	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,180
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$1,334
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304860	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,383
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	30065 ST CROIX PARK RD	<b>Deferred Maintenance:</b>	\$2,573
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	HINCKLEY	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900304880  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.49 - **Poor**

**Building Code:** R2900304910  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.31 - **Poor**

**Building Code:** R2900304980  
**Building Name:** Pump House  
**Facility Condition Index:** 0.19 - **Average**

**Building Code:** R2900304990  
**Building Name:** Shed  
**Facility Condition Index:** 0.05 - **Excellent**

**Building Code:** R2900305000  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Building Code:** R2900305010  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Building Code:** R2900305920  
**Building Name:** Shop  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900305930  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Building Code:** R2900305960  
**Building Name:** Shed  
**Facility Condition Index:** 0.08 - **Good**

**Building Code:** R2900306840  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.21 - **Average**

**Building Code:** R2900306850  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Tower  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Utility Shed  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Open Air Shelter  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Utility Shed  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Utility Shed  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$5,169  
**Deferred Maintenance:** \$2,536  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$16,620  
**Deferred Maintenance:** \$5,235  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$8,578  
**Deferred Maintenance:** \$1,639  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$22,495  
**Deferred Maintenance:** \$1,045  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$8,342  
**Deferred Maintenance:** \$1,601  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$8,342  
**Deferred Maintenance:** \$1,340  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,546  
**Deferred Maintenance:** \$191  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,383  
**Deferred Maintenance:** \$1,949  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$29,863  
**Deferred Maintenance:** \$2,263  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$13,724  
**Deferred Maintenance:** \$2,936  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$12,039  
**Deferred Maintenance:** \$1,892  
**Ext. Gross Area:** 0

**Building Code:** R2900306860  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.12 - [Good](#)

**Building Code:** R2900307310  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307320  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307330  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307340  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307350  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307360  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307730  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307740  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307750  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** R2900307760  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Cost Model Name:** Utility Shed  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$11,551  
**Deferred Maintenance:** \$1,434  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$13,724  
**Deferred Maintenance:** \$977  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$13,724  
**Deferred Maintenance:** \$977  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$15,088  
**Deferred Maintenance:** \$1,077  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$13,887  
**Deferred Maintenance:** \$991  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$13,892  
**Deferred Maintenance:** \$1,001  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$14,410  
**Deferred Maintenance:** \$1,036  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$14,571  
**Deferred Maintenance:** \$1,046  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,388  
**Deferred Maintenance:** \$810  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$14,308  
**Deferred Maintenance:** \$1,018  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$4,886  
**Deferred Maintenance:** \$568  
**Ext. Gross Area:** 0

**Building Code:** R2900307830  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$12,656  
**Deferred Maintenance:** \$907  
**Ext. Gross Area:** 0

**Building Code:** R2900307840  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$16,744  
**Deferred Maintenance:** \$2,196  
**Ext. Gross Area:** 0

**Building Code:** R2900307850  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$11,619  
**Deferred Maintenance:** \$835  
**Ext. Gross Area:** 0

**Building Code:** R2900308110  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.60 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$7,361  
**Deferred Maintenance:** \$4,387  
**Ext. Gross Area:** 0

**Building Code:** R2900308120  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Open Air Shelter  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$3,374  
**Deferred Maintenance:** \$1,209  
**Ext. Gross Area:** 0

**Building Code:** R2900308130  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.38 - **Poor**

**Cost Model Name:** Open Air Shelter  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$5,365  
**Deferred Maintenance:** \$2,046  
**Ext. Gross Area:** 0

**Building Code:** R2900308230  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 30065 ST CROIX PARK RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$611,559  
**Deferred Maintenance:** \$12,231  
**Ext. Gross Area:** 0

**Site: R290062 - Temperance River State Park**

**Building Code:** R2900200990  
**Building Name:** Oil House  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 7620 W HWY 61  
**City Code:** SCHROEDER

**Current Replacement Value:** \$12,157  
**Deferred Maintenance:** \$4,166  
**Ext. Gross Area:** 0

**Building Code:** R2900201010  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7620 W HWY 61  
**City Code:** SCHROEDER

**Current Replacement Value:** \$242,398  
**Deferred Maintenance:** \$54,192  
**Ext. Gross Area:** 0

**Building Code:** R2900201020  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 7620 W HWY 61  
**City Code:** SCHROEDER

**Current Replacement Value:** \$292,299  
**Deferred Maintenance:** \$59,391  
**Ext. Gross Area:** 0

**Building Code:** R2900201040  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7620 W HWY 61  
**City Code:** SCHROEDER

**Current Replacement Value:** \$48,010  
**Deferred Maintenance:** \$6,231  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900206780	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$331,797
<b>Building Name:</b>	Temperance River SP Shop	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$58,221
<b>Facility Condition Index:</b>	0.18 - <i>Average</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207520	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$331,061
<b>Building Name:</b>	Temperance River SP Contact St	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$8,090
<b>Facility Condition Index:</b>	0.02 - <i>Excellent</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208050	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,784
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,057
<b>Facility Condition Index:</b>	0.07 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208060	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,466
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208070	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,466
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208080	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,665
<b>Facility Condition Index:</b>	0.11 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208090	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,945
<b>Facility Condition Index:</b>	0.13 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208100	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,819
<b>Facility Condition Index:</b>	0.12 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208110	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,466
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208120	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,466
<b>Facility Condition Index:</b>	0.10 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208130	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,663
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	7620 W HWY 61	<b>Deferred Maintenance:</b>	\$1,759
<b>Facility Condition Index:</b>	0.12 - <i>Good</i>	<b>City Code:</b>	SCHROEDER	<b>Ext. Gross Area:</b>	0



**Building Code:** R2900208690  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 7620 W HWY 61  
**City Code:** SCHROEDER

**Current Replacement Value:** \$16,991  
**Deferred Maintenance:** \$1,395  
**Ext. Gross Area:** 0

**Site: R290063 - Tettegouche State Park**

**Building Code:** R2900201370  
**Building Name:** Shop  
**Facility Condition Index:** 0.55 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$61,095  
**Deferred Maintenance:** \$33,770  
**Ext. Gross Area:** 0

**Building Code:** R2900204010  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$361,596  
**Deferred Maintenance:** \$125,104  
**Ext. Gross Area:** 0

**Building Code:** R2900204020  
**Building Name:** Cabin  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$151,016  
**Deferred Maintenance:** \$49,764  
**Ext. Gross Area:** 0

**Building Code:** R2900204050  
**Building Name:** Barn  
**Facility Condition Index:** 1.00 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$90,757  
**Deferred Maintenance:** \$90,757  
**Ext. Gross Area:** 0

**Building Code:** R2900204070  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$24,120  
**Deferred Maintenance:** \$8,317  
**Ext. Gross Area:** 0

**Building Code:** R2900204080  
**Building Name:** Cabin  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$161,945  
**Deferred Maintenance:** \$53,363  
**Ext. Gross Area:** 0

**Building Code:** R2900204090  
**Building Name:** Cabin  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$117,234  
**Deferred Maintenance:** \$38,687  
**Ext. Gross Area:** 0

**Building Code:** R2900204100  
**Building Name:** Cabin  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$71,984  
**Deferred Maintenance:** \$12,681  
**Ext. Gross Area:** 0

**Building Code:** R2900204110  
**Building Name:** Filter Shop - BlackSmith  
**Facility Condition Index:** 1.00 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$36,798  
**Deferred Maintenance:** \$36,798  
**Ext. Gross Area:** 0

**Building Code:** R2900204120  
**Building Name:** Bath House  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$28,361  
**Deferred Maintenance:** \$9,016  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900204130	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$24,859
<b>Building Name:</b>	Boat House	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$9,726
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204480	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$375,430
<b>Building Name:</b>	Tettegouche SP Shop	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$79,312
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204500	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$477,750
<b>Building Name:</b>	Sanitation	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$52,479
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205500	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$4,420
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205540	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$3,063
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205560	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$4,420
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205920	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,428
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$2,251
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$1,784
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205970	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$2,187
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205980	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,709
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$4,486
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900205990	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$2,320
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900207390	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$245,016
<b>Building Name:</b>	Sanitation	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$25,605
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207450	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,361
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$2,548
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207660	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$348,538
<b>Building Name:</b>	Cabin	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$34,158
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207670	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,367
<b>Building Name:</b>	Shed	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$637
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208200	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$25,461
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$7,009
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208210	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$13,092
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$5,105
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208220	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,837
<b>Building Name:</b>	Shed	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$3,742
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,338
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$2,701
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208770	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$16,338
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$2,160
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208870	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,237
<b>Building Name:</b>	BlackSmith	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$1,026
<b>Facility Condition Index:</b>	0.05 - Excellent	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900208920	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$13,279
<b>Building Name:</b>	Shed	<b>Address:</b>	5702 HWY 61 E	<b>Deferred Maintenance:</b>	\$266
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	SILVER BAY	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900209060  
**Building Name:** Tettegouche SP Interpretive Cr  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$4,239,719  
**Deferred Maintenance:** \$84,794  
**Ext. Gross Area:** 0

**Site: R290064 - Upper Sioux Agency State Park**

**Building Code:** R2900401130  
**Building Name:** Garage  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$80,863  
**Deferred Maintenance:** \$29,431  
**Ext. Gross Area:** 0

**Building Code:** R2900401150  
**Building Name:** Upper Sioux Agency SP Intrp Ct  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$676,592  
**Deferred Maintenance:** \$220,217  
**Ext. Gross Area:** 0

**Building Code:** R2900401160  
**Building Name:** Upper Sioux Agency SP Cont St  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$37,543  
**Deferred Maintenance:** \$11,388  
**Ext. Gross Area:** 0

**Building Code:** R2900403510  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$117,989  
**Deferred Maintenance:** \$11,799  
**Ext. Gross Area:** 0

**Building Code:** R2900403520  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$8,033  
**Deferred Maintenance:** \$2,857  
**Ext. Gross Area:** 0

**Building Code:** R2900403530  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$8,033  
**Deferred Maintenance:** \$2,001  
**Ext. Gross Area:** 0

**Building Code:** R2900403890  
**Building Name:** Shed  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$4,713  
**Deferred Maintenance:** \$1,555  
**Ext. Gross Area:** 0

**Building Code:** R2900404040  
**Building Name:** Upper Sioux Agency SP Shop  
**Facility Condition Index:** 0.30 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$308,589  
**Deferred Maintenance:** \$91,072  
**Ext. Gross Area:** 0

**Building Code:** R2900404160  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$357,623  
**Deferred Maintenance:** \$76,778  
**Ext. Gross Area:** 0

**Building Code:** R2900404390  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$79,383  
**Deferred Maintenance:** \$7,465  
**Ext. Gross Area:** 0

**Building Code:** R2900404570  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$15,353  
**Deferred Maintenance:** \$2,891  
**Ext. Gross Area:** 0

**Building Code:** R2900404580  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$42,543  
**Deferred Maintenance:** \$11,863  
**Ext. Gross Area:** 0

**Building Code:** R2900404590  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$15,353  
**Deferred Maintenance:** \$3,808  
**Ext. Gross Area:** 0

**Building Code:** R2900404790  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$15,353  
**Deferred Maintenance:** \$3,808  
**Ext. Gross Area:** 0

**Building Code:** R2900404800  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$15,353  
**Deferred Maintenance:** \$3,311  
**Ext. Gross Area:** 0

**Building Code:** R2900404820  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$29,212  
**Deferred Maintenance:** \$2,132  
**Ext. Gross Area:** 0

**Building Code:** R2900404830  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.15 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$20,716  
**Deferred Maintenance:** \$3,193  
**Ext. Gross Area:** 0

**Building Code:** R2900405250  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 5908 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$21,911  
**Deferred Maintenance:** \$3,652  
**Ext. Gross Area:** 0

**Site: R290065 - Whitewater State Park**

**Building Code:** R2900501060  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.23 - *Average*

**Cost Model Name:** Open Air Shelter  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$319,975  
**Deferred Maintenance:** \$72,586  
**Ext. Gross Area:** 0

**Building Code:** R2900501110  
**Building Name:** Dining Hall  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$626,634  
**Deferred Maintenance:** \$81,207  
**Ext. Gross Area:** 0

**Building Code:** R2900501120  
**Building Name:** Infirmary  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$113,269  
**Deferred Maintenance:** \$3,282  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900501130	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$124,074
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$9,011
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501140	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$124,074
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$9,011
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501150	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$124,074
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$7,945
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501160	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$116,760
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$9,649
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501170	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$124,074
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$7,945
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501180	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$116,760
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$7,799
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501200	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$240,947
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$30,123
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$31,412
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$6,330
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501240	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$516,538
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$123,586
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501250	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$854,670
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$119,857
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501260	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$340,994
<b>Building Name:</b>	Interp Unoccupied	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$73,544
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900501270	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$76,750
<b>Building Name:</b>	Pump House	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$16,089
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501290	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$219,683
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$43,490
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501300	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$813,459
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$159,680
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501320	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$426,658
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$140,923
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501330	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$215,460
<b>Building Name:</b>	Whitewater SP Nature Store	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$23,666
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501340	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$1,502,826
<b>Building Name:</b>	Whitewater SP Office	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$386,794
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501350	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$37,335
<b>Building Name:</b>	Pump House	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$5,493
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501870	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$124,074
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$9,425
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501910	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$241,702
<b>Building Name:</b>	Whitewater SP Shop	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$32,738
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501920	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,317
<b>Building Name:</b>	Oil House	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$1,207
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	98
<b>Building Code:</b>	R2900501980	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$336,658
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$53,401
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900501990	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$528,463
<b>Building Name:</b>	Sanitation	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$37,347
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502850	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$2,280,431
<b>Building Name:</b>	Whitewater SP Contact Station	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$140,827
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503580	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,221
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$1,211
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503590	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,746
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$3,356
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503600	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,746
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$3,356
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503610	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,221
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$1,211
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503620	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,385
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$1,584
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503630	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,746
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$1,704
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504560	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,482
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$1,626
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504570	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$46,769
<b>Building Name:</b>	Cabin	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$6,498
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$20,526
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	19041 HWY 74	<b>Deferred Maintenance:</b>	\$2,687
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900504970  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$19,229  
**Deferred Maintenance:** \$1,374  
**Ext. Gross Area:** 0

**Building Code:** R2900505150  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$13,843  
**Deferred Maintenance:** \$2,518  
**Ext. Gross Area:** 0

**Building Code:** R2900505160  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$14,547  
**Deferred Maintenance:** \$1,046  
**Ext. Gross Area:** 0

**Building Code:** R2900505450  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$33,061  
**Deferred Maintenance:** \$661  
**Ext. Gross Area:** 0

**Building Code:** R2900505460  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$33,061  
**Deferred Maintenance:** \$661  
**Ext. Gross Area:** 0

**Site: R290066 - Wild River State Park**

**Building Code:** R2900301400  
**Building Name:** Wild River SP Office  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$517,853  
**Deferred Maintenance:** \$91,128  
**Ext. Gross Area:** 0

**Building Code:** R2900301430  
**Building Name:** Garage  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$61,929  
**Deferred Maintenance:** \$11,323  
**Ext. Gross Area:** 0

**Building Code:** R2900303090  
**Building Name:** Oil House  
**Facility Condition Index:** 0.39 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$15,690  
**Deferred Maintenance:** \$6,122  
**Ext. Gross Area:** 0

**Building Code:** R2900303100  
**Building Name:** Wild River SP Shop  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$331,270  
**Deferred Maintenance:** \$85,199  
**Ext. Gross Area:** 0

**Building Code:** R2900303110  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$175,386  
**Deferred Maintenance:** \$26,202  
**Ext. Gross Area:** 0

**Building Code:** R2900303120  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$425,024  
**Deferred Maintenance:** \$124,596  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900303130	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$643,885
<b>Building Name:</b>	Wild River SP Interp Center	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$209,253
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303140	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$288,523
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$56,312
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303150	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$252,987
<b>Building Name:</b>	Sanitation	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$40,473
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303160	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$252,987
<b>Building Name:</b>	Sanitation	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$76,846
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303170	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$318,056
<b>Building Name:</b>	Residence	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$59,807
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303700	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$205,298
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$142,318
<b>Facility Condition Index:</b>	0.69 - Crisis	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304380	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,767
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$2,578
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304430	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,990
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$2,234
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304440	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$8,990
<b>Building Name:</b>	DISPOSED - Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,488
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306110	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$249,557
<b>Building Name:</b>	Guest House	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$68,037
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306340	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$15,490
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,549
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900306350	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$51,110
<b>Building Name:</b>	Cabin #5	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$6,148
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306360	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$51,110
<b>Building Name:</b>	Cabin #6	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$5,316
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306590	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,549
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$2,145
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306780	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,518
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,277
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307200	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,360
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,031
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307210	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,861
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,592
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307220	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,300
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,629
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307230	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$13,861
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$2,232
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307390	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$27,945
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$2,794
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307600	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$52,841
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$5,284
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307610	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$66,568
<b>Building Name:</b>	Cabin #1	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,726
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900307620	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$66,568
<b>Building Name:</b>	Cabin #2	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,726
<b>Facility Condition Index:</b>	0.03 - Excellent	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307630	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$66,568
<b>Building Name:</b>	Cabin #3	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$5,045
<b>Facility Condition Index:</b>	0.08 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307640	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$66,568
<b>Building Name:</b>	Cabin #4	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$4,838
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307860	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,424
<b>Building Name:</b>	Concession	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$1,182
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307870	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$8,880
<b>Building Name:</b>	Adirondack	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$6,270
<b>Facility Condition Index:</b>	0.71 - Crisis	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307880	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,158
<b>Building Name:</b>	Adirondack	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$2,180
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307890	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$6,863
<b>Building Name:</b>	Adirondack	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$4,975
<b>Facility Condition Index:</b>	0.72 - Crisis	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307900	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$8,584
<b>Building Name:</b>	Adirondack	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$6,094
<b>Facility Condition Index:</b>	0.71 - Crisis	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308100	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$24,388
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$488
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308290	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$27,437
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$549
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900308300	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$27,437
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	39797 PARK TRAIL	<b>Deferred Maintenance:</b>	\$549
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CENTER CITY	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900308530  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$25,913  
**Deferred Maintenance:** \$518  
**Ext. Gross Area:** 0

**Site: R290067 - William O'Brien State Park**

**Building Code:** R2900600370  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.30 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$132,379  
**Deferred Maintenance:** \$39,267  
**Ext. Gross Area:** 0

**Building Code:** R2900600380  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$151,500  
**Deferred Maintenance:** \$32,142  
**Ext. Gross Area:** 0

**Building Code:** R2900600420  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.30 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$123,702  
**Deferred Maintenance:** \$36,625  
**Ext. Gross Area:** 0

**Building Code:** R2900600460  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$344,649  
**Deferred Maintenance:** \$79,540  
**Ext. Gross Area:** 0

**Building Code:** R2900601190  
**Building Name:** Residence  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$388,182  
**Deferred Maintenance:** \$93,540  
**Ext. Gross Area:** 0

**Building Code:** R2900601200  
**Building Name:** William O'Brien SP Interp Ctr  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$1,075,884  
**Deferred Maintenance:** \$163,518  
**Ext. Gross Area:** 0

**Building Code:** R2900601220  
**Building Name:** Garage  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$60,750  
**Deferred Maintenance:** \$9,752  
**Ext. Gross Area:** 0

**Building Code:** R2900601230  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$151,475  
**Deferred Maintenance:** \$19,572  
**Ext. Gross Area:** 0

**Building Code:** R2900601240  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$151,475  
**Deferred Maintenance:** \$28,683  
**Ext. Gross Area:** 0

**Building Code:** R2900601590  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 16821 O'BRIEN TRAIL N  
**City Code:** MARINE ON ST CRO

**Current Replacement Value:** \$11,384  
**Deferred Maintenance:** \$2,093  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900601600	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,384
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$2,093
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601610	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,384
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$2,226
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601620	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,384
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$2,226
<b>Facility Condition Index:</b>	0.15 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601640	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,384
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,138
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601650	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,384
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,138
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601660	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,406
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,745
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,384
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,830
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601790	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$295,134
<b>Building Name:</b>	Sanitation	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$71,371
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601860	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,406
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,525
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601870	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,406
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,525
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900601940	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$938,928
<b>Building Name:</b>	William O'Brien SP Shop	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$187,749
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0



<b>Building Code:</b>	R2900602020	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$50,655
<b>Building Name:</b>	Copas Cabin	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$11,327
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602080	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,836
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,213
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602090	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,890
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$2,491
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602100	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,642
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$3,585
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602110	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,836
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$2,130
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602140	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$9,473
<b>Building Name:</b>	Adirondack	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$6,633
<b>Facility Condition Index:</b>	0.70 - Crisis	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602150	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$13,411
<b>Building Name:</b>	Adirondack	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$10,059
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602160	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$8,728
<b>Building Name:</b>	Adirondack	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$6,546
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602170	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$341,317
<b>Building Name:</b>	William O'Brien SP Contact Sta	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$23,408
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$52,371
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$5,237
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602200	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$47,887
<b>Building Name:</b>	Otisville Cabin	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$5,439
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900602210	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$47,887
<b>Building Name:</b>	Vasa Cabin	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$6,059
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602230	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,727
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$1,550
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602240	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$44,641
<b>Building Name:</b>	Marine Mills Cabin	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$5,543
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602290	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$40,752
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$16,833
<b>Facility Condition Index:</b>	0.41 - <b>Poor</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602390	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$47,110
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$13,792
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602400	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$96,762
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$28,081
<b>Facility Condition Index:</b>	0.29 - <b>Average</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602410	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$297,999
<b>Building Name:</b>	Heated Storage	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$51,768
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602420	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$635,891
<b>Building Name:</b>	Heated Storage	<b>Address:</b>	16821 O'BRIEN TRAIL N	<b>Deferred Maintenance:</b>	\$158,000
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	MARINE ON ST CRO	<b>Ext. Gross Area:</b>	0

**Site: R290068 - Zippel Bay State Park**

<b>Building Code:</b>	R2900100700	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$124,833
<b>Building Name:</b>	Sanitation	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$11,868
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100720	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$12,730
<b>Building Name:</b>	Shower Building Vault 1	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$1,711
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100780	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,240
<b>Building Name:</b>	Shower building Vault 2	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$3,520
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900100790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,941
<b>Building Name:</b>	Unisex Vault Birch Campground	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,955
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,941
<b>Building Name:</b>	Mens Vault Birch Campground	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,955
<b>Facility Condition Index:</b>	0.25 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100850	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,903
<b>Building Name:</b>	Anglers Campground Mens Vault	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$3,350
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100890	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$2,302
<b>Building Name:</b>	Bath House	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$760
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101190	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,867
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,227
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101360	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,867
<b>Building Name:</b>	Anglers Campground Unisex Vault	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,227
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102510	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$24,506
<b>Building Name:</b>	Fish Cleaning House	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$7,205
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102520	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$94,756
<b>Building Name:</b>	Zippel Bay SP Office	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$32,141
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102530	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$102,650
<b>Building Name:</b>	Zippel Bay SP Contact Station	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$17,489
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102540	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$260,382
<b>Building Name:</b>	Shop	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$30,908
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900102550	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$31,492
<b>Building Name:</b>	Picnic Shelter Beach	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$6,138
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900104720	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$20,699
<b>Building Name:</b>	Open Storage by Shop	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$15,524
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105460	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,867
<b>Building Name:</b>	Ridge Campground Vault 1	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,227
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105470	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,867
<b>Building Name:</b>	Ridge Campground Vault 2	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,227
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106470	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,240
<b>Building Name:</b>	Swimming Beach Vault 1	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,209
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106480	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,240
<b>Building Name:</b>	Swimming Beach Vault 2	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$2,209
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106580	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,240
<b>Building Name:</b>	Lady Slipper Vault	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$3,529
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106590	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$23,716
<b>Building Name:</b>	Picnic Shelter Harbor	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$1,748
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900108450	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$14,245
<b>Building Name:</b>	ADA Vault Toilet	<b>Address:</b>	3684 54TH AVE NW	<b>Deferred Maintenance:</b>	\$1,740
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0

**Site: R290069 - Birch Lake State Forest**

<b>Building Code:</b>	R2900306180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$66,502
<b>Building Name:</b>	Cold Storage	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$3,340
<b>Facility Condition Index:</b>	0.05 - <b>Good</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900306670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$11,876
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$2,230
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900307670	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,540
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>		<b>Deferred Maintenance:</b>	\$954
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	LITTLE FALLS	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900307680  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Vault Toilet  
**Address:**  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$9,540  
**Deferred Maintenance:** \$1,486  
**Ext. Gross Area:** 0

**Building Code:** R2900307690  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Vault Toilet  
**Address:**  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$9,540  
**Deferred Maintenance:** \$1,195  
**Ext. Gross Area:** 0

**Building Code:** R2900307700  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Vault Toilet  
**Address:**  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$9,540  
**Deferred Maintenance:** \$1,195  
**Ext. Gross Area:** 0

**Building Code:** R2900307710  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Vault Toilet  
**Address:**  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$8,664  
**Deferred Maintenance:** \$1,088  
**Ext. Gross Area:** 0

**Building Code:** R2900307720  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Vault Toilet  
**Address:**  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$8,923  
**Deferred Maintenance:** \$1,114  
**Ext. Gross Area:** 0

**Site: R290070 - Carley State Park**

**Building Code:** R2900503970  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.42 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** WABASHA CTY RD 4  
**City Code:** PLAINVIEW

**Current Replacement Value:** \$19,064  
**Deferred Maintenance:** \$7,963  
**Ext. Gross Area:** 0

**Building Code:** R2900503980  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** WABASHA CTY RD 4  
**City Code:** PLAINVIEW

**Current Replacement Value:** \$19,064  
**Deferred Maintenance:** \$5,860  
**Ext. Gross Area:** 0

**Building Code:** R2900503990  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.31 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** WABASHA CTY RD 4  
**City Code:** PLAINVIEW

**Current Replacement Value:** \$19,064  
**Deferred Maintenance:** \$5,860  
**Ext. Gross Area:** 0

**Building Code:** R2900504000  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.42 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** WABASHA CTY RD 4  
**City Code:** PLAINVIEW

**Current Replacement Value:** \$19,064  
**Deferred Maintenance:** \$7,963  
**Ext. Gross Area:** 0

**Building Code:** R2900504010  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.42 - Poor

**Cost Model Name:** Vault Toilet  
**Address:** WABASHA CTY RD 4  
**City Code:** PLAINVIEW

**Current Replacement Value:** \$19,064  
**Deferred Maintenance:** \$7,963  
**Ext. Gross Area:** 0

**Building Code:** R2900504730  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.04 - Excellent

**Cost Model Name:** Open Air Shelter  
**Address:** WABASHA CTY RD 4  
**City Code:** PLAINVIEW

**Current Replacement Value:** \$49,183  
**Deferred Maintenance:** \$2,017  
**Ext. Gross Area:** 0

**Building Code:** R2900505750  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 19040 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$27,195  
**Deferred Maintenance:** \$544  
**Ext. Gross Area:** 0

**Building Code:** R2900505760  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 19040 hwy 74  
**City Code:** ALTURA

**Current Replacement Value:** \$27,195  
**Deferred Maintenance:** \$544  
**Ext. Gross Area:** 0

**Building Code:** R2900505780  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 19040 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$27,195  
**Deferred Maintenance:** \$544  
**Ext. Gross Area:** 0

**Building Code:** R2900505790  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 19040 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$27,195  
**Deferred Maintenance:** \$544  
**Ext. Gross Area:** 0

**Site: R290071 - George H Crosby-Manitou State Park**

**Building Code:** R2900208740  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 474 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$16,338  
**Deferred Maintenance:** \$1,673  
**Ext. Gross Area:** 0

**Site: R290072 - John A Latsch State Park**

**Building Code:** R2900504580  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 43605 KIPP DR  
**City Code:** WINONA

**Current Replacement Value:** \$14,390  
**Deferred Maintenance:** \$3,177  
**Ext. Gross Area:** 0

**Site: R290073 - Garden Island SRA**

**Building Code:** R2900107040  
**Building Name:** Lodging House  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Hotel/Dorm  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$19,089  
**Deferred Maintenance:** \$6,126  
**Ext. Gross Area:** 0

**Site: R290074 - Cass Lake**

**Building Code:** R2900103460  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 706 ASH AVE  
**City Code:** CASS LAKE

**Current Replacement Value:** \$29,850  
**Deferred Maintenance:** \$9,289  
**Ext. Gross Area:** 0

**Building Code:** R2900103470  
**Building Name:** Cass Lake Office  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 706 ASH AVE  
**City Code:** CASS LAKE

**Current Replacement Value:** \$239,281  
**Deferred Maintenance:** \$65,386  
**Ext. Gross Area:** 0

**Site: R290075 - Backus**

**Building Code:** R2900303740  
**Building Name:** Oil House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 4391 ST 87 NW  
**City Code:** BACKUS

**Current Replacement Value:** \$23,272  
**Deferred Maintenance:** \$2,327  
**Ext. Gross Area:** 0

**Building Code:** R2900304460  
**Building Name:** Backus Shop  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4391 ST 87 NW  
**City Code:** BACKUS

**Current Replacement Value:** \$251,908  
**Deferred Maintenance:** \$46,916  
**Ext. Gross Area:** 0

**Building Code:** R2900306170  
**Building Name:** Backus Office  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 4391 ST 87 NW  
**City Code:** BACKUS

**Current Replacement Value:** \$689,487  
**Deferred Maintenance:** \$71,805  
**Ext. Gross Area:** 0

**Site: R290076 - Baudette Forestry**

**Building Code:** R2900103840  
**Building Name:** Oil House  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 206 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$22,037  
**Deferred Maintenance:** \$4,947  
**Ext. Gross Area:** 124

**Building Code:** R2900103870  
**Building Name:** Baudette Forestry Shop  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 206 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$451,295  
**Deferred Maintenance:** \$72,674  
**Ext. Gross Area:** 2,268

**Building Code:** R2900103880  
**Building Name:** Baudette Forestry Office  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 206 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$532,260  
**Deferred Maintenance:** \$102,662  
**Ext. Gross Area:** 1,363

**Building Code:** R2900109180  
**Building Name:** Fire Truck Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 206 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$232,325  
**Deferred Maintenance:** \$4,647  
**Ext. Gross Area:** 0

**Site: R290077 - Blackduck**

**Building Code:** R2900106250  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 417B FORESTRY DR  
**City Code:** BLACKDUCK

**Current Replacement Value:** \$572,658  
**Deferred Maintenance:** \$97,620  
**Ext. Gross Area:** 0

**Site: R290079 - Fergus Falls**

**Building Code:** R2900107290  
**Building Name:** Fergus Falls Office  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1509 1ST AVE N  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$6,987,933  
**Deferred Maintenance:** \$970,686  
**Ext. Gross Area:** 29,784



**Building Code:** R2900107720  
**Building Name:** Anderson East  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1509 1ST AVE N  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$301,207  
**Deferred Maintenance:** \$100,552  
**Ext. Gross Area:** 2,856

**Building Code:** R2900107730  
**Building Name:** Anderson West  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1509 1ST AVE N  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$527,289  
**Deferred Maintenance:** \$148,401  
**Ext. Gross Area:** 3,724

**Site: R290080 - Glenwood**

**Building Code:** R2900100220  
**Building Name:** Wildlife Metal Cold Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$286,302  
**Deferred Maintenance:** \$28,630  
**Ext. Gross Area:** 0

**Building Code:** R2900101230  
**Building Name:** DISPOSED - Garage  
**Facility Condition Index:** 0.42 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$33,887  
**Deferred Maintenance:** \$14,352  
**Ext. Gross Area:** 0

**Building Code:** R2900101240  
**Building Name:** Oil House  
**Facility Condition Index:** 0.51 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$20,847  
**Deferred Maintenance:** \$10,576  
**Ext. Gross Area:** 0

**Building Code:** R2900101250  
**Building Name:** Six Stall Storage Garage  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$637,144  
**Deferred Maintenance:** \$165,128  
**Ext. Gross Area:** 0

**Building Code:** R2900101260  
**Building Name:** Glenwood Fish Hatchery  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$284,234  
**Deferred Maintenance:** \$73,107  
**Ext. Gross Area:** 0

**Building Code:** R2900101270  
**Building Name:** South Garage  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$53,958  
**Deferred Maintenance:** \$10,966  
**Ext. Gross Area:** 0

**Building Code:** R2900101290  
**Building Name:** North Garage  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$43,757  
**Deferred Maintenance:** \$7,760  
**Ext. Gross Area:** 0

**Building Code:** R2900101310  
**Building Name:** Glenwood Shop Office  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$649,453  
**Deferred Maintenance:** \$152,875  
**Ext. Gross Area:** 0

**Site: R290081 - Grygla**

**Building Code:** R2900103970  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.69 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 239 E PARK DR  
**City Code:** GRYGLA

**Current Replacement Value:** \$15,571  
**Deferred Maintenance:** \$10,807  
**Ext. Gross Area:** 0

**Building Code:** R2900103980  
**Building Name:** Residence  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-family Residence  
**Address:** 239 E PARK DR  
**City Code:** GRYGLA

**Current Replacement Value:** \$261,713  
**Deferred Maintenance:** \$6,282  
**Ext. Gross Area:** 0

**Building Code:** R2900103990  
**Building Name:** Grygla Office  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 239 E PARK DR  
**City Code:** GRYGLA

**Current Replacement Value:** \$312,125  
**Deferred Maintenance:** \$9,023  
**Ext. Gross Area:** 0

**Building Code:** R2900104000  
**Building Name:** Garage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 239 E PARK DR  
**City Code:** GRYGLA

**Current Replacement Value:** \$43,406  
**Deferred Maintenance:** \$868  
**Ext. Gross Area:** 0

**Site: R290082 - Kelliher**

**Building Code:** R2900103740  
**Building Name:** Kelliher Office  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 485 W MAIN ST  
**City Code:** KELLIHER

**Current Replacement Value:** \$451,509  
**Deferred Maintenance:** \$126,321  
**Ext. Gross Area:** 0

**Site: R290083 - Nimrod**

**Building Code:** R2900107770  
**Building Name:** Nimrod Shop  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 30066 HUNTERSVILLE RD  
**City Code:** SEBEKA

**Current Replacement Value:** \$218,519  
**Deferred Maintenance:** \$29,609  
**Ext. Gross Area:** 0

**Building Code:** R2900109150  
**Building Name:** Fire Truck Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 30066 HUNTERSVILLE RD  
**City Code:** SEBEKA

**Current Replacement Value:** \$87,209  
**Deferred Maintenance:** \$8,721  
**Ext. Gross Area:** 0

**Building Code:** R2900300560  
**Building Name:** Nimrod Office  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 30066 HUNTERSVILLE RD  
**City Code:** SEBEKA

**Current Replacement Value:** \$293,032  
**Deferred Maintenance:** \$63,371  
**Ext. Gross Area:** 0

**Building Code:** R2900303310  
**Building Name:** Oil House  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 30066 HUNTERSVILLE RD  
**City Code:** SEBEKA

**Current Replacement Value:** \$11,069  
**Deferred Maintenance:** \$3,687  
**Ext. Gross Area:** 0

**Building Code:** R2900303320  
**Building Name:** DISPOSED - Radio Shelter  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 30066 HUNTERSVILLE RD  
**City Code:** SEBEKA

**Current Replacement Value:** \$4,824  
**Deferred Maintenance:** \$1,706  
**Ext. Gross Area:** 0

**Building Code:** R2900305580  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** NIMROD  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$12,781  
**Deferred Maintenance:** \$4,218  
**Ext. Gross Area:** 0

**Site: R290084 - Northome**

**Building Code:** R2900206930  
**Building Name:** Northome Office  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 12006 HWY 1 E  
**City Code:** NORTHOME

**Current Replacement Value:** \$388,463  
**Deferred Maintenance:** \$74,949  
**Ext. Gross Area:** 0

**Building Code:** R2900206940  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 12006 HWY 1 E  
**City Code:** NORTHOME

**Current Replacement Value:** \$322,542  
**Deferred Maintenance:** \$90,489  
**Ext. Gross Area:** 0

**Site: R290085 - Spire Valley**

**Building Code:** R2900107680  
**Building Name:** Residence  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$400,532  
**Deferred Maintenance:** \$70,367  
**Ext. Gross Area:** 0

**Building Code:** R2900108400  
**Building Name:** North Raceway Shelter  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Fabric Structure  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$48,982  
**Deferred Maintenance:** \$16,012  
**Ext. Gross Area:** 0

**Building Code:** R2900108410  
**Building Name:** South Raceway Shelter  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$88,439  
**Deferred Maintenance:** \$22,394  
**Ext. Gross Area:** 0

**Building Code:** R2900303360  
**Building Name:** Spire Valley Fish Hatchery  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$175,413  
**Deferred Maintenance:** \$53,317  
**Ext. Gross Area:** 0

**Building Code:** R2900303370  
**Building Name:** Shed  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$18,218  
**Deferred Maintenance:** \$2,651  
**Ext. Gross Area:** 0

**Building Code:** R2900304180  
**Building Name:** Oil House  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$11,100  
**Deferred Maintenance:** \$1,699  
**Ext. Gross Area:** 0

**Building Code:** R2900304550  
**Building Name:** Shed  
**Facility Condition Index:** 0.57 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$9,852  
**Deferred Maintenance:** \$5,639  
**Ext. Gross Area:** 0

**Building Code:** R2900305160  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.32 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$23,456  
**Deferred Maintenance:** \$7,466  
**Ext. Gross Area:** 0

**Building Code:** R2900306560  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 1852 ST 6 NE  
**City Code:** REMER

**Current Replacement Value:** \$214,926  
**Deferred Maintenance:** \$21,493  
**Ext. Gross Area:** 0

**Site: R290086 - Thief River Falls**

**Building Code:** R2900108150  
**Building Name:** Thief River Falls Office  
**Facility Condition Index:** 0.04 - Excellent

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 246 125TH AVE NE  
**City Code:** THIEF RIVER FALL

**Current Replacement Value:** \$635,520  
**Deferred Maintenance:** \$23,936  
**Ext. Gross Area:** 0

**Building Code:** R2900108430  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Single-story Work Facility  
**Address:** 246 125TH AVE NE  
**City Code:** THIEF RIVER FALL

**Current Replacement Value:** \$525,027  
**Deferred Maintenance:** \$10,501  
**Ext. Gross Area:** 0

**Site: R290087 - Wannaska**

**Building Code:** R2900104140  
**Building Name:** Wannaska Main Office  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$310,930  
**Deferred Maintenance:** \$66,487  
**Ext. Gross Area:** 0

**Building Code:** R2900104150  
**Building Name:** Wannaska Shop Office  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$375,347  
**Deferred Maintenance:** \$38,615  
**Ext. Gross Area:** 0

**Building Code:** R2900104890  
**Building Name:** Equipment Pole Shelter  
**Facility Condition Index:** 0.48 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$28,457  
**Deferred Maintenance:** \$13,735  
**Ext. Gross Area:** 0

**Building Code:** R2900106360  
**Building Name:** Tree Storage  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$57,175  
**Deferred Maintenance:** \$3,955  
**Ext. Gross Area:** 0

**Building Code:** R2900106390  
**Building Name:** Metal Garage with Lean-To  
**Facility Condition Index:** 0.03 - Excellent

**Cost Model Name:** Single-story Work Facility  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$61,951  
**Deferred Maintenance:** \$2,005  
**Ext. Gross Area:** 0

**Building Code:** R2900106400  
**Building Name:** Oil House  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Utility Shed  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$24,698  
**Deferred Maintenance:** \$1,579  
**Ext. Gross Area:** 0

**Building Code:** R2900108440  
**Building Name:** Generator Shed  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$11,553  
**Deferred Maintenance:** \$231  
**Ext. Gross Area:** 0

**Building Code:** R2900109160  
**Building Name:** Fire Truck Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 16945 STATE HWY 89  
**City Code:** WANNASKA

**Current Replacement Value:** \$162,628  
**Deferred Maintenance:** \$3,253  
**Ext. Gross Area:** 0

**Site: R290088 - Warroad**

**Building Code:** R2900108140  
**Building Name:** Warroad Office  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 804 CHERNE DR NW  
**City Code:** WARROAD

**Current Replacement Value:** \$1,403,046  
**Deferred Maintenance:** \$28,061  
**Ext. Gross Area:** 0

**Building Code:** R2900108180  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 804 CHERNE DR NW  
**City Code:** WARROAD

**Current Replacement Value:** \$444,225  
**Deferred Maintenance:** \$8,884  
**Ext. Gross Area:** 0

**Site: R290089 - Williams**

**Building Code:** R2900103900  
**Building Name:** Williams Office  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 115 WILDERNESS AVE  
**City Code:** WILLIAMS

**Current Replacement Value:** \$299,229  
**Deferred Maintenance:** \$58,260  
**Ext. Gross Area:** 0

**Building Code:** R2900103910  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 115 WILDERNESS AVE  
**City Code:** WILLIAMS

**Current Replacement Value:** \$300,681  
**Deferred Maintenance:** \$51,901  
**Ext. Gross Area:** 0

**Building Code:** R2900103920  
**Building Name:** Garage  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 115 WILDERNESS AVE  
**City Code:** WILLIAMS

**Current Replacement Value:** \$37,932  
**Deferred Maintenance:** \$6,254  
**Ext. Gross Area:** 0

**Site: R290090 - Hinckley**

**Building Code:** R2900303180  
**Building Name:** Garage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 306 POWER AVE N  
**City Code:** HINCKLEY

**Current Replacement Value:** \$121,036  
**Deferred Maintenance:** \$39,443  
**Ext. Gross Area:** 0

**Building Code:** R2900304470  
**Building Name:** Hinckley Hatchery  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 306 POWER AVE N  
**City Code:** HINCKLEY

**Current Replacement Value:** \$573,789  
**Deferred Maintenance:** \$142,939  
**Ext. Gross Area:** 0

**Building Code:** R2900307920  
**Building Name:** Pump House  
**Facility Condition Index:** 0.43 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 306 POWER AVE N  
**City Code:** HINCKLEY

**Current Replacement Value:** \$24,457  
**Deferred Maintenance:** \$10,425  
**Ext. Gross Area:** 0

**Site: R290091 - Paul Bunyan State Forest**

**Building Code:** R2900100090  
**Building Name:** Gulch Campground  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$7,719  
**Deferred Maintenance:** \$1,917  
**Ext. Gross Area:** 0

**Building Code:** R2900105500  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.75 - Crisis

**Cost Model Name:** Tower  
**Address:** SCHOOLCRAFT  
**City Code:** GUTHRIE

**Current Replacement Value:** \$12,781  
**Deferred Maintenance:** \$9,586  
**Ext. Gross Area:** 0

**Building Code:** R2900107300  
**Building Name:** Shed  
**Facility Condition Index:** 0.14 - Good

**Cost Model Name:** Utility Shed  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$3,647  
**Deferred Maintenance:** \$510  
**Ext. Gross Area:** 0

**Building Code:** R2900107310  
**Building Name:** Site 15 Vault  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$10,680  
**Deferred Maintenance:** \$2,647  
**Ext. Gross Area:** 0

**Building Code:** R2900107320  
**Building Name:** Site 22 Vault  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$10,680  
**Deferred Maintenance:** \$2,647  
**Ext. Gross Area:** 0

**Building Code:** R2900107330  
**Building Name:** Site 19 Vault  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$10,680  
**Deferred Maintenance:** \$2,647  
**Ext. Gross Area:** 0

**Building Code:** R2900107340  
**Building Name:** Site 27 Vault  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$10,680  
**Deferred Maintenance:** \$2,647  
**Ext. Gross Area:** 0

**Building Code:** R2900107350  
**Building Name:** Water Access Vault  
**Facility Condition Index:** 0.19 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$12,883  
**Deferred Maintenance:** \$2,425  
**Ext. Gross Area:** 0

**Building Code:** R2900107360  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.23 - Average

**Cost Model Name:** Open Air Shelter  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$18,652  
**Deferred Maintenance:** \$4,323  
**Ext. Gross Area:** 0

**Building Code:** R2900107370  
**Building Name:** Kiosk  
**Facility Condition Index:** 0.19 - Average

**Cost Model Name:** Open Air Shelter  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$2,285  
**Deferred Maintenance:** \$429  
**Ext. Gross Area:** 0

**Building Code:** R2900107610  
**Building Name:** West Gulch Trail Adirondack  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Open Air Shelter  
**Address:** W. Gulch Trail  
**City Code:** BEMIDJI

**Current Replacement Value:** \$11,231  
**Deferred Maintenance:** \$2,795  
**Ext. Gross Area:** 0

**Building Code:** R2900107620  
**Building Name:** Gulch Campground Kiosk  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Open Air Shelter  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$4,462  
**Deferred Maintenance:** \$838  
**Ext. Gross Area:** 0

**Building Code:** R2900107630  
**Building Name:** Site 2 Vault  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$13,560  
**Deferred Maintenance:** \$1,356  
**Ext. Gross Area:** 0

**Building Code:** R2900107640  
**Building Name:** Nelson Access Vault  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** NELSON ACCESS  
**City Code:** BEMIDJI

**Current Replacement Value:** \$13,560  
**Deferred Maintenance:** \$1,356  
**Ext. Gross Area:** 0

**Building Code:** R2900107650  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 3401 STATE PARK RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$13,350  
**Deferred Maintenance:** \$3,308  
**Ext. Gross Area:** 0

**Building Code:** R2900107660  
**Building Name:** Lake 21 Day Use Adirondack  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** Lake 21 day use area  
**City Code:** BEMIDJI

**Current Replacement Value:** \$14,227  
**Deferred Maintenance:** \$1,423  
**Ext. Gross Area:** 0

**Building Code:** R2900107940  
**Building Name:** Campground Vault  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DR  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$14,921  
**Deferred Maintenance:** \$1,492  
**Ext. Gross Area:** 0

**Site: R290092 - Sand Dunes State Forest**

**Building Code:** R2900305550  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.75 - *Crisis*

**Cost Model Name:** Tower  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$7,446  
**Deferred Maintenance:** \$5,584  
**Ext. Gross Area:** 0

**Building Code:** R2900307400  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$27,945  
**Deferred Maintenance:** \$2,794  
**Ext. Gross Area:** 0

**Building Code:** R2900307410  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$27,945  
**Deferred Maintenance:** \$2,794  
**Ext. Gross Area:** 0

**Building Code:** R2900307930  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$11,174  
**Deferred Maintenance:** \$1,117  
**Ext. Gross Area:** 0



**Building Code:** R2900307940  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$9,239  
**Deferred Maintenance:** \$1,448  
**Ext. Gross Area:** 0

**Building Code:** R2900307950  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$9,239  
**Deferred Maintenance:** \$2,294  
**Ext. Gross Area:** 0

**Building Code:** R2900307960  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$1,877  
**Ext. Gross Area:** 0

**Building Code:** R2900307970  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$1,877  
**Ext. Gross Area:** 0

**Building Code:** R2900307980  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$1,362  
**Ext. Gross Area:** 0

**Building Code:** R2900307990  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$2,156  
**Ext. Gross Area:** 0

**Building Code:** R2900308000  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.31 - *Poor*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$2,665  
**Ext. Gross Area:** 0

**Building Code:** R2900308010  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.30 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$2,578  
**Ext. Gross Area:** 0

**Building Code:** R2900308020  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$8,678  
**Deferred Maintenance:** \$2,156  
**Ext. Gross Area:** 0

**Building Code:** R2900308030  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$14,360  
**Deferred Maintenance:** \$608  
**Ext. Gross Area:** 0

**Building Code:** R2900308040  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$14,360  
**Deferred Maintenance:** \$1,022  
**Ext. Gross Area:** 0

**Building Code:** R2900308050  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$14,360  
**Deferred Maintenance:** \$1,220  
**Ext. Gross Area:** 0

**Building Code:** R2900308060  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$9,948  
**Deferred Maintenance:** \$3,550  
**Ext. Gross Area:** 0

**Building Code:** R2900308070  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 11411 CLEMENTA AVE NW  
**City Code:** MONTICELLO

**Current Replacement Value:** \$21,737  
**Deferred Maintenance:** \$3,481  
**Ext. Gross Area:** 0

**Building Code:** R2900308080  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 940 INDUSTRIAL DR S #103  
**City Code:** SAUK RAPIDS

**Current Replacement Value:** \$14,787  
**Deferred Maintenance:** \$1,505  
**Ext. Gross Area:** 0

**Building Code:** R2900308090  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 940 INDUSTRIAL DR S #103  
**City Code:** SAUK RAPIDS

**Current Replacement Value:** \$14,787  
**Deferred Maintenance:** \$2,813  
**Ext. Gross Area:** 0

**Site: R290093 - George Washington State Forest**

**Building Code:** R2900206000  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 55334 W BEAR LAKE FOREST RD  
**City Code:** NASHWAUK

**Current Replacement Value:** \$11,471  
**Deferred Maintenance:** \$3,785  
**Ext. Gross Area:** 0

**Building Code:** R2900206020  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 55334 W BEAR LAKE FOREST RD  
**City Code:** NASHWAUK

**Current Replacement Value:** \$11,471  
**Deferred Maintenance:** \$2,843  
**Ext. Gross Area:** 0

**Building Code:** R2900206030  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$11,471  
**Deferred Maintenance:** \$3,785  
**Ext. Gross Area:** 0

**Building Code:** R2900206050  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$11,471  
**Deferred Maintenance:** \$3,785  
**Ext. Gross Area:** 0

**Building Code:** R2900206060  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$11,471  
**Deferred Maintenance:** \$3,785  
**Ext. Gross Area:** 0

**Building Code:** R2900206070  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 7622 MCCARTHY BEACH RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$11,471  
**Deferred Maintenance:** \$3,785  
**Ext. Gross Area:** 0

**Building Code:** R2900206270  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 55379 OWEN LAKE CAMPGROUND RI  
**City Code:** BIGFORK

**Current Replacement Value:** \$9,382  
**Deferred Maintenance:** \$2,328  
**Ext. Gross Area:** 0

**Building Code:** R2900206280  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 55379 OWEN LAKE CAMPGROUND RI  
**City Code:** BIGFORK

**Current Replacement Value:** \$9,382  
**Deferred Maintenance:** \$1,767  
**Ext. Gross Area:** 0

**Building Code:** R2900206290  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 55379 OWEN LAKE CAMPGROUND RI  
**City Code:** BIGFORK

**Current Replacement Value:** \$9,382  
**Deferred Maintenance:** \$2,328  
**Ext. Gross Area:** 0

**Building Code:** R2900206330  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 61186 LARSON LAKE STATE FOREST  
**City Code:** EFFIE

**Current Replacement Value:** \$9,382  
**Deferred Maintenance:** \$2,328  
**Ext. Gross Area:** 0

**Building Code:** R2900206340  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 61186 LARSON LAKE STATE FOREST  
**City Code:** EFFIE

**Current Replacement Value:** \$9,382  
**Deferred Maintenance:** \$2,328  
**Ext. Gross Area:** 0

**Building Code:** R2900206360  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 54669 E BEAR LAKE FOREST RD  
**City Code:** NASHWAUK

**Current Replacement Value:** \$9,894  
**Deferred Maintenance:** \$2,455  
**Ext. Gross Area:** 0

**Building Code:** R2900206380  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** BUTTON BOX RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$9,894  
**Deferred Maintenance:** \$2,455  
**Ext. Gross Area:** 0

**Building Code:** R2900207990  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Vault Toilet  
**Address:** 55659 LOST LAKE CAMPGROUND RD  
**City Code:** BIGFORK

**Current Replacement Value:** \$11,259  
**Deferred Maintenance:** \$2,793  
**Ext. Gross Area:** 0

**Building Code:** R2900208260  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$13,765  
**Deferred Maintenance:** \$2,135  
**Ext. Gross Area:** 0

**Building Code:** R2900208270  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$13,765  
**Deferred Maintenance:** \$2,135  
**Ext. Gross Area:** 0

**Building Code:** R2900208280  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$13,765  
**Deferred Maintenance:** \$2,135  
**Ext. Gross Area:** 0

**Building Code:** R2900208350  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 61186 LARSON LAKE STATE FOREST  
**City Code:** EFFIE

**Current Replacement Value:** \$14,005  
**Deferred Maintenance:** \$2,175  
**Ext. Gross Area:** 0

**Building Code:** R2900208360  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 551  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$14,769  
**Deferred Maintenance:** \$2,294  
**Ext. Gross Area:** 0

**Building Code:** R2900208370  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** BUTTON BOX RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$16,635  
**Deferred Maintenance:** \$1,639  
**Ext. Gross Area:** 0

**Building Code:** R2900208380  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** BUTTON BOX RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$9,894  
**Deferred Maintenance:** \$2,173  
**Ext. Gross Area:** 0

**Building Code:** R2900208480  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 55334 W BEAR LAKE FOREST RD  
**City Code:** NASHWAUK

**Current Replacement Value:** \$45,476  
**Deferred Maintenance:** \$2,958  
**Ext. Gross Area:** 0

**Building Code:** R2900208700  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** SNAKE TRAIL FOREST RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$15,161  
**Deferred Maintenance:** \$1,079  
**Ext. Gross Area:** 0

**Building Code:** R2900208710  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** SNAKE TRAIL FOREST RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$15,161  
**Deferred Maintenance:** \$1,079  
**Ext. Gross Area:** 0

**Building Code:** R2900208720  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** SNAKE TRAIL FOREST RD  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$15,161  
**Deferred Maintenance:** \$1,079  
**Ext. Gross Area:** 0

**Site: R290094 - Kabetogama State Forest**

**Building Code:** R2900203060  
**Building Name:** Refectory  
**Facility Condition Index:** 0.36 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Current Replacement Value:** \$265,819  
**Deferred Maintenance:** \$94,743  
**Ext. Gross Area:** 0

**Building Code:** R2900203070  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Bunker  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Current Replacement Value:** \$88,560  
**Deferred Maintenance:** \$22,726  
**Ext. Gross Area:** 0

**Building Code:** R2900203200  
**Building Name:** Kabetogama SF Office  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 8730 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$437,974  
**Deferred Maintenance:** \$46,222  
**Ext. Gross Area:** 0

**Building Code:** R2900203210  
**Building Name:** Guard Shack  
**Facility Condition Index:** 0.29 - Average

**Building Code:** R2900203220  
**Building Name:** Garage  
**Facility Condition Index:** 0.41 - Poor

**Building Code:** R2900203610  
**Building Name:** Spring House  
**Facility Condition Index:** 0.41 - Poor

**Building Code:** R2900204400  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.11 - Good

**Building Code:** R2900206080  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - Average

**Building Code:** R2900206090  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - Average

**Building Code:** R2900206100  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Building Code:** R2900206110  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - Average

**Building Code:** R2900206120  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Building Code:** R2900206130  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - Average

**Building Code:** R2900206220  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.23 - Average

**Cost Model Name:** Single-family Residence  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Single-story Work Facility  
**Address:** 8730 HWY 53  
**City Code:** ORR

**Cost Model Name:** Utility Shed  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Cost Model Name:** Vault Toilet  
**Address:** 8501 PETERSON RD  
**City Code:** COOK

**Current Replacement Value:** \$42,923  
**Deferred Maintenance:** \$12,561  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$29,939  
**Deferred Maintenance:** \$12,255  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$12,657  
**Deferred Maintenance:** \$5,197  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$70,178  
**Deferred Maintenance:** \$7,824  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,111  
**Deferred Maintenance:** \$1,821  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,111  
**Deferred Maintenance:** \$1,927  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,111  
**Deferred Maintenance:** \$2,518  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,111  
**Deferred Maintenance:** \$1,821  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,111  
**Deferred Maintenance:** \$2,518  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,111  
**Deferred Maintenance:** \$2,518  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,003  
**Deferred Maintenance:** \$2,284  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900206230	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,003
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8501 PETERSON RD	<b>Deferred Maintenance:</b>	\$2,290
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	COOK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206240	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,003
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8501 PETERSON RD	<b>Deferred Maintenance:</b>	\$1,427
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	COOK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206250	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,003
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8501 PETERSON RD	<b>Deferred Maintenance:</b>	\$1,699
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	COOK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206260	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,003
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	8501 PETERSON RD	<b>Deferred Maintenance:</b>	\$1,699
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	COOK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206390	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,183
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$2,237
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206400	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$10,183
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	1379 STUNTZ BAY RD	<b>Deferred Maintenance:</b>	\$2,370
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	SOUDAN	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207140	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$13,728
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	CO RD 422	<b>Deferred Maintenance:</b>	\$4,530
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	COOK	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207160	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$13,728
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	8730 HWY 53	<b>Deferred Maintenance:</b>	\$4,530
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	ORR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207170	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$13,728
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	4656 HWY 53	<b>Deferred Maintenance:</b>	\$10,296
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	ORR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207260	<b>Cost Model Name:</b>	Tower	<b>Current Replacement Value:</b>	\$13,728
<b>Building Name:</b>	Fire Tower	<b>Address:</b>	4656 HWY 53	<b>Deferred Maintenance:</b>	\$10,296
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	ORR	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207440	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$34,563
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	8501 PETERSON RD	<b>Deferred Maintenance:</b>	\$12,606
<b>Facility Condition Index:</b>	0.36 - Poor	<b>City Code:</b>	COOK	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900208390  
**Building Name:** Spring House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 8501 PETERSON RD  
**City Code:** COOK

**Current Replacement Value:** \$11,739  
**Deferred Maintenance:** \$1,130  
**Ext. Gross Area:** 0

**Building Code:** R2900208610  
**Building Name:** Shed  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 1379 STUNTZ BAY RD  
**City Code:** SOUDAN

**Current Replacement Value:** \$20,478  
**Deferred Maintenance:** \$2,188  
**Ext. Gross Area:** 0

**Site: R290095 - Finland State Forest**

**Building Code:** R2900206160  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$1,940  
**Ext. Gross Area:** 0

**Building Code:** R2900206170  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$2,576  
**Ext. Gross Area:** 0

**Building Code:** R2900206180  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$1,940  
**Ext. Gross Area:** 0

**Building Code:** R2900206190  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$2,576  
**Ext. Gross Area:** 0

**Building Code:** R2900206200  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$1,940  
**Ext. Gross Area:** 0

**Building Code:** R2900206210  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$2,576  
**Ext. Gross Area:** 0

**Building Code:** R2900206410  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$2,508  
**Ext. Gross Area:** 0

**Building Code:** R2900206420  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 6253 SULLIVAN LAKE RD  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$10,818  
**Deferred Maintenance:** \$1,526  
**Ext. Gross Area:** 0

**Building Code:** R2900207230  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$18,492  
**Deferred Maintenance:** \$6,102  
**Ext. Gross Area:** 0



**Building Code:** R2900207780  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 6253 SULLIVAN LAKE RD  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$15,067  
**Deferred Maintenance:** \$1,080  
**Ext. Gross Area:** 0

**Building Code:** R2900208040  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 5702 HWY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$12,556  
**Deferred Maintenance:** \$2,551  
**Ext. Gross Area:** 0

**Building Code:** R2900208290  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$12,556  
**Deferred Maintenance:** \$900  
**Ext. Gross Area:** 0

**Site: R290096 - Cloquet Valley State Forest**

**Building Code:** R2900206430  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 2147 INDIAN LAKE RD, BRIMSON  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$10,973  
**Deferred Maintenance:** \$1,572  
**Ext. Gross Area:** 0

**Building Code:** R2900206440  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 2147 INDIAN LAKE RD, BRIMSON  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$10,973  
**Deferred Maintenance:** \$1,572  
**Ext. Gross Area:** 0

**Building Code:** R2900207770  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 2147 INDIAN LAKE RD, BRIMSON  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$15,067  
**Deferred Maintenance:** \$1,080  
**Ext. Gross Area:** 0

**Site: R290097 - St Croix Valley State Forest**

**Building Code:** R2900306630  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$11,680  
**Deferred Maintenance:** \$1,555  
**Ext. Gross Area:** 0

**Building Code:** R2900306640  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$11,680  
**Deferred Maintenance:** \$3,227  
**Ext. Gross Area:** 0

**Building Code:** R2900306650  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$11,680  
**Deferred Maintenance:** \$2,521  
**Ext. Gross Area:** 0

**Building Code:** R2900306660  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$11,680  
**Deferred Maintenance:** \$2,521  
**Ext. Gross Area:** 0

**Building Code:** R2900307520  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.45 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$7,982  
**Deferred Maintenance:** \$3,565  
**Ext. Gross Area:** 0

**Building Code:** R2900307530  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$12,656  
**Deferred Maintenance:** \$1,266  
**Ext. Gross Area:** 0

**Building Code:** R2900307540  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$29,443  
**Deferred Maintenance:** \$4,791  
**Ext. Gross Area:** 0

**Building Code:** R2900307790  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$12,656  
**Deferred Maintenance:** \$2,420  
**Ext. Gross Area:** 0

**Building Code:** R2900307800  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$12,656  
**Deferred Maintenance:** \$1,672  
**Ext. Gross Area:** 0

**Building Code:** R2900307810  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$12,656  
**Deferred Maintenance:** \$2,420  
**Ext. Gross Area:** 0

**Building Code:** R2900307820  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** TAMARACK FOREST RD  
**City Code:** HINCKLEY

**Current Replacement Value:** \$12,656  
**Deferred Maintenance:** \$2,420  
**Ext. Gross Area:** 0

**Site: R290098 - Chengwatana State Forest**

**Building Code:** R2900307550  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$8,742  
**Deferred Maintenance:** \$1,638  
**Ext. Gross Area:** 0

**Building Code:** R2900307560  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$13,897  
**Deferred Maintenance:** \$996  
**Ext. Gross Area:** 0

**Building Code:** R2900307570  
**Building Name:** DISPOSED - Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$8,814  
**Deferred Maintenance:** \$1,900  
**Ext. Gross Area:** 0

**Building Code:** R2900307580  
**Building Name:** DISPOSED - Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$8,814  
**Deferred Maintenance:** \$1,659  
**Ext. Gross Area:** 0

**Building Code:** R2900308520  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 39797 PARK TRAIL  
**City Code:** CENTER CITY

**Current Replacement Value:** \$25,913  
**Deferred Maintenance:** \$518  
**Ext. Gross Area:** 0

**Site: R290099 - Beltrami Island State Forest**

**Building Code:** R2900104010  
**Building Name:** Bemis Hill Well House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 48990 CO RD 4  
**City Code:** ROSEAU

**Current Replacement Value:** \$16,722  
**Deferred Maintenance:** \$1,672  
**Ext. Gross Area:** 0

**Building Code:** R2900104020  
**Building Name:** Bemis Hill Trails Center  
**Facility Condition Index:** 0.50 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 48990 CO RD 4  
**City Code:** ROSEAU

**Current Replacement Value:** \$144,197  
**Deferred Maintenance:** \$71,983  
**Ext. Gross Area:** 0

**Building Code:** R2900105540  
**Building Name:** DISPOSED - Fire Tower  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Tower  
**Address:** CLEAR RIVER  
**City Code:** WARROAD

**Current Replacement Value:** \$17,012  
**Deferred Maintenance:** \$12,759  
**Ext. Gross Area:** 0

**Building Code:** R2900105550  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Tower  
**Address:** FAUNCE  
**City Code:** WILLIAMS

**Current Replacement Value:** \$17,752  
**Deferred Maintenance:** \$13,314  
**Ext. Gross Area:** 0

**Building Code:** R2900105640  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** NORRIS  
**City Code:** WARROAD

**Current Replacement Value:** \$17,012  
**Deferred Maintenance:** \$5,614  
**Ext. Gross Area:** 0

**Building Code:** R2900106500  
**Building Name:** Bemis Hill Vault 1  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 48990 CO RD 4  
**City Code:** ROSEAU

**Current Replacement Value:** \$13,647  
**Deferred Maintenance:** \$2,562  
**Ext. Gross Area:** 0

**Building Code:** R2900106510  
**Building Name:** Bemis Hill Vault 2  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 48990 CO RD 4  
**City Code:** ROSEAU

**Current Replacement Value:** \$13,647  
**Deferred Maintenance:** \$4,435  
**Ext. Gross Area:** 0

**Building Code:** R2900107440  
**Building Name:** Blueberry Hill Vault  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$14,240  
**Deferred Maintenance:** \$1,862  
**Ext. Gross Area:** 0

**Building Code:** R2900107450  
**Building Name:** Faunce Campground Vault  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$13,368  
**Deferred Maintenance:** \$3,306  
**Ext. Gross Area:** 0

**Site: R290100 - General Andrews State Forest**

<b>Building Code:</b>	R2900300160	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$177,567
<b>Building Name:</b>	Tin Pole	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$105,711
<b>Facility Condition Index:</b>	0.60 - <b>Crisis</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	3,258
<b>Building Code:</b>	R2900300170	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$172,640
<b>Building Name:</b>	Fertilizer Building	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$118,028
<b>Facility Condition Index:</b>	0.68 - <b>Crisis</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	2,040
<b>Building Code:</b>	R2900300180	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$265,816
<b>Building Name:</b>	Greenhouse	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$65,230
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	1,844
<b>Building Code:</b>	R2900300190	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$4,592,336
<b>Building Name:</b>	General Andrews SF Shop	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$1,787,178
<b>Facility Condition Index:</b>	0.39 - <b>Poor</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	29,330
<b>Building Code:</b>	R2900300200	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,941,846
<b>Building Name:</b>	Cement Seedling Pack House	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$713,473
<b>Facility Condition Index:</b>	0.37 - <b>Poor</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	12,927
<b>Building Code:</b>	R2900300220	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$30,468
<b>Building Name:</b>	F Block Pump House	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$6,252
<b>Facility Condition Index:</b>	0.21 - <b>Average</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	332
<b>Building Code:</b>	R2900300230	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$50,648
<b>Building Name:</b>	2 Stall Garage	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$16,205
<b>Facility Condition Index:</b>	0.32 - <b>Poor</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	480
<b>Building Code:</b>	R2900300240	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$595,375
<b>Building Name:</b>	Metal Seedling Pack House	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$93,217
<b>Facility Condition Index:</b>	0.16 - <b>Average</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	4,466
<b>Building Code:</b>	R2900300250	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$462,857
<b>Building Name:</b>	General Andrews SF Office	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$131,538
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	4,417
<b>Building Code:</b>	R2900303190	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$614,704
<b>Building Name:</b>	South Garage	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$234,493
<b>Facility Condition Index:</b>	0.38 - <b>Poor</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	4,228
<b>Building Code:</b>	R2900303730	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$78,490
<b>Building Name:</b>	Shop Pump House	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$20,337
<b>Facility Condition Index:</b>	0.26 - <b>Average</b>	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	224

<b>Building Code:</b>	R2900303810	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$15,247
<b>Building Name:</b>	Oil House	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$1,737
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	96
<b>Building Code:</b>	R2900303980	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$201,776
<b>Building Name:</b>	Machine Shed	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$63,647
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	3,303
<b>Building Code:</b>	R2900304210	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$35,757
<b>Building Name:</b>	Lumber Shed	<b>Address:</b>	85894 CO HWY 61	<b>Deferred Maintenance:</b>	\$9,495
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	WILLOW RIVER	<b>Ext. Gross Area:</b>	650
<b>Building Code:</b>	R2900307030	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,636
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$894
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307040	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,636
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$686
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307050	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,928
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$706
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307060	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,928
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$2,167
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307070	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,928
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$2,648
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307080	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,928
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$1,123
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307090	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,928
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$706
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30
<b>Building Code:</b>	R2900307100	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$9,928
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	61101 BANNING PARK RD	<b>Deferred Maintenance:</b>	\$706
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	SANDSTONE	<b>Ext. Gross Area:</b>	30

**Building Code:** R2900307660  
**Building Name:** Walk-in-Freezer  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 85894 CO HWY 61  
**City Code:** WILLOW RIVER

**Current Replacement Value:** \$454,834  
**Deferred Maintenance:** \$9,568  
**Ext. Gross Area:** 3,062

**Site: R290101 - Bemidji Glidden**

**Building Code:** R2900100950  
**Building Name:** Bemidji Glidden Shop  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7902 GLIDDEN RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$200,861  
**Deferred Maintenance:** \$61,879  
**Ext. Gross Area:** 1,171

**Building Code:** R2900100960  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7902 GLIDDEN RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$297,097  
**Deferred Maintenance:** \$52,236  
**Ext. Gross Area:** 6,000

**Building Code:** R2900104670  
**Building Name:** Oil House  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 7902 GLIDDEN RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$4,776  
**Deferred Maintenance:** \$1,576  
**Ext. Gross Area:** 57

**Site: R290102 - Bagley**

**Building Code:** R2900103340  
**Building Name:** 4 Stall Storage  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 36452 STATE 92  
**City Code:** BAGLEY

**Current Replacement Value:** \$98,487  
**Deferred Maintenance:** \$19,113  
**Ext. Gross Area:** 0

**Building Code:** R2900103360  
**Building Name:** Bagley Shop Office  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 36452 STATE 92  
**City Code:** BAGLEY

**Current Replacement Value:** \$337,309  
**Deferred Maintenance:** \$68,302  
**Ext. Gross Area:** 0

**Building Code:** R2900103480  
**Building Name:** Bagley Office  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 36452 STATE 92  
**City Code:** BAGLEY

**Current Replacement Value:** \$287,795  
**Deferred Maintenance:** \$50,088  
**Ext. Gross Area:** 0

**Building Code:** R2900106720  
**Building Name:** Pump House  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 36452 STATE 92  
**City Code:** BAGLEY

**Current Replacement Value:** \$7,030  
**Deferred Maintenance:** \$1,278  
**Ext. Gross Area:** 0

**Building Code:** R2900107780  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 36452 STATE 92  
**City Code:** BAGLEY

**Current Replacement Value:** \$61,845  
**Deferred Maintenance:** \$6,184  
**Ext. Gross Area:** 0

**Site: R290103 - Pine Island State Forest**

**Building Code:** R2900103700  
**Building Name:** Lost River Cabin  
**Facility Condition Index:** 0.49 - **Poor**

**Cost Model Name:** Single-family Residence  
**Address:** 10.5 mi. E. of State 72 Lost River Road  
**City Code:** KELLIHER

**Current Replacement Value:** \$45,296  
**Deferred Maintenance:** \$22,155  
**Ext. Gross Area:** 0

**Site: R290104 - Land O'Lakes State Forest**

**Building Code:** R2900108190  
**Building Name:** Site 1 Vault  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** Washburn Lake solitude area  
**City Code:** BRAINERD

**Current Replacement Value:** \$12,986  
**Deferred Maintenance:** \$3,224  
**Ext. Gross Area:** 39

**Building Code:** R2900108200  
**Building Name:** Site 8 Vault  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** C/o CUYUNA COUNTRY SRA 307 3RD  
**City Code:** IRONTON

**Current Replacement Value:** \$12,950  
**Deferred Maintenance:** \$3,215  
**Ext. Gross Area:** 0

**Building Code:** R2900108210  
**Building Name:** Site 18 Vault  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** C/o CUYUNA COUNTRY SRA 307 3RD  
**City Code:** IRONTON

**Current Replacement Value:** \$10,814  
**Deferred Maintenance:** \$2,686  
**Ext. Gross Area:** 0

**Building Code:** R2900108220  
**Building Name:** Site 30 Vault  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** C/o CUYUNA COUNTRY SRA 307 3RD  
**City Code:** IRONTON

**Current Replacement Value:** \$12,950  
**Deferred Maintenance:** \$3,215  
**Ext. Gross Area:** 0

**Building Code:** R2900108230  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** C/o CUYUNA COUNTRY SRA 307 3RD  
**City Code:** IRONTON

**Current Replacement Value:** \$9,688  
**Deferred Maintenance:** \$2,819  
**Ext. Gross Area:** 0

**Building Code:** R2900300610  
**Building Name:** Land O'Lakes SF-Washburn Lake  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1145 STATE 6 NE  
**City Code:** OUTING

**Current Replacement Value:** \$439,187  
**Deferred Maintenance:** \$162,200  
**Ext. Gross Area:** 0

**Building Code:** R2900303270  
**Building Name:** Oil House  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 1145 STATE 6 NE  
**City Code:** OUTING

**Current Replacement Value:** \$11,100  
**Deferred Maintenance:** \$1,558  
**Ext. Gross Area:** 0

**Building Code:** R2900305500  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Tower  
**Address:** BEN DRAPER  
**City Code:** BRAINERD

**Current Replacement Value:** \$10,225  
**Deferred Maintenance:** \$7,669  
**Ext. Gross Area:** 0

**Building Code:** R2900306600  
**Building Name:** Baker Lake Vault  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** Draper Rd ATV Trail  
**City Code:** BRAINERD

**Current Replacement Value:** \$12,950  
**Deferred Maintenance:** \$2,994  
**Ext. Gross Area:** 39

**Site: R290105 - Lac Qui Parle WMA**



<b>Building Code:</b>	R2900402010	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$594,162
<b>Building Name:</b>	Lac Qui Parle WMA Shop	<b>Address:</b>	1407 20TH ST NW	<b>Deferred Maintenance:</b>	\$230,280
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	2,424
<b>Building Code:</b>	R2900402080	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$140,516
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$47,016
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	1,536
<b>Building Code:</b>	R2900402090	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$1,027,915
<b>Building Name:</b>	Residence	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$306,287
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	3,224
<b>Building Code:</b>	R2900402670	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$358,366
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$118,261
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	7,040
<b>Building Code:</b>	R2900403790	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$20,511
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$6,768
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900404110	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,166,239
<b>Building Name:</b>	Lac Qui Parle WMA Main Office	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$146,342
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	3,670
<b>Building Code:</b>	R2900404120	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$109,696
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$38,679
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	612
<b>Building Code:</b>	R2900404130	<b>Cost Model Name:</b>	Single-story Restroom Facility	<b>Current Replacement Value:</b>	\$42,315
<b>Building Name:</b>	Sanitation	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$13,964
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	270
<b>Building Code:</b>	R2900404600	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$259,413
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$25,941
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	2,880
<b>Building Code:</b>	R2900404620	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$21,565
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$15,194
<b>Facility Condition Index:</b>	0.70 - Crisis	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	144
<b>Building Code:</b>	R2900405080	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$44,481
<b>Building Name:</b>	Garage	<b>Address:</b>	14047 20TH ST NW	<b>Deferred Maintenance:</b>	\$3,017
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	WATSON	<b>Ext. Gross Area:</b>	592

Site: R290106 - Red Lake WMA

<b>Building Code:</b>	R2900100230	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$328,285
<b>Building Name:</b>	Residence - Remote	<b>Address:</b>	2879 N ROOSEVELT RD	<b>Deferred Maintenance:</b>	\$46,198
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100240	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$474,851
<b>Building Name:</b>	Residence - Onsite	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$129,759
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100280	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$208,531
<b>Building Name:</b>	Red Lake WMA Shop	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$48,754
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100320	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$139,024
<b>Building Name:</b>	CCC Sanitation	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$58,880
<b>Facility Condition Index:</b>	0.42 - Poor	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100330	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,461
<b>Building Name:</b>	Garbage Shed	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$6,986
<b>Facility Condition Index:</b>	0.61 - Crisis	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100340	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$634,148
<b>Building Name:</b>	Red Lake WMA Office	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$204,459
<b>Facility Condition Index:</b>	0.32 - Poor	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100350	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$308,135
<b>Building Name:</b>	Dining Hall	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$190,224
<b>Facility Condition Index:</b>	0.62 - Crisis	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100360	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$51,428
<b>Building Name:</b>	BlackSmith	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$38,571
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100370	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$62,862
<b>Building Name:</b>	Pump House	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$24,268
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100380	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$192,899
<b>Building Name:</b>	Old CCC shop	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$118,646
<b>Facility Condition Index:</b>	0.62 - Crisis	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100390	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$217,993
<b>Building Name:</b>	Wolf Shack	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$116,428
<b>Facility Condition Index:</b>	0.53 - Crisis	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900100420	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$119,835
<b>Building Name:</b>	Cabin	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$75,504
<b>Facility Condition Index:</b>	0.63 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100430	<b>Cost Model Name:</b>	Single-story Hotel/Dorm	<b>Current Replacement Value:</b>	\$371,313
<b>Building Name:</b>	Duplex	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$44,162
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100440	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,536
<b>Building Name:</b>	Oil House	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$8,652
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100450	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$66,831
<b>Building Name:</b>	Northwest Garage	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$41,692
<b>Facility Condition Index:</b>	0.62 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100460	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$225,467
<b>Building Name:</b>	Assistant Managers Garage	<b>Address:</b>	2879 N ROOSEVELT RD	<b>Deferred Maintenance:</b>	\$4,509
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100830	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$433,815
<b>Building Name:</b>	CCC Rec Hall	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$122,589
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100840	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$261,485
<b>Building Name:</b>	Tool House	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$93,655
<b>Facility Condition Index:</b>	0.36 - <b>Poor</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100990	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$7,612
<b>Building Name:</b>	Oaks Cabin	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$7,612
<b>Facility Condition Index:</b>	1.00 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101060	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$14,524
<b>Building Name:</b>	Gates Corner Cabin	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$9,852
<b>Facility Condition Index:</b>	0.68 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101080	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$21,215
<b>Building Name:</b>	Blue Kettle Trail Cabin	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$12,665
<b>Facility Condition Index:</b>	0.60 - <b>Crisis</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104370	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$140,217
<b>Building Name:</b>	Metal Building	<b>Address:</b>	11536 FAUNCE BUTTERFIELD RD SW	<b>Deferred Maintenance:</b>	\$34,895
<b>Facility Condition Index:</b>	0.25 - <b>Average</b>	<b>City Code:</b>	WILLIAMS	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900105210  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 11536 FAUNCE BUTTERFIELD RD SW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$28,533  
**Deferred Maintenance:** \$571  
**Ext. Gross Area:** 0

**Building Code:** R2900106570  
**Building Name:** Gas Building  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 11536 FAUNCE BUTTERFIELD RD SW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$57,712  
**Deferred Maintenance:** \$6,412  
**Ext. Gross Area:** 0

**Site: R290107 - Roseau River WMA**

**Building Code:** R2900100080  
**Building Name:** Wildlife Research Metal Shed  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$17,190  
**Deferred Maintenance:** \$12,893  
**Ext. Gross Area:** 0

**Building Code:** R2900100470  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$45,007  
**Deferred Maintenance:** \$900  
**Ext. Gross Area:** 0

**Building Code:** R2900100520  
**Building Name:** Quonset  
**Facility Condition Index:** 0.41 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$465,384  
**Deferred Maintenance:** \$188,932  
**Ext. Gross Area:** 0

**Building Code:** R2900100530  
**Building Name:** Metal Storage Building  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$581,503  
**Deferred Maintenance:** \$64,482  
**Ext. Gross Area:** 0

**Building Code:** R2900100540  
**Building Name:** Roseau River WMA Office  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$549,668  
**Deferred Maintenance:** \$141,824  
**Ext. Gross Area:** 0

**Building Code:** R2900100550  
**Building Name:** Roseau River WMA Shop  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$728,395  
**Deferred Maintenance:** \$234,423  
**Ext. Gross Area:** 0

**Building Code:** R2900100560  
**Building Name:** Residence Near Office  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$910,181  
**Deferred Maintenance:** \$178,084  
**Ext. Gross Area:** 0

**Building Code:** R2900100570  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$45,007  
**Deferred Maintenance:** \$4,501  
**Ext. Gross Area:** 0

**Building Code:** R2900101100  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 27952 400TH ST  
**City Code:** ROSEAU

**Current Replacement Value:** \$19,791  
**Deferred Maintenance:** \$14,843  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900103800	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$858,620
<b>Building Name:</b>	Residence	<b>Address:</b>	27909 400TH ST	<b>Deferred Maintenance:</b>	\$60,427
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104460	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,989
<b>Building Name:</b>	Office Site Pump House	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$1,119
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105200	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,312
<b>Building Name:</b>	Pump House	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$3,518
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105300	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$49,101
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$4,910
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105310	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$24,551
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$2,455
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105320	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$247,629
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$24,763
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105330	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$5,353
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$2,832
<b>Facility Condition Index:</b>	0.53 - Crisis	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107670	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$18,713
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	27952 400TH ST	<b>Deferred Maintenance:</b>	\$6,175
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	ROSEAU	<b>Ext. Gross Area:</b>	0

**Site: R290108 - Thief Lake WMA**

<b>Building Code:</b>	R2900100260	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$8,794
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$2,539
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100670	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$703,416
<b>Building Name:</b>	Thief Lake WMA Barracks Office	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$211,347
<b>Facility Condition Index:</b>	0.30 - Poor	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100680	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$748,454
<b>Building Name:</b>	Log Residence	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$85,041
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900100690	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$400,585
<b>Building Name:</b>	Residence Near Dam	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$42,001
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100710	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$40,988
<b>Building Name:</b>	Garage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$30,741
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100730	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$17,595
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$352
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100740	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$17,595
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$352
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100750	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$35,190
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$704
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100760	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$29,876
<b>Building Name:</b>	Garage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$22,407
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100810	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$386,925
<b>Building Name:</b>	Thief Lake WMA Office	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$82,916
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900100820	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$60,971
<b>Building Name:</b>	Pump House	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$8,074
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900104610	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$833,291
<b>Building Name:</b>	Thief Lake WMA Shop	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$46,041
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105070	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$11,590
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$8,693
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900105080	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$35,190
<b>Building Name:</b>	Granary Storage	<b>Address:</b>	42280 240TH AVE NE	<b>Deferred Maintenance:</b>	\$704
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	MIDDLE RIVER	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900107420  
**Building Name:** Garage Next to Farm Residence  
**Facility Condition Index:** 0.69 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$66,673  
**Deferred Maintenance:** \$46,079  
**Ext. Gross Area:** 0

**Building Code:** R2900107430  
**Building Name:** Residence At Farm  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$609,894  
**Deferred Maintenance:** \$157,966  
**Ext. Gross Area:** 0

**Building Code:** R2900107490  
**Building Name:** Barn  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$382,462  
**Deferred Maintenance:** \$138,550  
**Ext. Gross Area:** 0

**Building Code:** R2900107500  
**Building Name:** Quonset  
**Facility Condition Index:** 0.45 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$155,939  
**Deferred Maintenance:** \$70,057  
**Ext. Gross Area:** 0

**Building Code:** R2900107510  
**Building Name:** Oil House  
**Facility Condition Index:** 0.57 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$13,696  
**Deferred Maintenance:** \$7,789  
**Ext. Gross Area:** 0

**Building Code:** R2900107520  
**Building Name:** Barn Silo  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$40,479  
**Deferred Maintenance:** \$13,358  
**Ext. Gross Area:** 0

**Building Code:** R2900107530  
**Building Name:** Metal Building at Farm  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$299,415  
**Deferred Maintenance:** \$52,442  
**Ext. Gross Area:** 0

**Building Code:** R2900107540  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$35,190  
**Deferred Maintenance:** \$704  
**Ext. Gross Area:** 0

**Building Code:** R2900107580  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$31,668  
**Deferred Maintenance:** \$633  
**Ext. Gross Area:** 0

**Building Code:** R2900108830  
**Building Name:** North Vault  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 42280 240TH AVE NE  
**City Code:** MIDDLE RIVER

**Current Replacement Value:** \$15,565  
**Deferred Maintenance:** \$3,856  
**Ext. Gross Area:** 0

**Site: R290109 - Heartland State Trail**

**Building Code:** R2900100050  
**Building Name:** Demolished - Heartland ST Office  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 115 BUNYAN TRAILS DR  
**City Code:** NEVIS

**Current Replacement Value:** \$162,934  
**Deferred Maintenance:** \$57,523  
**Ext. Gross Area:** 0



<b>Building Code:</b>	R2900106740	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$12,654
<b>Building Name:</b>	Nevis Picnic Shelter	<b>Address:</b>	115 BUNYAN TRAILS DR	<b>Deferred Maintenance:</b>	\$1,608
<b>Facility Condition Index:</b>	0.13 - <b>Good</b>	<b>City Code:</b>	NEVIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106750	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$40,492
<b>Building Name:</b>	Dorset Picnic Shelter	<b>Address:</b>	DORSET	<b>Deferred Maintenance:</b>	\$13,362
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	NEVIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106760	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$40,492
<b>Building Name:</b>	Kabakona Picnic Shelter	<b>Address:</b>	KABAKONA	<b>Deferred Maintenance:</b>	\$16,784
<b>Facility Condition Index:</b>	0.41 - <b>Poor</b>	<b>City Code:</b>	NEVIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106770	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$40,492
<b>Building Name:</b>	Akeley Picnic Shelter	<b>Address:</b>	ACKLEY	<b>Deferred Maintenance:</b>	\$16,784
<b>Facility Condition Index:</b>	0.41 - <b>Poor</b>	<b>City Code:</b>	NEVIS	<b>Ext. Gross Area:</b>	0

**Site: R290110 - R J Dorer State Forest**

<b>Building Code:</b>	R2900502700	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,569
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,165
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502710	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,569
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,165
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502720	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,569
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,165
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502730	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,046
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,654
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502740	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$21,026
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	2300 SILVER CREEK RD NE	<b>Deferred Maintenance:</b>	\$4,238
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	ROCHESTER	<b>Ext. Gross Area:</b>	36
<b>Building Code:</b>	R2900502750	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,194
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$24,895
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502760	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,194
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$24,895
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900502770	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,891
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,845
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502780	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,046
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,061
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502800	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,672
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$14,004
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502810	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$18,672
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$14,004
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503350	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$28,991
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$10,251
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503360	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$41,837
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$10,955
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503370	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$28,991
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$9,525
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503660	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$25,578
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$9,457
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503820	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,894
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$3,259
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503830	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,093
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,236
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503840	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,093
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$4,076
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900503850	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$73,051
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$5,398
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504790	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,194
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$10,954
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504810	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$7,732
<b>Building Name:</b>	Picnic Shelter 1	<b>Address:</b>	2300 SILVER CREEK RD NE	<b>Deferred Maintenance:</b>	\$1,729
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	ROCHESTER	<b>Ext. Gross Area:</b>	430
<b>Building Code:</b>	R2900504870	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$26,451
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$529
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504880	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$14,822
<b>Building Name:</b>	Adirondack	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$1,654
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504890	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$13,022
<b>Building Name:</b>	Adirondack	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$2,209
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504900	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$24,517
<b>Building Name:</b>	Adirondack	<b>Address:</b>	15954 CO RD 1	<b>Deferred Maintenance:</b>	\$2,925
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	CALEDONIA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504940	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$20,046
<b>Building Name:</b>	Vault Toilet	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$3,174
<b>Facility Condition Index:</b>	0.16 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504950	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,194
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$3,319
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504960	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$33,194
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$3,319
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505370	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,506
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	29223 CO 28 BLVD	<b>Deferred Maintenance:</b>	\$250
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900505480  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$25,113  
**Deferred Maintenance:** \$2,511  
**Ext. Gross Area:** 0

**Building Code:** R2900505500  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$27,729  
**Deferred Maintenance:** \$2,773  
**Ext. Gross Area:** 0

**Site: R290111 - Crow Wing State Forest**

**Building Code:** R2900305480  
**Building Name:** Fish Cleaning House  
**Facility Condition Index:** 0.64 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 17447 GREER LAKE RD  
**City Code:** CROSBY

**Current Replacement Value:** \$19,338  
**Deferred Maintenance:** \$12,430  
**Ext. Gross Area:** 0

**Building Code:** R2900305490  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 17447 GREER LAKE RD  
**City Code:** CROSBY

**Current Replacement Value:** \$3,930  
**Deferred Maintenance:** \$879  
**Ext. Gross Area:** 0

**Building Code:** R2900308330  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 17447 GREER LAKE RD  
**City Code:** CROSBY

**Current Replacement Value:** \$17,929  
**Deferred Maintenance:** \$359  
**Ext. Gross Area:** 0

**Building Code:** R2900308340  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 17447 GREER LAKE RD  
**City Code:** CROSBY

**Current Replacement Value:** \$27,709  
**Deferred Maintenance:** \$554  
**Ext. Gross Area:** 0

**Building Code:** R2900308350  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 17447 GREER LAKE RD  
**City Code:** CROSBY

**Current Replacement Value:** \$17,929  
**Deferred Maintenance:** \$359  
**Ext. Gross Area:** 0

**Building Code:** R2900308360  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 17447 GREER LAKE RD  
**City Code:** CROSBY

**Current Replacement Value:** \$17,929  
**Deferred Maintenance:** \$359  
**Ext. Gross Area:** 0

**Site: R290112 - Bowstring State Forest**

**Building Code:** R2900206310  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 880 GARY ST  
**City Code:** CALUMET

**Current Replacement Value:** \$9,656  
**Deferred Maintenance:** \$2,408  
**Ext. Gross Area:** 0

**Building Code:** R2900206320  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 880 GARY ST  
**City Code:** CALUMET

**Current Replacement Value:** \$9,656  
**Deferred Maintenance:** \$2,408  
**Ext. Gross Area:** 0

**Building Code:** R2900208300  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 880 GARY ST  
**City Code:** CALUMET

**Current Replacement Value:** \$9,519  
**Deferred Maintenance:** \$2,368  
**Ext. Gross Area:** 0

**Site: R290114 - Grand Portage State Forest**

**Building Code:** R2900207800  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 1127 ESTER LAKE RD  
**City Code:** HOVLAND

**Current Replacement Value:** \$15,426  
**Deferred Maintenance:** \$3,823  
**Ext. Gross Area:** 0

**Building Code:** R2900207810  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 3505 ARROWHEAD TRAIL  
**City Code:** HOVLAND

**Current Replacement Value:** \$15,426  
**Deferred Maintenance:** \$3,320  
**Ext. Gross Area:** 0

**Building Code:** R2900207820  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** 951 ESTER LAKE RD  
**City Code:** HOVLAND

**Current Replacement Value:** \$15,426  
**Deferred Maintenance:** \$1,518  
**Ext. Gross Area:** 0

**Site: R290115 - R1 HQ Bemidji**

**Building Code:** R2900100010  
**Building Name:** Bemidji R1 HQ Main Office  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$2,348,485  
**Deferred Maintenance:** \$486,943  
**Ext. Gross Area:** 8,883

**Building Code:** R2900100020  
**Building Name:** Enforcement Garage  
**Facility Condition Index:** 0.09 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$51,695  
**Deferred Maintenance:** \$4,661  
**Ext. Gross Area:** 885

**Building Code:** R2900104350  
**Building Name:** Bemidji R1 HQ Shop  
**Facility Condition Index:** 0.15 - *Average*

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$1,881,854  
**Deferred Maintenance:** \$290,428  
**Ext. Gross Area:** 13,029

**Building Code:** R2900105250  
**Building Name:** Hazardous Mat Storage  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$38,505  
**Deferred Maintenance:** \$12,707  
**Ext. Gross Area:** 217

**Building Code:** R2900105260  
**Building Name:** Hazardous Mat Storage  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$6,697  
**Deferred Maintenance:** \$2,210  
**Ext. Gross Area:** 35

**Building Code:** R2900105270  
**Building Name:** Bemidji R1 HQ CCM Office  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$354,008  
**Deferred Maintenance:** \$49,327  
**Ext. Gross Area:** 2,846

**Building Code:** R2900107240  
**Building Name:** Bemidji R1 HQ Annex Office  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2115 BIRCHMONT BEACH RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$981,047  
**Deferred Maintenance:** \$144,895  
**Ext. Gross Area:** 5,741

**Site: R290116 - Whitewater WMA**

**Building Code:** R2900500130  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$162,613  
**Deferred Maintenance:** \$30,219  
**Ext. Gross Area:** 0

**Building Code:** R2900500150  
**Building Name:** Whitewater WMA Shop  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$491,859  
**Deferred Maintenance:** \$128,692  
**Ext. Gross Area:** 0

**Building Code:** R2900500160  
**Building Name:** Whitewater WMA Main Office  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$564,076  
**Deferred Maintenance:** \$57,348  
**Ext. Gross Area:** 0

**Building Code:** R2900500190  
**Building Name:** Oil House  
**Facility Condition Index:** 0.61 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$15,349  
**Deferred Maintenance:** \$9,319  
**Ext. Gross Area:** 0

**Building Code:** R2900502010  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$120,709  
**Deferred Maintenance:** \$44,948  
**Ext. Gross Area:** 0

**Building Code:** R2900502130  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$58,700  
**Deferred Maintenance:** \$21,944  
**Ext. Gross Area:** 0

**Building Code:** R2900503190  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$15,549  
**Deferred Maintenance:** \$5,131  
**Ext. Gross Area:** 0

**Building Code:** R2900503200  
**Building Name:** Marnack House  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Bunker  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$623,839  
**Deferred Maintenance:** \$108,507  
**Ext. Gross Area:** 0

**Building Code:** R2900503340  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.69 - **Crisis**

**Cost Model Name:** Tower  
**Address:** 19041 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$20,538  
**Deferred Maintenance:** \$14,147  
**Ext. Gross Area:** 0

**Building Code:** R2900504750  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 15035 HWY 74  
**City Code:** ALTURA

**Current Replacement Value:** \$463,911  
**Deferred Maintenance:** \$33,483  
**Ext. Gross Area:** 0

**Site: R290117 - Twin Lakes WMA**

**Building Code:** R2900104530  
**Building Name:** Heated Storage  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1&1/2 mi. E. of Karlstad Hwy. 11  
**City Code:** KARLSTAD

**Current Replacement Value:** \$256,346  
**Deferred Maintenance:** \$70,996  
**Ext. Gross Area:** 0

**Site: R290118 - Franz Jevne State Park**

**Building Code:** R2900107050  
**Building Name:** Entry Vault  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$14,315  
**Deferred Maintenance:** \$3,551  
**Ext. Gross Area:** 0

**Building Code:** R2900107060  
**Building Name:** Rapid Trail Vault  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$14,315  
**Deferred Maintenance:** \$3,551  
**Ext. Gross Area:** 0

**Building Code:** R2900107070  
**Building Name:** Site 8 Vault  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$14,315  
**Deferred Maintenance:** \$3,551  
**Ext. Gross Area:** 0

**Building Code:** R2900107080  
**Building Name:** Camp Picnic Shelter  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$4,221  
**Deferred Maintenance:** \$422  
**Ext. Gross Area:** 0

**Building Code:** R2900107090  
**Building Name:** Site 7 Shelter  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$4,221  
**Deferred Maintenance:** \$422  
**Ext. Gross Area:** 0

**Building Code:** R2900107100  
**Building Name:** Site 8 Shelter  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$4,221  
**Deferred Maintenance:** \$422  
**Ext. Gross Area:** 0

**Building Code:** R2900107110  
**Building Name:** Site 9 Shelter  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$4,221  
**Deferred Maintenance:** \$422  
**Ext. Gross Area:** 0

**Building Code:** R2900107120  
**Building Name:** Site 10 Shelter  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$4,221  
**Deferred Maintenance:** \$422  
**Ext. Gross Area:** 0

**Building Code:** R2900107130  
**Building Name:** Site 12 Shelter  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$4,221  
**Deferred Maintenance:** \$422  
**Ext. Gross Area:** 0



**Building Code:** R2900107140  
**Building Name:** Picnic Shelter  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 3684 54TH AVE NW  
**City Code:** WILLIAMS

**Current Replacement Value:** \$24,169  
**Deferred Maintenance:** \$2,417  
**Ext. Gross Area:** 0

**Site: R290119 - Elysian**

**Building Code:** R2900402930  
**Building Name:** Trails Center  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 101 4TH ST SW  
**City Code:** ELYSIAN

**Current Replacement Value:** \$318,911  
**Deferred Maintenance:** \$73,407  
**Ext. Gross Area:** 0

**Building Code:** R2900404060  
**Building Name:** Elysian Office  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 101 4TH ST SW  
**City Code:** ELYSIAN

**Current Replacement Value:** \$336,041  
**Deferred Maintenance:** \$37,642  
**Ext. Gross Area:** 0

**Site: R290120 - Spicer**

**Building Code:** R2900401760  
**Building Name:** Pump House  
**Facility Condition Index:** 0.71 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 10590 CO RD 8 NE  
**City Code:** SPICER

**Current Replacement Value:** \$7,322  
**Deferred Maintenance:** \$5,204  
**Ext. Gross Area:** 67

**Building Code:** R2900401780  
**Building Name:** Spicer Office  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 164 CTY RD 8 NE  
**City Code:** SPICER

**Current Replacement Value:** \$884,954  
**Deferred Maintenance:** \$237,650  
**Ext. Gross Area:** 4,608

**Site: R290122 - Floodwood**

**Building Code:** R2900202620  
**Building Name:** Floodwood Office  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 11809 FLOODWOOD RD  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$279,334  
**Deferred Maintenance:** \$70,401  
**Ext. Gross Area:** 0

**Building Code:** R2900202630  
**Building Name:** River Garage  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 307 RAILROAD ST  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$85,037  
**Deferred Maintenance:** \$18,365  
**Ext. Gross Area:** 0

**Building Code:** R2900207120  
**Building Name:** Fire Tower  
**Facility Condition Index:** 1.00 - **Crisis**

**Cost Model Name:** Tower  
**Address:** 306 RAILROAD AVE  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$17,160  
**Deferred Maintenance:** \$17,160  
**Ext. Gross Area:** 0

**Site: R290123 - International Wolf Center**

**Building Code:** R2900207050  
**Building Name:** International Wolf Center  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1396 HWY 169  
**City Code:** ELY

**Current Replacement Value:** \$5,072,146  
**Deferred Maintenance:** \$478,683  
**Ext. Gross Area:** 0

**Building Code:** R2900208590  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1396 HWY 169  
**City Code:** ELY

**Current Replacement Value:** \$63,293  
**Deferred Maintenance:** \$5,543  
**Ext. Gross Area:** 0

**Site: R290124 - State Fairgrounds**

**Building Code:** R2900601890  
**Building Name:** Nature Bldg  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1265 NELSON ST  
**City Code:** ST. PAUL

**Current Replacement Value:** \$253,866  
**Deferred Maintenance:** \$54,437  
**Ext. Gross Area:** 640

**Building Code:** R2900601900  
**Building Name:** DNR Outdoor Stage  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 1251 NELSON ST  
**City Code:** ST. PAUL

**Current Replacement Value:** \$65,322  
**Deferred Maintenance:** \$18,757  
**Ext. Gross Area:** 317

**Building Code:** R2900602040  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Tower  
**Address:** 1765 CARNES AVE  
**City Code:** ST. PAUL

**Current Replacement Value:** \$11,495  
**Deferred Maintenance:** \$3,452  
**Ext. Gross Area:** 121

**Building Code:** R2900602220  
**Building Name:** Fire Prevention Bldg  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1265 SNELLING AVE N  
**City Code:** ST. PAUL

**Current Replacement Value:** \$52,543  
**Deferred Maintenance:** \$1,265  
**Ext. Gross Area:** 301

**Building Code:** R2900602380  
**Building Name:** Cabin  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-family Residence  
**Address:** 1265 SNELLING AVE N  
**City Code:** ST. PAUL

**Current Replacement Value:** \$62,664  
**Deferred Maintenance:** \$1,253  
**Ext. Gross Area:** 334

**Site: R290127 - Hutchinson**

**Building Code:** R2900401810  
**Building Name:** Hutchinson Office  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Recreation Center  
**Address:** 20596 HWY 7  
**City Code:** HUTCHINSON

**Current Replacement Value:** \$3,080,943  
**Deferred Maintenance:** \$502,468  
**Ext. Gross Area:** 17,485

**Building Code:** R2900402850  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.55 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 20596 HWY 7  
**City Code:** HUTCHINSON

**Current Replacement Value:** \$7,911  
**Deferred Maintenance:** \$4,349  
**Ext. Gross Area:** 83

**Site: R290128 - Brainerd**

**Building Code:** R2900303720  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1601 MINNESOTA DR  
**City Code:** BRAINERD

**Current Replacement Value:** \$303,437  
**Deferred Maintenance:** \$71,288  
**Ext. Gross Area:** 1,700

<b>Building Code:</b>	R2900304020	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$8,738,035
<b>Building Name:</b>	Brainerd Office	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$1,081,122
<b>Facility Condition Index:</b>	0.12 - <b>Good</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	38,156
<b>Building Code:</b>	R2900304040	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$970,557
<b>Building Name:</b>	Brainerd Shop	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$203,453
<b>Facility Condition Index:</b>	0.21 - <b>Average</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	11,754
<b>Building Code:</b>	R2900304050	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,136,793
<b>Building Name:</b>	Heated Storage	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$190,168
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	13,351
<b>Building Code:</b>	R2900304060	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,028,657
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$103,536
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	19,878
<b>Building Code:</b>	R2900304070	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$102,208
<b>Building Name:</b>	Central Heat Plant	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$7,553
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	798
<b>Building Code:</b>	R2900305090	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$41,787
<b>Building Name:</b>	Hazardous Mat Storage	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$31,340
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	209
<b>Building Code:</b>	R2900305100	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$5,893
<b>Building Name:</b>	Hazardous Mat Storage	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$4,420
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	34
<b>Building Code:</b>	R2900307650	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$354,490
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1601 MINNESOTA DR	<b>Deferred Maintenance:</b>	\$7,090
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	BRAINERD	<b>Ext. Gross Area:</b>	3,566

**Site: R290129 - Pine River**

<b>Building Code:</b>	R2900300760	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$38,067
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	36765 PIN KNOLLS CR	<b>Deferred Maintenance:</b>	\$8,687
<b>Facility Condition Index:</b>	0.23 - <b>Average</b>	<b>City Code:</b>	JENKINS	<b>Ext. Gross Area:</b>	539
<b>Building Code:</b>	R2900305070	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$24,070
<b>Building Name:</b>	Pine River Contact Station	<b>Address:</b>	36765 PIN KNOLLS CR	<b>Deferred Maintenance:</b>	\$7,599
<b>Facility Condition Index:</b>	0.32 - <b>Poor</b>	<b>City Code:</b>	JENKINS	<b>Ext. Gross Area:</b>	180
<b>Building Code:</b>	R2900305080	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$6,078
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	36765 PIN KNOLLS CR	<b>Deferred Maintenance:</b>	\$2,006
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	JENKINS	<b>Ext. Gross Area:</b>	122

**Site: R290130 - Gull Lake**

**Building Code:** R2900306260  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 5056 NASHWAY RD  
**City Code:** NISSWA

**Current Replacement Value:** \$86,142  
**Deferred Maintenance:** \$7,283  
**Ext. Gross Area:** 272

**Site: R290131 - Badoura State Forest**

**Building Code:** R2900105580  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Tower  
**Address:** 607 W 1ST ST  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$15,977  
**Deferred Maintenance:** \$11,983  
**Ext. Gross Area:** 0

**Building Code:** R2900108160  
**Building Name:** Residence Garage  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$57,207  
**Deferred Maintenance:** \$1,578  
**Ext. Gross Area:** 768

**Building Code:** R2900300010  
**Building Name:** Old Seedling Pack House  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$2,899,740  
**Deferred Maintenance:** \$940,496  
**Ext. Gross Area:** 6,732

**Building Code:** R2900300020  
**Building Name:** Residence  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$295,811  
**Deferred Maintenance:** \$37,449  
**Ext. Gross Area:** 971

**Building Code:** R2900300060  
**Building Name:** Old Carpenters Shop  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$139,142  
**Deferred Maintenance:** \$39,376  
**Ext. Gross Area:** 1,536

**Building Code:** R2900300070  
**Building Name:** Oil House  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$52,090  
**Deferred Maintenance:** \$17,670  
**Ext. Gross Area:** 286

**Building Code:** R2900300080  
**Building Name:** Badoura Office  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$449,578  
**Deferred Maintenance:** \$33,670  
**Ext. Gross Area:** 2,240

**Building Code:** R2900300100  
**Building Name:** Badoura Shop  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$1,033,108  
**Deferred Maintenance:** \$361,489  
**Ext. Gross Area:** 6,043

**Building Code:** R2900300110  
**Building Name:** Two Stall Garage  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 13885 STATE HWY 64  
**City Code:** AKELEY

**Current Replacement Value:** \$132,644  
**Deferred Maintenance:** \$28,836  
**Ext. Gross Area:** 1,059

<b>Building Code:</b>	R2900300120	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$465,769
<b>Building Name:</b>	Cold Storage Ikes Building	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$180,790
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	4,473
<b>Building Code:</b>	R2900300130	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$112,584
<b>Building Name:</b>	Fertilizer Building	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$31,488
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	1,319
<b>Building Code:</b>	R2900300150	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$621,685
<b>Building Name:</b>	Pine Cone Storage	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$183,045
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	5,084
<b>Building Code:</b>	R2900300360	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$217,483
<b>Building Name:</b>	Mamie's Building	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$85,817
<b>Facility Condition Index:</b>	0.39 - Poor	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	1,612
<b>Building Code:</b>	R2900300400	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$63,665
<b>Building Name:</b>	Quonset	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$21,388
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	1,600
<b>Building Code:</b>	R2900303640	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$203,603
<b>Building Name:</b>	Open Cold Storage	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$67,189
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	2,703
<b>Building Code:</b>	R2900304770	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$987,575
<b>Building Name:</b>	Seed Extractory	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$170,743
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	10,118
<b>Building Code:</b>	R2900305800	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,216,174
<b>Building Name:</b>	New Seedling Pack House	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$43,085
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	6,294
<b>Building Code:</b>	R2900305810	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,355
<b>Building Name:</b>	Radio Shelter	<b>Address:</b>	13885 STATE HWY 64	<b>Deferred Maintenance:</b>	\$3,420
<b>Facility Condition Index:</b>	0.37 - Poor	<b>City Code:</b>	AKELEY	<b>Ext. Gross Area:</b>	39

**Site: R290133 - Cambridge**

<b>Building Code:</b>	R2900305190	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$923,373
<b>Building Name:</b>	Cambridge Office	<b>Address:</b>	800 OAK SAVANNA LN SW	<b>Deferred Maintenance:</b>	\$203,264
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	CAMBRIDGE	<b>Ext. Gross Area:</b>	5,000
<b>Building Code:</b>	R2900305200	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$522,312
<b>Building Name:</b>	Cambridge Shop	<b>Address:</b>	800 OAK SAVANNA LN SW	<b>Deferred Maintenance:</b>	\$154,512
<b>Facility Condition Index:</b>	0.30 - Average	<b>City Code:</b>	CAMBRIDGE	<b>Ext. Gross Area:</b>	3,270

**Building Code:** R2900305210  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 800 OAK SAVANNA LN SW  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$160,806  
**Deferred Maintenance:** \$29,997  
**Ext. Gross Area:** 2,715

**Site: R290134 - Dalbo WMA**

**Building Code:** R2900306760  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.53 - *Crisis*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 421ST AVE NW  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$323,398  
**Deferred Maintenance:** \$170,425  
**Ext. Gross Area:** 3,431

**Building Code:** R2900306930  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.53 - *Crisis*

**Cost Model Name:** Single-story Work Facility  
**Address:** 421ST AVE NW  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$2,916,839  
**Deferred Maintenance:** \$1,531,793  
**Ext. Gross Area:** 18,937

**Building Code:** R2900306950  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.48 - *Poor*

**Cost Model Name:** Single-story Work Facility  
**Address:** 421ST AVE NW  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$340,575  
**Deferred Maintenance:** \$164,850  
**Ext. Gross Area:** 3,655

**Site: R290135 - Ruff-Nik WMA**

**Building Code:** R2900307450  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 16543 HAVEN RD  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$188,734  
**Deferred Maintenance:** \$39,904  
**Ext. Gross Area:** 0

**Building Code:** R2900307460  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 16543 HAVEN RD  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$103,740  
**Deferred Maintenance:** \$13,389  
**Ext. Gross Area:** 0

**Building Code:** R2900307470  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.58 - *Crisis*

**Cost Model Name:** Single-story Work Facility  
**Address:** 16543 HAVEN RD  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$122,497  
**Deferred Maintenance:** \$70,675  
**Ext. Gross Area:** 0

**Site: R290136 - Cook**

**Building Code:** R2900203140  
**Building Name:** Cook Office  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 310 2ND ST SE  
**City Code:** COOK

**Current Replacement Value:** \$235,385  
**Deferred Maintenance:** \$39,308  
**Ext. Gross Area:** 0

**Building Code:** R2900203150  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 310 2ND ST SE  
**City Code:** COOK

**Current Replacement Value:** \$217,265  
**Deferred Maintenance:** \$31,481  
**Ext. Gross Area:** 0

**Site: R290138 - Mentor Prairie WMA**

**Building Code:** R2900106950  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** .3 mile E. of intersection of 295th St. SE  
**City Code:** CROOKSTON

**Current Replacement Value:** \$260,231  
**Deferred Maintenance:** \$78,073  
**Ext. Gross Area:** 0

**Site: R290139 - Deer River City**

**Building Code:** R2900201790  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 403 DIVISION ST  
**City Code:** DEER RIVER

**Current Replacement Value:** \$162,304  
**Deferred Maintenance:** \$34,447  
**Ext. Gross Area:** 0

**Building Code:** R2900201800  
**Building Name:** Deer River City Office  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 403 DIVISION ST  
**City Code:** DEER RIVER

**Current Replacement Value:** \$553,710  
**Deferred Maintenance:** \$137,491  
**Ext. Gross Area:** 0

**Building Code:** R2900201810  
**Building Name:** Oil House  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 403 DIVISION ST  
**City Code:** DEER RIVER

**Current Replacement Value:** \$19,730  
**Deferred Maintenance:** \$6,112  
**Ext. Gross Area:** 0

**Building Code:** R2900203560  
**Building Name:** Deer River City Shop  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 403 DIVISION ST  
**City Code:** DEER RIVER

**Current Replacement Value:** \$353,231  
**Deferred Maintenance:** \$113,052  
**Ext. Gross Area:** 0

**Site: R290140 - Detroit Lakes**

**Building Code:** R2900100910  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 14583 CTY HWY 19  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$247,197  
**Deferred Maintenance:** \$76,975  
**Ext. Gross Area:** 2,881

**Building Code:** R2900100930  
**Building Name:** Sign Shed  
**Facility Condition Index:** 0.66 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 14583 CTY HWY 19  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$30,125  
**Deferred Maintenance:** \$19,797  
**Ext. Gross Area:** 220

**Building Code:** R2900105240  
**Building Name:** Detroit Lakes Office  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 14583 CTY HWY 19  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$1,131,183  
**Deferred Maintenance:** \$176,340  
**Ext. Gross Area:** 9,042

**Building Code:** R2900105690  
**Building Name:** Detroit Lakes Fish Hatchery  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 14583 CTY HWY 19  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$2,391,373  
**Deferred Maintenance:** \$333,257  
**Ext. Gross Area:** 20,114

**Building Code:** R2900106350  
**Building Name:** Tree Storage  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 14583 CTY HWY 19  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$47,656  
**Deferred Maintenance:** \$7,086  
**Ext. Gross Area:** 515



**Site: R290141 - Sedan Pond WMA**

**Building Code:** R2900101210  
**Building Name:** Water Control Structure  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 23070 N LAKESHORE DR  
**City Code:** GLENWOOD

**Current Replacement Value:** \$17,297  
**Deferred Maintenance:** \$4,629  
**Ext. Gross Area:** 0

**Site: R290142 - Finland**

**Building Code:** R2900201920  
**Building Name:** Shop  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$302,245  
**Deferred Maintenance:** \$105,255  
**Ext. Gross Area:** 0

**Building Code:** R2900201930  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$236,303  
**Deferred Maintenance:** \$52,508  
**Ext. Gross Area:** 0

**Building Code:** R2900201950  
**Building Name:** Finland Office  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$697,137  
**Deferred Maintenance:** \$49,527  
**Ext. Gross Area:** 0

**Building Code:** R2900204140  
**Building Name:** Oil House  
**Facility Condition Index:** 0.61 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$16,020  
**Deferred Maintenance:** \$9,723  
**Ext. Gross Area:** 0

**Building Code:** R2900204290  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 6686 HWY 1  
**City Code:** FINLAND

**Current Replacement Value:** \$377,808  
**Deferred Maintenance:** \$25,200  
**Ext. Gross Area:** 0

**Site: R290143 - Grand Marais**

**Building Code:** R2900201980  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1356 E HWY 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$443,477  
**Deferred Maintenance:** \$77,040  
**Ext. Gross Area:** 2,821

**Building Code:** R2900202030  
**Building Name:** Grand Marais Office  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1356 E HWY 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$822,240  
**Deferred Maintenance:** \$17,951  
**Ext. Gross Area:** 2,829

**Building Code:** R2900203810  
**Building Name:** Oil House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 1356 E HWY 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$22,186  
**Deferred Maintenance:** \$2,149  
**Ext. Gross Area:** 300

**Building Code:** R2900204170  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.54 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1356 E HWY 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$10,966  
**Deferred Maintenance:** \$5,935  
**Ext. Gross Area:** 96

**Site: R290144 - Hibbing Minerals**

<b>Building Code:</b>	R2900204640	<b>Cost Model Name:</b>	Single-story Educational Facility	<b>Current Replacement Value:</b>	\$4,107,294
<b>Building Name:</b>	Hibbing Minerals Office	<b>Address:</b>	1525 3RD AVE E	<b>Deferred Maintenance:</b>	\$1,175,931
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	HIBBING	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204650	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$29,180
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1525 3RD AVE E	<b>Deferred Maintenance:</b>	\$17,854
<b>Facility Condition Index:</b>	0.61 - Crisis	<b>City Code:</b>	HIBBING	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204660	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$697,141
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1525 3RD AVE E	<b>Deferred Maintenance:</b>	\$79,968
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	HIBBING	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900204680	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$870,989
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1525 3RD AVE E	<b>Deferred Maintenance:</b>	\$103,526
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	HIBBING	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900206580	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$2,436,624
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1525 3RD AVE E	<b>Deferred Maintenance:</b>	\$147,212
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	HIBBING	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900207530	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$121,967
<b>Building Name:</b>	Laboratory	<b>Address:</b>	1525 3RD AVE E	<b>Deferred Maintenance:</b>	\$8,284
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	HIBBING	<b>Ext. Gross Area:</b>	0

**Site: R290145 - Hill City**

<b>Building Code:</b>	R2900303840	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$505,011
<b>Building Name:</b>	Hill City Office	<b>Address:</b>	454 N HWY 169	<b>Deferred Maintenance:</b>	\$136,240
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	HILL CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303850	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$461,014
<b>Building Name:</b>	Hill City Shop	<b>Address:</b>	454 N HWY 169	<b>Deferred Maintenance:</b>	\$103,701
<b>Facility Condition Index:</b>	0.22 - Average	<b>City Code:</b>	HILL CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303970	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$11,420
<b>Building Name:</b>	Oil House	<b>Address:</b>	454 N HWY 169	<b>Deferred Maintenance:</b>	\$1,558
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	HILL CITY	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900303990	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$369,919
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	454 N HWY 169	<b>Deferred Maintenance:</b>	\$96,607
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	HILL CITY	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900304000  
**Building Name:** Radio Shelter  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 454 N HWY 169  
**City Code:** HILL CITY

**Current Replacement Value:** \$13,670  
**Deferred Maintenance:** \$2,686  
**Ext. Gross Area:** 0

**Site: R290146 - International Falls**

**Building Code:** R2900200310  
**Building Name:** RepShopHeatCold  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 392 HWY 11 E  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$410,724  
**Deferred Maintenance:** \$51,458  
**Ext. Gross Area:** 3,003

**Building Code:** R2900202720  
**Building Name:** International Falls Office  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 392 HWY 11 E  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$605,736  
**Deferred Maintenance:** \$101,766  
**Ext. Gross Area:** 3,045

**Building Code:** R2900203720  
**Building Name:** Oil House  
**Facility Condition Index:** 0.53 - *Crisis*

**Cost Model Name:** Utility Shed  
**Address:** 392 HWY 11 E  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$11,184  
**Deferred Maintenance:** \$5,977  
**Ext. Gross Area:** 96

**Building Code:** R2900207550  
**Building Name:** International Falls Modulr Off  
**Facility Condition Index:** 0.09 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 392 HWY 11 E  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$180,707  
**Deferred Maintenance:** \$16,766  
**Ext. Gross Area:** 984

**Building Code:** R2900209480  
**Building Name:** Storage Shed  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 392 HWY 11 E  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$17,865  
**Deferred Maintenance:** \$5,050  
**Ext. Gross Area:** 0

**Site: R290147 - Iron Range OHVRA**

**Building Code:** R2900208310  
**Building Name:** Iron Range OHVRA Contact Sta  
**Facility Condition Index:** 0.05 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7196 PETTIT RD  
**City Code:** GILBERT

**Current Replacement Value:** \$278,536  
**Deferred Maintenance:** \$14,308  
**Ext. Gross Area:** 0

**Building Code:** R2900208320  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7196 PETTIT RD  
**City Code:** GILBERT

**Current Replacement Value:** \$265,624  
**Deferred Maintenance:** \$5,588  
**Ext. Gross Area:** 0

**Building Code:** R2900208330  
**Building Name:** Iron Range OHVRA Office  
**Facility Condition Index:** 0.05 - *Excellent*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7196 PETTIT RD  
**City Code:** GILBERT

**Current Replacement Value:** \$252,292  
**Deferred Maintenance:** \$12,597  
**Ext. Gross Area:** 0

**Building Code:** R2900208500  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Open Air Shelter  
**Address:** 7196 PETTIT RD  
**City Code:** GILBERT

**Current Replacement Value:** \$114,299  
**Deferred Maintenance:** \$8,722  
**Ext. Gross Area:** 0

**Building Code:** R2900208570  
**Building Name:** Pump House  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 7196 PETTIT RD  
**City Code:** GILBERT

**Current Replacement Value:** \$17,608  
**Deferred Maintenance:** \$714  
**Ext. Gross Area:** 0

**Site: R290149 - Lewiston**

**Building Code:** R2900501820  
**Building Name:** Lewiston Office  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** Hwy 14 & Fremont St  
**City Code:** LEWISTON

**Current Replacement Value:** \$378,247  
**Deferred Maintenance:** \$73,171  
**Ext. Gross Area:** 0

**Building Code:** R2900501970  
**Building Name:** Oil House  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** Hwy 14 & Fremont St  
**City Code:** LEWISTON

**Current Replacement Value:** \$36,203  
**Deferred Maintenance:** \$11,452  
**Ext. Gross Area:** 0

**Site: R290151 - Baudette Fairgrounds**

**Building Code:** R2900103830  
**Building Name:** Interp Unoccupied  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** FAIRGOUNDS  
**City Code:** BAUDETTE

**Current Replacement Value:** \$76,347  
**Deferred Maintenance:** \$9,739  
**Ext. Gross Area:** 355

**Site: R290152 - Brainerd-Crow Wing County Airport**

**Building Code:** R2900306740  
**Building Name:** Shed  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$44,210  
**Deferred Maintenance:** \$3,622  
**Ext. Gross Area:** 204

**Building Code:** R2900306750  
**Building Name:** Brainerd Airport Office  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$267,051  
**Deferred Maintenance:** \$28,570  
**Ext. Gross Area:** 0

**Building Code:** R2900308370  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.05 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$5,301  
**Deferred Maintenance:** \$266  
**Ext. Gross Area:** 0

**Building Code:** R2900308380  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$30,930  
**Deferred Maintenance:** \$1,504  
**Ext. Gross Area:** 0

**Building Code:** R2900308390  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$31,584  
**Deferred Maintenance:** \$734  
**Ext. Gross Area:** 0

**Building Code:** R2900308400  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$28,719  
**Deferred Maintenance:** \$1,124  
**Ext. Gross Area:** 0

**Building Code:** R2900308410  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 12834 HWY 210 E  
**City Code:** BRAINERD

**Current Replacement Value:** \$28,760  
**Deferred Maintenance:** \$1,217  
**Ext. Gross Area:** 0

**Site: R290154 - Foot Hills State Forest**

**Building Code:** R2900301160  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** Spider Lake Rec. Area  
**City Code:** BRAINERD

**Current Replacement Value:** \$9,212  
**Deferred Maintenance:** \$1,104  
**Ext. Gross Area:** 38

**Building Code:** R2900301420  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** Spider Lake Rec. Area  
**City Code:** BRAINERD

**Current Replacement Value:** \$9,212  
**Deferred Maintenance:** \$1,104  
**Ext. Gross Area:** 38

**Site: R290155 - Chisholm-Hibbing Airport**

**Building Code:** R2900207680  
**Building Name:** Hibbing Airport Main Office  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 10956 HWY 37  
**City Code:** HIBBING

**Current Replacement Value:** \$304,727  
**Deferred Maintenance:** \$40,760  
**Ext. Gross Area:** 0

**Building Code:** R2900208400  
**Building Name:** Spring House  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 10956 HWY 37  
**City Code:** HIBBING

**Current Replacement Value:** \$66,802  
**Deferred Maintenance:** \$1,336  
**Ext. Gross Area:** 0

**Building Code:** R2900209030  
**Building Name:** Hibbing Airport Dispatch Off  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 10956 HWY 37  
**City Code:** HIBBING

**Current Replacement Value:** \$143,496  
**Deferred Maintenance:** \$6,742  
**Ext. Gross Area:** 0

**Site: R290156 - Hibbing Forestry**

**Building Code:** R2900201550  
**Building Name:** Hibbing Forestry Office  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$486,328  
**Deferred Maintenance:** \$117,962  
**Ext. Gross Area:** 0

**Building Code:** R2900201560  
**Building Name:** DISPOSED - Cold Storage  
**Facility Condition Index:** 0.62 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$130,685  
**Deferred Maintenance:** \$80,622  
**Ext. Gross Area:** 0

**Building Code:** R2900201570  
**Building Name:** Shop  
**Facility Condition Index:** 0.27 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$339,838  
**Deferred Maintenance:** \$90,276  
**Ext. Gross Area:** 0

**Building Code:** R2900201580  
**Building Name:** DISPOSED - Cold Storage  
**Facility Condition Index:** 0.35 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$118,579  
**Deferred Maintenance:** \$41,151  
**Ext. Gross Area:** 0

**Building Code:** R2900201590  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.26 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$181,880  
**Deferred Maintenance:** \$47,923  
**Ext. Gross Area:** 0

**Building Code:** R2900204280  
**Building Name:** Oil House  
**Facility Condition Index:** 0.14 - Good

**Cost Model Name:** Utility Shed  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$11,281  
**Deferred Maintenance:** \$1,619  
**Ext. Gross Area:** 0

**Building Code:** R2900209900  
**Building Name:** Fire Truck Storage  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1208 E HOWARD ST  
**City Code:** HIBBING

**Current Replacement Value:** \$314,416  
**Deferred Maintenance:** \$6,288  
**Ext. Gross Area:** 0

**Site: R290157 - Munson Lake**

**Building Code:** R2900104540  
**Building Name:** Spring House  
**Facility Condition Index:** 0.84 - Crisis

**Cost Model Name:** Utility Shed  
**Address:** 14583 CTY HWY 19  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$17,332  
**Deferred Maintenance:** \$14,500  
**Ext. Gross Area:** 128

**Site: R290158 - Littlefork**

**Building Code:** R2900202670  
**Building Name:** Littlefork Office  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 421 3RD AVE  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$510,186  
**Deferred Maintenance:** \$62,696  
**Ext. Gross Area:** 0

**Building Code:** R2900202680  
**Building Name:** Oil House  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Utility Shed  
**Address:** 421 3RD AVE  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$43,594  
**Deferred Maintenance:** \$4,359  
**Ext. Gross Area:** 0

**Building Code:** R2900202690  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.23 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 421 3RD AVE  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$219,454  
**Deferred Maintenance:** \$49,841  
**Ext. Gross Area:** 0

**Building Code:** R2900202700  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.32 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 421 3RD AVE  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$431,628  
**Deferred Maintenance:** \$138,188  
**Ext. Gross Area:** 0

**Building Code:** R2900204300  
**Building Name:** Littlefork Shop  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 421 3RD AVE  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$303,942  
**Deferred Maintenance:** \$32,468  
**Ext. Gross Area:** 0

***Site: R290160 - McGrath***

**Building Code:** R2900303950  
**Building Name:** McGrath Shop  
**Facility Condition Index:** 0.30 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 16082 STATE HWY 65  
**City Code:** MCGRATH

**Current Replacement Value:** \$356,316  
**Deferred Maintenance:** \$105,479  
**Ext. Gross Area:** 0

**Building Code:** R2900303960  
**Building Name:** McGrath Office  
**Facility Condition Index:** 0.29 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 16082 STATE HWY 65  
**City Code:** MCGRATH

**Current Replacement Value:** \$305,124  
**Deferred Maintenance:** \$88,017  
**Ext. Gross Area:** 0

**Building Code:** R2900304110  
**Building Name:** Oil House  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 16082 STATE HWY 65  
**City Code:** MCGRATH

**Current Replacement Value:** \$15,494  
**Deferred Maintenance:** \$1,848  
**Ext. Gross Area:** 0

***Site: R290161 - Otter Tail Lake***

**Building Code:** R2900102750  
**Building Name:** Pleasure Park Storage  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 42911 Pleasure Park Rd., Ottertail MN  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$62,601  
**Deferred Maintenance:** \$8,028  
**Ext. Gross Area:** 644

***Site: R290162 - Dead River-Walker Lake***

**Building Code:** R2900101110  
**Building Name:** Dead River-Walker Lake Htchry  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 32870 HWY 14  
**City Code:** RICHVILLE

**Current Replacement Value:** \$661,517  
**Deferred Maintenance:** \$86,733  
**Ext. Gross Area:** 1,787

**Building Code:** R2900104630  
**Building Name:** Garage  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 32870 CO HWY 14  
**City Code:** RICHVILLE

**Current Replacement Value:** \$46,558  
**Deferred Maintenance:** \$5,583  
**Ext. Gross Area:** 583

**Building Code:** R2900107020  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 32870 CO HWY 14  
**City Code:** RICHVILLE

**Current Replacement Value:** \$97,558  
**Deferred Maintenance:** \$9,756  
**Ext. Gross Area:** 1,179

***Site: R290163 - Birchdale***

**Building Code:** R2900101120  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Tower  
**Address:** HWY 11 BIRCHDALE  
**City Code:** BAUDETTE

**Current Replacement Value:** \$13,610  
**Deferred Maintenance:** \$272  
**Ext. Gross Area:** 0



**Building Code:** R2900103940  
**Building Name:** Birchdale Office  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** HWY 11 BIRCHDALE  
**City Code:** BAUDETTE

**Current Replacement Value:** \$308,890  
**Deferred Maintenance:** \$36,069  
**Ext. Gross Area:** 0

**Building Code:** R2900104250  
**Building Name:** Oil House  
**Facility Condition Index:** 0.67 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** HWY 11 BIRCHDALE  
**City Code:** BAUDETTE

**Current Replacement Value:** \$5,868  
**Deferred Maintenance:** \$3,918  
**Ext. Gross Area:** 0

**Site: R290164 - Lake of the Woods State Forest**

**Building Code:** R2900105570  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** RAPID RIVER  
**City Code:** BAUDETTE

**Current Replacement Value:** \$7,988  
**Deferred Maintenance:** \$2,636  
**Ext. Gross Area:** 0

**Site: R290165 - Smoky Hills State Forest**

**Building Code:** R2900105600  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** 607 W 1ST ST  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$12,781  
**Deferred Maintenance:** \$4,218  
**Ext. Gross Area:** 176

**Site: R290166 - Two Inlets State Forest**

**Building Code:** R2900107380  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DRIVE  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$10,680  
**Deferred Maintenance:** \$2,647  
**Ext. Gross Area:** 0

**Building Code:** R2900107390  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DRIVE  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$10,680  
**Deferred Maintenance:** \$2,647  
**Ext. Gross Area:** 0

**Building Code:** R2900107400  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 36750 MAIN PARK DRIVE  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$14,685  
**Deferred Maintenance:** \$2,283  
**Ext. Gross Area:** 0

**Site: R290167 - Park Rapids Area**

**Building Code:** R2900100030  
**Building Name:** Park Rapids Wildlife Office  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 603 1ST ST W  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$564,001  
**Deferred Maintenance:** \$101,902  
**Ext. Gross Area:** 2,593

**Building Code:** R2900103510  
**Building Name:** Park Rapids Forestry Office  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 607 W 1ST ST  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$420,684  
**Deferred Maintenance:** \$93,984  
**Ext. Gross Area:** 2,416

<b>Building Code:</b>	R2900103520	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$127,160
<b>Building Name:</b>	Second Garage	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$25,896
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,367
<b>Building Code:</b>	R2900103530	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$205,186
<b>Building Name:</b>	First Garage	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$43,484
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,622
<b>Building Code:</b>	R2900103540	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$92,609
<b>Building Name:</b>	Ice house	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$21,625
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	1,062
<b>Building Code:</b>	R2900103550	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$70,085
<b>Building Name:</b>	Oil House	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$7,280
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	195
<b>Building Code:</b>	R2900103570	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$29,045
<b>Building Name:</b>	Garage	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$9,585
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	306
<b>Building Code:</b>	R2900103580	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$468,920
<b>Building Name:</b>	Park Rapids Forestry Shop	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$88,598
<b>Facility Condition Index:</b>	0.19 - Average	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	3,027
<b>Building Code:</b>	R2900104560	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,941
<b>Building Name:</b>	Trails Shed	<b>Address:</b>	115 BUNYAN TRAILS DR	<b>Deferred Maintenance:</b>	\$3,361
<b>Facility Condition Index:</b>	0.31 - Poor	<b>City Code:</b>	NEVIS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106160	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$44,434
<b>Building Name:</b>	Deer Hunters Association	<b>Address:</b>	607 W 1ST ST	<b>Deferred Maintenance:</b>	\$18,987
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	646
<b>Building Code:</b>	R2900106730	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,860
<b>Building Name:</b>	Trails Shed 2	<b>Address:</b>	603 W 1ST	<b>Deferred Maintenance:</b>	\$3,222
<b>Facility Condition Index:</b>	0.41 - Poor	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900107250	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$277,675
<b>Building Name:</b>	Wildlife Metal Building	<b>Address:</b>	603 1ST ST W	<b>Deferred Maintenance:</b>	\$27,767
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	3,562
<b>Building Code:</b>	R2900109440	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$9,118
<b>Building Name:</b>	Trails Shed	<b>Address:</b>	603 1ST ST W	<b>Deferred Maintenance:</b>	\$912
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PARK RAPIDS	<b>Ext. Gross Area:</b>	0

Site: R290168 - Whitewater WMA Crystal Springs

<b>Building Code:</b>	R2900502140	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$65,784
<b>Building Name:</b>	Spring House	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$2,550
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503240	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$291,104
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$62,620
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503250	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$291,104
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$57,796
<b>Facility Condition Index:</b>	0.20 - <b>Average</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503260	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$291,104
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$54,758
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503270	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$280,058
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$60,677
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503280	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$529,409
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$57,218
<b>Facility Condition Index:</b>	0.11 - <b>Good</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503290	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$115,009
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$54,503
<b>Facility Condition Index:</b>	0.47 - <b>Poor</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503720	<b>Cost Model Name:</b>	Joint Office/Warehouse Facility	<b>Current Replacement Value:</b>	\$1,399,290
<b>Building Name:</b>	Crystal Springs Fish Hatchery	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$55,278
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504150	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$547,461
<b>Building Name:</b>	Intermediate Hatchery	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$52,689
<b>Facility Condition Index:</b>	0.10 - <b>Good</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505530	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$689,114
<b>Building Name:</b>	Residence	<b>Address:</b>	14672 CO RD 112	<b>Deferred Maintenance:</b>	\$26,609
<b>Facility Condition Index:</b>	0.04 - <b>Excellent</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505610	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$22,375
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	14674 CO RD 112	<b>Deferred Maintenance:</b>	\$448
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	ALTURA	<b>Ext. Gross Area:</b>	0

**Site: R290169 - Woman Lake**

**Building Code:** R2900106410  
**Building Name:** Heated Storage  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 07316 STATE 371 NW  
**City Code:** WALKER

**Current Replacement Value:** \$87,504  
**Deferred Maintenance:** \$26,790  
**Ext. Gross Area:** 0

**Site: R290170 - Walker**

**Building Code:** R2900103370  
**Building Name:** Walker Office  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7316 STATE 371 NW  
**City Code:** WALKER

**Current Replacement Value:** \$352,870  
**Deferred Maintenance:** \$101,558  
**Ext. Gross Area:** 0

**Building Code:** R2900104660  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 07316 STATE 371 NW  
**City Code:** WALKER

**Current Replacement Value:** \$11,983  
**Deferred Maintenance:** \$3,087  
**Ext. Gross Area:** 0

**Building Code:** R2900105220  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 07316 STATE 371 NW  
**City Code:** WALKER

**Current Replacement Value:** \$196,478  
**Deferred Maintenance:** \$19,648  
**Ext. Gross Area:** 0

**Site: R290171 - Longville Fire Tower**

**Building Code:** R2900305600  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** LONGVILLE  
**City Code:** BRAINERD

**Current Replacement Value:** \$7,210  
**Deferred Maintenance:** \$2,379  
**Ext. Gross Area:** 0

**Site: R290172 - Linder Fire Tower**

**Building Code:** R2900105680  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** LINDER  
**City Code:** GRYGLA

**Current Replacement Value:** \$7,656  
**Deferred Maintenance:** \$2,526  
**Ext. Gross Area:** 0

**Site: R290173 - Lawson Fire Tower**

**Building Code:** R2900105480  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** LAWSON  
**City Code:** WANNASKA

**Current Replacement Value:** \$7,656  
**Deferred Maintenance:** \$2,526  
**Ext. Gross Area:** 0

**Site: R290174 - Prosper Fire Tower**

**Building Code:** R2900105560  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** PROSPER  
**City Code:** WILLIAMS

**Current Replacement Value:** \$7,988  
**Deferred Maintenance:** \$2,636  
**Ext. Gross Area:** 0

**Site: R290175 - Moose Lake City**

<b>Building Code:</b>	R2900300300	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$480,222
<b>Building Name:</b>	Moose Lake City Shop	<b>Address:</b>	701 S KENWOOD RR 2	<b>Deferred Maintenance:</b>	\$135,381
<b>Facility Condition Index:</b>	0.28 - <i>Average</i>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900300310	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$596,052
<b>Building Name:</b>	Moose Lake City Office	<b>Address:</b>	701 S KENWOOD RR 2	<b>Deferred Maintenance:</b>	\$128,343
<b>Facility Condition Index:</b>	0.22 - <i>Average</i>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304130	<b>Cost Model Name:</b>	Bunker	<b>Current Replacement Value:</b>	\$10,395
<b>Building Name:</b>	Oil House	<b>Address:</b>	701 S KENWOOD RR 2	<b>Deferred Maintenance:</b>	\$1,218
<b>Facility Condition Index:</b>	0.12 - <i>Good</i>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900304580	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$26,137
<b>Building Name:</b>	Oil House	<b>Address:</b>	701 S KENWOOD RR 2	<b>Deferred Maintenance:</b>	\$2,450
<b>Facility Condition Index:</b>	0.09 - <i>Good</i>	<b>City Code:</b>	MOOSE LAKE	<b>Ext. Gross Area:</b>	0

**Site: R290176 - Waskish**

<b>Building Code:</b>	R2900101030	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$1,053,484
<b>Building Name:</b>	Waskish Fish Hatchery	<b>Address:</b>	55478 TAMARAC RIVER ACCESS NE,	<b>Deferred Maintenance:</b>	\$364,101
<b>Facility Condition Index:</b>	0.35 - <i>Poor</i>	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101040	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$223,545
<b>Building Name:</b>	Garage	<b>Address:</b>	55478 TAMARAC RIVER ACCESS NE,	<b>Deferred Maintenance:</b>	\$48,829
<b>Facility Condition Index:</b>	0.22 - <i>Average</i>	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101050	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$45,862
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	55478 TAMARAC RIVER ACCESS NE,	<b>Deferred Maintenance:</b>	\$21,418
<b>Facility Condition Index:</b>	0.47 - <i>Poor</i>	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900101070	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,381
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	55478 TAMARAC RIVER ACCESS NE,	<b>Deferred Maintenance:</b>	\$17,218
<b>Facility Condition Index:</b>	0.74 - <i>Crisis</i>	<b>City Code:</b>	WASKISH	<b>Ext. Gross Area:</b>	0

**Site: R290177 - Bemidji-Beltrami County Airport**

<b>Building Code:</b>	R2900104510	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$14,743
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	2823 GILLETT DR NW	<b>Deferred Maintenance:</b>	\$3,581
<b>Facility Condition Index:</b>	0.24 - <i>Average</i>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900106180	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$485,954
<b>Building Name:</b>	Bemidji Airport Office	<b>Address:</b>	3219 GILLETT NW	<b>Deferred Maintenance:</b>	\$97,059
<b>Facility Condition Index:</b>	0.20 - <i>Average</i>	<b>City Code:</b>	BEMIDJI	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900106560  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Building Code:** R2900108590  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 2823 GILLETT DR NW  
**City Code:** BEMIDJI

**Cost Model Name:** Utility Shed  
**Address:** 2823 GILLETT DR NW  
**City Code:** BEMIDJI

**Current Replacement Value:** \$16,375  
**Deferred Maintenance:** \$5,404  
**Ext. Gross Area:** 195

**Current Replacement Value:** \$18,547  
**Deferred Maintenance:** \$6,121  
**Ext. Gross Area:** 122

**Site: R290178 - Mora**

**Building Code:** R2900300340  
**Building Name:** Mora Office  
**Facility Condition Index:** 0.34 - **Poor**

**Building Code:** R2900300350  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.28 - **Average**

**Building Code:** R2900304190  
**Building Name:** Gas Shed  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 460 W MAPLE  
**City Code:** MORA

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 460 W MAPLE  
**City Code:** MORA

**Cost Model Name:** Utility Shed  
**Address:** 460 W MAPLE  
**City Code:** MORA

**Current Replacement Value:** \$325,379  
**Deferred Maintenance:** \$109,140  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$156,094  
**Deferred Maintenance:** \$43,385  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$14,898  
**Deferred Maintenance:** \$1,777  
**Ext. Gross Area:** 0

**Site: R290179 - Big Falls**

**Building Code:** R2900202770  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - **Good**

**Building Code:** R2900202780  
**Building Name:** Garage  
**Facility Condition Index:** 0.06 - **Good**

**Building Code:** R2900202800  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.21 - **Average**

**Building Code:** R2900202810  
**Building Name:** Big Falls Office  
**Facility Condition Index:** 0.22 - **Average**

**Building Code:** R2900203790  
**Building Name:** Oil House  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7754 TOWN RD 293  
**City Code:** BIG FALLS

**Cost Model Name:** Single-story Work Facility  
**Address:** 7754 TOWN RD 293  
**City Code:** BIG FALLS

**Cost Model Name:** Single-story Work Facility  
**Address:** 7754 TOWN RD 293  
**City Code:** BIG FALLS

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7754 TOWN RD 293  
**City Code:** BIG FALLS

**Cost Model Name:** Utility Shed  
**Address:** 7754 TOWN RD 293  
**City Code:** BIG FALLS

**Current Replacement Value:** \$202,637  
**Deferred Maintenance:** \$19,789  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$23,529  
**Deferred Maintenance:** \$1,398  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$288,993  
**Deferred Maintenance:** \$60,842  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$286,892  
**Deferred Maintenance:** \$62,327  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$11,184  
**Deferred Maintenance:** \$3,038  
**Ext. Gross Area:** 0

**Building Code:** R2900209490  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.71 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 7754 TOWN RD 293  
**City Code:** BIG FALLS

**Current Replacement Value:** \$2,624  
**Deferred Maintenance:** \$1,868  
**Ext. Gross Area:** 0

**Site: R290180 - Big Fork River**

**Building Code:** R2900206450  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** CO RD VT 83  
**City Code:** BIG FALLS

**Current Replacement Value:** \$10,095  
**Deferred Maintenance:** \$2,518  
**Ext. Gross Area:** 0

**Building Code:** R2900206460  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** STATE FOREST RD 0852  
**City Code:** BIG FALLS

**Current Replacement Value:** \$10,095  
**Deferred Maintenance:** \$1,614  
**Ext. Gross Area:** 0

**Building Code:** R2900206470  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** STATE FOREST RD 0948  
**City Code:** BIG FALLS

**Current Replacement Value:** \$10,095  
**Deferred Maintenance:** \$1,614  
**Ext. Gross Area:** 0

**Site: R290181 - Cloquet**

**Building Code:** R2900200080  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$203,403  
**Deferred Maintenance:** \$20,340  
**Ext. Gross Area:** 0

**Building Code:** R2900202510  
**Building Name:** Cloquet Office  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$680,474  
**Deferred Maintenance:** \$147,846  
**Ext. Gross Area:** 3,600

**Building Code:** R2900202520  
**Building Name:** Cloquet Shop  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$371,151  
**Deferred Maintenance:** \$93,966  
**Ext. Gross Area:** 2,428

**Building Code:** R2900202530  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.53 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$121,022  
**Deferred Maintenance:** \$63,539  
**Ext. Gross Area:** 1,223

**Building Code:** R2900202540  
**Building Name:** Oil House  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$28,057  
**Deferred Maintenance:** \$9,318  
**Ext. Gross Area:** 168

**Building Code:** R2900206920  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$118,958  
**Deferred Maintenance:** \$20,216  
**Ext. Gross Area:** 1,753



**Building Code:** R2900210170  
**Building Name:** Sign Storage  
**Facility Condition Index:** 0.49 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$13,521  
**Deferred Maintenance:** \$6,687  
**Ext. Gross Area:** 87

**Building Code:** R2900210180  
**Building Name:** Smoking Shelter  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 1604 S HWY 33  
**City Code:** CLOQUET

**Current Replacement Value:** \$17,250  
**Deferred Maintenance:** \$1,725  
**Ext. Gross Area:** 230

**Site: R290182 - Effie**

**Building Code:** R2900201730  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 205 1/2 SE HWY 1  
**City Code:** EFFIE

**Current Replacement Value:** \$281,030  
**Deferred Maintenance:** \$26,833  
**Ext. Gross Area:** 0

**Building Code:** R2900201830  
**Building Name:** Effie Main Office  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 205 1/2 SE HWY 1  
**City Code:** EFFIE

**Current Replacement Value:** \$416,131  
**Deferred Maintenance:** \$66,198  
**Ext. Gross Area:** 0

**Building Code:** R2900201840  
**Building Name:** Oil House  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 205 1/2 SE HWY 1  
**City Code:** EFFIE

**Current Replacement Value:** \$27,568  
**Deferred Maintenance:** \$2,340  
**Ext. Gross Area:** 0

**Building Code:** R2900201850  
**Building Name:** Garage  
**Facility Condition Index:** 0.53 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 205 1/2 SE HWY 1  
**City Code:** EFFIE

**Current Replacement Value:** \$42,547  
**Deferred Maintenance:** \$22,734  
**Ext. Gross Area:** 0

**Building Code:** R2900201870  
**Building Name:** Shop  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 205 1/2 SE HWY 1  
**City Code:** EFFIE

**Current Replacement Value:** \$211,178  
**Deferred Maintenance:** \$47,465  
**Ext. Gross Area:** 0

**Building Code:** R2900207510  
**Building Name:** Effie Modular Office  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 205 1/2 SE HWY 1  
**City Code:** EFFIE

**Current Replacement Value:** \$110,015  
**Deferred Maintenance:** \$15,891  
**Ext. Gross Area:** 0

**Site: R290183 - Madelia WMA**

**Building Code:** R2900402400  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.44 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 35365 800TH AVE  
**City Code:** MADELIA

**Current Replacement Value:** \$267,328  
**Deferred Maintenance:** \$117,206  
**Ext. Gross Area:** 0

**Building Code:** R2900402410  
**Building Name:** Madelia WMA Office  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 35365 800TH AVE  
**City Code:** MADELIA

**Current Replacement Value:** \$1,771,754  
**Deferred Maintenance:** \$328,235  
**Ext. Gross Area:** 0

**Building Code:** R2900402430  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 35365 800TH AVE  
**City Code:** MADELIA

**Current Replacement Value:** \$299,433  
**Deferred Maintenance:** \$98,813  
**Ext. Gross Area:** 0

**Building Code:** R2900402480  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 35365 800TH AVE  
**City Code:** MADELIA

**Current Replacement Value:** \$36,992  
**Deferred Maintenance:** \$12,790  
**Ext. Gross Area:** 0

**Site: R290184 - Mille Lacs WMA**

**Building Code:** R2900300650  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.67 - **Crisis**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 29172 100TH AVE  
**City Code:** ONAMIA

**Current Replacement Value:** \$175,154  
**Deferred Maintenance:** \$117,305  
**Ext. Gross Area:** 0

**Building Code:** R2900300670  
**Building Name:** Mille Lacs WMA Office  
**Facility Condition Index:** 0.26 - **Average**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 29172 100TH AVE  
**City Code:** ONAMIA

**Current Replacement Value:** \$775,525  
**Deferred Maintenance:** \$203,249  
**Ext. Gross Area:** 0

**Building Code:** R2900300700  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.61 - **Crisis**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 29172 100TH AVE  
**City Code:** ONAMIA

**Current Replacement Value:** \$199,259  
**Deferred Maintenance:** \$121,773  
**Ext. Gross Area:** 0

**Site: R290185 - New London**

**Building Code:** R2900404630  
**Building Name:** New London Office  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 308 1ST AVE NW  
**City Code:** NEW LONDON

**Current Replacement Value:** \$746,127  
**Deferred Maintenance:** \$79,520  
**Ext. Gross Area:** 0

**Site: R290186 - Woodland WMA**

**Building Code:** R2900300770  
**Building Name:** Woodland WMA-Montrose Shop  
**Facility Condition Index:** 0.49 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7372 STATE HWY 25 SW  
**City Code:** MONTROSE

**Current Replacement Value:** \$270,169  
**Deferred Maintenance:** \$131,681  
**Ext. Gross Area:** 0

**Building Code:** R2900300790  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7372 STATE HWY 25 SW  
**City Code:** MONTROSE

**Current Replacement Value:** \$295,693  
**Deferred Maintenance:** \$107,525  
**Ext. Gross Area:** 0

**Building Code:** R2900300800  
**Building Name:** Woodland WMA-Montrose Office  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7372 STATE HWY 25 SW  
**City Code:** MONTROSE

**Current Replacement Value:** \$191,678  
**Deferred Maintenance:** \$66,777  
**Ext. Gross Area:** 0

**Building Code:** R2900303200  
**Building Name:** Shed  
**Facility Condition Index:** 0.62 - **Crisis**

**Building Code:** R2900303580  
**Building Name:** Pump House  
**Facility Condition Index:** 0.51 - **Crisis**

**Building Code:** R2900304140  
**Building Name:** Oil House  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 7372 STATE HWY 25 SW  
**City Code:** MONTROSE

**Cost Model Name:** Utility Shed  
**Address:** 7372 STATE HWY 25 SW  
**City Code:** MONTROSE

**Cost Model Name:** Utility Shed  
**Address:** 7372 STATE HWY 25 SW  
**City Code:** MONTROSE

**Current Replacement Value:** \$58,280  
**Deferred Maintenance:** \$36,139  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$29,051  
**Deferred Maintenance:** \$14,914  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$17,258  
**Deferred Maintenance:** \$3,323  
**Ext. Gross Area:** 0

**Site: R290187 - Nickerson**

**Building Code:** R2900300330  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.57 - **Crisis**

**Building Code:** R2900305570  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.71 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 701 S KENWOOD RR 2  
**City Code:** MOOSE LAKE

**Cost Model Name:** Tower  
**Address:** 701 S KENWOOD RR 2  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$342,655  
**Deferred Maintenance:** \$194,497  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,616  
**Deferred Maintenance:** \$6,797  
**Ext. Gross Area:** 0

**Site: R290188 - Nicollet**

**Building Code:** R2900404450  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.40 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 501 9TH ST  
**City Code:** NICOLLET

**Current Replacement Value:** \$400,126  
**Deferred Maintenance:** \$160,729  
**Ext. Gross Area:** 0

**Site: R290189 - Ortonville**

**Building Code:** R2900405470  
**Building Name:** Shed  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 811 PINE AVE  
**City Code:** ORTONVILLE

**Current Replacement Value:** \$19,763  
**Deferred Maintenance:** \$395  
**Ext. Gross Area:** 0

**Site: R290190 - Orr**

**Building Code:** R2900202870  
**Building Name:** Orr Main Office  
**Facility Condition Index:** 0.12 - **Good**

**Building Code:** R2900202880  
**Building Name:** Garage  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Cost Model Name:** Single-story Work Facility  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$487,950  
**Deferred Maintenance:** \$60,855  
**Ext. Gross Area:** 1,224

**Current Replacement Value:** \$108,792  
**Deferred Maintenance:** \$25,996  
**Ext. Gross Area:** 0

**Building Code:** R2900202890  
**Building Name:** Oil House  
**Facility Condition Index:** 0.28 - Average

**Cost Model Name:** Utility Shed  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$18,030  
**Deferred Maintenance:** \$5,116  
**Ext. Gross Area:** 0

**Building Code:** R2900202900  
**Building Name:** Orr Shop  
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$156,779  
**Deferred Maintenance:** \$16,658  
**Ext. Gross Area:** 0

**Building Code:** R2900202910  
**Building Name:** Pine Cone Storage  
**Facility Condition Index:** 0.40 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$12,126  
**Deferred Maintenance:** \$4,840  
**Ext. Gross Area:** 0

**Building Code:** R2900202930  
**Building Name:** Garage  
**Facility Condition Index:** 0.18 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$44,868  
**Deferred Maintenance:** \$8,130  
**Ext. Gross Area:** 0

**Building Code:** R2900202940  
**Building Name:** Garage  
**Facility Condition Index:** 0.17 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$365,600  
**Deferred Maintenance:** \$62,771  
**Ext. Gross Area:** 0

**Building Code:** R2900202950  
**Building Name:** Orr Hilltop Office  
**Facility Condition Index:** 0.09 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 4656 HWY 53  
**City Code:** ORR

**Current Replacement Value:** \$376,224  
**Deferred Maintenance:** \$33,140  
**Ext. Gross Area:** 0

**Building Code:** R2900203340  
**Building Name:** Garage  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** ORR

**Current Replacement Value:** \$48,606  
**Deferred Maintenance:** \$4,096  
**Ext. Gross Area:** 0

**Building Code:** R2900204260  
**Building Name:** Garage  
**Facility Condition Index:** 0.18 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** ORR

**Current Replacement Value:** \$11,800  
**Deferred Maintenance:** \$2,090  
**Ext. Gross Area:** 0

**Site: R290191 - Pelican Lake**

**Building Code:** R2900305220  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 30483 STATE HWY 371  
**City Code:** PEQUOT LAKES

**Current Replacement Value:** \$48,606  
**Deferred Maintenance:** \$10,129  
**Ext. Gross Area:** 0

**Site: R290192 - Pequot Fire Tower**

**Building Code:** R2900305310  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.71 - Crisis

**Cost Model Name:** Tower  
**Address:** 30483 STATE HWY 371  
**City Code:** PEQUOT LAKES

**Current Replacement Value:** \$9,616  
**Deferred Maintenance:** \$6,797  
**Ext. Gross Area:** 0

**Site: R290194 - Peterson Hatchery**

<b>Building Code:</b>	R2900502160	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$1,559,677
<b>Building Name:</b>	Peterson Hatchery Office/Res	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$166,317
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502170	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$340,712
<b>Building Name:</b>	Peterson Hatchery Shop	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$34,299
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502200	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$127,447
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$16,884
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502210	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$256,471
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$22,261
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502250	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$60,301
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$5,325
<b>Facility Condition Index:</b>	0.09 - Good	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504050	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$11,825
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,869
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504060	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$11,825
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,869
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504070	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$11,825
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,869
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504080	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$11,825
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,869
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504090	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$11,825
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,869
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504100	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$11,825
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,869
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0

<b>Building Code:</b>	R2900504110	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504120	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504130	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504760	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$866,471
<b>Building Name:</b>	Peterson Fish Hatchery	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$31,829
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505080	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$54,330
<b>Building Name:</b>	Vault Toilet Concrete	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$5,433
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505300	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505310	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505320	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505330	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505340	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900505350	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$26,588
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	28376 CO RD S	<b>Deferred Maintenance:</b>	\$8,774
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	PETERSON	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900505840  
**Building Name:** Shed  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 28376 CO HWY 25  
**City Code:** RUSHFORD VILLAGE

**Current Replacement Value:** \$14,542  
**Deferred Maintenance:** \$291  
**Ext. Gross Area:** 0

**Site: R290196 - Grand Rapids Resource Assessment**

**Building Code:** R2900207560  
**Building Name:** Grand Rapids Resource Assessmt  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 483 PETERSON RD  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$3,579,162  
**Deferred Maintenance:** \$91,026  
**Ext. Gross Area:** 17,549

**Building Code:** R2900208340  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 483 PETERSON RD  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$67,830  
**Deferred Maintenance:** \$5,128  
**Ext. Gross Area:** 847

**Site: R290197 - R4 HQ New Ulm**

**Building Code:** R2900400010  
**Building Name:** New Ulm R4 HQ Office  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 21371 STATE HWY 15  
**City Code:** NEW ULM

**Current Replacement Value:** \$3,869,866  
**Deferred Maintenance:** \$438,953  
**Ext. Gross Area:** 16,550

**Building Code:** R2900402980  
**Building Name:** New Ulm R4 HQ Shop  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 21371 STATE HWY 15  
**City Code:** NEW ULM

**Current Replacement Value:** \$692,151  
**Deferred Maintenance:** \$174,492  
**Ext. Gross Area:** 0

**Building Code:** R2900402990  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.30 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 21371 STATE HWY 15  
**City Code:** NEW ULM

**Current Replacement Value:** \$243,881  
**Deferred Maintenance:** \$72,181  
**Ext. Gross Area:** 2,728

**Building Code:** R2900403780  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 21371 STATE HWY 15  
**City Code:** NEW ULM

**Current Replacement Value:** \$52,958  
**Deferred Maintenance:** \$17,476  
**Ext. Gross Area:** 209

**Site: R290200 - Rochester**

**Building Code:** R2900500010  
**Building Name:** Shop  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$2,099,712  
**Deferred Maintenance:** \$783,583  
**Ext. Gross Area:** 8,890

**Building Code:** R2900500080  
**Building Name:** Heated Storage Barn  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$232,457  
**Deferred Maintenance:** \$39,902  
**Ext. Gross Area:** 1,128



**Building Code:** R2900502050  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** R2900504740  
**Building Name:** Cave Shed  
**Facility Condition Index:** 0.33 - *Poor*

**Building Code:** R2900505550  
**Building Name:** HazardMatStorage  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Cost Model Name:** Utility Shed  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Cost Model Name:** Utility Shed  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$466,213  
**Deferred Maintenance:** \$98,788  
**Ext. Gross Area:** 5,225

**Current Replacement Value:** \$8,664  
**Deferred Maintenance:** \$2,859  
**Ext. Gross Area:** 108

**Current Replacement Value:** \$46,429  
**Deferred Maintenance:** \$929  
**Ext. Gross Area:** 0

**Site: R290202 - Savanna State Forest**

**Building Code:** R2900303890  
**Building Name:** Savanna SF-Sandy Lake Shop  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** R2900303900  
**Building Name:** Savanna SF-Sandy Lake Office  
**Facility Condition Index:** 0.28 - *Average*

**Building Code:** R2900303920  
**Building Name:** Shed  
**Facility Condition Index:** 0.33 - *Poor*

**Building Code:** R2900304010  
**Building Name:** Oil House  
**Facility Condition Index:** 0.04 - *Excellent*

**Building Code:** R2900305120  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.04 - *Excellent*

**Building Code:** R2900305540  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.10 - *Good*

**Building Code:** R2900308450  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - *Excellent*

**Building Code:** R2900308460  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 49928 LAKE AVENUE  
**City Code:** MCGREGOR

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 49928 LAKE AVENUE  
**City Code:** MCGREGOR

**Cost Model Name:** Utility Shed  
**Address:** 49928 LAKE AVENUE  
**City Code:** MCGREGOR

**Cost Model Name:** Utility Shed  
**Address:** 49928 LAKE AVENUE  
**City Code:** MCGREGOR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 49928 LAKE AVENUE  
**City Code:** MCGREGOR

**Cost Model Name:** Tower  
**Address:** 49928 LAKE AVENUE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 64893 170TH PLACE  
**City Code:** MCGREGOR

**Cost Model Name:** Vault Toilet  
**Address:** 64893 170TH PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$251,751  
**Deferred Maintenance:** \$51,989  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$433,317  
**Deferred Maintenance:** \$122,881  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,993  
**Deferred Maintenance:** \$3,298  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$10,936  
**Deferred Maintenance:** \$481  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$144,304  
**Deferred Maintenance:** \$5,165  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$18,941  
**Deferred Maintenance:** \$1,894  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$17,713  
**Deferred Maintenance:** \$354  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$17,713  
**Deferred Maintenance:** \$354  
**Ext. Gross Area:** 0

**Building Code:** R2900308470  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 64893 170TH PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$17,176  
**Deferred Maintenance:** \$344  
**Ext. Gross Area:** 0

**Building Code:** R2900308480  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 64893 170TH PLACE  
**City Code:** MCGREGOR

**Current Replacement Value:** \$17,713  
**Deferred Maintenance:** \$354  
**Ext. Gross Area:** 0

**Site: R290204 - Side Lake**

**Building Code:** R2900201640  
**Building Name:** Side Lake Office  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$403,853  
**Deferred Maintenance:** \$45,101  
**Ext. Gross Area:** 0

**Building Code:** R2900201650  
**Building Name:** Side Lake Shop  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$504,019  
**Deferred Maintenance:** \$108,144  
**Ext. Gross Area:** 0

**Building Code:** R2900201660  
**Building Name:** Shed  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$89,545  
**Deferred Maintenance:** \$14,541  
**Ext. Gross Area:** 0

**Building Code:** R2900201670  
**Building Name:** Garage  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$95,986  
**Deferred Maintenance:** \$22,989  
**Ext. Gross Area:** 0

**Building Code:** R2900201680  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$31,288  
**Deferred Maintenance:** \$7,838  
**Ext. Gross Area:** 0

**Building Code:** R2900201690  
**Building Name:** Oil House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$21,302  
**Deferred Maintenance:** \$2,130  
**Ext. Gross Area:** 0

**Building Code:** R2900204230  
**Building Name:** Radio Shelter  
**Facility Condition Index:** 0.39 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 7711 HWY %  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$4,950  
**Deferred Maintenance:** \$1,941  
**Ext. Gross Area:** 0

**Building Code:** R2900207200  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Tower  
**Address:** 7711 HWY 5  
**City Code:** SIDE LAKE

**Current Replacement Value:** \$17,160  
**Deferred Maintenance:** \$1,716  
**Ext. Gross Area:** 0

**Site: R290206 - Albion WMA**

**Building Code:** R2900307590  
**Building Name:** Quonset  
**Facility Condition Index:** 0.61 - **Crisis**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 940 INDUSTRIAL DR S #103  
**City Code:** ST. CLOUD

**Current Replacement Value:** \$121,587  
**Deferred Maintenance:** \$74,362  
**Ext. Gross Area:** 0

**Site: R290207 - Talcot Lake WMA**

**Building Code:** R2900402260  
**Building Name:** Dormitory  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Single-family Residence  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$544,561  
**Deferred Maintenance:** \$156,053  
**Ext. Gross Area:** 0

**Building Code:** R2900402330  
**Building Name:** Talcot Lake WMA Office  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$396,077  
**Deferred Maintenance:** \$119,624  
**Ext. Gross Area:** 0

**Building Code:** R2900402340  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$10,974  
**Deferred Maintenance:** \$3,467  
**Ext. Gross Area:** 0

**Building Code:** R2900402350  
**Building Name:** Talcot Lake WMA Shop  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$221,193  
**Deferred Maintenance:** \$64,522  
**Ext. Gross Area:** 0

**Building Code:** R2900402390  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Bunker  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$115,786  
**Deferred Maintenance:** \$38,209  
**Ext. Gross Area:** 0

**Building Code:** R2900402750  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$18,517  
**Deferred Maintenance:** \$6,111  
**Ext. Gross Area:** 0

**Building Code:** R2900402760  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$14,500  
**Deferred Maintenance:** \$3,942  
**Ext. Gross Area:** 0

**Building Code:** R2900403080  
**Building Name:** Garage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$23,121  
**Deferred Maintenance:** \$2,312  
**Ext. Gross Area:** 0

**Building Code:** R2900403090  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$259,898  
**Deferred Maintenance:** \$85,766  
**Ext. Gross Area:** 0

**Building Code:** R2900404010  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$318,648  
**Deferred Maintenance:** \$105,154  
**Ext. Gross Area:** 0

**Building Code:** R2900404210  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Vault Toilet  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$7,240  
**Deferred Maintenance:** \$1,564  
**Ext. Gross Area:** 0

**Building Code:** R2900404460  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$124,051  
**Deferred Maintenance:** \$2,481  
**Ext. Gross Area:** 0

**Building Code:** R2900404530  
**Building Name:** Shed  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$237,526  
**Deferred Maintenance:** \$31,467  
**Ext. Gross Area:** 0

**Building Code:** R2900404540  
**Building Name:** Shed  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$254,919  
**Deferred Maintenance:** \$5,098  
**Ext. Gross Area:** 0

**Building Code:** R2900405040  
**Building Name:** Shed  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$16,394  
**Deferred Maintenance:** \$3,013  
**Ext. Gross Area:** 0

**Building Code:** R2900405050  
**Building Name:** Shed  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$26,281  
**Deferred Maintenance:** \$5,676  
**Ext. Gross Area:** 0

**Building Code:** R2900405060  
**Building Name:** Granary Storage  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 40249 CO RD 7  
**City Code:** DUNDEE

**Current Replacement Value:** \$10,266  
**Deferred Maintenance:** \$3,388  
**Ext. Gross Area:** 0

**Site: R290208 - Tower**

**Building Code:** R2900207720  
**Building Name:** Tower Office  
**Facility Condition Index:** 0.05 - *Excellent*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$2,244,178  
**Deferred Maintenance:** \$106,171  
**Ext. Gross Area:** 10,590

**Building Code:** R2900207730  
**Building Name:** Heated Storage  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$2,174,014  
**Deferred Maintenance:** \$88,674  
**Ext. Gross Area:** 10,430

**Building Code:** R2900207740  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$728,486  
**Deferred Maintenance:** \$19,361  
**Ext. Gross Area:** 7,794

**Building Code:** R2900207750  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$691,054  
**Deferred Maintenance:** \$24,517  
**Ext. Gross Area:** 7,378

**Building Code:** R2900207760  
**Building Name:** Hazardous Mat Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$25,675  
**Deferred Maintenance:** \$513  
**Ext. Gross Area:** 120

**Building Code:** R2900208560  
**Building Name:** Refrigerated Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$67,328  
**Deferred Maintenance:** \$1,476  
**Ext. Gross Area:** 186

**Building Code:** R2900208820  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$26,462  
**Deferred Maintenance:** \$622  
**Ext. Gross Area:** 140

**Building Code:** R2900210360  
**Building Name:** Wood Pellet Boiler Enclosure  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$46,779  
**Deferred Maintenance:** \$936  
**Ext. Gross Area:** 0

**Building Code:** R2900210370  
**Building Name:** Wood Pellet Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 650 HWY 169  
**City Code:** TOWER

**Current Replacement Value:** \$24,837  
**Deferred Maintenance:** \$497  
**Ext. Gross Area:** 0

**Site: R290209 - Pike River Hatchery**

**Building Code:** R2900203620  
**Building Name:** Pike River Fish Hatchery  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9380 ANGUS RD VERMILION LK TWSI  
**City Code:** TOWER

**Current Replacement Value:** \$727,291  
**Deferred Maintenance:** \$56,431  
**Ext. Gross Area:** 3,037

**Building Code:** R2900203730  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** 9380 ANGUS RD VERMILION LK TWSI  
**City Code:** TOWER

**Current Replacement Value:** \$13,417  
**Deferred Maintenance:** \$3,794  
**Ext. Gross Area:** 98

**Building Code:** R2900208190  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 9380 ANGUS RD VERMILION LK TWSI  
**City Code:** TOWER

**Current Replacement Value:** \$9,894  
**Deferred Maintenance:** \$2,152  
**Ext. Gross Area:** 0

**Building Code:** R2900208460  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9380 ANGUS RD VERMILION LK TWSI  
**City Code:** TOWER

**Current Replacement Value:** \$51,803  
**Deferred Maintenance:** \$1,303  
**Ext. Gross Area:** 578

**Site: R290211 - Lake Vermilion**

**Building Code:** R2900203310  
**Building Name:** Cook Boat House  
**Facility Condition Index:** 0.64 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 2505 CENTER ISLAND RD  
**City Code:** COOK

**Current Replacement Value:** \$362,282  
**Deferred Maintenance:** \$231,711  
**Ext. Gross Area:** 0

**Building Code:** R2900207830  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.65 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** PEDERSON RD  
**City Code:** TOWER

**Current Replacement Value:** \$3,200  
**Deferred Maintenance:** \$2,067  
**Ext. Gross Area:** 0

***Site: R290212 - Jasper Peak Fire Tower***

**Building Code:** R2900207150  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** 5080 HWY169  
**City Code:** TOWER

**Current Replacement Value:** \$12,355  
**Deferred Maintenance:** \$4,077  
**Ext. Gross Area:** 0

***Site: R290213 - Two Harbors***

**Building Code:** R2900207060  
**Building Name:** Two Harbors Office  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,618,225  
**Deferred Maintenance:** \$77,455  
**Ext. Gross Area:** 6,992

**Building Code:** R2900207070  
**Building Name:** Heated Storage  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,238,697  
**Deferred Maintenance:** \$110,308  
**Ext. Gross Area:** 4,284

**Building Code:** R2900207590  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,012,960  
**Deferred Maintenance:** \$48,052  
**Ext. Gross Area:** 9,296

***Site: R290214 - Silver Bay Marina***

**Building Code:** R2900208240  
**Building Name:** Silver Bay Marina Intrap Center  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$637,357  
**Deferred Maintenance:** \$14,195  
**Ext. Gross Area:** 0

**Building Code:** R2900208250  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$312,044  
**Deferred Maintenance:** \$6,241  
**Ext. Gross Area:** 0

**Building Code:** R2900208410  
**Building Name:** Spring House  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$7,149  
**Deferred Maintenance:** \$980  
**Ext. Gross Area:** 0

**Building Code:** R2900208860  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Shelter  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$7,260  
**Deferred Maintenance:** \$145  
**Ext. Gross Area:** 0

**Building Code:** R2900208900  
**Building Name:** Fish Cleaning House  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$39,875  
**Deferred Maintenance:** \$798  
**Ext. Gross Area:** 0

**Building Code:** R2900209440  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$58,885  
**Deferred Maintenance:** \$17,111  
**Ext. Gross Area:** 0

**Building Code:** R2900209450  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$25,251  
**Deferred Maintenance:** \$3,339  
**Ext. Gross Area:** 0

**Building Code:** R2900209460  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.60 - **Crisis**

**Cost Model Name:** Open Air Shelter  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$58,885  
**Deferred Maintenance:** \$35,555  
**Ext. Gross Area:** 0

**Building Code:** R2900209470  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$25,251  
**Deferred Maintenance:** \$3,716  
**Ext. Gross Area:** 0

**Building Code:** R2900210330  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Vault Toilet  
**Address:** 156 MARINA DRIVE  
**City Code:** SILVER BAY

**Current Replacement Value:** \$64,140  
**Deferred Maintenance:** \$1,283  
**Ext. Gross Area:** 0

**Site: R290215 - Knife River Marina**

**Building Code:** R2900208510  
**Building Name:** Knife River Marina Shop  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$362,936  
**Deferred Maintenance:** \$26,560  
**Ext. Gross Area:** 0

**Building Code:** R2900208520  
**Building Name:** Knife River Marina Office  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$112,333  
**Deferred Maintenance:** \$11,409  
**Ext. Gross Area:** 0

**Building Code:** R2900208530  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$296,097  
**Deferred Maintenance:** \$38,474  
**Ext. Gross Area:** 0

**Building Code:** R2900208540  
**Building Name:** Yacht Club Bldg.  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1568 HWY 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$87,967  
**Deferred Maintenance:** \$10,754  
**Ext. Gross Area:** 0

**Site: R290216 - McQuade Road Harbor**



**Building Code:** R2900208910  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** R2900209430  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.18 - **Average**

**Site: R290218 - Winona**

**Building Code:** R2900500100  
**Building Name:** Boat House  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 5107 McQUADE RD  
**City Code:** DULUTH

**Cost Model Name:** Single-story Work Facility  
**Address:** 5107 McQUADE RD  
**City Code:** DULUTH

**Current Replacement Value:** \$252,249  
**Deferred Maintenance:** \$5,045  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$32,338  
**Deferred Maintenance:** \$5,797  
**Ext. Gross Area:** 0

**Site: R290219 - Wood-Rill SNA**

**Building Code:** R2900601980  
**Building Name:** Garage  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 845 OLD LONG LAKE RD  
**City Code:** ORONO

**Current Replacement Value:** \$135,291  
**Deferred Maintenance:** \$30,809  
**Ext. Gross Area:** 0

**Site: R290220 - Zimmerman**

**Building Code:** R2900300420  
**Building Name:** HeatColdStorage  
**Facility Condition Index:** 0.31 - **Poor**

**Building Code:** R2900300430  
**Building Name:** Zimmerman Office  
**Facility Condition Index:** 0.55 - **Crisis**

**Building Code:** R2900303260  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.40 - **Poor**

**Building Code:** R2900304080  
**Building Name:** Oil House  
**Facility Condition Index:** 0.14 - **Good**

**Building Code:** R2900308510  
**Building Name:** Fire Truck Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 12969 FREMONT AVE  
**City Code:** ZIMMERMAN

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 12969 FREMONT AVE  
**City Code:** ZIMMERMAN

**Cost Model Name:** Single-story Work Facility  
**Address:** 12969 FREMONT AVE  
**City Code:** ZIMMERMAN

**Cost Model Name:** Utility Shed  
**Address:** 12969 FREMONT AVE  
**City Code:** ZIMMERMAN

**Cost Model Name:** Single-story Work Facility  
**Address:** 12969 FREMONT AVE  
**City Code:** ZIMMERMAN

**Current Replacement Value:** \$228,468  
**Deferred Maintenance:** \$70,603  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$346,970  
**Deferred Maintenance:** \$189,863  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$126,518  
**Deferred Maintenance:** \$51,189  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$19,554  
**Deferred Maintenance:** \$2,710  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$104,356  
**Deferred Maintenance:** \$2,087  
**Ext. Gross Area:** 0

**Site: R290222 - Douglas State Trail**

**Building Code:** R2900502460  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$18,835  
**Deferred Maintenance:** \$14,126  
**Ext. Gross Area:** 0

**Building Code:** R2900502470  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$18,835  
**Deferred Maintenance:** \$14,126  
**Ext. Gross Area:** 0

**Building Code:** R2900502550  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 2300 SILVER CREEK RD NE  
**City Code:** ROCHESTER

**Current Replacement Value:** \$12,006  
**Deferred Maintenance:** \$2,292  
**Ext. Gross Area:** 0

**Building Code:** R2900504590  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:**  
**City Code:** PINE ISLAND

**Current Replacement Value:** \$12,006  
**Deferred Maintenance:** \$2,171  
**Ext. Gross Area:** 0

**Site: R290226 - Park Rapids Fisheries**

**Building Code:** R2900101000  
**Building Name:** Park Rapids Fisheries Hatchery  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 301 S GROVE AVE  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$262,560  
**Deferred Maintenance:** \$49,183  
**Ext. Gross Area:** 1,948

**Building Code:** R2900101010  
**Building Name:** Garage  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 301 S GROVE AVE  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$68,540  
**Deferred Maintenance:** \$8,581  
**Ext. Gross Area:** 635

**Building Code:** R2900101020  
**Building Name:** Park Rapids Fisheries Office  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 301 S GROVE AVE  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$595,356  
**Deferred Maintenance:** \$127,359  
**Ext. Gross Area:** 2,921

**Site: R290227 - Bemidji Area Forestry**

**Building Code:** R2900103290  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 2220 BEMIDJI AVE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$120,800  
**Deferred Maintenance:** \$19,984  
**Ext. Gross Area:** 2,001

**Building Code:** R2900103300  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 2220 BEMIDJI AVE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$92,535  
**Deferred Maintenance:** \$16,110  
**Ext. Gross Area:** 890

**Building Code:** R2900103310  
**Building Name:** Bemidji Forestry Office  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2220 BEMIDJI AVE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$518,695  
**Deferred Maintenance:** \$91,687  
**Ext. Gross Area:** 2,338

**Building Code:** R2900103320  
**Building Name:** Bemidji Forestry Shop  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2220 BEMIDJI AVE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$613,973  
**Deferred Maintenance:** \$172,553  
**Ext. Gross Area:** 6,638

**Site: R290228 - Wolf Lake WMA**

**Building Code:** R2900401860  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.39 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 175 CTY RD 26  
**City Code:** WINDOM

**Current Replacement Value:** \$279,492  
**Deferred Maintenance:** \$108,321  
**Ext. Gross Area:** 2,877

**Site: R290230 - Carlos Avery WMA**

**Building Code:** R2900600480  
**Building Name:** Carlos Avery WMA Zodiac Shop  
**Facility Condition Index:** 0.30 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 18310 ZODIAC ST  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$862,607  
**Deferred Maintenance:** \$256,213  
**Ext. Gross Area:** 5,600

**Building Code:** R2900600490  
**Building Name:** Residence  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** 18306 ZODIAC ST NE  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$336,362  
**Deferred Maintenance:** \$92,876  
**Ext. Gross Area:** 2,021

**Building Code:** R2900600510  
**Building Name:** Carlos Avery WMA Zodiac Office  
**Facility Condition Index:** 0.38 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 18310 ZODIAC ST  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$576,104  
**Deferred Maintenance:** \$220,562  
**Ext. Gross Area:** 3,967

**Building Code:** R2900600530  
**Building Name:** Garage  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 18310 ZODIAC ST  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$133,643  
**Deferred Maintenance:** \$28,907  
**Ext. Gross Area:** 1,025

**Building Code:** R2900600540  
**Building Name:** Hanger  
**Facility Condition Index:** 0.81 - *Crisis*

**Cost Model Name:** Single-story Work Facility  
**Address:** 18310 ZODIAC ST  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$114,454  
**Deferred Maintenance:** \$92,692  
**Ext. Gross Area:** 1,163

**Building Code:** R2900600560  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.41 - *Poor*

**Cost Model Name:** Single-story Work Facility  
**Address:** 18310 ZODIAC ST  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$749,640  
**Deferred Maintenance:** \$310,612  
**Ext. Gross Area:** 6,534

**Building Code:** R2900600570  
**Building Name:** Carlos Avery Research Office  
**Facility Condition Index:** 0.30 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 5463-C WEST BROADWAY  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$753,450  
**Deferred Maintenance:** \$228,510  
**Ext. Gross Area:** 3,574

**Building Code:** R2900600580  
**Building Name:** Residence  
**Facility Condition Index:** 0.23 - *Average*

**Cost Model Name:** Single-family Residence  
**Address:** 5463-A WEST BROADWAY  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$592,967  
**Deferred Maintenance:** \$138,180  
**Ext. Gross Area:** 3,386

<b>Building Code:</b>	R2900600590	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$138,776
<b>Building Name:</b>	Garage	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$25,586
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	1,267
<b>Building Code:</b>	R2900600630	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,241,323
<b>Building Name:</b>	Carlos Avery Game Farm Office	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$184,075
<b>Facility Condition Index:</b>	0.15 - Good	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	5,916
<b>Building Code:</b>	R2900600640	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$384,895
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$70,615
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900600770	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$91,669
<b>Building Name:</b>	Brooder House	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$12,757
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	1,032
<b>Building Code:</b>	R2900600840	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$71,302
<b>Building Name:</b>	Spring House	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$17,316
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	210
<b>Building Code:</b>	R2900600870	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$235,481
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$55,503
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	2,425
<b>Building Code:</b>	R2900600890	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$377,118
<b>Building Name:</b>	Garage	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$90,660
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	3,467
<b>Building Code:</b>	R2900601950	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$170,145
<b>Building Name:</b>	Wildlife Science Center	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$78,076
<b>Facility Condition Index:</b>	0.46 - Poor	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900602030	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$35,809
<b>Building Name:</b>	Picnic Shelter 2	<b>Address:</b>	18310 ZODIAC ST	<b>Deferred Maintenance:</b>	\$3,711
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	98
<b>Building Code:</b>	R2900602060	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$143,808
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	5463-C WEST BROADWAY	<b>Deferred Maintenance:</b>	\$9,508
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	FOREST LAKE	<b>Ext. Gross Area:</b>	1,736

**Site: R290231 - Eveleth**

<b>Building Code:</b>	R2900205150	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$222,938
<b>Building Name:</b>	Eveleth Main Office	<b>Address:</b>	7979 HWY 37	<b>Deferred Maintenance:</b>	\$16,314
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	EVELETH	<b>Ext. Gross Area:</b>	1,056

**Building Code:** R2900205160  
**Building Name:** Garage  
**Facility Condition Index:** 0.34 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$30,046  
**Deferred Maintenance:** \$10,270  
**Ext. Gross Area:** 250

**Building Code:** R2900205170  
**Building Name:** Oil House  
**Facility Condition Index:** 0.49 - Poor

**Cost Model Name:** Utility Shed  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$11,316  
**Deferred Maintenance:** \$5,569  
**Ext. Gross Area:** 123

**Building Code:** R2900205180  
**Building Name:** Spring House  
**Facility Condition Index:** 0.03 - Excellent

**Cost Model Name:** Utility Shed  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$144,834  
**Deferred Maintenance:** \$4,578  
**Ext. Gross Area:** 98

**Building Code:** R2900205190  
**Building Name:** Shop  
**Facility Condition Index:** 0.49 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$456,639  
**Deferred Maintenance:** \$223,148  
**Ext. Gross Area:** 2,411

**Building Code:** R2900205200  
**Building Name:** Shop  
**Facility Condition Index:** 0.20 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$524,981  
**Deferred Maintenance:** \$103,837  
**Ext. Gross Area:** 2,302

**Building Code:** R2900205210  
**Building Name:** Pine Cone Storage  
**Facility Condition Index:** 0.57 - Crisis

**Cost Model Name:** Single-story Work Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$622,001  
**Deferred Maintenance:** \$353,083  
**Ext. Gross Area:** 5,145

**Building Code:** R2900205220  
**Building Name:** Eveleth Shop Office  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$2,172,617  
**Deferred Maintenance:** \$347,502  
**Ext. Gross Area:** 9,602

**Building Code:** R2900205230  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.42 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$57,846  
**Deferred Maintenance:** \$24,483  
**Ext. Gross Area:** 583

**Building Code:** R2900205240  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.18 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$200,934  
**Deferred Maintenance:** \$37,105  
**Ext. Gross Area:** 1,964

**Building Code:** R2900205270  
**Building Name:** Cold Storage  
**Facility Condition Index:** 1.00 - Crisis

**Cost Model Name:** Single-story Work Facility  
**Address:** 7979 HWY 37  
**City Code:** EVELETH

**Current Replacement Value:** \$29,508  
**Deferred Maintenance:** \$29,508  
**Ext. Gross Area:** 392

**Site: R290233 - Warroad Boathouse**

**Building Code:** R2900108610  
**Building Name:** Boat House  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Single-story Work Facility  
**Address:** 1101 LAKE ST NE  
**City Code:** WARROAD

**Current Replacement Value:** \$55,656  
**Deferred Maintenance:** \$1,113  
**Ext. Gross Area:** 524

**Site: R290234 - R3 HQ St Paul**

<b>Building Code:</b>	R2900601080	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$110,858
<b>Building Name:</b>	Garage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$33,923
<b>Facility Condition Index:</b>	0.31 - <b>Poor</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	1,170
<b>Building Code:</b>	R2900601260	<b>Cost Model Name:</b>	Single-story Office/Public Access Facility	<b>Current Replacement Value:</b>	\$1,053,648
<b>Building Name:</b>	St Paul R3 HQ Warehouse	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$227,853
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	6,211
<b>Building Code:</b>	R2900601290	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$20,841
<b>Building Name:</b>	Garage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$5,823
<b>Facility Condition Index:</b>	0.28 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	250
<b>Building Code:</b>	R2900601300	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$172,437
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$41,458
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	2,079
<b>Building Code:</b>	R2900601310	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$221,705
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$53,304
<b>Facility Condition Index:</b>	0.24 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	2,663
<b>Building Code:</b>	R2900601320	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$8,926,344
<b>Building Name:</b>	St Paul R3 HQ Main Office	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$1,304,452
<b>Facility Condition Index:</b>	0.15 - <b>Good</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	35,179
<b>Building Code:</b>	R2900601330	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$405,220
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$186,285
<b>Facility Condition Index:</b>	0.46 - <b>Poor</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	4,430
<b>Building Code:</b>	R2900601770	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,834
<b>Building Name:</b>	Hazardous Mat Storage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$17,875
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	142
<b>Building Code:</b>	R2900601780	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$23,834
<b>Building Name:</b>	Hazardous Mat Storage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$17,875
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	142
<b>Building Code:</b>	R2900601840	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$235,705
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	1200 WARNER ROAD	<b>Deferred Maintenance:</b>	\$40,427
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	ST. PAUL	<b>Ext. Gross Area:</b>	885

**Site: R290235 - R2 HQ Grand Rapids**

<b>Building Code:</b>	R2900200020	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$213,534
<b>Building Name:</b>	Wildlife Warehouse	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$48,725
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	2,230
<b>Building Code:</b>	R2900203860	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$91,699
<b>Building Name:</b>	Oil House	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$26,410
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	720
<b>Building Code:</b>	R2900203880	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$206,274
<b>Building Name:</b>	Carpenter Shop	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$73,219
<b>Facility Condition Index:</b>	0.35 - Poor	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	1,515
<b>Building Code:</b>	R2900203930	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,387,309
<b>Building Name:</b>	Grand Rapids R2 HQ G1 Shop	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$385,302
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	9,478
<b>Building Code:</b>	R2900203940	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$637,653
<b>Building Name:</b>	Cold Storage W-1	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$112,296
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	6,395
<b>Building Code:</b>	R2900203980	<b>Cost Model Name:</b>	Joint Office/Warehouse Facility	<b>Current Replacement Value:</b>	\$14,387,810
<b>Building Name:</b>	Grand Rapids R2 HQ Main Office	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$2,056,783
<b>Facility Condition Index:</b>	0.14 - Good	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	54,666
<b>Building Code:</b>	R2900204540	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$100,532
<b>Building Name:</b>	Cold Storage N-5	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$46,752
<b>Facility Condition Index:</b>	0.47 - Poor	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	976
<b>Building Code:</b>	R2900204550	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$175,931
<b>Building Name:</b>	Cold Storage N-7	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$47,276
<b>Facility Condition Index:</b>	0.27 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	1,712
<b>Building Code:</b>	R2900204570	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$175,931
<b>Building Name:</b>	Cold Storage N-15	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$76,034
<b>Facility Condition Index:</b>	0.43 - Poor	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	1,352
<b>Building Code:</b>	R2900204580	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$166,695
<b>Building Name:</b>	Fire Control Center	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$54,483
<b>Facility Condition Index:</b>	0.33 - Poor	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	1,905
<b>Building Code:</b>	R2900204600	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$346,490
<b>Building Name:</b>	Sign Shop	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$99,761
<b>Facility Condition Index:</b>	0.29 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	2,312



<b>Building Code:</b>	R2900204630	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$59,166
<b>Building Name:</b>	Cold Storage N-1	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$23,761
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	570
<b>Building Code:</b>	R2900204690	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$767,681
<b>Building Name:</b>	Grand Rapids R2 HQ N9	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$127,888
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	4,798
<b>Building Code:</b>	R2900204730	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$383,682
<b>Building Name:</b>	Central Heat Plant	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$87,071
<b>Facility Condition Index:</b>	0.23 - Average	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	1,430
<b>Building Code:</b>	R2900206830	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$37,650
<b>Building Name:</b>	Hazardous Mat Storage	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$28,237
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	209
<b>Building Code:</b>	R2900206840	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$37,650
<b>Building Name:</b>	Hazardous Mat Storage	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$28,237
<b>Facility Condition Index:</b>	0.75 - Crisis	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	209
<b>Building Code:</b>	R2900206870	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$26,721
<b>Building Name:</b>	Engineering Shed	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$1,179
<b>Facility Condition Index:</b>	0.04 - Excellent	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	181
<b>Building Code:</b>	R2900207080	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,076,045
<b>Building Name:</b>	Grand Rapids R2 HQ Fish Hatch	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$133,398
<b>Facility Condition Index:</b>	0.12 - Good	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	6,230
<b>Building Code:</b>	R2900207700	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$165,259
<b>Building Name:</b>	Cold Storage N-13	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$10,935
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	1,432
<b>Building Code:</b>	R2900208580	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,424
<b>Building Name:</b>	Explosives Shed	<b>Address:</b>	1201 E HWY 2	<b>Deferred Maintenance:</b>	\$248
<b>Facility Condition Index:</b>	0.02 - Excellent	<b>City Code:</b>	GRAND RAPIDS	<b>Ext. Gross Area:</b>	134

**Site: R290236 - Lake City**

<b>Building Code:</b>	R2900501790	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$547,859
<b>Building Name:</b>	Shop	<b>Address:</b>	1801 S OAK ST	<b>Deferred Maintenance:</b>	\$94,877
<b>Facility Condition Index:</b>	0.17 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	4,577
<b>Building Code:</b>	R2900501800	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$30,677
<b>Building Name:</b>	Oil House	<b>Address:</b>	1801 S OAK ST	<b>Deferred Maintenance:</b>	\$7,971
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	LAKE CITY	<b>Ext. Gross Area:</b>	168

**Building Code:** R2900501810  
**Building Name:** Lake City Office  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1801 S OAK ST  
**City Code:** LAKE CITY

**Current Replacement Value:** \$578,871  
**Deferred Maintenance:** \$64,348  
**Ext. Gross Area:** 6,386

**Building Code:** R2900503810  
**Building Name:** Lake City EWR Shop  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 1801 S OAK ST  
**City Code:** LAKE CITY

**Current Replacement Value:** \$375,317  
**Deferred Maintenance:** \$32,987  
**Ext. Gross Area:** 3,296

**Site: R290237 - Waterville**

**Building Code:** R2900401870  
**Building Name:** Pump House  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Bunker  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$34,521  
**Deferred Maintenance:** \$2,661  
**Ext. Gross Area:** 0

**Building Code:** R2900401880  
**Building Name:** Waterville Office  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$2,115,153  
**Deferred Maintenance:** \$194,919  
**Ext. Gross Area:** 0

**Building Code:** R2900401900  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$478,762  
**Deferred Maintenance:** \$102,855  
**Ext. Gross Area:** 0

**Building Code:** R2900401910  
**Building Name:** Residence  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$349,277  
**Deferred Maintenance:** \$39,567  
**Ext. Gross Area:** 0

**Building Code:** R2900401920  
**Building Name:** Garage  
**Facility Condition Index:** 0.31 - [Poor](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$35,625  
**Deferred Maintenance:** \$10,918  
**Ext. Gross Area:** 0

**Building Code:** R2900401930  
**Building Name:** Pump House  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$21,960  
**Deferred Maintenance:** \$2,165  
**Ext. Gross Area:** 0

**Building Code:** R2900401940  
**Building Name:** Pump House  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$10,346  
**Deferred Maintenance:** \$810  
**Ext. Gross Area:** 0

**Building Code:** R2900401950  
**Building Name:** Pump House  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Bunker  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$30,663  
**Deferred Maintenance:** \$2,365  
**Ext. Gross Area:** 0

**Building Code:** R2900401960  
**Building Name:** Pump House  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Bunker  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$30,663  
**Deferred Maintenance:** \$7,016  
**Ext. Gross Area:** 0

**Building Code:** R2900404330  
**Building Name:** Shed  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$17,277  
**Deferred Maintenance:** \$2,418  
**Ext. Gross Area:** 0

**Building Code:** R2900404340  
**Building Name:** Pump House  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Bunker  
**Address:** 50317 FISH HATCHERY RD  
**City Code:** WATERVILLE

**Current Replacement Value:** \$34,086  
**Deferred Maintenance:** \$7,885  
**Ext. Gross Area:** 0

**Site: R290238 - Minnesota Interagency Fire Center**

**Building Code:** R2900208470  
**Building Name:** MIFC Modular Office  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 402 11TH ST SE  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$173,483  
**Deferred Maintenance:** \$27,617  
**Ext. Gross Area:** 1,068

**Site: R290240 - Duluth Area**

**Building Code:** R2900201880  
**Building Name:** Duluth Office  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 4805 RICE LAKE RD  
**City Code:** DULUTH

**Current Replacement Value:** \$460,665  
**Deferred Maintenance:** \$125,663  
**Ext. Gross Area:** 1,834

**Building Code:** R2900201890  
**Building Name:** Duluth Shop  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 4805 RICE LAKE RD  
**City Code:** DULUTH

**Current Replacement Value:** \$407,460  
**Deferred Maintenance:** \$115,679  
**Ext. Gross Area:** 3,115

**Building Code:** R2900201900  
**Building Name:** Fuel Shed  
**Facility Condition Index:** 0.46 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 4805 RICE LAKE RD  
**City Code:** DULUTH

**Current Replacement Value:** \$29,876  
**Deferred Maintenance:** \$13,807  
**Ext. Gross Area:** 168

**Building Code:** R2900201910  
**Building Name:** Fire Cache  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 4805 RICE LAKE RD  
**City Code:** DULUTH

**Current Replacement Value:** \$31,531  
**Deferred Maintenance:** \$8,615  
**Ext. Gross Area:** 299

**Building Code:** R2900202010  
**Building Name:** Lower Garage  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 4805 RICE LAKE RD  
**City Code:** DULUTH

**Current Replacement Value:** \$50,403  
**Deferred Maintenance:** \$5,741  
**Ext. Gross Area:** 582

**Site: R290242 - Lanesboro Area**

**Building Code:** R2900501580  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 23785 GROSBEAK LN  
**City Code:** LANESBORO

**Current Replacement Value:** \$25,015  
**Deferred Maintenance:** \$8,219  
**Ext. Gross Area:** 0

**Building Code:** R2900501720  
**Building Name:** Lanesboro Area Office  
**Facility Condition Index:** 0.13 - [Good](#)

**Building Code:** R2900504640  
**Building Name:** Oil House  
**Facility Condition Index:** 0.11 - [Good](#)

**Building Code:** R2900505290  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 23785 GROSBEAK LN  
**City Code:** LANESBORO

**Cost Model Name:** Utility Shed  
**Address:** 23785 GROSBEAK LN  
**City Code:** LANESBORO

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 23785 GROSBEAK LN  
**City Code:** LANESBORO

**Current Replacement Value:** \$936,739  
**Deferred Maintenance:** \$123,805  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$25,602  
**Deferred Maintenance:** \$2,752  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$280,049  
**Deferred Maintenance:** \$17,565  
**Ext. Gross Area:** 0

**Site: [R290243 - Onamia](#)**

**Building Code:** R2900300460  
**Building Name:** Onamia Office  
**Facility Condition Index:** 0.28 - [Average](#)

**Building Code:** R2900300480  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.30 - [Average](#)

**Building Code:** R2900304090  
**Building Name:** Oil House  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 303 ROOSEVELT RD  
**City Code:** ONAMIA

**Cost Model Name:** Single-story Work Facility  
**Address:** 303 ROOSEVELT RD  
**City Code:** ONAMIA

**Cost Model Name:** Utility Shed  
**Address:** 303 ROOSEVELT RD  
**City Code:** ONAMIA

**Current Replacement Value:** \$309,129  
**Deferred Maintenance:** \$85,531  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$92,425  
**Deferred Maintenance:** \$27,577  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$17,617  
**Deferred Maintenance:** \$2,447  
**Ext. Gross Area:** 0

**Site: [R290263 - Crane Lake - St Louis](#)**

**Building Code:** R2900203090  
**Building Name:** Boat House  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** R2900206860  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 7144 COUNTY RD 425  
**City Code:** CRANE LAKE

**Cost Model Name:** Vault Toilet  
**Address:** 7144 COUNTY RD 425  
**City Code:** CRANE LAKE

**Current Replacement Value:** \$350,871  
**Deferred Maintenance:** \$29,404  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$12,046  
**Deferred Maintenance:** \$1,249  
**Ext. Gross Area:** 0

**Site: [R290264 - Namakan Lake](#)**

**Building Code:** R2900203330  
**Building Name:** Cabin  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-family Residence  
**Address:** 1201 E HWY 2  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$156,436  
**Deferred Maintenance:** \$20,913  
**Ext. Gross Area:** 0

**Building Code:** R2900204210  
**Building Name:** Oil House  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Utility Shed  
**Address:** Namakan Island  
**City Code:**

**Current Replacement Value:** \$1,759  
**Deferred Maintenance:** \$580  
**Ext. Gross Area:** 0

**Building Code:** R2900204220  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.32 - Poor

**Cost Model Name:** Utility Shed  
**Address:**  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$4,586  
**Deferred Maintenance:** \$1,454  
**Ext. Gross Area:** 0

**Site: R290265 - Sauk Centre**

**Building Code:** R2900307440  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** SAUK CENTRE

**Current Replacement Value:** \$171,047  
**Deferred Maintenance:** \$17,046  
**Ext. Gross Area:** 0

**Site: R290267 - Mille Lacs Lake**

**Building Code:** R2900303060  
**Building Name:** DISPOSED - Cove Bay Boat House  
**Facility Condition Index:** 0.25 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** ONAMIA

**Current Replacement Value:** \$71,130  
**Deferred Maintenance:** \$17,695  
**Ext. Gross Area:** 0

**Building Code:** R2900303070  
**Building Name:** Isle Boat House  
**Facility Condition Index:** 0.27 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 41294 HENNEPIN PK RD  
**City Code:** ISLE

**Current Replacement Value:** \$78,200  
**Deferred Maintenance:** \$21,230  
**Ext. Gross Area:** 0

**Site: R290268 - Hastings**

**Building Code:** R2900602180  
**Building Name:** Boat House  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 1350 DAM RD  
**City Code:** HASTINGS

**Current Replacement Value:** \$30,578  
**Deferred Maintenance:** \$3,058  
**Ext. Gross Area:** 0

**Site: R290269 - Lake Minnetonka**

**Building Code:** R2900600010  
**Building Name:** Boat House  
**Facility Condition Index:** 0.35 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** MINNETONKA

**Current Replacement Value:** \$69,381  
**Deferred Maintenance:** \$24,378  
**Ext. Gross Area:** 0

**Site: R290270 - Lake Saganaga**

**Building Code:** R2900203390  
**Building Name:** Cabin  
**Facility Condition Index:** 0.24 - Average

**Cost Model Name:** Single-family Residence  
**Address:**  
**City Code:** UNASSIGNED

**Current Replacement Value:** \$40,519  
**Deferred Maintenance:** \$9,688  
**Ext. Gross Area:** 0

**Site: R290271 - Nemadji State Forest**

**Building Code:** R2900305560  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** 701 S KENWOOD RR 2  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$14,242  
**Deferred Maintenance:** \$4,700  
**Ext. Gross Area:** 0

**Building Code:** R2900306620  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 67491 STATE FOREST RD  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$11,876  
**Deferred Maintenance:** \$2,192  
**Ext. Gross Area:** 0

**Building Code:** R2900308210  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 67491 STATE FOREST RD  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$11,876  
**Deferred Maintenance:** \$848  
**Ext. Gross Area:** 0

**Building Code:** R2900308220  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 67491 STATE FOREST RD  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$15,284  
**Deferred Maintenance:** \$2,207  
**Ext. Gross Area:** 0

**Site: R290272 - Cross Lake**

**Building Code:** R2900306610  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** 701 S KENWOOD RR 2  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$11,941  
**Deferred Maintenance:** \$2,963  
**Ext. Gross Area:** 0

**Site: R290274 - McCarthy Lake WMA**

**Building Code:** R2900308160  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** HWY 61  
**City Code:** KELLOGG

**Current Replacement Value:** \$207,767  
**Deferred Maintenance:** \$18,956  
**Ext. Gross Area:** 0

**Site: R290275 - New London Hatchery**

**Building Code:** R2900403710  
**Building Name:** New London Fish Hatchery  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** ONE OAK STREET N  
**City Code:** NEW LONDON

**Current Replacement Value:** \$781,656  
**Deferred Maintenance:** \$78,362  
**Ext. Gross Area:** 0

**Building Code:** R2900403720  
**Building Name:** Pump House  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** ONE OAK STREET N  
**City Code:** NEW LONDON

**Current Replacement Value:** \$137,548  
**Deferred Maintenance:** \$36,510  
**Ext. Gross Area:** 0

**Building Code:** R2900403730  
**Building Name:** Pump House  
**Facility Condition Index:** 0.39 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** ONE OAK STREET N  
**City Code:** NEW LONDON

**Current Replacement Value:** \$24,670  
**Deferred Maintenance:** \$9,607  
**Ext. Gross Area:** 0

**Building Code:** R2900404730  
**Building Name:** Raceway Shelter  
**Facility Condition Index:** 0.07 - Good

**Building Code:** R2900405280  
**Building Name:** Shed  
**Facility Condition Index:** 0.64 - Crisis

**Site: R290276 - Red Wing**

**Building Code:** R2900500090  
**Building Name:** Boat House  
**Facility Condition Index:** 0.05 - Good

**Site: R290277 - Wabasha**

**Building Code:** R2900500120  
**Building Name:** Boat House  
**Facility Condition Index:** 0.10 - Good

**Site: R290278 - La Cresent**

**Building Code:** R2900503700  
**Building Name:** Boat House  
**Facility Condition Index:** 0.12 - Good

**Site: R290281 - Rainy Lake**

**Building Code:** R2900207250  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.10 - Good

**Site: R290282 - Lake Winnibigoshish**

**Building Code:** R2900208450  
**Building Name:** Boat House  
**Facility Condition Index:** 0.03 - Excellent

**Site: R290283 - Coleraine**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** ONE OAK STREET N  
**City Code:** NEW LONDON

**Cost Model Name:** Utility Shed  
**Address:** ONE OAK STREET N  
**City Code:** NEW LONDON

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** RED WING

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** WABASHA

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** LA CRESCENT

**Cost Model Name:** Tower  
**Address:** 392 HWY 11 E  
**City Code:** INTL. FALLS

**Cost Model Name:** Single-story Work Facility  
**Address:** 1201 E HWY 2  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$176,863  
**Deferred Maintenance:** \$13,113  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$6,641  
**Deferred Maintenance:** \$4,268  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$41,509  
**Deferred Maintenance:** \$2,120  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$43,912  
**Deferred Maintenance:** \$4,391  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$76,384  
**Deferred Maintenance:** \$8,969  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$13,610  
**Deferred Maintenance:** \$1,361  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$19,333  
**Deferred Maintenance:** \$531  
**Ext. Gross Area:** 0



**Building Code:** R2900203870  
**Building Name:** Radio Shelter  
**Facility Condition Index:** 0.40 - **Poor**

**Building Code:** R2900207210  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 403 DIVISION ST  
**City Code:** DEER RIVER

**Cost Model Name:** Tower  
**Address:** 403 DIVISION ST  
**City Code:** DEER RIVER

**Current Replacement Value:** \$7,516  
**Deferred Maintenance:** \$3,025  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,373  
**Deferred Maintenance:** \$7,030  
**Ext. Gross Area:** 0

**Site: R290284 - Devil Track Hatchery**

**Building Code:** R2900204510  
**Building Name:** Devil Track Hatchery  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 137 SOUTH SHORE DRIVE  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$263,437  
**Deferred Maintenance:** \$41,802  
**Ext. Gross Area:** 0

**Site: R290285 - Cromwell**

**Building Code:** R2900207090  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.58 - **Crisis**

**Cost Model Name:** Tower  
**Address:** CO RD 5  
**City Code:** CROMWELL

**Current Replacement Value:** \$26,293  
**Deferred Maintenance:** \$15,119  
**Ext. Gross Area:** 0

**Building Code:** R2900207110  
**Building Name:** Cromwell Fire Tower  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Tower  
**Address:** 824 CO RD 120  
**City Code:** CROMWELL

**Current Replacement Value:** \$27,024  
**Deferred Maintenance:** \$8,918  
**Ext. Gross Area:** 0

**Site: R290286 - Hill River State Forest**

**Building Code:** R2900305510  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Tower  
**Address:** 454 N HWY 169  
**City Code:** HILL CITY

**Current Replacement Value:** \$15,784  
**Deferred Maintenance:** \$1,578  
**Ext. Gross Area:** 0

**Building Code:** R2900305530  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Tower  
**Address:** 454 N HWY 169  
**City Code:** HILL CITY

**Current Replacement Value:** \$13,259  
**Deferred Maintenance:** \$1,326  
**Ext. Gross Area:** 0

**Site: R290287 - Cannon Falls**

**Building Code:** R2900504980  
**Building Name:** Picnic Shelter 1  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:**  
**City Code:** CANNON FALLS

**Current Replacement Value:** \$52,680  
**Deferred Maintenance:** \$6,663  
**Ext. Gross Area:** 0

**Building Code:** R2900504990  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** CANNON FALLS

**Current Replacement Value:** \$160,905  
**Deferred Maintenance:** \$23,479  
**Ext. Gross Area:** 0

**Site: R290289 - Vermillion Highlands WMA**

**Building Code:** R2900308170  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 15325 BABCOCK AVE  
**City Code:** ROSEMOUNT

**Current Replacement Value:** \$130,037  
**Deferred Maintenance:** \$21,111  
**Ext. Gross Area:** 0

**Site: R290290 - Sand Prairie WMA & Environmental Ed**

**Building Code:** R2900308150  
**Building Name:** Info Center  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Open Air Shelter  
**Address:** East side of Hwy 10, South of Hwy 23  
**City Code:** SAUK RAPIDS

**Current Replacement Value:** \$19,073  
**Deferred Maintenance:** \$1,289  
**Ext. Gross Area:** 0

**Site: R290291 - Bemidji Hatchery**

**Building Code:** R2900100980  
**Building Name:** Bemidji Hatchery  
**Facility Condition Index:** 0.26 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 10307 POWER DAM RD NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$564,104  
**Deferred Maintenance:** \$148,330  
**Ext. Gross Area:** 2,016

**Site: R290292 - Bemidji Area Fish & Wildlife**

**Building Code:** R2900100200  
**Building Name:** Bemidji FAW Office  
**Facility Condition Index:** 0.17 - Average

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2114 BEMIDJI AVE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$563,738  
**Deferred Maintenance:** \$98,218  
**Ext. Gross Area:** 3,002

**Site: R290293 - Bemidji Area Wildlife Research**

**Building Code:** R2900103270  
**Building Name:** Bemidji Research Old Office  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 102 23RD ST NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$382,029  
**Deferred Maintenance:** \$126,434  
**Ext. Gross Area:** 2,088

**Building Code:** R2900103280  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** 102 23RD ST NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$25,177  
**Deferred Maintenance:** \$8,309  
**Ext. Gross Area:** 278

**Building Code:** R2900106150  
**Building Name:** Bemidji Wild Research Mod Off  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 102 23RD ST NE  
**City Code:** BEMIDJI

**Current Replacement Value:** \$452,363  
**Deferred Maintenance:** \$58,527  
**Ext. Gross Area:** 2,010

**Site: R290294 - Duluth French River**

<b>Building Code:</b>	R2900200320	<b>Cost Model Name:</b>	Joint Office/Warehouse Facility	<b>Current Replacement Value:</b>	\$2,940,892
<b>Building Name:</b>	Duluth French River Nursery	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$704,150
<b>Facility Condition Index:</b>	0.24 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	12,016
<b>Building Code:</b>	R2900200330	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$68,202
<b>Building Name:</b>	Clarifier	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$18,606
<b>Facility Condition Index:</b>	0.27 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	217
<b>Building Code:</b>	R2900200340	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$4,699,944
<b>Building Name:</b>	Burrows / Biofilters	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$1,038,677
<b>Facility Condition Index:</b>	0.22 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	16,946
<b>Building Code:</b>	R2900200350	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$7,947
<b>Building Name:</b>	Pump Sump Pipe to Lake Superior	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$2,563
<b>Facility Condition Index:</b>	0.32 - <i>Poor</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	26
<b>Building Code:</b>	R2900200370	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$412,963
<b>Building Name:</b>	Residence	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$76,476
<b>Facility Condition Index:</b>	0.19 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	2,342
<b>Building Code:</b>	R2900200400	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$66,408
<b>Building Name:</b>	Pump House	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$19,780
<b>Facility Condition Index:</b>	0.30 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	606
<b>Building Code:</b>	R2900203630	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$248,716
<b>Building Name:</b>	Duluth French River Shop	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$52,598
<b>Facility Condition Index:</b>	0.21 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	1,930
<b>Building Code:</b>	R2900206970	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$113,477
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$16,274
<b>Facility Condition Index:</b>	0.14 - <i>Good</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	957
<b>Building Code:</b>	R2900208430	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$258,969
<b>Building Name:</b>	Bruder Stock - Pole Shed	<b>Address:</b>	5357 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$24,537
<b>Facility Condition Index:</b>	0.09 - <i>Good</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	3,293

**Site: R290295 - Duluth Area Fisheries**

<b>Building Code:</b>	R2900200380	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$498,456
<b>Building Name:</b>	Garage	<b>Address:</b>	5351 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$105,550
<b>Facility Condition Index:</b>	0.21 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	4,240
<b>Building Code:</b>	R2900200390	<b>Cost Model Name:</b>	Low-rise Office Building, 2 to 4 story	<b>Current Replacement Value:</b>	\$2,205,963
<b>Building Name:</b>	Duluth Office-Hatchery	<b>Address:</b>	5351 NORTH SHORE DR	<b>Deferred Maintenance:</b>	\$505,679
<b>Facility Condition Index:</b>	0.23 - <i>Average</i>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	8,505

**Building Code:** R2900200410  
**Building Name:** 2 Stall Garage  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5351 NORTH SHORE DR  
**City Code:** DULUTH

**Current Replacement Value:** \$124,960  
**Deferred Maintenance:** \$17,593  
**Ext. Gross Area:** 673

**Building Code:** R2900200420  
**Building Name:** Net Shed  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5351 NORTH SHORE DR  
**City Code:** DULUTH

**Current Replacement Value:** \$30,083  
**Deferred Maintenance:** \$5,662  
**Ext. Gross Area:** 331

**Building Code:** R2900200430  
**Building Name:** Duluth Fisheries Shop  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5351 NORTH SHORE DR  
**City Code:** DULUTH

**Current Replacement Value:** \$493,943  
**Deferred Maintenance:** \$88,920  
**Ext. Gross Area:** 4,480

**Building Code:** R2900206140  
**Building Name:** Cold Storage  
**Facility Condition Index:** 0.76 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 5351 NORTH SHORE DR  
**City Code:** DULUTH

**Current Replacement Value:** \$11,722  
**Deferred Maintenance:** \$8,961  
**Ext. Gross Area:** 96

**Building Code:** R2900206150  
**Building Name:** Cold Storage  
**Facility Condition Index:** 1.00 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 5351 NORTH SHORE DR  
**City Code:** DULUTH

**Current Replacement Value:** \$10,147  
**Deferred Maintenance:** \$10,147  
**Ext. Gross Area:** 146

**Building Code:** R2900206850  
**Building Name:** Walk In Freezer Building  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 5351 NORTH SHORE DR  
**City Code:** DULUTH

**Current Replacement Value:** \$38,278  
**Deferred Maintenance:** \$28,708  
**Ext. Gross Area:** 131

**Site: R290296 - Baudette Fish & Wildlife**

**Building Code:** R2900103860  
**Building Name:** Garage  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** 204 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$25,786  
**Deferred Maintenance:** \$9,123  
**Ext. Gross Area:** 331

**Building Code:** R2900103890  
**Building Name:** Baudette FAW Office  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 204 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$376,595  
**Deferred Maintenance:** \$47,761  
**Ext. Gross Area:** 1,057

**Building Code:** R2900104520  
**Building Name:** Baudette FAW Shop  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 204 MAIN ST E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$466,057  
**Deferred Maintenance:** \$64,491  
**Ext. Gross Area:** 0

**Site: R290297 - Lanesboro Hatchery**

**Building Code:** R2900501550  
**Building Name:** Lanesboro Fish Hatchery  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 23789 GROSBEAK LN  
**City Code:** LANESBORO

**Current Replacement Value:** \$868,476  
**Deferred Maintenance:** \$64,968  
**Ext. Gross Area:** 0

<b>Building Code:</b>	R2900501560	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$224,154
<b>Building Name:</b>	Shop	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$15,744
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501570	<b>Cost Model Name:</b>	Single-family Residence	<b>Current Replacement Value:</b>	\$327,928
<b>Building Name:</b>	Residence	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$85,998
<b>Facility Condition Index:</b>	0.26 - Average	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501600	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$194,586
<b>Building Name:</b>	Spring House	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$65,571
<b>Facility Condition Index:</b>	0.34 - Poor	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501610	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$12,723
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$2,622
<b>Facility Condition Index:</b>	0.21 - Average	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900501940	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$10,432
<b>Building Name:</b>	Cold Storage	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$6,773
<b>Facility Condition Index:</b>	0.65 - Crisis	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502110	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$2,538,423
<b>Building Name:</b>	Pole Shed Raceway	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$154,390
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502410	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$317,200
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$287,116
<b>Facility Condition Index:</b>	0.91 - Crisis	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502420	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$308,168
<b>Building Name:</b>	Raceway Shelter	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$278,084
<b>Facility Condition Index:</b>	0.90 - Crisis	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900502430	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$70,813
<b>Building Name:</b>	Brood Stock Raceway	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$7,513
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504650	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$27,611
<b>Building Name:</b>	Gazebo Spring House	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$3,579
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504710	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$67,153
<b>Building Name:</b>	Generator Shed	<b>Address:</b>	23789 GROSBEAK LN	<b>Deferred Maintenance:</b>	\$19,129
<b>Facility Condition Index:</b>	0.28 - Average	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900505000  
**Building Name:** Coverall Shelter  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Fabric Structure  
**Address:** 23789 GROSBEAK LN  
**City Code:** LANESBORO

**Current Replacement Value:** \$62,138  
**Deferred Maintenance:** \$20,506  
**Ext. Gross Area:** 0

**Building Code:** R2900505360  
**Building Name:** Fingerlings Raceway  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 23789 GROSBEAK LN  
**City Code:** LANESBORO

**Current Replacement Value:** \$258,799  
**Deferred Maintenance:** \$15,716  
**Ext. Gross Area:** 0

**Site: R290322 - LaSalle Lake SRA**

**Building Code:** R2900108890  
**Building Name:** Black Bear Cabin  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Single-family Residence  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$438,799  
**Deferred Maintenance:** \$16,012  
**Ext. Gross Area:** 0

**Building Code:** R2900108900  
**Building Name:** Black Bear Pump House  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$33,537  
**Deferred Maintenance:** \$757  
**Ext. Gross Area:** 0

**Building Code:** R2900108910  
**Building Name:** Fish Cleaning House  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$34,936  
**Deferred Maintenance:** \$4,798  
**Ext. Gross Area:** 0

**Building Code:** R2900108920  
**Building Name:** LaSalle Lake SRA Shop  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$196,819  
**Deferred Maintenance:** \$29,831  
**Ext. Gross Area:** 0

**Building Code:** R2900108930  
**Building Name:** Sanitation  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Restroom Facility  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$323,035  
**Deferred Maintenance:** \$32,303  
**Ext. Gross Area:** 0

**Building Code:** R2900108960  
**Building Name:** Lone Wolf Cabin  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-family Residence  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$103,471  
**Deferred Maintenance:** \$10,347  
**Ext. Gross Area:** 0

**Building Code:** R2900108980  
**Building Name:** Black Bear Garage  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$50,178  
**Deferred Maintenance:** \$5,018  
**Ext. Gross Area:** 0

**Building Code:** R2900109400  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$27,709  
**Deferred Maintenance:** \$2,771  
**Ext. Gross Area:** 0

**Building Code:** R2900109410  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$55,417  
**Deferred Maintenance:** \$5,542  
**Ext. Gross Area:** 0

**Building Code:** R2900109420  
**Building Name:** Picnic Shelter 2  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 9887 CO RD 9  
**City Code:** SOLWAY

**Current Replacement Value:** \$170,535  
**Deferred Maintenance:** \$17,054  
**Ext. Gross Area:** 0

**Site: R290323 - McDougall WMA**

**Building Code:** R2900308260  
**Building Name:** Brooder House  
**Facility Condition Index:** 0.71 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5815 HILTON RD  
**City Code:** ROYALTON

**Current Replacement Value:** \$42,823  
**Deferred Maintenance:** \$30,556  
**Ext. Gross Area:** 0

**Building Code:** R2900308270  
**Building Name:** Barn  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5815 HILTON RD  
**City Code:** ROYALTON

**Current Replacement Value:** \$293,830  
**Deferred Maintenance:** \$220,372  
**Ext. Gross Area:** 0

**Site: R290324 - Lake Christina WAS - Grant**

**Building Code:** R2900109040  
**Building Name:** Pump House  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** ASHBY

**Current Replacement Value:** \$38,702  
**Deferred Maintenance:** \$3,870  
**Ext. Gross Area:** 0

**Building Code:** R2900109480  
**Building Name:** Fish Control Structure  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:**  
**City Code:** ASHBY

**Current Replacement Value:** \$11,677  
**Deferred Maintenance:** \$1,168  
**Ext. Gross Area:** 0

**Site: R290325 - Moose Lake**

**Building Code:** R2900206480  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Vault Toilet  
**Address:** CO RD 217  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$10,095  
**Deferred Maintenance:** \$1,932  
**Ext. Gross Area:** 0

**Site: R290357 - Root River State Trail**

**Building Code:** R2900502790  
**Building Name:** Trout Valley Trail Vault Toilet  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$34,771  
**Deferred Maintenance:** \$26,079  
**Ext. Gross Area:** 0

**Building Code:** R2900502820  
**Building Name:** Gribbon Valley Vault Toilet  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$34,771  
**Deferred Maintenance:** \$26,079  
**Ext. Gross Area:** 0

**Building Code:** R2900502830  
**Building Name:** Isinour Women's Vault Toilet  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Vault Toilet  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$34,771  
**Deferred Maintenance:** \$26,079  
**Ext. Gross Area:** 0



<b>Building Code:</b>	R2900502840	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$34,771
<b>Building Name:</b>	Isinour Men's Vault Toilet	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$26,079
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503030	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$18,375
<b>Building Name:</b>	Fountain Adirondack	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$6,979
<b>Facility Condition Index:</b>	0.38 - <b>Poor</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503040	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$14,470
<b>Building Name:</b>	Upper Isinour Adirondack	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$4,775
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503910	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$34,771
<b>Building Name:</b>	Peterson/Lanesboro River Acces VT	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$26,079
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503920	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$34,771
<b>Building Name:</b>	Peterson River Access Vault Toilet	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$26,079
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503930	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$34,771
<b>Building Name:</b>	Whalan Trail Men's Vault Toilet	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$26,079
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900503940	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$34,771
<b>Building Name:</b>	Whalan Trail Women's Vault Toilet	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$26,079
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504660	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$17,921
<b>Building Name:</b>	S Branch Root River Adirondack	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$3,192
<b>Facility Condition Index:</b>	0.18 - <b>Average</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504680	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$17,251
<b>Building Name:</b>	Vinegar Ridge Camp Site Adirondack	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$3,812
<b>Facility Condition Index:</b>	0.22 - <b>Average</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504820	<b>Cost Model Name:</b>	Vault Toilet	<b>Current Replacement Value:</b>	\$34,771
<b>Building Name:</b>	Brightdale Mgmt Unit, Vault Toilet	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$11,475
<b>Facility Condition Index:</b>	0.33 - <b>Poor</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0
<b>Building Code:</b>	R2900504830	<b>Cost Model Name:</b>	Open Air Shelter	<b>Current Replacement Value:</b>	\$17,251
<b>Building Name:</b>	Whalen Adirondack	<b>Address:</b>	100 MILWAUKEE RD	<b>Deferred Maintenance:</b>	\$12,938
<b>Facility Condition Index:</b>	0.75 - <b>Crisis</b>	<b>City Code:</b>	LANESBORO	<b>Ext. Gross Area:</b>	0

**Building Code:** R2900504840  
**Building Name:** Eagle Bluff Center Vault Toilet  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Vault Toilet  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$34,771  
**Deferred Maintenance:** \$11,475  
**Ext. Gross Area:** 0

**Building Code:** R2900504850  
**Building Name:** Preston Adirondack  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$11,484  
**Deferred Maintenance:** \$1,462  
**Ext. Gross Area:** 0

**Building Code:** R2900504860  
**Building Name:** Isonaurs Lower PL Adirondack  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$17,251  
**Deferred Maintenance:** \$2,412  
**Ext. Gross Area:** 0

**Building Code:** R2900504910  
**Building Name:** Wet Bark/Oak Ridge Adirondack  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$15,965  
**Deferred Maintenance:** \$1,815  
**Ext. Gross Area:** 0

**Building Code:** R2900504920  
**Building Name:** Wet Bark Unit Adirondack  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Shelter  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$15,526  
**Deferred Maintenance:** \$1,771  
**Ext. Gross Area:** 0

**Building Code:** R2900505520  
**Building Name:** North of Peterson Adirondack  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Open Air Shelter  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$9,488  
**Deferred Maintenance:** \$2,096  
**Ext. Gross Area:** 0

**Site: R290358 - Harmony-Preston State Trail**

**Building Code:** R2900504670  
**Building Name:** Adirondack  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Open Air Shelter  
**Address:** 100 MILWAUKEE RD  
**City Code:** LANESBORO

**Current Replacement Value:** \$17,251  
**Deferred Maintenance:** \$6,368  
**Ext. Gross Area:** 0

**Site: R290362 - Round-Rice WMA**

**Building Code:** R2900209390  
**Building Name:** Heated Storage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** STATE HWY 17 & CROW WING CO 10  
**City Code:** GARRISON

**Current Replacement Value:** \$10,278  
**Deferred Maintenance:** \$233  
**Ext. Gross Area:** 0

**Site: R290363 - Oak Lake WAS**

**Building Code:** R2900209400  
**Building Name:** Vault Toilet Concrete  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** 89999 OAK LAKE RD S  
**City Code:** KERRICK

**Current Replacement Value:** \$18,487  
**Deferred Maintenance:** \$1,849  
**Ext. Gross Area:** 0

**Site: R290364 - Sturgeon Lake WAS**

**Building Code:** R2900209410  
**Building Name:** Vault Toilet  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Vault Toilet  
**Address:** 38714 LAUNCH DR  
**City Code:** STURGEON LAKE

**Current Replacement Value:** \$15,317  
**Deferred Maintenance:** \$1,562  
**Ext. Gross Area:** 0

***Site: R290367 - Ray Berglund State Wayside***

**Building Code:** R2900209500  
**Building Name:** Ray Berglund State Wayside  
**Facility Condition Index:** 0.03 - Excellent

**Cost Model Name:** Vault Toilet  
**Address:**  
**City Code:** TOFTE

**Current Replacement Value:** \$117,825  
**Deferred Maintenance:** \$3,555  
**Ext. Gross Area:** 0

***Site: R290453 - White Earth State Forest***

**Building Code:** R2900105510  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Tower  
**Address:** TULBAY  
**City Code:** MAHNOMEN

**Current Replacement Value:** \$7,323  
**Deferred Maintenance:** \$2,416  
**Ext. Gross Area:** 0

**Building Code:** R2900105610  
**Building Name:** Fire Tower  
**Facility Condition Index:** 0.33 - Poor

**Cost Model Name:** Tower  
**Address:** Height of Land  
**City Code:** MAHNOMEN

**Current Replacement Value:** \$7,323  
**Deferred Maintenance:** \$2,416  
**Ext. Gross Area:** 0

***Site: R290635 - Peterson***

**Building Code:** R2900504770  
**Building Name:** Peterson T&W Storage  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 416 PARK ST  
**City Code:** PETERSON

**Current Replacement Value:** \$526,635  
**Deferred Maintenance:** \$43,874  
**Ext. Gross Area:** 0

***Site: R290643 - Sea Gull Lake***

**Building Code:** R2900204200  
**Building Name:** Sea Gull Cabin  
**Facility Condition Index:** 0.32 - Poor

**Cost Model Name:** Single-family Residence  
**Address:** 92 Gull Lake Lane  
**City Code:** Grand Marais

**Current Replacement Value:** \$86,097  
**Deferred Maintenance:** \$27,412  
**Ext. Gross Area:** 0

***Site: R290644 - Windom***

**Building Code:** R2900404300  
**Building Name:** Windom Office  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Low-rise Office Building, 2 to 4 story  
**Address:** 175 CTY RD 26  
**City Code:** WINDOM

**Current Replacement Value:** \$4,501,565  
**Deferred Maintenance:** \$90,031  
**Ext. Gross Area:** 22,145

**Building Code:** R2900404810  
**Building Name:** Shed  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Utility Shed  
**Address:** 175 CTY RD 26  
**City Code:** WINDOM

**Current Replacement Value:** \$16,906  
**Deferred Maintenance:** \$1,987  
**Ext. Gross Area:** 197

## Agency: R32 - Pollution Control Agency

**FCI Rating:** Average  
**Facility Condition Index:** 0.17

**Current Replacement Value:** \$2,869,361  
**Deferred Maintenance:** \$490,905

**Ext. Gross Area:** 0  
**Building Count:** 18

### Site: R32B30 - BECKER COUNTY LANDFILL

**Building Code:** R32B30B3001  
**Building Name:** Groundwater Treatment Building  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 24413 County Road 144  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$5,059  
**Deferred Maintenance:** \$321  
**Ext. Gross Area:** 0

### Site: R32E10 - EAST BETHEL LANDFILL

**Building Code:** R32E10E1001  
**Building Name:** Groundwater Treatment Building  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 217th Avenue Northeast  
**City Code:** EAST BETHEL

**Current Replacement Value:** \$189,588  
**Deferred Maintenance:** \$21,875  
**Ext. Gross Area:** 0

### Site: R32F40 - FLYING CLOUD LANDFILL

**Building Code:** R32F40F4001  
**Building Name:** Former Gas to Energy Building  
**Facility Condition Index:** 0.14 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 9813 Flying Cloud Drive  
**City Code:** EDEN PRAIRIE

**Current Replacement Value:** \$952,011  
**Deferred Maintenance:** \$132,725  
**Ext. Gross Area:** 0

### Site: R32I20 - IRONWOOD LANDFILL

**Building Code:** R32I20I2001  
**Building Name:** Manifold Building  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Sec. 22, Bloomfield Twp.  
**City Code:** Spring Valley

**Current Replacement Value:** \$19,062  
**Deferred Maintenance:** \$1,906  
**Ext. Gross Area:** 0

### Site: R32K40 - KOOCHICHING COUNTY LANDFILL

**Building Code:** R32K40K4001  
**Building Name:** Leachate Pump Control Building  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4100 Highway 11 West  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$5,841  
**Deferred Maintenance:** \$117  
**Ext. Gross Area:** 0

### Site: R32L80 - LINDENFELSER LANDFILL

**Building Code:** R32L80L8001  
**Building Name:** Garage  
**Facility Condition Index:** 0.27 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1890 Kadler Avenue  
**City Code:** St. Michael

**Current Replacement Value:** \$883,071  
**Deferred Maintenance:** \$236,206  
**Ext. Gross Area:** 0

### Site: R32L90 - LONG PRAIRIE LANDFILL

**Building Code:** R32L90L9002  
**Building Name:** Pole Barn  
**Facility Condition Index:** 0.17 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 28824 State Highway 27  
**City Code:** Long Prairie

**Current Replacement Value:** \$190,880  
**Deferred Maintenance:** \$33,093  
**Ext. Gross Area:** 0

**Site: R32W40 - WASHINGTON COUNTY LANDFILL**

**Building Code:** R32W40W4001  
**Building Name:** Storage Building  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3855 Jamaca Avenue  
**City Code:** Lake Elmo

**Current Replacement Value:** \$62,719  
**Deferred Maintenance:** \$6,272  
**Ext. Gross Area:** 0

**Building Code:** R32W40W4003  
**Building Name:** Leachate Pump Control Building  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3855 Jamaca Avenue  
**City Code:** LAKE ELMO

**Current Replacement Value:** \$9,360  
**Deferred Maintenance:** \$936  
**Ext. Gross Area:** 0

**Site: R32W50 - ANOKA-RAMSEY LANDFILL**

**Building Code:** R32W50W5001  
**Building Name:** Equipment Storage Bldg  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 14730 Sunfish Lake Blvd.  
**City Code:** RAMSEY

**Current Replacement Value:** \$70,541  
**Deferred Maintenance:** \$7,054  
**Ext. Gross Area:** 0

**Building Code:** R32W50W5002  
**Building Name:** Former Air Stripper Blower Bldg  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 14730 Sunfish Lake Blvd.  
**City Code:** RAMSEY

**Current Replacement Value:** \$127,443  
**Deferred Maintenance:** \$12,744  
**Ext. Gross Area:** 0

**Building Code:** R32W50W5003  
**Building Name:** Former Flare Blower Bldg  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 14730 Sunfish Lake Blvd.  
**City Code:** RAMSEY

**Current Replacement Value:** \$45,073  
**Deferred Maintenance:** \$4,507  
**Ext. Gross Area:** 0

**Building Code:** R32W50W5004  
**Building Name:** Emergency Blower Building  
**Facility Condition Index:** 0.21 - Average

**Cost Model Name:** Utility Shed  
**Address:** 14730 Sunfish Lake Blvd.  
**City Code:** RAMSEY

**Current Replacement Value:** \$5,936  
**Deferred Maintenance:** \$1,244  
**Ext. Gross Area:** 0

**Building Code:** R32W50W5005  
**Building Name:** Control Panel Building  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Utility Shed  
**Address:** 14730 Sunfish Lake Blvd.  
**City Code:** RAMSEY

**Current Replacement Value:** \$8,874  
**Deferred Maintenance:** \$887  
**Ext. Gross Area:** 0

**Site: R32W70 - WASTE DISPOSAL ENGINEERING LANDFILL**

**Building Code:** R32W70W7001  
**Building Name:** Groundwater Treatment Bldg  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 14437 Crosstown Blvd.  
**City Code:** Andover

**Current Replacement Value:** \$32,660  
**Deferred Maintenance:** \$3,266  
**Ext. Gross Area:** 0

**Building Code:** R32W70W7002  
**Building Name:** Former Turbine Building  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 14437 Crosstown Blvd.  
**City Code:** ANDOVER

**Current Replacement Value:** \$117,007  
**Deferred Maintenance:** \$11,701  
**Ext. Gross Area:** 0

***Site: R32W90 - WOODLAKE LANDFILL***

**Building Code:** R32W90W9003  
**Building Name:** Former Blower Building  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 4000 Hamel Road  
**City Code:** Medina

**Current Replacement Value:** \$88,666  
**Deferred Maintenance:** \$9,151  
**Ext. Gross Area:** 0

***Site: R32X20 - OLMSTED COUNTY LANDFILL***

**Building Code:** R32X20X2001  
**Building Name:** Garage  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2683 - 85th Street NW  
**City Code:** ORONOCO

**Current Replacement Value:** \$55,569  
**Deferred Maintenance:** \$6,899  
**Ext. Gross Area:** 0

## Agency: T79 - Department of Transportation

FCI Rating: Good  
Facility Condition Index: 0.14

Current Replacement Value: \$1,180,606,038  
Deferred Maintenance: \$159,568,088

Ext. Gross Area: 6,152,573  
Building Count: 884

### Site: T791092020 - MATERIALS LAB

Building Code: T7907792020  
Building Name: MATERIALS LAB -MATLS & RESEARCH LAB  
Facility Condition Index: 0.17 - Average

Cost Model Name: Joint Office/Warehouse Facility  
Address: 1400 Gervais Ave.  
City Code: MAPLEWOOD

Current Replacement Value: \$22,306,142  
Deferred Maintenance: \$3,767,263  
Ext. Gross Area: 80,340

Building Code: T7907792050  
Building Name: MATERIALS LAB - POLE STG BLDG  
Facility Condition Index: 0.16 - Average

Cost Model Name: Butler-style Warehouse Building  
Address: 1400 Gervais Ave.  
City Code: MAPLEWOOD

Current Replacement Value: \$1,231,419  
Deferred Maintenance: \$203,046  
Ext. Gross Area: 11,776

### Site: T791092026 - CENTRAL SERVICES

Building Code: T7909192026  
Building Name: CENTRAL SERVICES-MAIN BLDG  
Facility Condition Index: 0.19 - Average

Cost Model Name: Joint Office/Warehouse Facility  
Address: 6000 MINNEHAHA AVE  
City Code: RICHFIELD

Current Replacement Value: \$18,643,545  
Deferred Maintenance: \$3,521,030  
Ext. Gross Area: 93,704

Building Code: T7909192027  
Building Name: CENTRAL SERVICES - POLE STORAGE BLD  
Facility Condition Index: 0.15 - Average

Cost Model Name: Butler-style Warehouse Building  
Address: 6000 MINNEHAHA AVE  
City Code: RICHFIELD

Current Replacement Value: \$630,342  
Deferred Maintenance: \$95,878  
Ext. Gross Area: 0

Building Code: T7909192059  
Building Name: CENTRAL SERVICES - POLE STORAGE BLD  
Facility Condition Index: 0.06 - Good

Cost Model Name: Butler-style Warehouse Building  
Address: 6000 MINNEHAHA AVE  
City Code: RICHFIELD

Current Replacement Value: \$467,015  
Deferred Maintenance: \$25,743  
Ext. Gross Area: 5,163

### Site: T791092036 - ARDEN HILLS - TRAINING CENTER

Building Code: T7900092034  
Building Name: ARDEN HILLS - MISC STORAGE  
Facility Condition Index: 0.09 - Good

Cost Model Name: Single-story Work Facility  
Address: 1900 W CO RD I  
City Code: ARDEN HILLS

Current Replacement Value: \$82,456  
Deferred Maintenance: \$7,286  
Ext. Gross Area: 0

Building Code: T7900092036  
Building Name: ARDEN HILLS TRAINING CENTER  
Facility Condition Index: 0.12 - Good

Cost Model Name: Low-rise Office Building, 2 to 4 story  
Address: 1900 W CO RD I  
City Code: ARDEN HILLS

Current Replacement Value: \$8,470,614  
Deferred Maintenance: \$1,025,589  
Ext. Gross Area: 40,992

Building Code: T7900092057  
Building Name: ARDEN HILLS TC-MISC STORAGE  
Facility Condition Index: 0.06 - Good

Cost Model Name: Single-story Work Facility  
Address: 1900 W CO RD I  
City Code: ARDEN HILLS

Current Replacement Value: \$104,502  
Deferred Maintenance: \$5,846  
Ext. Gross Area: 1,081

### Site: T791092043 - PLYMOUTH DRIVERS EXAM STATION



**Building Code:** T7900092043  
**Building Name:** PLYMOUTH - DRIVERS LICENSE  
**Facility Condition Index:** 0.13 - **Good**

**Building Code:** T7900092047  
**Building Name:** PLYMOUTH EXAM STORAGE  
**Facility Condition Index:** 0.61 - **Crisis**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2455 FERNBROOK LN  
**City Code:** PLYMOUTH

**Cost Model Name:** Single-story Work Facility  
**Address:** 2455 FERNBROOK LN  
**City Code:** PLYMOUTH

**Current Replacement Value:** \$1,657,643  
**Deferred Maintenance:** \$211,322  
**Ext. Gross Area:** 6,633

**Current Replacement Value:** \$7,655  
**Deferred Maintenance:** \$4,659  
**Ext. Gross Area:** 199

**Site: T791092051 - MnROAD RESEARCH**

**Building Code:** T7907792051  
**Building Name:** MNROAD RESEARCH - OFFICE  
**Facility Condition Index:** 0.14 - **Good**

**Building Code:** T7907792053  
**Building Name:** MNROAD RESEARCH - POLE STG BLDG  
**Facility Condition Index:** 0.06 - **Good**

**Building Code:** T7907792066  
**Building Name:** MNROAD WIM BUILDING  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 907 77TH Street NE  
**City Code:** MONTICELLO

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 907 77TH Street NE  
**City Code:** MONTICELLO

**Cost Model Name:** Utility Shed  
**Address:** 907 77TH Street NE  
**City Code:** ALBERTVILLE

**Current Replacement Value:** \$898,604  
**Deferred Maintenance:** \$126,533  
**Ext. Gross Area:** 4,724

**Current Replacement Value:** \$937,153  
**Deferred Maintenance:** \$51,589  
**Ext. Gross Area:** 6,400

**Current Replacement Value:** \$23,380  
**Deferred Maintenance:** \$2,338  
**Ext. Gross Area:** 0

**Site: T791092055 - AERONAUTICS OFFICE**

**Building Code:** T7906092055  
**Building Name:** AERONAUTICS OFFICE  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 222 East Plato Blvd  
**City Code:** ST. PAUL

**Current Replacement Value:** \$4,681,987  
**Deferred Maintenance:** \$1,054,010  
**Ext. Gross Area:** 20,301

**Site: T791A20210 - Cromwell**

**Building Code:** T7910020210  
**Building Name:** CROMWELL - SALT/SAND STORAGE  
**Facility Condition Index:** 0.15 - **Average**

**Building Code:** T7910090254  
**Building Name:** CROMWELL - MISC STORAGE  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1353 Hwy 73  
**City Code:** CROMWELL

**Cost Model Name:** Single-story Work Facility  
**Address:** 1353 Hwy 73  
**City Code:** CROMWELL

**Current Replacement Value:** \$85,303  
**Deferred Maintenance:** \$12,821  
**Ext. Gross Area:** 1,218

**Current Replacement Value:** \$41,199  
**Deferred Maintenance:** \$13,839  
**Ext. Gross Area:** 288

**Site: T791A20211 - Fond Du Lac**

**Building Code:** T7910020211  
**Building Name:** FOND DU LAC - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2923 Fon Du Lac Road  
**City Code:** SUPERIOR

**Current Replacement Value:** \$77,977  
**Deferred Maintenance:** \$9,329  
**Ext. Gross Area:** 1,064

**Building Code:** T7910090220  
**Building Name:** FOND DU LAC - MISC STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2923 Fon Du Lac Road  
**City Code:** SUPERIOR

**Current Replacement Value:** \$96,926  
**Deferred Maintenance:** \$6,589  
**Ext. Gross Area:** 780

***Site: T791A20212 - Saginaw***

**Building Code:** T7910020212  
**Building Name:** SAGINAW - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 6886 US Hwy 2  
**City Code:** SAGINAW

**Current Replacement Value:** \$135,727  
**Deferred Maintenance:** \$22,253  
**Ext. Gross Area:** 1,852

**Building Code:** T7910090282  
**Building Name:** SAGINAW - LOADER STORAGE  
**Facility Condition Index:** 0.05 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 6886 US Hwy 2  
**City Code:** SAGINAW

**Current Replacement Value:** \$69,588  
**Deferred Maintenance:** \$3,273  
**Ext. Gross Area:** 560

***Site: T791A20214 - Jacobson***

**Building Code:** T7910020214  
**Building Name:** JACOBSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.22 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 18907 HWY200  
**City Code:** JACOBSON

**Current Replacement Value:** \$60,400  
**Deferred Maintenance:** \$13,424  
**Ext. Gross Area:** 1,054

**Building Code:** T7910090264  
**Building Name:** JACOBSON - MISC STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 18907 HWY200  
**City Code:** JACOBSON

**Current Replacement Value:** \$49,378  
**Deferred Maintenance:** \$4,242  
**Ext. Gross Area:** 580

***Site: T791A20218 - Thompson Hill***

**Building Code:** T7910020218  
**Building Name:** THOMPSON HILL - SALT/SAND STORAGE  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** I 35 At US 2  
**City Code:** DULUTH

**Current Replacement Value:** \$221,619  
**Deferred Maintenance:** \$39,434  
**Ext. Gross Area:** 3,024

**Building Code:** T7910090279  
**Building Name:** THOMPSON HILL - MISC STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I 35 At US 2  
**City Code:** DULUTH

**Current Replacement Value:** \$67,172  
**Deferred Maintenance:** \$8,289  
**Ext. Gross Area:** 606

***Site: T791A20219 - McGrath***

**Building Code:** T7910020219  
**Building Name:** MCGRATH - SALT/SAND STORAGE  
**Facility Condition Index:** 0.22 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1/2 Mile South of McGrath Hwy 65  
**City Code:** MCGRATH

**Current Replacement Value:** \$52,496  
**Deferred Maintenance:** \$11,527  
**Ext. Gross Area:** 798

**Building Code:** T7910090255  
**Building Name:** MCGRATH - MISC STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 1/2 Mile South of McGrath Hwy 65  
**City Code:** MCGRATH

**Current Replacement Value:** \$72,010  
**Deferred Maintenance:** \$8,544  
**Ext. Gross Area:** 630

**Site: T791A20221 - Isabella**

**Building Code:** T7910020221  
**Building Name:** ISABELLA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2111 Minn Hwy 1  
**City Code:** ISABELLA

**Current Replacement Value:** \$43,445  
**Deferred Maintenance:** \$4,855  
**Ext. Gross Area:** 459

**Building Code:** T7910090275  
**Building Name:** ISABELLA - MISC STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2111 Minn Hwy 1  
**City Code:** ISABELLA

**Current Replacement Value:** \$78,266  
**Deferred Maintenance:** \$8,769  
**Ext. Gross Area:** 582

**Site: T791A20222 - Lester River**

**Building Code:** T7910020222  
**Building Name:** LESTER RIVER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 6831 East Superior Street  
**City Code:** DULUTH

**Current Replacement Value:** \$98,489  
**Deferred Maintenance:** \$12,047  
**Ext. Gross Area:** 1,067

**Building Code:** T7910090274  
**Building Name:** LESTER RIVER - MISC STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 6831 East Superior Street  
**City Code:** DULUTH

**Current Replacement Value:** \$63,747  
**Deferred Maintenance:** \$7,059  
**Ext. Gross Area:** 513

**Site: T791A20225 - Libby**

**Building Code:** T7910020225  
**Building Name:** LIBBY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** PALISADE

**Current Replacement Value:** \$49,075  
**Deferred Maintenance:** \$5,553  
**Ext. Gross Area:** 635

**Building Code:** T7910090283  
**Building Name:** LIBBY - LOADER STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** PALISADE

**Current Replacement Value:** \$64,009  
**Deferred Maintenance:** \$5,499  
**Ext. Gross Area:** 560

**Site: T791A20228 - Gooseberry Falls**

**Building Code:** T7910020228  
**Building Name:** GOOSEBERRY FALLS-SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** BEAVER BAY

**Current Replacement Value:** \$183,535  
**Deferred Maintenance:** \$14,734  
**Ext. Gross Area:** 1,597

**Site: T791A20230 - Temperance River**

**Building Code:** T7910020230  
**Building Name:** TEMPERANCE RIVER - SALT/SAND STORA  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 7631 HIGHWAY 61  
**City Code:** TOFTE

**Current Replacement Value:** \$91,314  
**Deferred Maintenance:** \$10,213  
**Ext. Gross Area:** 798

**Building Code:** T7910090270  
**Building Name:** TEMPERANCE RIVER - MISC STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 7631 HIGHWAY 61  
**City Code:** TOFTE

**Current Replacement Value:** \$71,709  
**Deferred Maintenance:** \$6,574  
**Ext. Gross Area:** 0

***Site: T791A20231 - Reservation River***

**Building Code:** T7910020217  
**Building Name:** RESERVATION RIVER - SALT/SAND STOR  
**Facility Condition Index:** 0.28 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** HOVLAND

**Current Replacement Value:** \$6,412  
**Deferred Maintenance:** \$1,816  
**Ext. Gross Area:** 80

**Building Code:** T7910020231  
**Building Name:** RESERVATION RIVER - SALT/SAND STOR  
**Facility Condition Index:** 0.15 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** HOVLAND

**Current Replacement Value:** \$122,210  
**Deferred Maintenance:** \$18,783  
**Ext. Gross Area:** 1,068

**Building Code:** T7910090265  
**Building Name:** RESERVATION RIVER - MISC STORAGE  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** HOVLAND

**Current Replacement Value:** \$90,277  
**Deferred Maintenance:** \$11,491  
**Ext. Gross Area:** 705

***Site: T791A90209 - DUXBURY TOWER SITE***

**Building Code:** T7910090209  
**Building Name:** DUXBURY - MISC STRG  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 60449 Duxbury Road  
**City Code:** SANDSTONE

**Current Replacement Value:** \$358,030  
**Deferred Maintenance:** \$76,293  
**Ext. Gross Area:** 624

**Building Code:** T7910090210  
**Building Name:** DUXBURY - POLE STRG  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 60449 Duxbury Road  
**City Code:** SANDSTONE

**Current Replacement Value:** \$235,310  
**Deferred Maintenance:** \$28,396  
**Ext. Gross Area:** 1,760

***Site: T791A90211 - Grand Marais***

**Building Code:** T7910020239  
**Building Name:** GRAND MARAIS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Fabric Structure  
**Address:** 1361 East US Hwy 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$597,339  
**Deferred Maintenance:** \$11,947  
**Ext. Gross Area:** 8,000

**Building Code:** T7910090211  
**Building Name:** GRAND MARAIS - TRUCK STATION  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1361 East US Hwy 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$1,164,446  
**Deferred Maintenance:** \$263,667  
**Ext. Gross Area:** 5,286

**Building Code:** T7910090287  
**Building Name:** GRAND MARAIS - BRINE BUILDING  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 1361 East US Hwy 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$30,953  
**Deferred Maintenance:** \$3,101  
**Ext. Gross Area:** 117

**Building Code:** T7910090291  
**Building Name:** GRAND MARAIS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1361 East US Hwy 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$288,606  
**Deferred Maintenance:** \$36,791  
**Ext. Gross Area:** 2,560

**Site: T791A90221 - Duluth**

**Building Code:** T7910020223  
**Building Name:** DULUTH - SALT/SAND STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1123 Mesaba Avenue  
**City Code:** DULUTH

**Current Replacement Value:** \$667,192  
**Deferred Maintenance:** \$61,217  
**Ext. Gross Area:** 6,104

**Building Code:** T7910090208  
**Building Name:** DULUTH - POLE STORAGE BLDG  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1123 Mesaba Avenue  
**City Code:** DULUTH

**Current Replacement Value:** \$418,479  
**Deferred Maintenance:** \$64,978  
**Ext. Gross Area:** 4,160

**Building Code:** T7910090221  
**Building Name:** DULUTH - DISTRICT HEADQUARTERS  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1123 Mesaba Avenue  
**City Code:** DULUTH

**Current Replacement Value:** \$33,385,850  
**Deferred Maintenance:** \$7,046,621  
**Ext. Gross Area:** 125,938

**Building Code:** T7910090289  
**Building Name:** DULUTH - POLE STORAGE BLDG  
**Facility Condition Index:** 0.15 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1123 Mesaba Avenue  
**City Code:** DULUTH

**Current Replacement Value:** \$532,682  
**Deferred Maintenance:** \$80,556  
**Ext. Gross Area:** 4,160

**Site: T791A90222 - FLOODWOOD**

**Building Code:** T7910020209  
**Building Name:** FLOODWOOD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 106 West Hwy 2  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$158,879  
**Deferred Maintenance:** \$12,867  
**Ext. Gross Area:** 1,852

**Building Code:** T7910090222  
**Building Name:** FLOODWOOD - TRUCK STATION  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 106 West Hwy 2  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$1,107,291  
**Deferred Maintenance:** \$256,089  
**Ext. Gross Area:** 6,508

**Building Code:** T7910090225  
**Building Name:** FLOODWOOD - MISC STORAGE  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 106 West Hwy 2  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$252,889  
**Deferred Maintenance:** \$39,901  
**Ext. Gross Area:** 1,590

**Building Code:** T7910090252  
**Building Name:** FLOODWOOD - MISC STORAGE  
**Facility Condition Index:** 0.28 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 106 West Hwy 2  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$44,472  
**Deferred Maintenance:** \$12,411  
**Ext. Gross Area:** 400

**Building Code:** T7910090288  
**Building Name:** FLOODWOOD - BRINE BUILDING  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Utility Shed  
**Address:** 106 West Hwy 2  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$27,620  
**Deferred Maintenance:** \$558  
**Ext. Gross Area:** 117

**Site: T791A90223 - Silver Cliff Tunnel**

**Building Code:** T7910090223  
**Building Name:** SILVER CLIFF TUNNEL - SERVICE BUILD  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 61 5 MI NE of Two Harbors  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$5,263,874  
**Deferred Maintenance:** \$1,692,442  
**Ext. Gross Area:** 1,113

**Site: T791A90224 - Silver Bay**

**Building Code:** T7910020235  
**Building Name:** SILVER BAY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 5163 Highway 61  
**City Code:** SILVER BAY

**Current Replacement Value:** \$429,357  
**Deferred Maintenance:** \$73,445  
**Ext. Gross Area:** 4,800

**Building Code:** T7910090224  
**Building Name:** SILVER BAY - TRUCK STATION  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 5163 Highway 61  
**City Code:** SILVER BAY

**Current Replacement Value:** \$1,293,358  
**Deferred Maintenance:** \$35,216  
**Ext. Gross Area:** 7,187

**Building Code:** T7910090232  
**Building Name:** SILVER BAY - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 5163 Highway 61  
**City Code:** SILVER BAY

**Current Replacement Value:** \$435,400  
**Deferred Maintenance:** \$9,456  
**Ext. Gross Area:** 4,032

**Building Code:** T7910090240  
**Building Name:** SILVER BAY - BRINE BUILDING  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 5163 Highway 61  
**City Code:** SILVER BAY

**Current Replacement Value:** \$31,797  
**Deferred Maintenance:** \$636  
**Ext. Gross Area:** 117

**Site: T791A90227 - Lafayette Bluff Tunnel**

**Building Code:** T7910090227  
**Building Name:** LAFAYETTE BLUFF TUNNEL - SERVICE BU  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 61-7.5 MI NE of Two Harbors  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$3,306,618  
**Deferred Maintenance:** \$327,113  
**Ext. Gross Area:** 654

**Site: T791A90229 - Pine City**

**Building Code:** T7910020229  
**Building Name:** PINE CITY(JUSE) - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 905 Hillside SW  
**City Code:** PINE CITY

**Current Replacement Value:** \$623,415  
**Deferred Maintenance:** \$118,821  
**Ext. Gross Area:** 8,297

**Building Code:** T7910090229  
**Building Name:** PINE CITY - TRUCK STATION  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 905 Hillside SW  
**City Code:** PINE CITY

**Current Replacement Value:** \$1,428,468  
**Deferred Maintenance:** \$305,664  
**Ext. Gross Area:** 8,598

**Building Code:** T7910090244  
**Building Name:** PINE CITY - BRINE BUILDING  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 905 Hillside SW  
**City Code:** PINE CITY

**Current Replacement Value:** \$25,000  
**Deferred Maintenance:** \$505  
**Ext. Gross Area:** 117

**Site: T791A90230 - Sandstone**

**Building Code:** T7910020202  
**Building Name:** SANDSTONE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1618 Hwy 23 N  
**City Code:** SANDSTONE

**Current Replacement Value:** \$247,324  
**Deferred Maintenance:** \$27,968  
**Ext. Gross Area:** 2,676

**Building Code:** T7910090202  
**Building Name:** SANDSTONE - EQUIP STORAGE  
**Facility Condition Index:** 0.22 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1618 Hwy 23 N  
**City Code:** SANDSTONE

**Current Replacement Value:** \$395,469  
**Deferred Maintenance:** \$86,668  
**Ext. Gross Area:** 2,889

**Building Code:** T7910090230  
**Building Name:** SANDSTONE - TRUCK STATION  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1618 Hwy 23 N  
**City Code:** SANDSTONE

**Current Replacement Value:** \$1,592,862  
**Deferred Maintenance:** \$60,026  
**Ext. Gross Area:** 11,012

**Building Code:** T7910090243  
**Building Name:** SANDSTONE - BRINE BUILDING  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Utility Shed  
**Address:** 1618 Hwy 23 N  
**City Code:** SANDSTONE

**Current Replacement Value:** \$26,709  
**Deferred Maintenance:** \$534  
**Ext. Gross Area:** 117

**Building Code:** T7910090277  
**Building Name:** SANDSTONE - MISC STORAGE  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1618 Hwy 23 N  
**City Code:** SANDSTONE

**Current Replacement Value:** \$196,233  
**Deferred Maintenance:** \$27,368  
**Ext. Gross Area:** 2,058

**Site: T791A90245 - Two Harbors**

**Building Code:** T7910090204  
**Building Name:** TWO HARBORS - BRINE BUILDING  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 1561 Hwy 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$31,797  
**Deferred Maintenance:** \$3,017  
**Ext. Gross Area:** 117

**Building Code:** T7910090235  
**Building Name:** TWO HARBORS-COLD STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1561 Hwy 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$355,401  
**Deferred Maintenance:** \$7,108  
**Ext. Gross Area:** 4,032

**Building Code:** T7910090245  
**Building Name:** TWO HARBORS - TRUCK STATION  
**Facility Condition Index:** 0.24 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1561 Hwy 2  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,509,124  
**Deferred Maintenance:** \$357,439  
**Ext. Gross Area:** 8,705

**Site: T791A90246 - CARLTON**

**Building Code:** T7910020233  
**Building Name:** CARLTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.15 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1515 Hwy 210  
**City Code:** CARLTON

**Current Replacement Value:** \$1,396,585  
**Deferred Maintenance:** \$208,737  
**Ext. Gross Area:** 14,950

**Building Code:** T7910090207  
**Building Name:** CARLTON - MISC STORAGE  
**Facility Condition Index:** 0.26 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 1515 Hwy 210  
**City Code:** CARLTON

**Current Replacement Value:** \$88,212  
**Deferred Maintenance:** \$23,033  
**Ext. Gross Area:** 720



<b>Building Code:</b>	T7910090217	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$940,044
<b>Building Name:</b>	CARLTON - Bridge Crew BldgOLD	<b>Address:</b>	1515 Hwy 210	<b>Deferred Maintenance:</b>	\$139,251
<b>Facility Condition Index:</b>	0.15 - <b>Good</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	5,288
<b>Building Code:</b>	T7910090218	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$236,064
<b>Building Name:</b>	CARLTON - MISC STORAGE	<b>Address:</b>	1515 Hwy 210	<b>Deferred Maintenance:</b>	\$45,945
<b>Facility Condition Index:</b>	0.19 - <b>Average</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	2,100
<b>Building Code:</b>	T7910090234	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,044,677
<b>Building Name:</b>	CARLTON Bridge Crew Bldg	<b>Address:</b>	1515 HWY 210	<b>Deferred Maintenance:</b>	\$20,894
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	6,571
<b>Building Code:</b>	T7910090246	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$2,265,290
<b>Building Name:</b>	CARLTON - TRUCK STATION	<b>Address:</b>	1515 Hwy 210	<b>Deferred Maintenance:</b>	\$393,220
<b>Facility Condition Index:</b>	0.17 - <b>Average</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	12,333
<b>Building Code:</b>	T7910090253	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$80,278
<b>Building Name:</b>	CARLTON - MISC STORAGE	<b>Address:</b>	1515 Hwy 210	<b>Deferred Maintenance:</b>	\$23,768
<b>Facility Condition Index:</b>	0.30 - <b>Average</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	796
<b>Building Code:</b>	T7910090296	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$273,297
<b>Building Name:</b>	CARLTON (Bridge Crew) - POLE STORAG	<b>Address:</b>	1515 Hwy 210	<b>Deferred Maintenance:</b>	\$19,792
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	2,586
<b>Building Code:</b>	T7910090297	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$95,437
<b>Building Name:</b>	CARLTON - LOADER STORAGE BLDG	<b>Address:</b>	1515 Hwy 210	<b>Deferred Maintenance:</b>	\$6,365
<b>Facility Condition Index:</b>	0.07 - <b>Good</b>	<b>City Code:</b>	CARLTON	<b>Ext. Gross Area:</b>	847

**Site: T791A90256 - NOPEMING**

<b>Building Code:</b>	T7910020227	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$10,700
<b>Building Name:</b>	NOPEMING- SALT/SAND STORAGE	<b>Address:</b>	2650 Midway Road	<b>Deferred Maintenance:</b>	\$3,244
<b>Facility Condition Index:</b>	0.30 - <b>Poor</b>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	146
<b>Building Code:</b>	T7910020236	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$1,394,550
<b>Building Name:</b>	NOPEMING - SALT/SAND STORAGE	<b>Address:</b>	2650 Midway Road	<b>Deferred Maintenance:</b>	\$27,891
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	16,800
<b>Building Code:</b>	T7910090231	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$136,384
<b>Building Name:</b>	NOPEMING - BRINE BUILDING	<b>Address:</b>	2650 Midway Road	<b>Deferred Maintenance:</b>	\$2,728
<b>Facility Condition Index:</b>	0.02 - <b>Excellent</b>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	1,012
<b>Building Code:</b>	T7910090256	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$3,007,033
<b>Building Name:</b>	NOPEMING - TRUCK STATION	<b>Address:</b>	2650 Midway Road	<b>Deferred Maintenance:</b>	\$448,587
<b>Facility Condition Index:</b>	0.15 - <b>Good</b>	<b>City Code:</b>	DULUTH	<b>Ext. Gross Area:</b>	16,023

**Building Code:** T7910090276  
**Building Name:** NOPEMING - MISC STORAGE  
**Facility Condition Index:** 0.19 - *Average*

**Building Code:** T7910090286  
**Building Name:** NOPEMING - HAZ MAT BLDG  
**Facility Condition Index:** 0.33 - *Poor*

**Building Code:** T7910090290  
**Building Name:** NOPEMING - POLE STORAGE BLDG  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2650 Midway Road  
**City Code:** DULUTH

**Cost Model Name:** Utility Shed  
**Address:** 2650 Midway Road  
**City Code:** DULUTH

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2650 Midway Road  
**City Code:** DULUTH

**Current Replacement Value:** \$264,796  
**Deferred Maintenance:** \$49,078  
**Ext. Gross Area:** 2,184

**Current Replacement Value:** \$73,652  
**Deferred Maintenance:** \$24,305  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$436,446  
**Deferred Maintenance:** \$73,265  
**Ext. Gross Area:** 4,232

**Site: T791A90257 - Moose Lake**

**Building Code:** T7910090237  
**Building Name:** MOOSE LAKE - MISC STORAGE  
**Facility Condition Index:** 0.24 - *Average*

**Building Code:** T7910090238  
**Building Name:** MOOSE LAKE - BRINE BLDG  
**Facility Condition Index:** 0.02 - *Excellent*

**Building Code:** T7910090257  
**Building Name:** MOOSE LAKE - TRUCK STATION  
**Facility Condition Index:** 0.24 - *Average*

**Building Code:** T7910090259  
**Building Name:** MOOSE LAKE - UNHEATED STRG  
**Facility Condition Index:** 0.64 - *Crisis*

**Building Code:** T7910090295  
**Building Name:** MOOSE LAKE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 975 Hwy 73  
**City Code:** MOOSE LAKE

**Cost Model Name:** Utility Shed  
**Address:** 975 Hwy 73  
**City Code:** MOOSE LAKE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 975 Hwy 73  
**City Code:** MOOSE LAKE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 975 Hwy 73  
**City Code:** MOOSE LAKE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 975 Hwy 73  
**City Code:** MOOSE LAKE

**Current Replacement Value:** \$43,568  
**Deferred Maintenance:** \$10,318  
**Ext. Gross Area:** 421

**Current Replacement Value:** \$24,801  
**Deferred Maintenance:** \$496  
**Ext. Gross Area:** 130

**Current Replacement Value:** \$914,234  
**Deferred Maintenance:** \$216,498  
**Ext. Gross Area:** 5,520

**Current Replacement Value:** \$192,482  
**Deferred Maintenance:** \$122,627  
**Ext. Gross Area:** 2,686

**Current Replacement Value:** \$345,799  
**Deferred Maintenance:** \$7,479  
**Ext. Gross Area:** 3,513

**Site: T791A90260 - Erickson Tunnel**

**Building Code:** T7910090260  
**Building Name:** DULUTH - ERICKSON TUNNEL - SVC BLDG  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** Lief Erickson Tunnel  
**City Code:** DULUTH

**Current Replacement Value:** \$10,407,673  
**Deferred Maintenance:** \$1,040,924  
**Ext. Gross Area:** 6,403

**Site: T791A90266 - McGregor**

**Building Code:** T7910020216  
**Building Name:** MCGREGOR - SALT/SAND STORAGE  
**Facility Condition Index:** 0.38 - **Poor**

**Building Code:** T7910090266  
**Building Name:** MCGREGOR-TRUCK STATION  
**Facility Condition Index:** 0.21 - **Average**

**Building Code:** T7910090269  
**Building Name:** MCGREGOR - MISC STORAGE  
**Facility Condition Index:** 0.33 - **Poor**

**Building Code:** T7910090292  
**Building Name:** MCGREGOR - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 38182 Mn Hwy 65  
**City Code:** MCGREGOR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 38182 Mn Hwy 65  
**City Code:** MCGREGOR

**Cost Model Name:** Single-story Work Facility  
**Address:** 38182 Mn Hwy 65  
**City Code:** MCGREGOR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 38182 Mn Hwy 65  
**City Code:** MCGREGOR

**Current Replacement Value:** \$152,643  
**Deferred Maintenance:** \$58,662  
**Ext. Gross Area:** 1,852

**Current Replacement Value:** \$1,103,775  
**Deferred Maintenance:** \$233,755  
**Ext. Gross Area:** 6,149

**Current Replacement Value:** \$33,504  
**Deferred Maintenance:** \$11,059  
**Ext. Gross Area:** 360

**Current Replacement Value:** \$236,879  
**Deferred Maintenance:** \$16,197  
**Ext. Gross Area:** 2,560

***Site: T791A90281 - Black Bear Scale Site***

**Building Code:** T7910090281  
**Building Name:** CARLTON - HAZARD MATL STORAGE  
**Facility Condition Index:** 0.14 - **Good**

**Building Code:** T7910090284  
**Building Name:** Office Building  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1369 Interstate 35  
**City Code:** CARLTON

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 1369 Interstate 35  
**City Code:** CARLTON

**Current Replacement Value:** \$130,040  
**Deferred Maintenance:** \$18,476  
**Ext. Gross Area:** 1,124

**Current Replacement Value:** \$286,567  
**Deferred Maintenance:** \$54,772  
**Ext. Gross Area:** 1,352

***Site: T791A90294 - Duluth Air Quality***

**Building Code:** T7910090294  
**Building Name:** DULUTH - AIR QUALITY - SVC BLDG  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** Superior Street Near Lief Erickson Tunn  
**City Code:** DULUTH

**Current Replacement Value:** \$46,608  
**Deferred Maintenance:** \$4,693  
**Ext. Gross Area:** 312

***Site: T791A90298 - Pike Lake***

**Building Code:** T7910020237  
**Building Name:** PIKE LAKE S/S STOR JNT USE  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** T7910090285  
**Building Name:** PIKE LAKE - BRINE BUILDING  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Fabric Structure  
**Address:** 4787 Midway Road  
**City Code:** DULUTH

**Cost Model Name:** Single-story Work Facility  
**Address:** 4787 Midway Road  
**City Code:** DULUTH

**Current Replacement Value:** \$792,071  
**Deferred Maintenance:** \$15,841  
**Ext. Gross Area:** 9,542

**Current Replacement Value:** \$102,672  
**Deferred Maintenance:** \$13,356  
**Ext. Gross Area:** 784

**Building Code:** T7910090299  
**Building Name:** PIKE LAKE - POLE STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4787 Midway Road  
**City Code:** DULUTH

**Current Replacement Value:** \$529,127  
**Deferred Maintenance:** \$36,352  
**Ext. Gross Area:** 4,664

***Site: T791A92125 - Saginaw Scale***

**Building Code:** T7910090216  
**Building Name:** SAGINAW - SCALE - MISC STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** Junction US 2 and TH 33  
**City Code:** SAGINAW

**Current Replacement Value:** \$96,036  
**Deferred Maintenance:** \$11,223  
**Ext. Gross Area:** 624

**Building Code:** T7910092125  
**Building Name:** SAGINAW - SCALE - WEIGH SCALE BLDG  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** Junction US 2 and TH 33  
**City Code:** SAGINAW

**Current Replacement Value:** \$635,038  
**Deferred Maintenance:** \$68,417  
**Ext. Gross Area:** 3,065

***Site: T791AR035880 - Kettle River RA***

**Building Code:** T7910095105  
**Building Name:** KETTLE RIVER - REST AREA  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 North Bound  
**City Code:** SANDSTONE

**Current Replacement Value:** \$881,891  
**Deferred Maintenance:** \$82,710  
**Ext. Gross Area:** 3,182

**Building Code:** T7910095130  
**Building Name:** KETTLE RIVER - RA - Misc Stg  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I-35 Northbound  
**City Code:** SANDSTONE

**Current Replacement Value:** \$15,826  
**Deferred Maintenance:** \$1,598  
**Ext. Gross Area:** 144

***Site: T791AR045880 - General Andrews RA***

**Building Code:** T7910095106  
**Building Name:** GENERAL ANDREWS - REST AREA  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 Southbound  
**City Code:** WILLOW RIVER

**Current Replacement Value:** \$881,891  
**Deferred Maintenance:** \$78,012  
**Ext. Gross Area:** 3,182

**Building Code:** T7910095131  
**Building Name:** GENERAL ANDREWS - REST AREA - MISC  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I-35 Southbound  
**City Code:** WILLOW RIVER

**Current Replacement Value:** \$13,609  
**Deferred Maintenance:** \$1,746  
**Ext. Gross Area:** 157

***Site: T791AR097160 - Grand Portage RA***

**Building Code:** T7910095125  
**Building Name:** GRAND PORTAGE - REST AREA  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 9393 HWY 61 EAST  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$1,021,813  
**Deferred Maintenance:** \$39,484  
**Ext. Gross Area:** 2,466

***Site: T791AR216982 - Thompson Hill RA-TIC***

**Building Code:** T7910092141  
**Building Name:** THOMPSON HILL-State Patrol Office  
**Facility Condition Index:** 0.16 - *Average*

**Building Code:** T7910095104  
**Building Name:** Thompson Hill - Rest Area - TIC  
**Facility Condition Index:** 0.27 - *Average*

**Building Code:** T7910095132  
**Building Name:** Thompson Hill - RA - TIC - MISC STO  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 8525 West Skyline Drive  
**City Code:** DULUTH

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 8525 West Skyline Drive  
**City Code:** DULUTH

**Cost Model Name:** Utility Shed  
**Address:** 8525 West Skyline Drive  
**City Code:** DULUTH

**Current Replacement Value:** \$727,761  
**Deferred Maintenance:** \$117,901  
**Ext. Gross Area:** 2,731

**Current Replacement Value:** \$1,216,320  
**Deferred Maintenance:** \$324,551  
**Ext. Gross Area:** 4,185

**Current Replacement Value:** \$15,403  
**Deferred Maintenance:** \$1,292  
**Ext. Gross Area:** 120

**Site: T791AR340980 - Culkan RA**

**Building Code:** T7910095103  
**Building Name:** Culkan - Rest Area  
**Facility Condition Index:** 0.13 - *Good*

**Building Code:** T7910095133  
**Building Name:** Culkan - Rest Area - Misc Stg  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 Northbound  
**City Code:** MAHTOWA

**Cost Model Name:** Single-story Work Facility  
**Address:** I-35 Northbound  
**City Code:** MAHTOWA

**Current Replacement Value:** \$415,795  
**Deferred Maintenance:** \$53,967  
**Ext. Gross Area:** 1,637

**Current Replacement Value:** \$27,996  
**Deferred Maintenance:** \$3,727  
**Ext. Gross Area:** 384

**Site: T791AR356917 - Independence RA**

**Building Code:** T7910095117  
**Building Name:** Independence - Rest Area  
**Facility Condition Index:** 0.09 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** Junction TH 53 and TH 33  
**City Code:** INDEPENDENCE

**Current Replacement Value:** \$141,293  
**Deferred Maintenance:** \$12,921  
**Ext. Gross Area:** 154

**Site: T791AR363880 - Knife River RA**

**Building Code:** T7910095116  
**Building Name:** Knife River - Rest Area  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Vault Toilet  
**Address:** TH 61  
**City Code:** DULUTH

**Current Replacement Value:** \$145,097  
**Deferred Maintenance:** \$14,557  
**Ext. Gross Area:** 322

**Site: T791AR371604 - Mount Josephine**

**Building Code:** T7910095112  
**Building Name:** Mount Josephine - Rest Area  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Vault Toilet  
**Address:** Hwy 61  
**City Code:** GRAND PORTAGE

**Current Replacement Value:** \$140,627  
**Deferred Maintenance:** \$3,152  
**Ext. Gross Area:** 0

**Site: T791AR380121 - McGregor RA**

**Building Code:** T7910095122  
**Building Name:** McGregor - Rest Area  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** TH 210  
**City Code:** MCGREGOR

**Current Replacement Value:** \$129,966  
**Deferred Maintenance:** \$16,907  
**Ext. Gross Area:** 492

***Site: T791AR743806 - TETTEGOUCH-BAPTISM R.:RA***

**Building Code:** T7910095127  
**Building Name:** TETTEGOUCH-BAPTISM R.:RA  
**Facility Condition Index:** 0.05 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 474 HIGHWAY 61 E  
**City Code:** SILVER BAY

**Current Replacement Value:** \$1,682,554  
**Deferred Maintenance:** \$85,934  
**Ext. Gross Area:** 4,154

***Site: T791AR876906 - FLOODWOOD RA***

**Building Code:** T7910095135  
**Building Name:** FLOODWOOD - REST AREA  
**Facility Condition Index:** 0.26 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 223 W HIGHWAY 2  
**City Code:** FLOODWOOD

**Current Replacement Value:** \$372,919  
**Deferred Maintenance:** \$98,371  
**Ext. Gross Area:** 1,600

***Site: T791AR883805 - Gooseberry Falls RA***

**Building Code:** T7910095121  
**Building Name:** Gooseberry Falls - Rest Area  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 3206 Highway 61  
**City Code:** TWO HARBORS

**Current Replacement Value:** \$1,062,246  
**Deferred Maintenance:** \$107,118  
**Ext. Gross Area:** 3,137

***Site: T791AR921602 - Cut Face Creek RA***

**Building Code:** T7910095119  
**Building Name:** Cut Face Creek - Rest Area  
**Facility Condition Index:** 0.05 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** Highway 61  
**City Code:** GRAND MARAIS

**Current Replacement Value:** \$140,627  
**Deferred Maintenance:** \$7,209  
**Ext. Gross Area:** 492

***Site: T791AR931601 - Cross River RA***

**Building Code:** T7910095123  
**Building Name:** Cross River - Rest Area  
**Facility Condition Index:** 0.05 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** Highway 61  
**City Code:** SCHROEDER

**Current Replacement Value:** \$140,627  
**Deferred Maintenance:** \$7,209  
**Ext. Gross Area:** 492

***Site: T791AR940102 - Big Sandy Lake RA***

**Building Code:** T7910095124  
**Building Name:** Big Sandy Lake - Rest Area  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Cost Model Name:** Vault Toilet  
**Address:** Trunk Highway 65  
**City Code:** PALISADE

**Current Replacement Value:** \$38,932  
**Deferred Maintenance:** \$1,541  
**Ext. Gross Area:** 154

***Site: T791B20107 - Melrude***

**Building Code:** T7915020107  
**Building Name:** MELRUDE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Building Code:** T7915090164  
**Building Name:** MELRUDE - MISC STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH53(SB) 0.1 MILE N OF CO RD 59  
**City Code:** COTTON

**Cost Model Name:** Single-story Work Facility  
**Address:** TH53(SB) 0.1 MILE N OF CO RD 59  
**City Code:** COTTON

**Current Replacement Value:** \$44,782  
**Deferred Maintenance:** \$5,123  
**Ext. Gross Area:** 533

**Current Replacement Value:** \$82,014  
**Deferred Maintenance:** \$5,576  
**Ext. Gross Area:** 660

**Site: [T791B20111 - Canyon](#)**

**Building Code:** T7915020111  
**Building Name:** CANYON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** T7915090163  
**Building Name:** CANYON - MISC STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 7285 Hwy 53  
**City Code:** CANYON

**Cost Model Name:** Single-story Work Facility  
**Address:** 7285 Hwy 53  
**City Code:** CANYON

**Current Replacement Value:** \$82,099  
**Deferred Maintenance:** \$6,260  
**Ext. Gross Area:** 957

**Current Replacement Value:** \$53,682  
**Deferred Maintenance:** \$3,649  
**Ext. Gross Area:** 432

**Site: [T791B20112 - Buck Lake](#)**

**Building Code:** T7915020112  
**Building Name:** BUCK LAKE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** T7915090167  
**Building Name:** BUCK LAKE - MISC STORAGE  
**Facility Condition Index:** 0.03 - [Excellent](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 49256 MN HWY 65  
**City Code:** NASHWAUK

**Cost Model Name:** Single-story Work Facility  
**Address:** 49256 MN HWY 65  
**City Code:** NASHWAUK

**Current Replacement Value:** \$46,144  
**Deferred Maintenance:** \$3,690  
**Ext. Gross Area:** 554

**Current Replacement Value:** \$65,988  
**Deferred Maintenance:** \$1,731  
**Ext. Gross Area:** 560

**Site: [T791B20116 - Talmoon](#)**

**Building Code:** T7915020116  
**Building Name:** TALMOON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** T7915090161  
**Building Name:** TALMOON - MISC STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 6 - 1.75 MI So of TH286  
**City Code:** TALMOON

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 6 - 1.75 MI So of TH286  
**City Code:** TALMOON

**Current Replacement Value:** \$42,466  
**Deferred Maintenance:** \$3,217  
**Ext. Gross Area:** 533

**Current Replacement Value:** \$65,988  
**Deferred Maintenance:** \$4,486  
**Ext. Gross Area:** 560

**Site: [T791B20120 - Big Falls](#)**

**Building Code:** T7915020120  
**Building Name:** BIG FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 7515 COUNTY ROAD 13  
**City Code:** BIG FALLS

**Current Replacement Value:** \$267,496  
**Deferred Maintenance:** \$26,721  
**Ext. Gross Area:** 2,528



**Site: T791B20121 - Kinmount**

**Building Code:** T7915020121  
**Building Name:** KINMOUNT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 53 & Sheep Ranch Road  
**City Code:** ORR

**Current Replacement Value:** \$266,406  
**Deferred Maintenance:** \$25,723  
**Ext. Gross Area:** 2,496

**Site: T791B20122 - Biwabik**

**Building Code:** T7915020122  
**Building Name:** BIWABIK - SALT/SAND STORAGE  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 600 1st St So  
**City Code:** BIWABIK

**Current Replacement Value:** \$162,448  
**Deferred Maintenance:** \$34,927  
**Ext. Gross Area:** 1,522

**Site: T791B20125 - Linden Grove**

**Building Code:** T7915020125  
**Building Name:** LINDEN GROVE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 11193 Hwy 1  
**City Code:** LINDEN GROVE

**Current Replacement Value:** \$69,736  
**Deferred Maintenance:** \$4,345  
**Ext. Gross Area:** 830

**Site: T791B20132 - ELY; Joint Use Site**

**Building Code:** T7915020132  
**Building Name:** ELY; Joint Use Site  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1389 Hidden Valley Trail  
**City Code:** ELY

**Current Replacement Value:** \$135,727  
**Deferred Maintenance:** \$4,954  
**Ext. Gross Area:** 12,000

**Site: T791B90110 - Hibbing (Old Site)**

**Building Code:** T7915020113  
**Building Name:** HIBBING - SALT/SAND STORAGE  
**Facility Condition Index:** 0.38 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3801 Marksmanship Center Road  
**City Code:** HIBBING

**Current Replacement Value:** \$226,520  
**Deferred Maintenance:** \$85,833  
**Ext. Gross Area:** 2,528

**Building Code:** T7915090110  
**Building Name:** HIBBING - STORAGE FACILITY  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3801 Marksmanship Center Road  
**City Code:** HIBBING

**Current Replacement Value:** \$1,456,953  
**Deferred Maintenance:** \$335,793  
**Ext. Gross Area:** 10,353

**Building Code:** T7915090139  
**Building Name:** HIBBING - MISC STORAGE  
**Facility Condition Index:** 0.30 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3801 Marksmanship Center Road  
**City Code:** HIBBING

**Current Replacement Value:** \$298,633  
**Deferred Maintenance:** \$88,163  
**Ext. Gross Area:** 2,721

**Site: T791B90112 - Cook**

**Building Code:** T7915020109  
**Building Name:** COOK - SALT/SAND STORAGE  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 305 River Street  
**City Code:** COOK

**Current Replacement Value:** \$258,123  
**Deferred Maintenance:** \$81,599  
**Ext. Gross Area:** 2,528

**Building Code:** T7915090112  
**Building Name:** COOK - TRUCK STATION  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 305 South River Street  
**City Code:** COOK

**Current Replacement Value:** \$1,028,903  
**Deferred Maintenance:** \$180,204  
**Ext. Gross Area:** 6,658

**Building Code:** T7915090145  
**Building Name:** COOK - POLE STORAGE BLDG  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 305 South River Street  
**City Code:** COOK

**Current Replacement Value:** \$217,340  
**Deferred Maintenance:** \$36,822  
**Ext. Gross Area:** 1,590

**Site: T791B90122 - Ely**

**Building Code:** T7915020123  
**Building Name:** ELY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2100 East Sheridan Street  
**City Code:** ELY

**Current Replacement Value:** \$158,879  
**Deferred Maintenance:** \$12,867  
**Ext. Gross Area:** 1,852

**Building Code:** T7915090122  
**Building Name:** ELY - TRUCK STATION  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2100 East Sheridan Street  
**City Code:** ELY

**Current Replacement Value:** \$767,876  
**Deferred Maintenance:** \$85,069  
**Ext. Gross Area:** 3,778

**Building Code:** T7915090146  
**Building Name:** ELY - MISC STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 2100 East Sheridan Street  
**City Code:** ELY

**Current Replacement Value:** \$109,381  
**Deferred Maintenance:** \$18,882  
**Ext. Gross Area:** 1,003

**Site: T791B90123 - Virginia**

**Building Code:** T7915020118  
**Building Name:** VIRGINIA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$544,026  
**Deferred Maintenance:** \$177,829  
**Ext. Gross Area:** 5,011

**Building Code:** T7915090102  
**Building Name:** VIRGINIA - MISC STORAGE  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$43,071  
**Deferred Maintenance:** \$6,592  
**Ext. Gross Area:** 540

**Building Code:** T7915090123  
**Building Name:** VIRGINIA - MAINTENANCE HEADQUARTERS  
**Facility Condition Index:** 0.29 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$19,750,505  
**Deferred Maintenance:** \$5,769,827  
**Ext. Gross Area:** 81,823

**Building Code:** T7915090127  
**Building Name:** VIRGINIA - EQUIP STORAGE  
**Facility Condition Index:** 0.56 - **Crisis**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$115,987  
**Deferred Maintenance:** \$64,630  
**Ext. Gross Area:** 1,537

**Building Code:** T7915090134  
**Building Name:** VIRGINIA - MISC STORAGE  
**Facility Condition Index:** 0.53 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$30,456  
**Deferred Maintenance:** \$16,117  
**Ext. Gross Area:** 502

**Building Code:** T7915090138  
**Building Name:** VIRGINIA - MISC STORAGE  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$303,073  
**Deferred Maintenance:** \$104,552  
**Ext. Gross Area:** 2,875

**Building Code:** T7915090142  
**Building Name:** VIRGINIA - MISC STORAGE  
**Facility Condition Index:** 0.53 - **Crisis**

**Cost Model Name:** Single-story Work Facility  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$52,384  
**Deferred Maintenance:** \$27,722  
**Ext. Gross Area:** 780

**Building Code:** T7915090149  
**Building Name:** VIRGINIA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$882,739  
**Deferred Maintenance:** \$38,009  
**Ext. Gross Area:** 7,414

**Building Code:** T7915090159  
**Building Name:** VIRGINIA - BRINE BUILDING  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$84,447  
**Deferred Maintenance:** \$4,663  
**Ext. Gross Area:** 619

**Building Code:** T7915090160  
**Building Name:** VIRGINIA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 101 N Hoover Road  
**City Code:** VIRGINIA

**Current Replacement Value:** \$548,669  
**Deferred Maintenance:** \$13,941  
**Ext. Gross Area:** 5,261

**Site: T791B90133 - Littlefork**

**Building Code:** T7915020124  
**Building Name:** LITTLEFORK - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 4892 Co Rd 22  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$270,198  
**Deferred Maintenance:** \$21,832  
**Ext. Gross Area:** 2,568

**Building Code:** T7915090133  
**Building Name:** LITTLEFORK - TRUCK STATION  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4892 Co Rd 22  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$1,309,858  
**Deferred Maintenance:** \$310,157  
**Ext. Gross Area:** 6,637

**Building Code:** T7915090154  
**Building Name:** LITTLEFORK - MISC STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4892 Co Rd 22  
**City Code:** LITTLEFORK

**Current Replacement Value:** \$191,276  
**Deferred Maintenance:** \$36,164  
**Ext. Gross Area:** 1,360

**Site: T791B90140 - International Falls**

**Building Code:** T7915020115  
**Building Name:** INTERNATIONAL FALLS - SALT/SAND STO  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2407 Highway 332 South  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$187,469  
**Deferred Maintenance:** \$22,643  
**Ext. Gross Area:** 1,852

**Building Code:** T7915020129  
**Building Name:** INTERNATIONAL FALLS - SALT/SAND STO  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 2407 Highway 332 South  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$569,058  
**Deferred Maintenance:** \$108,461  
**Ext. Gross Area:** 6,915

**Building Code:** T7915090144  
**Building Name:** INTERNATIONAL FALLS - MISC STORAGE  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2407 Highway 332 South  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$133,279  
**Deferred Maintenance:** \$15,928  
**Ext. Gross Area:** 1,070

**Building Code:** T7915090148  
**Building Name:** INTERNATIONAL FALLS - MISC STORAGE  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2407 Highway 332 South  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$129,542  
**Deferred Maintenance:** \$18,627  
**Ext. Gross Area:** 893

**Building Code:** T7915090168  
**Building Name:** INTERNATIONAL FALLS-TRUCK STATION(N  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2407 Highway 332 South  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$1,530,061  
**Deferred Maintenance:** \$31,431  
**Ext. Gross Area:** 8,862

**Building Code:** T7915090170  
**Building Name:** INTERNATIONAL FALLS-BRINE BLDG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Utility Shed  
**Address:** 2407 Highway 332 South  
**City Code:** INTL. FALLS

**Current Replacement Value:** \$29,253  
**Deferred Maintenance:** \$585  
**Ext. Gross Area:** 117

**Site: T791B90143 - Grand Rapids**

**Building Code:** T7915020119  
**Building Name:** GRAND RAPIDS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2606 Hwy 2 East  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$244,772  
**Deferred Maintenance:** \$43,817  
**Ext. Gross Area:** 2,528

**Building Code:** T7915020131  
**Building Name:** GRAND RAPIDS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 2606 Hwy 2 East  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$991,892  
**Deferred Maintenance:** \$189,052  
**Ext. Gross Area:** 12,601

**Building Code:** T7915090130  
**Building Name:** GRAND RAPIDS - MISC STORAGE  
**Facility Condition Index:** 0.29 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2606 Hwy 2 East  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$39,153  
**Deferred Maintenance:** \$11,193  
**Ext. Gross Area:** 432

**Building Code:** T7915090143  
**Building Name:** GRAND RAPIDS - TRUCK STATION  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2606 Hwy 2 East  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$3,167,339  
**Deferred Maintenance:** \$442,111  
**Ext. Gross Area:** 17,668

**Building Code:** T7915090152  
**Building Name:** GRAND RAPIDS - MISC STORAGE  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 2606 Hwy 2 East  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$70,549  
**Deferred Maintenance:** \$6,714  
**Ext. Gross Area:** 576

**Building Code:** T7915090153  
**Building Name:** GRAND RAPIDS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2606 Hwy 2 East  
**City Code:** GRAND RAPIDS

**Current Replacement Value:** \$476,200  
**Deferred Maintenance:** \$32,560  
**Ext. Gross Area:** 4,992

**Site: T791B90155 - Hibbing (New Site)**

**Building Code:** T7915020127  
**Building Name:** HIBBING - SALT/SAND STORAGE  
**Facility Condition Index:** 0.13 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1425 East 23rd Street  
**City Code:** HIBBING

**Current Replacement Value:** \$955,561  
**Deferred Maintenance:** \$126,191  
**Ext. Gross Area:** 5,163

**Building Code:** T7915020128  
**Building Name:** HIBBING - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1425 East 23rd Street  
**City Code:** HIBBING

**Current Replacement Value:** \$288,820  
**Deferred Maintenance:** \$23,191  
**Ext. Gross Area:** 2,706

**Building Code:** T7915090155  
**Building Name:** HIBBING - TRUCK STATION  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1425 East 23rd Street  
**City Code:** HIBBING

**Current Replacement Value:** \$3,309,568  
**Deferred Maintenance:** \$388,722  
**Ext. Gross Area:** 51,214

**Building Code:** T7915090162  
**Building Name:** HIBBING - POLE STORAGE BLDG  
**Facility Condition Index:** 0.05 - Excellent

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1425 East 23rd Street  
**City Code:** HIBBING

**Current Replacement Value:** \$444,231  
**Deferred Maintenance:** \$21,683  
**Ext. Gross Area:** 4,416

**Site: T791B90156 - DEER LAKE**

**Building Code:** T7915020126  
**Building Name:** DEER LAKE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 27267 State Highway 1  
**City Code:** EFFIE

**Current Replacement Value:** \$559,830  
**Deferred Maintenance:** \$32,993  
**Ext. Gross Area:** 5,417

**Building Code:** T7915090156  
**Building Name:** DEER LAKE - TRUCK STATION  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 27267 State Hwy 1  
**City Code:** EFFIE

**Current Replacement Value:** \$1,100,373  
**Deferred Maintenance:** \$63,519  
**Ext. Gross Area:** 6,823

**Building Code:** T7915090157  
**Building Name:** DEER LAKE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.04 - Excellent

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 27267 State Highway 1  
**City Code:** EFFIE

**Current Replacement Value:** \$275,572  
**Deferred Maintenance:** \$9,911  
**Ext. Gross Area:** 2,400

**Building Code:** T7915090171  
**Building Name:** DEER LAKE - BRINE BUILDING  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Utility Shed  
**Address:** 27267 State Hwy 1  
**City Code:** EFFIE

**Current Replacement Value:** \$26,191  
**Deferred Maintenance:** \$529  
**Ext. Gross Area:** 117

**Site: T791BR406917 - Anchor Lake RA-TIC**

**Building Code:** T7915095161  
**Building Name:** Anchor Lake - Rest Area - TIC  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2702 Highway 53  
**City Code:** EVELETH

**Current Replacement Value:** \$751,077  
**Deferred Maintenance:** \$162,803  
**Ext. Gross Area:** 3,867

**Building Code:** T7915095180  
**Building Name:** Anchor Lake - Rest Area - Misc Stor  
**Facility Condition Index:** 0.20 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** 2702 Highway 53  
**City Code:** EVELETH

**Current Replacement Value:** \$30,561  
**Deferred Maintenance:** \$6,231  
**Ext. Gross Area:** 256

**Site: T792A20311 - Waskish**

**Building Code:** T7920020311  
**Building Name:** Waskish - Salt/Sand Storage  
**Facility Condition Index:** 0.22 - Average

**Cost Model Name:** Open Air Storage Structure  
**Address:** 51701 MN 72  
**City Code:** WASKISH

**Current Replacement Value:** \$215,709  
**Deferred Maintenance:** \$48,245  
**Ext. Gross Area:** 4,985

**Site: T792A20317 - Loman Pit**

**Building Code:** T7920020317  
**Building Name:** LOMAN PIT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 7602 MN-11  
**City Code:** LOMAN

**Current Replacement Value:** \$116,088  
**Deferred Maintenance:** \$9,507  
**Ext. Gross Area:** 1,008

**Site: T792A20318 - Lake Itasca**

**Building Code:** T7920020318  
**Building Name:** LAKE ITASCA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.09 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 16379 CR 108  
**City Code:** LAKE ITASCA

**Current Replacement Value:** \$380,256  
**Deferred Maintenance:** \$32,964  
**Ext. Gross Area:** 3,757

**Site: T792A20518 - Warroad**

**Building Code:** T7925020518  
**Building Name:** WARROAD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 210 EAST GARFIELD  
**City Code:** WARROAD

**Current Replacement Value:** \$145,996  
**Deferred Maintenance:** \$13,883  
**Ext. Gross Area:** 1,852

**Site: T792A20521 - Greenbush**

**Building Code:** T7925020521  
**Building Name:** GREENBUSH (1) - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 234 Co Rd 4  
**City Code:** GREENBUSH

**Current Replacement Value:** \$145,996  
**Deferred Maintenance:** \$10,646  
**Ext. Gross Area:** 1,852

**Site: T792A90308 - Baudette**

**Building Code:** T7920020304  
**Building Name:** BAUDETTE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 504 Main Street E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$114,922  
**Deferred Maintenance:** \$13,881  
**Ext. Gross Area:** 1,037

**Building Code:** T7920020312  
**Building Name:** BAUDETTE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 504 Main Street E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$155,482  
**Deferred Maintenance:** \$13,065  
**Ext. Gross Area:** 1,037

**Building Code:** T7920020321  
**Building Name:** BAUDETTE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.05 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 504 Main Street E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$484,494  
**Deferred Maintenance:** \$25,892  
**Ext. Gross Area:** 5,589

**Building Code:** T7920090312  
**Building Name:** BAUDETTE - MISC STORAGE  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 504 Main Street E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$98,704  
**Deferred Maintenance:** \$15,709  
**Ext. Gross Area:** 532

**Building Code:** T7920090332  
**Building Name:** BAUDETTE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 504 Main Street E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$268,082  
**Deferred Maintenance:** \$34,203  
**Ext. Gross Area:** 2,586

**Building Code:** T7920090339  
**Building Name:** BAUDETTE - TRUCK STATION  
**Facility Condition Index:** 0.03 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 504 Main Street E  
**City Code:** BAUDETTE

**Current Replacement Value:** \$1,447,824  
**Deferred Maintenance:** \$38,272  
**Ext. Gross Area:** 8,017

***Site: T792A90316 - Walker***

**Building Code:** T7920020308  
**Building Name:** WALKER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 8005 Sautbine Road NW  
**City Code:** WALKER

**Current Replacement Value:** \$83,057  
**Deferred Maintenance:** \$6,727  
**Ext. Gross Area:** 1,037

**Building Code:** T7920020316  
**Building Name:** WALKER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.15 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 8005 Sautbine Road NW  
**City Code:** WALKER

**Current Replacement Value:** \$445,086  
**Deferred Maintenance:** \$67,916  
**Ext. Gross Area:** 4,669

**Building Code:** T7920090316  
**Building Name:** WALKER - TRUCK STATION  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 8005 Sautbine Road NW  
**City Code:** WALKER

**Current Replacement Value:** \$1,710,492  
**Deferred Maintenance:** \$300,023  
**Ext. Gross Area:** 7,184

**Building Code:** T7920090333  
**Building Name:** WALKER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 8005 Sautbine Road NW  
**City Code:** WALKER

**Current Replacement Value:** \$365,433  
**Deferred Maintenance:** \$25,581  
**Ext. Gross Area:** 3,098

***Site: T792A90317 - Bagley***

**Building Code:** T7920020307  
**Building Name:** BAGLEY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 20602 US 2  
**City Code:** BAGLEY

**Current Replacement Value:** \$100,407  
**Deferred Maintenance:** \$12,127  
**Ext. Gross Area:** 1,037

**Building Code:** T7920020315  
**Building Name:** BAGLEY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 20602 US 2  
**City Code:** BAGLEY

**Current Replacement Value:** \$297,335  
**Deferred Maintenance:** \$23,117  
**Ext. Gross Area:** 3,424



**Building Code:** T7920090317  
**Building Name:** BAGLEY - STORAGE FACILITY  
**Facility Condition Index:** 0.19 - *Average*

**Building Code:** T7920090324  
**Building Name:** BAGLEY - MISC STORAGE  
**Facility Condition Index:** 0.12 - *Good*

**Building Code:** T7920090340  
**Building Name:** BAGLEY TRUCK STATION  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 20602 US 2  
**City Code:** BAGLEY

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 20602 US 2  
**City Code:** BAGLEY

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 20602 US 2  
**City Code:** BAGLEY

**Current Replacement Value:** \$957,503  
**Deferred Maintenance:** \$177,627  
**Ext. Gross Area:** 4,944

**Current Replacement Value:** \$175,311  
**Deferred Maintenance:** \$20,779  
**Ext. Gross Area:** 1,793

**Current Replacement Value:** \$1,415,537  
**Deferred Maintenance:** \$36,275  
**Ext. Gross Area:** 8,798

**Site: T792A90319 - Deer River**

**Building Code:** T7920020309  
**Building Name:** DEER RIVER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.13 - *Good*

**Building Code:** T7920090319  
**Building Name:** DEER RIVER - TRUCK STATION  
**Facility Condition Index:** 0.24 - *Average*

**Building Code:** T7920090334  
**Building Name:** DEER RIVER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 44703 Chase Lake Road  
**City Code:** DEER RIVER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 44703 Chase Lake Road  
**City Code:** DEER RIVER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 44703 Chase Lake Road  
**City Code:** DEER RIVER

**Current Replacement Value:** \$386,584  
**Deferred Maintenance:** \$50,575  
**Ext. Gross Area:** 5,497

**Current Replacement Value:** \$952,528  
**Deferred Maintenance:** \$228,138  
**Ext. Gross Area:** 5,144

**Current Replacement Value:** \$244,205  
**Deferred Maintenance:** \$26,978  
**Ext. Gross Area:** 266

**Site: T792A90323 - Northome**

**Building Code:** T7920020319  
**Building Name:** NORTHOME - SALT/SAND STORAGE  
**Facility Condition Index:** 0.13 - *Good*

**Building Code:** T7920090322  
**Building Name:** NORTHOME - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.23 - *Average*

**Building Code:** T7920090323  
**Building Name:** NORTHOME - TRUCK STATION  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 12080 Town Road 299  
**City Code:** NORTHOME

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 12080 Town Road 299  
**City Code:** NORTHOME

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 12080 Town Road 299  
**City Code:** NORTHOME

**Current Replacement Value:** \$1,011,686  
**Deferred Maintenance:** \$131,882  
**Ext. Gross Area:** 10,106

**Current Replacement Value:** \$503,108  
**Deferred Maintenance:** \$117,437  
**Ext. Gross Area:** 4,800

**Current Replacement Value:** \$748,237  
**Deferred Maintenance:** \$177,214  
**Ext. Gross Area:** 4,283

**Site: T792A90329 - Park Rapids**

**Building Code:** T7920020302  
**Building Name:** PARK RAPIDS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 505 Industrial Park Road  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$101,528  
**Deferred Maintenance:** \$12,263  
**Ext. Gross Area:** 1,068

**Building Code:** T7920020313  
**Building Name:** PARK RAPIDS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 505 Industrial Park Road  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$318,286  
**Deferred Maintenance:** \$32,566  
**Ext. Gross Area:** 3,008

**Building Code:** T7920090329  
**Building Name:** PARK RAPIDS - TRUCK STATION  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 505 Industrial Park Road  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$1,223,706  
**Deferred Maintenance:** \$176,329  
**Ext. Gross Area:** 7,618

**Building Code:** T7920090331  
**Building Name:** PARK RAPIDS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.15 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 505 Industrial Park Road  
**City Code:** PARK RAPIDS

**Current Replacement Value:** \$447,840  
**Deferred Maintenance:** \$65,197  
**Ext. Gross Area:** 4,800

***Site: T792A90330 - Bemidji***

**Building Code:** T7920020320  
**Building Name:** BEMIDJI - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$1,010,459  
**Deferred Maintenance:** \$125,455  
**Ext. Gross Area:** 9,382

**Building Code:** T7920090330  
**Building Name:** BEMIDJI - DISTRICT HEADQUARTERS  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$30,432,975  
**Deferred Maintenance:** \$3,072,694  
**Ext. Gross Area:** 113,625

**Building Code:** T7920090335  
**Building Name:** BEMIDJI - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$904,622  
**Deferred Maintenance:** \$115,079  
**Ext. Gross Area:** 8,064

**Building Code:** T7920090336  
**Building Name:** BEMIDJI - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$1,022,560  
**Deferred Maintenance:** \$135,691  
**Ext. Gross Area:** 8,064

**Building Code:** T7920090337  
**Building Name:** BEMIDJI - HAZARD MATL STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$69,158  
**Deferred Maintenance:** \$6,562  
**Ext. Gross Area:** 384

**Building Code:** T7920090338  
**Building Name:** BEMIDJI - MISC STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$380,091  
**Deferred Maintenance:** \$30,289  
**Ext. Gross Area:** 3,906

**Building Code:** T7920090341  
**Building Name:** BEMIDJI - COLD STORAGE BLDG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3920 Hwy 2 West  
**City Code:** BEMIDJI

**Current Replacement Value:** \$902,278  
**Deferred Maintenance:** \$18,046  
**Ext. Gross Area:** 7,300

**Site: T792A90511 - Warren**

**Building Code:** T7925020502  
**Building Name:** WARREN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 417 South Main Street  
**City Code:** WARREN

**Current Replacement Value:** \$165,701  
**Deferred Maintenance:** \$12,967  
**Ext. Gross Area:** 2,100

**Building Code:** T7925020526  
**Building Name:** WARREN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Fabric Structure  
**Address:** 417 South Main Street  
**City Code:** WARREN

**Current Replacement Value:** \$296,256  
**Deferred Maintenance:** \$23,262  
**Ext. Gross Area:** 3,615

**Building Code:** T7925090514  
**Building Name:** WARREN - MISC STORAGE  
**Facility Condition Index:** 0.71 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 417 South Main Street  
**City Code:** WARREN

**Current Replacement Value:** \$26,797  
**Deferred Maintenance:** \$19,090  
**Ext. Gross Area:** 280

**Building Code:** T7925090544  
**Building Name:** WARREN - TRUCK STATION  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 417 South Main Street  
**City Code:** WARREN

**Current Replacement Value:** \$1,171,507  
**Deferred Maintenance:** \$43,728  
**Ext. Gross Area:** 7,260

**Site: T792A90516 - Hallock**

**Building Code:** T7925020520  
**Building Name:** HALLOCK - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 307 SOUTH COLUMBUS AVENUE  
**City Code:** HALLOCK

**Current Replacement Value:** \$459,279  
**Deferred Maintenance:** \$32,564  
**Ext. Gross Area:** 0

**Building Code:** T7925090516  
**Building Name:** HALLOCK - TRUCK STATION  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 307 SOUTH COLUMBUS AVENUE  
**City Code:** HALLOCK

**Current Replacement Value:** \$884,218  
**Deferred Maintenance:** \$102,812  
**Ext. Gross Area:** 6,056

**Building Code:** T7925090542  
**Building Name:** HALLOCK - POLE STORAGE BLDG  
**Facility Condition Index:** 0.05 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 307 SOUTH COLUMBUS AVENUE  
**City Code:** HALLOCK

**Current Replacement Value:** \$322,106  
**Deferred Maintenance:** \$17,318  
**Ext. Gross Area:** 2,560

**Site: T792A90517 - Ada**

**Building Code:** T7925020505  
**Building Name:** ADA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 508 Fourth Street East  
**City Code:** ADA

**Current Replacement Value:** \$74,474  
**Deferred Maintenance:** \$7,301  
**Ext. Gross Area:** 0

**Building Code:** T7925020515  
**Building Name:** ADA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 508 Fourth Street East  
**City Code:** ADA

**Current Replacement Value:** \$181,759  
**Deferred Maintenance:** \$11,599  
**Ext. Gross Area:** 1,855

**Building Code:** T7925020525  
**Building Name:** ADA-SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Fabric Structure  
**Address:** 508 Fourth Street East  
**City Code:** ADA

**Current Replacement Value:** \$377,834  
**Deferred Maintenance:** \$7,557  
**Ext. Gross Area:** 4,800

**Building Code:** T7925090517  
**Building Name:** ADA - TRUCK STATION  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 508 Fourth Street East  
**City Code:** ADA

**Current Replacement Value:** \$859,097  
**Deferred Maintenance:** \$83,744  
**Ext. Gross Area:** 6,132

**Building Code:** T7925090534  
**Building Name:** ADA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 508 Fourth Street East  
**City Code:** ADA

**Current Replacement Value:** \$291,654  
**Deferred Maintenance:** \$22,769  
**Ext. Gross Area:** 2,586

**Site: T792A90524 - Erskine**

**Building Code:** T7925020504  
**Building Name:** ERSKINE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 34659 Hwy 59 SE  
**City Code:** ERSKINE

**Current Replacement Value:** \$127,115  
**Deferred Maintenance:** \$13,780  
**Ext. Gross Area:** 1,852

**Building Code:** T7925020512  
**Building Name:** ERSKINE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 34659 Hwy 59 SE  
**City Code:** ERSKINE

**Current Replacement Value:** \$349,252  
**Deferred Maintenance:** \$55,432  
**Ext. Gross Area:** 0

**Building Code:** T7925090519  
**Building Name:** ERSKINE - MISC STORAGE  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 34659 Hwy 59 SE  
**City Code:** ERSKINE

**Current Replacement Value:** \$61,696  
**Deferred Maintenance:** \$14,081  
**Ext. Gross Area:** 616

**Building Code:** T7925090524  
**Building Name:** ERSKINE - TRUCK STATION  
**Facility Condition Index:** 0.22 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 34659 Hwy 59 SE  
**City Code:** ERSKINE

**Current Replacement Value:** \$1,237,378  
**Deferred Maintenance:** \$271,781  
**Ext. Gross Area:** 8,871

**Building Code:** T7925090541  
**Building Name:** ERSKINE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 34659 Hwy 59 SE  
**City Code:** ERSKINE

**Current Replacement Value:** \$316,864  
**Deferred Maintenance:** \$38,948  
**Ext. Gross Area:** 2,560

**Site: T792A90525 - Marcoux**

**Building Code:** T7925090525  
**Building Name:** MARCOUX - MISC STORAGE  
**Facility Condition Index:** 0.29 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** TH 2, 16 Mi East of Crookston  
**City Code:** CROOKSTON

**Current Replacement Value:** \$315,810  
**Deferred Maintenance:** \$91,641  
**Ext. Gross Area:** 0

**Site: T792A90526 - Karlstad**

**Building Code:** T7925020509  
**Building Name:** KARLSTAD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 312 Harding Street South  
**City Code:** KARLSTAD

**Current Replacement Value:** \$101,735  
**Deferred Maintenance:** \$6,999  
**Ext. Gross Area:** 1,336

**Building Code:** T7925020516  
**Building Name:** KARLSTAD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 312 Harding Street South  
**City Code:** KARLSTAD

**Current Replacement Value:** \$228,230  
**Deferred Maintenance:** \$15,277  
**Ext. Gross Area:** 2,472

**Building Code:** T7925090526  
**Building Name:** KARLSTAD - TRUCK STATION  
**Facility Condition Index:** 0.20 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 312 Harding Street South  
**City Code:** KARLSTAD

**Current Replacement Value:** \$550,561  
**Deferred Maintenance:** \$107,728  
**Ext. Gross Area:** 3,699

**Building Code:** T7925090535  
**Building Name:** KARLSTAD - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 312 Harding Street South  
**City Code:** KARLSTAD

**Current Replacement Value:** \$324,837  
**Deferred Maintenance:** \$18,847  
**Ext. Gross Area:** 2,586

**Site: T792A90527 - Grygla**

**Building Code:** T7925020507  
**Building Name:** GRYGLA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 410 South Marshall Ave  
**City Code:** GRYGLA

**Current Replacement Value:** \$104,409  
**Deferred Maintenance:** \$6,073  
**Ext. Gross Area:** 1,190

**Building Code:** T7925020517  
**Building Name:** GRYGLA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 410 South Marshall Ave  
**City Code:** GRYGLA

**Current Replacement Value:** \$223,402  
**Deferred Maintenance:** \$26,625  
**Ext. Gross Area:** 2,367

**Building Code:** T7925090523  
**Building Name:** GRYGLA - MISC STORAGE  
**Facility Condition Index:** 0.30 - [Poor](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 410 South Marshall Ave  
**City Code:** GRYGLA

**Current Replacement Value:** \$199,048  
**Deferred Maintenance:** \$60,423  
**Ext. Gross Area:** 1,200

**Building Code:** T7925090527  
**Building Name:** GRYGLA - TRUCK STATION  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 410 South Marshall Ave  
**City Code:** GRYGLA

**Current Replacement Value:** \$498,339  
**Deferred Maintenance:** \$114,641  
**Ext. Gross Area:** 4,303

**Site: T792A90528 - EAST GRAND FORKS**

**Building Code:** T7925020510  
**Building Name:** EAST GRAND FORKS - SALT/SAND STORAG  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2512 10th Street NE  
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** \$331,414  
**Deferred Maintenance:** \$32,663  
**Ext. Gross Area:** 0

**Building Code:** T7925020524  
**Building Name:** EAST GRAND FORKS - SALT/SAND STORAG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 2512 10th Street NE  
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** \$284,148  
**Deferred Maintenance:** \$17,841  
**Ext. Gross Area:** 3,615

**Building Code:** T7925090528  
**Building Name:** EAST GRAND FORKS - TRUCK STATION  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2512 10th Street NE  
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** \$604,145  
**Deferred Maintenance:** \$94,865  
**Ext. Gross Area:** 4,281

**Building Code:** T7925090532  
**Building Name:** EAST GRAND FORKS - POLE STORAGE BLD  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2512 10th Street NE  
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** \$686,608  
**Deferred Maintenance:** \$77,907  
**Ext. Gross Area:** 5,632

**Site: T792A90530 - Crookston**

**Building Code:** T7925020511  
**Building Name:** CROOKSTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1320 Sunflower  
**City Code:** CROOKSTON

**Current Replacement Value:** \$319,619  
**Deferred Maintenance:** \$53,984  
**Ext. Gross Area:** 0

**Building Code:** T7925020519  
**Building Name:** CROOKSTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1320 Sunflower  
**City Code:** CROOKSTON

**Current Replacement Value:** \$208,933  
**Deferred Maintenance:** \$15,223  
**Ext. Gross Area:** 0

**Building Code:** T7925020522  
**Building Name:** CROOKSTON - SALT/SAND JOINT USE  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 319 3RD AVENUE SOUTH  
**City Code:** CROOKSTON

**Current Replacement Value:** \$696,031  
**Deferred Maintenance:** \$40,582  
**Ext. Gross Area:** 10,000

**Building Code:** T7925090500  
**Building Name:** CROOKSTON - EQUIP STORAGE  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1320 Sunflower  
**City Code:** CROOKSTON

**Current Replacement Value:** \$1,516,481  
**Deferred Maintenance:** \$341,386  
**Ext. Gross Area:** 10,275

**Building Code:** T7925090501  
**Building Name:** CROOKSTON - EQUIP STORAGE  
**Facility Condition Index:** 0.20 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1320 Sunflower  
**City Code:** CROOKSTON

**Current Replacement Value:** \$873,448  
**Deferred Maintenance:** \$179,033  
**Ext. Gross Area:** 7,284

**Building Code:** T7925090530  
**Building Name:** CROOKSTON - MAINT HEADQUARTERS  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1320 Sunflower  
**City Code:** CROOKSTON

**Current Replacement Value:** \$4,998,505  
**Deferred Maintenance:** \$409,109  
**Ext. Gross Area:** 25,225

**Building Code:** T7925090531  
**Building Name:** CROOKSTON - POLE STORAGE BLDG  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1320 Sunflower  
**City Code:** CROOKSTON

**Current Replacement Value:** \$755,654  
**Deferred Maintenance:** \$102,382  
**Ext. Gross Area:** 4,480

**Site: T792A90533 - THIEF RIVER FALLS:NEW**

**Building Code:** T7925020514  
**Building Name:** THIEF RIVER FALLS - SALT/SAND STORA  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 248 125th Ave NE  
**City Code:** THIEF RIVER FALL

**Current Replacement Value:** \$466,109  
**Deferred Maintenance:** \$42,456  
**Ext. Gross Area:** 5,238

**Building Code:** T7925020523  
**Building Name:** THIEF RIVER FALLS - SAND/SALT STRG  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 248 125th Ave NE  
**City Code:** THIEF RIVER FALL

**Current Replacement Value:** \$641,172  
**Deferred Maintenance:** \$50,346  
**Ext. Gross Area:** 8,403

**Building Code:** T7925090533  
**Building Name:** THIEF RIVER FALLS - TS JOINT USE  
**Facility Condition Index:** 0.10 - [Good](#)

**Building Code:** T7925090540  
**Building Name:** THIEF RIVER FALLS - POLE STG BLDG  
**Facility Condition Index:** 0.15 - [Good](#)

**Building Code:** T7925090543  
**Building Name:** THIEF RIVER FALLS - UNHEATED STRG  
**Facility Condition Index:** 0.03 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 248 125th Ave NE  
**City Code:** THIEF RIVER FALL

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 248 125th Ave NE  
**City Code:** THIEF RIVER FALL

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 248 125th Ave NE  
**City Code:** THIEF RIVER FALL

**Current Replacement Value:** \$15,888,634  
**Deferred Maintenance:** \$1,646,143  
**Ext. Gross Area:** 68,400

**Current Replacement Value:** \$539,948  
**Deferred Maintenance:** \$78,379  
**Ext. Gross Area:** 4,800

**Current Replacement Value:** \$662,167  
**Deferred Maintenance:** \$22,119  
**Ext. Gross Area:** 5,760

**Site: [T792A90536 - Roseau](#)**

**Building Code:** T7925020513  
**Building Name:** ROSEAU - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** T7925090536  
**Building Name:** ROSEAU - TRUCK STATION  
**Facility Condition Index:** 0.05 - [Good](#)

**Building Code:** T7925090539  
**Building Name:** ROSEAU - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1190 Center Street West  
**City Code:** ROSEAU

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1190 Center Street West  
**City Code:** ROSEAU

**Cost Model Name:** Single-story Work Facility  
**Address:** 1190 Center Street West  
**City Code:** ROSEAU

**Current Replacement Value:** \$485,865  
**Deferred Maintenance:** \$32,341  
**Ext. Gross Area:** 4,697

**Current Replacement Value:** \$1,451,777  
**Deferred Maintenance:** \$77,553  
**Ext. Gross Area:** 11,415

**Current Replacement Value:** \$484,793  
**Deferred Maintenance:** \$34,588  
**Ext. Gross Area:** 3,072

**Site: [T792A90547 - THIEF RIVER FALLS 6TH ST](#)**

**Building Code:** T7925090547  
**Building Name:** THIEF RIVER FALLS - MISC STRG  
**Facility Condition Index:** 0.24 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 1090 6TH ST W  
**City Code:** THIEF RIVER FALL

**Current Replacement Value:** \$100,175  
**Deferred Maintenance:** \$23,586  
**Ext. Gross Area:** 1,360

**Site: [T792A92042 - Erskine Scale](#)**

**Building Code:** T7925090537  
**Building Name:** ERSKINE - SCALE - MISC STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Building Code:** T7925092042  
**Building Name:** ERSKINE - SCALE - WEIGH SCALE BLDG  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Cost Model Name:** Utility Shed  
**Address:** 23647 US HWY 2 SE  
**City Code:** ERSKINE

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 23647 US HWY 2 SE  
**City Code:** ERSKINE

**Current Replacement Value:** \$13,266  
**Deferred Maintenance:** \$305  
**Ext. Gross Area:** 96

**Current Replacement Value:** \$867,541  
**Deferred Maintenance:** \$37,463  
**Ext. Gross Area:** 2,587

**Site: [T792AR141102 - Cass Lake RA](#)**



**Building Code:** T7920095211  
**Building Name:** Cass Lake - Rest Area  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2 MILES EAST CASS LAKE ON US 2  
**City Code:** CASS LAKE

**Current Replacement Value:** \$1,343,260  
**Deferred Maintenance:** \$97,870  
**Ext. Gross Area:** 4,566

**Building Code:** T7920095231  
**Building Name:** Cass Lake - Rest Area-Misc. Storage  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 2 MILES EAST CASS LAKE ON US 2  
**City Code:** CASS LAKE

**Current Replacement Value:** \$33,412  
**Deferred Maintenance:** \$877  
**Ext. Gross Area:** 192

**Site: T792AR256005 - Oak Lake RA**

**Building Code:** T7925095261  
**Building Name:** Oak Lake - Rest Area  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US2, MP59, 1 Mi E of Jct TH59  
**City Code:** MCINTOSH

**Current Replacement Value:** \$184,960  
**Deferred Maintenance:** \$20,263  
**Ext. Gross Area:** 924

**Building Code:** T7925095280  
**Building Name:** Oak Lake - Rest Area - Misc Stg  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** US2, MP59, 1 Mi E of Jct TH59  
**City Code:** MCINTOSH

**Current Replacement Value:** \$30,799  
**Deferred Maintenance:** \$8,488  
**Ext. Gross Area:** 196

**Site: T792AR436005 - Lengby RA**

**Building Code:** T7925095260  
**Building Name:** Lengby - Rest Area  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Vault Toilet  
**Address:** TH 2 - 2 Mi No of Lengby  
**City Code:** LENGBY

**Current Replacement Value:** \$66,473  
**Deferred Maintenance:** \$7,191  
**Ext. Gross Area:** 193

**Site: T792AR446001 - Fishers Landing RA-TIC**

**Building Code:** T7925095262  
**Building Name:** Fishers Landing - Rest Area - TIC  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US 2 9 Mi West of Crookston  
**City Code:** FISHER

**Current Replacement Value:** \$553,732  
**Deferred Maintenance:** \$136,914  
**Ext. Gross Area:** 0

**Building Code:** T7925095281  
**Building Name:** Fishers Landing - RA - TIC -MISC ST  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Utility Shed  
**Address:** US 2 9 Mi West of Crookston  
**City Code:** FISHER

**Current Replacement Value:** \$30,799  
**Deferred Maintenance:** \$6,144  
**Ext. Gross Area:** 0

**Site: T793A90413 - Remer**

**Building Code:** T7930020419  
**Building Name:** REMER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 112 Eagle Ave NE  
**City Code:** Remer

**Current Replacement Value:** \$547,505  
**Deferred Maintenance:** \$43,739  
**Ext. Gross Area:** 5,788

**Building Code:** T7930090413  
**Building Name:** REMER - TRUCK STATION  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 112 Eagle Ave. NE  
**City Code:** Remer

**Current Replacement Value:** \$936,889  
**Deferred Maintenance:** \$89,668  
**Ext. Gross Area:** 5,888

**Building Code:** T7930090463  
**Building Name:** REMER - MISC STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 112 Eagle Ave NE  
**City Code:** Remer

**Current Replacement Value:** \$167,939  
**Deferred Maintenance:** \$14,534  
**Ext. Gross Area:** 1,384

***Site: T793A90415 - Motley***

**Building Code:** T7930020417  
**Building Name:** MOTLEY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 149 River Front Lane  
**City Code:** MOTLEY

**Current Replacement Value:** \$631,657  
**Deferred Maintenance:** \$51,655  
**Ext. Gross Area:** 6,240

**Building Code:** T7930090415  
**Building Name:** MOTLEY - TRUCK STATION  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 149 River Front Lane  
**City Code:** MOTLEY

**Current Replacement Value:** \$1,409,980  
**Deferred Maintenance:** \$189,057  
**Ext. Gross Area:** 8,549

**Building Code:** T7930090435  
**Building Name:** MOTLEY - MISC STORAGE  
**Facility Condition Index:** 0.25 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 149 River Front Lane  
**City Code:** MOTLEY

**Current Replacement Value:** \$254,495  
**Deferred Maintenance:** \$63,294  
**Ext. Gross Area:** 1,889

**Building Code:** T7930090456  
**Building Name:** MOTLEY - MISC STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 149 River Front Lane  
**City Code:** MOTLEY

**Current Replacement Value:** \$135,068  
**Deferred Maintenance:** \$10,830  
**Ext. Gross Area:** 1,384

***Site: T793A90419 - Little Falls***

**Building Code:** T7930020411  
**Building Name:** LITTLE FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 207 13th Street Northwest  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$719,698  
**Deferred Maintenance:** \$133,387  
**Ext. Gross Area:** 7,224

**Building Code:** T7930090419  
**Building Name:** LITTLE FALLS - TRUCK STATION  
**Facility Condition Index:** 0.27 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 207 13th Street Northwest  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$2,035,161  
**Deferred Maintenance:** \$540,193  
**Ext. Gross Area:** 10,527

**Building Code:** T7930090422  
**Building Name:** LITTLE FALLS - MISC STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 207 13th Street Northwest  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$398,340  
**Deferred Maintenance:** \$46,743  
**Ext. Gross Area:** 4,140

**Building Code:** T7930090440  
**Building Name:** LITTLE FALLS - POLE STORAGE  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 207 13th Street Northwest  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$243,341  
**Deferred Maintenance:** \$51,394  
**Ext. Gross Area:** 2,080

**Building Code:** T7930090454  
**Building Name:** LITTLE FALLS - MISC STORAGE  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 207 13th Street Northwest  
**City Code:** LITTLE FALLS

**Current Replacement Value:** \$203,676  
**Deferred Maintenance:** \$36,996  
**Ext. Gross Area:** 2,087

**Site: T793A90438 - Aitkin**

**Building Code:** T7930020423  
**Building Name:** AITKIN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 1158 Air Park Drive  
**City Code:** AITKIN

**Current Replacement Value:** \$554,329  
**Deferred Maintenance:** \$105,654  
**Ext. Gross Area:** 7,260

**Building Code:** T7930090438  
**Building Name:** AITKIN - TRUCK STATION  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1158 Air Park Drive  
**City Code:** AITKIN

**Current Replacement Value:** \$995,126  
**Deferred Maintenance:** \$207,452  
**Ext. Gross Area:** 5,306

**Building Code:** T7930090449  
**Building Name:** AITKIN - POLE STORAGE BLDG  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1158 Air Park Drive  
**City Code:** AITKIN

**Current Replacement Value:** \$269,192  
**Deferred Maintenance:** \$27,315  
**Ext. Gross Area:** 2,560

**Building Code:** T7930090466  
**Building Name:** AITKIN - MISC STORAGE  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1158 Air Park Drive  
**City Code:** AITKIN

**Current Replacement Value:** \$120,758  
**Deferred Maintenance:** \$4,225  
**Ext. Gross Area:** 1,424

**Site: T793A90442 - Pine River**

**Building Code:** T7930020421  
**Building Name:** PINE RIVER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3019 MN Hwy 371 SW  
**City Code:** Pine River

**Current Replacement Value:** \$820,192  
**Deferred Maintenance:** \$91,535  
**Ext. Gross Area:** 8,424

**Building Code:** T7930090442  
**Building Name:** PINE RIVER - TRUCK STATION  
**Facility Condition Index:** 0.15 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3019 MN Hwy 371 SW  
**City Code:** Pine River

**Current Replacement Value:** \$793,072  
**Deferred Maintenance:** \$121,319  
**Ext. Gross Area:** 4,927

**Building Code:** T7930090461  
**Building Name:** PINE RIVER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3019 MN Hwy 371 SW  
**City Code:** Pine River

**Current Replacement Value:** \$289,454  
**Deferred Maintenance:** \$16,439  
**Ext. Gross Area:** 3,072

**Site: T793A90443 - Brainerd/Baxter**

**Building Code:** T7930020412  
**Building Name:** Brainerd/Baxter - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$1,061,638  
**Deferred Maintenance:** \$181,448  
**Ext. Gross Area:** 10,354

**Building Code:** T7930020422  
**Building Name:** Brainerd/Baxter - SALT/SAND STORAGE  
**Facility Condition Index:** 0.05 - **Good**

**Cost Model Name:** Fabric Structure  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$1,312,719  
**Deferred Maintenance:** \$66,452  
**Ext. Gross Area:** 13,872

**Building Code:** T7930090439  
**Building Name:** Brainerd/Baxter - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$700,114  
**Deferred Maintenance:** \$77,489  
**Ext. Gross Area:** 3,200

**Building Code:** T7930090443  
**Building Name:** Brainerd/Baxter - DISTRICT HEADQUAR  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$28,061,757  
**Deferred Maintenance:** \$4,646,988  
**Ext. Gross Area:** 104,845

**Building Code:** T7930090444  
**Building Name:** Brainerd/Baxter - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$1,011,327  
**Deferred Maintenance:** \$108,430  
**Ext. Gross Area:** 9,600

**Building Code:** T7930090451  
**Building Name:** Brainerd/Baxter - Patrol - POLE STO  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$117,184  
**Deferred Maintenance:** \$9,103  
**Ext. Gross Area:** 1,040

**Building Code:** T7930090452  
**Building Name:** Brainerd/Baxter - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$427,710  
**Deferred Maintenance:** \$29,392  
**Ext. Gross Area:** 3,837

**Building Code:** T7930090464  
**Building Name:** BRAINERD/BAXTER - HAZ MATRL STRG  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 1991 Industrial Park Road S  
**City Code:** BAXTER

**Current Replacement Value:** \$26,429  
**Deferred Maintenance:** \$2,643  
**Ext. Gross Area:** 190

**Site: T793A90445 - Isle**

**Building Code:** T7930020418  
**Building Name:** ISLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1100 MN Hwy 47  
**City Code:** ISLE

**Current Replacement Value:** \$475,639  
**Deferred Maintenance:** \$32,118  
**Ext. Gross Area:** 4,980

**Building Code:** T7930090447  
**Building Name:** ISLE - MISC STORAGE  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1100 MN Hwy 47  
**City Code:** ISLE

**Current Replacement Value:** \$55,222  
**Deferred Maintenance:** \$4,744  
**Ext. Gross Area:** 500

**Building Code:** T7930090460  
**Building Name:** ISLE - MISC STORAGE  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1100 Mn Hwy 47  
**City Code:** ISLE

**Current Replacement Value:** \$123,698  
**Deferred Maintenance:** \$10,627  
**Ext. Gross Area:** 1,120

**Building Code:** T7930090471  
**Building Name:** ISLE - TRUCK STATION (NEW)  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1100 Mn Hwy 47  
**City Code:** ISLE

**Current Replacement Value:** \$746,641  
**Deferred Maintenance:** \$14,933  
**Ext. Gross Area:** 4,695

**Site: T793A90450 - Wadena**

**Building Code:** T7930020416  
**Building Name:** WADENA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1701 Industrial Drive  
**City Code:** Wadena

**Current Replacement Value:** \$626,589  
**Deferred Maintenance:** \$136,313  
**Ext. Gross Area:** 3,951

**Building Code:** T7930090450  
**Building Name:** WADENA - TRUCK STATION  
**Facility Condition Index:** 0.04 - **Excellent**

**Building Code:** T7930090453  
**Building Name:** WADENA - MISC STORAGE  
**Facility Condition Index:** 0.14 - **Good**

**Building Code:** T7930090457  
**Building Name:** WADENA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1701 Industrial Drive  
**City Code:** Wadena

**Cost Model Name:** Single-story Work Facility  
**Address:** 1701 Industrial Drive  
**City Code:** Wadena

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1701 Industrial Drive  
**City Code:** Wadena

**Current Replacement Value:** \$1,078,162  
**Deferred Maintenance:** \$40,827  
**Ext. Gross Area:** 7,073

**Current Replacement Value:** \$50,203  
**Deferred Maintenance:** \$7,037  
**Ext. Gross Area:** 448

**Current Replacement Value:** \$359,648  
**Deferred Maintenance:** \$24,591  
**Ext. Gross Area:** 3,840

**Site: T793A90458 - Long Prairie**

**Building Code:** T7930020420  
**Building Name:** LONG PRAIRIE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - **Good**

**Building Code:** T7930090458  
**Building Name:** LONG PRAIRIE - TRUCK STATION  
**Facility Condition Index:** 0.20 - **Average**

**Building Code:** T7930090459  
**Building Name:** LONG PRAIRIE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 24291 STATE HWY 71  
**City Code:** LONG PRAIRIE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 24291 STATE HWY 71  
**City Code:** LONG PRAIRIE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 24291 STATE HWY 71  
**City Code:** LONG PRAIRIE

**Current Replacement Value:** \$539,051  
**Deferred Maintenance:** \$36,362  
**Ext. Gross Area:** 5,788

**Current Replacement Value:** \$1,089,405  
**Deferred Maintenance:** \$221,046  
**Ext. Gross Area:** 6,852

**Current Replacement Value:** \$281,881  
**Deferred Maintenance:** \$31,321  
**Ext. Gross Area:** 3,072

**Site: T793A90462 - Garrison**

**Building Code:** T7930020415  
**Building Name:** GARRISON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.09 - **Good**

**Building Code:** T7930090441  
**Building Name:** GARRISON - STORAGE FACILITY  
**Facility Condition Index:** 0.24 - **Average**

**Building Code:** T7930090455  
**Building Name:** GARRISON - MISC STORAGE  
**Facility Condition Index:** 0.11 - **Good**

**Building Code:** T7930090462  
**Building Name:** GARRISON - TRUCK STATION  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 27365 MN Hwy 18  
**City Code:** GARRISON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 27365 MN Hwy 18  
**City Code:** GARRISON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 27365 MN Hwy 18  
**City Code:** GARRISON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 27365 MN HWY 18  
**City Code:** GARRISON

**Current Replacement Value:** \$518,514  
**Deferred Maintenance:** \$44,289  
**Ext. Gross Area:** 4,954

**Current Replacement Value:** \$532,839  
**Deferred Maintenance:** \$128,918  
**Ext. Gross Area:** 3,229

**Current Replacement Value:** \$180,525  
**Deferred Maintenance:** \$19,810  
**Ext. Gross Area:** 1,652

**Current Replacement Value:** \$1,274,794  
**Deferred Maintenance:** \$72,706  
**Ext. Gross Area:** 8,383

**Site: T793AR961806 - Brainerd/Baxter RA**

**Building Code:** T7930095312  
**Building Name:** Brainerd/Baxter - Rest Area  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 7393 STATE HIGHWAY 371  
**City Code:** BRAINERD

**Current Replacement Value:** \$1,713,834  
**Deferred Maintenance:** \$207,366  
**Ext. Gross Area:** 5,550

**Site: T793B20718 - Clearwater**

**Building Code:** T7935020718  
**Building Name:** CLEARWATER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** County Rd 75 1 Mi S TH 24  
**City Code:** CLEARWATER

**Current Replacement Value:** \$80,670  
**Deferred Maintenance:** \$6,533  
**Ext. Gross Area:** 1,080

**Site: T793B90713 - Mora**

**Building Code:** T7935020702  
**Building Name:** MORA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 807 Howe Street  
**City Code:** MORA

**Current Replacement Value:** \$399,675  
**Deferred Maintenance:** \$63,128  
**Ext. Gross Area:** 5,054

**Building Code:** T7935090713  
**Building Name:** MORA - TRUCK STATION  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 807 Howe Street  
**City Code:** MORA

**Current Replacement Value:** \$980,706  
**Deferred Maintenance:** \$170,211  
**Ext. Gross Area:** 6,176

**Building Code:** T7935090780  
**Building Name:** MORA - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 807 Howe Street  
**City Code:** MORA

**Current Replacement Value:** \$341,665  
**Deferred Maintenance:** \$7,418  
**Ext. Gross Area:** 3,840

**Site: T793B90714 - Foley**

**Building Code:** T7935020712  
**Building Name:** FOLEY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 531 Norman Ave No  
**City Code:** FOLEY

**Current Replacement Value:** \$115,764  
**Deferred Maintenance:** \$13,259  
**Ext. Gross Area:** 1,852

**Building Code:** T7935090714  
**Building Name:** FOLEY - TRUCK STATION  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 531 Norman Ave No  
**City Code:** FOLEY

**Current Replacement Value:** \$389,138  
**Deferred Maintenance:** \$66,284  
**Ext. Gross Area:** 2,963

**Site: T793B90735 - Saint Cloud**

**Building Code:** T7935020711  
**Building Name:** ST CLOUD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3725 12th Street North  
**City Code:** St. Cloud

**Current Replacement Value:** \$122,606  
**Deferred Maintenance:** \$30,024  
**Ext. Gross Area:** 1,867

<b>Building Code:</b>	T7935020724	<b>Cost Model Name:</b>	Fabric Structure	<b>Current Replacement Value:</b>	\$1,207,494
<b>Building Name:</b>	ST CLOUD - SALT/SAND STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$477,272
<b>Facility Condition Index:</b>	0.40 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	17,282
<b>Building Code:</b>	T7935090725	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$148,719
<b>Building Name:</b>	ST CLOUD - BRINE BLDG	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$27,511
<b>Facility Condition Index:</b>	0.18 - Average	<b>City Code:</b>	ST. CLOUD	<b>Ext. Gross Area:</b>	1,523
<b>Building Code:</b>	T7935090726	<b>Cost Model Name:</b>	Utility Shed	<b>Current Replacement Value:</b>	\$26,639
<b>Building Name:</b>	ST CLOUD - MISC STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$5,348
<b>Facility Condition Index:</b>	0.20 - Average	<b>City Code:</b>	ST. CLOUD	<b>Ext. Gross Area:</b>	156
<b>Building Code:</b>	T7935090735	<b>Cost Model Name:</b>	Joint Office/Warehouse Facility	<b>Current Replacement Value:</b>	\$40,972,256
<b>Building Name:</b>	ST CLOUD - MAINTENANCE HEADQUARTERS	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$5,303,168
<b>Facility Condition Index:</b>	0.13 - Good	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	169,970
<b>Building Code:</b>	T7935090736	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$143,651
<b>Building Name:</b>	ST CLOUD - MISC STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$15,529
<b>Facility Condition Index:</b>	0.11 - Good	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	1,610
<b>Building Code:</b>	T7935090745	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$398,317
<b>Building Name:</b>	ST CLOUD - MISC STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$37,943
<b>Facility Condition Index:</b>	0.10 - Good	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,712
<b>Building Code:</b>	T7935090748	<b>Cost Model Name:</b>	Single-story Work Facility	<b>Current Replacement Value:</b>	\$32,885
<b>Building Name:</b>	ST CLOUD - MISC STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$13,450
<b>Facility Condition Index:</b>	0.41 - Poor	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	289
<b>Building Code:</b>	T7935090754	<b>Cost Model Name:</b>	Open Air Storage Structure	<b>Current Replacement Value:</b>	\$115,415
<b>Building Name:</b>	ST CLOUD - MISC STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$28,020
<b>Facility Condition Index:</b>	0.24 - Average	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	1,800
<b>Building Code:</b>	T7935090756	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$749,598
<b>Building Name:</b>	ST CLOUD - MISC STORAGE	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$45,478
<b>Facility Condition Index:</b>	0.06 - Good	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	7,184
<b>Building Code:</b>	T7935090771	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$1,386,533
<b>Building Name:</b>	ST CLOUD - POLE STORAGE BLDG	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$102,867
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	ST. CLOUD	<b>Ext. Gross Area:</b>	9,222
<b>Building Code:</b>	T7935090775	<b>Cost Model Name:</b>	Butler-style Warehouse Building	<b>Current Replacement Value:</b>	\$254,709
<b>Building Name:</b>	ST CLOUD - POLE STORAGE BLDG	<b>Address:</b>	3725 12th Street North	<b>Deferred Maintenance:</b>	\$17,385
<b>Facility Condition Index:</b>	0.07 - Good	<b>City Code:</b>	St. Cloud	<b>Ext. Gross Area:</b>	2,836



**Building Code:** T7935090777  
**Building Name:** ST CLOUD - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3725 12th Street North  
**City Code:** St. Cloud

**Current Replacement Value:** \$484,858  
**Deferred Maintenance:** \$30,766  
**Ext. Gross Area:** 5,376

**Building Code:** T7935090778  
**Building Name:** ST CLOUD - MISC STORAGE  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 3725 12th Street North  
**City Code:** St. Cloud

**Current Replacement Value:** \$112,962  
**Deferred Maintenance:** \$7,332  
**Ext. Gross Area:** 1,050

**Building Code:** T7935090786  
**Building Name:** ST CLOUD - MISC STORAGE OLD DNR  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3725 12th Street North  
**City Code:** ST. CLOUD

**Current Replacement Value:** \$125,340  
**Deferred Maintenance:** \$15,912  
**Ext. Gross Area:** 1,363

**Building Code:** T7935090787  
**Building Name:** ST CLOUD PATROL POST BLDG  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** 3725 12th Street North  
**City Code:** ST. CLOUD

**Current Replacement Value:** \$40,100  
**Deferred Maintenance:** \$5,550  
**Ext. Gross Area:** 231

**Building Code:** T7935090788  
**Building Name:** ST CLOUD - MISC STORAGE  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3725 12th Street North  
**City Code:** ST. CLOUD

**Current Replacement Value:** \$41,074  
**Deferred Maintenance:** \$5,181  
**Ext. Gross Area:** 401

**Site: [T793B90740 - Albany](#)**

**Building Code:** T7935020710  
**Building Name:** ALBANY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.27 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 34916 County Road 10  
**City Code:** ALBANY

**Current Replacement Value:** \$17,677  
**Deferred Maintenance:** \$4,855  
**Ext. Gross Area:** 290

**Building Code:** T7935020719  
**Building Name:** ALBANY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 34916 County Road 10  
**City Code:** ALBANY

**Current Replacement Value:** \$221,270  
**Deferred Maintenance:** \$22,339  
**Ext. Gross Area:** 2,360

**Building Code:** T7935090740  
**Building Name:** ALBANY - TRUCK STATION  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 34916 County Road 10  
**City Code:** ALBANY

**Current Replacement Value:** \$628,118  
**Deferred Maintenance:** \$75,737  
**Ext. Gross Area:** 4,904

**Building Code:** T7935090763  
**Building Name:** ALBANY - MISC STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 34916 County Road 10  
**City Code:** ALBANY

**Current Replacement Value:** \$108,064  
**Deferred Maintenance:** \$7,938  
**Ext. Gross Area:** 800

**Building Code:** T7935090773  
**Building Name:** ALBANY - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 34916 County Road 10  
**City Code:** ALBANY

**Current Replacement Value:** \$274,097  
**Deferred Maintenance:** \$17,528  
**Ext. Gross Area:** 3,072

**Site: [T793B90741 - Elk River](#)**

**Building Code:** T7935020713  
**Building Name:** ELK RIVER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.34 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 18938 Dodge Avenue Northwest  
**City Code:** ELK RIVER

**Current Replacement Value:** \$82,263  
**Deferred Maintenance:** \$27,727  
**Ext. Gross Area:** 1,425

**Building Code:** T7935020720  
**Building Name:** ELK RIVER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 18938 Dodge Avenue Northwest  
**City Code:** ELK RIVER

**Current Replacement Value:** \$179,790  
**Deferred Maintenance:** \$24,833  
**Ext. Gross Area:** 4,373

**Building Code:** T7935090741  
**Building Name:** ELK RIVER - TRUCK STATION  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 18938 Dodge Avenue Northwest  
**City Code:** ELK RIVER

**Current Replacement Value:** \$2,307,220  
**Deferred Maintenance:** \$313,600  
**Ext. Gross Area:** 11,406

**Building Code:** T7935090764  
**Building Name:** ELK RIVER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 18938 Dodge Avenue Northwest  
**City Code:** ELK RIVER

**Current Replacement Value:** \$733,434  
**Deferred Maintenance:** \$83,179  
**Ext. Gross Area:** 5,375

**Site: T793B90742 - Monticello**

**Building Code:** T7935020721  
**Building Name:** MONTICELLO - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 112 Chelsea Road  
**City Code:** MONTICELLO

**Current Replacement Value:** \$457,669  
**Deferred Maintenance:** \$54,094  
**Ext. Gross Area:** 5,227

**Building Code:** T7935090742  
**Building Name:** MONTICELLO - TRUCK STATION  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 112 Chelsea Road  
**City Code:** MONTICELLO

**Current Replacement Value:** \$1,998,982  
**Deferred Maintenance:** \$436,163  
**Ext. Gross Area:** 11,221

**Building Code:** T7935090762  
**Building Name:** MONTICELLO - MISC STORAGE  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 112 Chelsea Road  
**City Code:** MONTICELLO

**Current Replacement Value:** \$42,663  
**Deferred Maintenance:** \$9,549  
**Ext. Gross Area:** 444

**Building Code:** T7935090779  
**Building Name:** MONTICELLO - EQUIP STORAGE  
**Facility Condition Index:** 0.05 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 112 Chelsea Road  
**City Code:** MONTICELLO

**Current Replacement Value:** \$1,530,696  
**Deferred Maintenance:** \$79,801  
**Ext. Gross Area:** 11,289

**Building Code:** T7935090789  
**Building Name:** MONTICELLO - BRINE BUILDING  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 112 Chelsea Road  
**City Code:** MONTICELLO

**Current Replacement Value:** \$25,419  
**Deferred Maintenance:** \$4,539  
**Ext. Gross Area:** 318

**Site: T793B90749 - Milaca**

**Building Code:** T7935020714  
**Building Name:** MILACA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 605 8th Street Northeast  
**City Code:** MILACA

**Current Replacement Value:** \$351,343  
**Deferred Maintenance:** \$44,470  
**Ext. Gross Area:** 4,558

**Building Code:** T7935090749  
**Building Name:** MILACA - STORAGE FACILITY  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 605 8th Street Northeast  
**City Code:** MILACA

**Current Replacement Value:** \$1,238,119  
**Deferred Maintenance:** \$213,525  
**Ext. Gross Area:** 5,543

**Building Code:** T7935090770  
**Building Name:** MILACA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 605 8th Street Northeast  
**City Code:** MILACA

**Current Replacement Value:** \$257,553  
**Deferred Maintenance:** \$21,761  
**Ext. Gross Area:** 2,560

**Building Code:** T7935090784  
**Building Name:** MILACA TS(NEW)  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 605 8th Street Northeast  
**City Code:** MILACA

**Current Replacement Value:** \$1,380,295  
**Deferred Maintenance:** \$34,446  
**Ext. Gross Area:** 8,845

**Building Code:** T7935090791  
**Building Name:** MILACA - BRINE BUILDING  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 605 8th Street Northeast  
**City Code:** MILACA

**Current Replacement Value:** \$43,487  
**Deferred Maintenance:** \$4,989  
**Ext. Gross Area:** 318

**Site: T793B90753 - Buffalo**

**Building Code:** T7935020705  
**Building Name:** BUFFALO - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1137 TH 25 SE  
**City Code:** BUFFALO

**Current Replacement Value:** \$120,601  
**Deferred Maintenance:** \$14,882  
**Ext. Gross Area:** 1,890

**Building Code:** T7935020726  
**Building Name:** BUFFALO - SALT/SAND STORAGE  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1137 TH 25 SE  
**City Code:** BUFFALO

**Current Replacement Value:** \$566,107  
**Deferred Maintenance:** \$104,592  
**Ext. Gross Area:** 6,513

**Building Code:** T7935090753  
**Building Name:** BUFFALO - TRUCK STATION  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1137 TH 25 SE  
**City Code:** BUFFALO

**Current Replacement Value:** \$794,666  
**Deferred Maintenance:** \$96,174  
**Ext. Gross Area:** 7,628

**Building Code:** T7935090757  
**Building Name:** BUFFALO - POLE STORAGE  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1137 TH 25 SE  
**City Code:** BUFFALO

**Current Replacement Value:** \$324,264  
**Deferred Maintenance:** \$35,524  
**Ext. Gross Area:** 2,586

**Building Code:** T7935090792  
**Building Name:** BUFFALO - BRINE BUILDING  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Utility Shed  
**Address:** 1137 TH 25 SE  
**City Code:** BUFFALO

**Current Replacement Value:** \$43,394  
**Deferred Maintenance:** \$2,906  
**Ext. Gross Area:** 318

**Site: T793B90769 - Lake George Lift Station**

**Building Code:** T7935090769  
**Building Name:** ST CLOUD - LAKE GEORGE - LIFT STAT  
**Facility Condition Index:** 0.54 - *Crisis*

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 23 at Lake George  
**City Code:** St. Cloud

**Current Replacement Value:** \$98,215  
**Deferred Maintenance:** \$53,277  
**Ext. Gross Area:** 636

**Site: T793B90772 - Sauk Centre**

**Building Code:** T7935020723  
**Building Name:** SAUK CENTRE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1218 Beltline Road  
**City Code:** SAUK CENTRE

**Current Replacement Value:** \$447,737  
**Deferred Maintenance:** \$27,879  
**Ext. Gross Area:** 0

**Building Code:** T7935090772  
**Building Name:** SAUK CENTRE - TRUCK STATION  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1218 Beltline Road  
**City Code:** SAUK CENTRE

**Current Replacement Value:** \$2,021,966  
**Deferred Maintenance:** \$149,673  
**Ext. Gross Area:** 11,086

**Building Code:** T7935090774  
**Building Name:** SAUK CENTRE - POLE STORAGE  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1218 Beltline Road  
**City Code:** SAUK CENTRE

**Current Replacement Value:** \$407,434  
**Deferred Maintenance:** \$82,619  
**Ext. Gross Area:** 4,480

**Site: T793B90781 - CAMBRIDGE - NEW**

**Building Code:** T7935020728  
**Building Name:** CAMBRIDGE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Fabric Structure  
**Address:** 1620 KENNEDY STREET NORTH  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$405,483  
**Deferred Maintenance:** \$8,110  
**Ext. Gross Area:** 7,200

**Building Code:** T7935090781  
**Building Name:** CAMBRIDGE - TRUCK STATION  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1620 KENNEDY STREET NORTH  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$2,036,234  
**Deferred Maintenance:** \$40,725  
**Ext. Gross Area:** 13,949

**Building Code:** T7935090785  
**Building Name:** CAMBRIDGE - UNHEATED STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1620 KENNEDY STREET NORTH  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$375,095  
**Deferred Maintenance:** \$7,502  
**Ext. Gross Area:** 4,199

**Building Code:** T7935090790  
**Building Name:** CAMBRIDGE - CVRD STRG BIN  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1620 KENNEDY STREET NORTH  
**City Code:** CAMBRIDGE

**Current Replacement Value:** \$62,819  
**Deferred Maintenance:** \$1,256  
**Ext. Gross Area:** 1,153

**Site: T793B90782 - PAYNESVILLE**

**Building Code:** T7935020727  
**Building Name:** PAYNESVILLE- SALT/SAND STORAGE  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Fabric Structure  
**Address:** 223 Industrial Loop W  
**City Code:** PAYNESVILLE

**Current Replacement Value:** \$476,300  
**Deferred Maintenance:** \$22,748  
**Ext. Gross Area:** 6,403

**Building Code:** T7935090782  
**Building Name:** PAYNESVILLE - TRUCK STATION  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 223 Industrial Loop W  
**City Code:** Paynesville

**Current Replacement Value:** \$1,548,910  
**Deferred Maintenance:** \$88,864  
**Ext. Gross Area:** 9,441

**Building Code:** T7935090783  
**Building Name:** PAYNESVILLE-UNHEATED STRG/BB  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 223 Industrial Loop W  
**City Code:** Paynesville

**Current Replacement Value:** \$390,633  
**Deferred Maintenance:** \$7,813  
**Ext. Gross Area:** 4,043

**Site: T793BR307380 - Fuller Lake RA**

**Building Code:** T7935095351  
**Building Name:** Fuller Lake - Rest Area  
**Facility Condition Index:** 0.35 - Poor

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I94 WB N of Jct TH 24 Clearwater  
**City Code:** CLEARWATER

**Current Replacement Value:** \$432,375  
**Deferred Maintenance:** \$151,755  
**Ext. Gross Area:** 1,722

**Building Code:** T7935095380  
**Building Name:** Fuller Lake - Rest Area - Misc Stg  
**Facility Condition Index:** 0.37 - Poor

**Cost Model Name:** Utility Shed  
**Address:** I94 WB N of Jct TH 24 Clearwater  
**City Code:** CLEARWATER

**Current Replacement Value:** \$24,009  
**Deferred Maintenance:** \$8,995  
**Ext. Gross Area:** 123

**Site: T793BR317380 - Middle Spunk Creek RA**

**Building Code:** T7935095352  
**Building Name:** Middle Spunk Creek - Rest Area  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I94WB 1 MI W of Avon Interchan  
**City Code:** AVON

**Current Replacement Value:** \$538,349  
**Deferred Maintenance:** \$40,698  
**Ext. Gross Area:** 2,423

**Building Code:** T7935095381  
**Building Name:** Middle Spunk Creek - RA - Misc Stg  
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Utility Shed  
**Address:** I94WB 1 Mi W of Avon Interchan  
**City Code:** AVON

**Current Replacement Value:** \$75,205  
**Deferred Maintenance:** \$7,783  
**Ext. Gross Area:** 473

**Site: T793BR327380 - Big Spunk Lake RA**

**Building Code:** T7935095353  
**Building Name:** Big Spunk Lake - Rest Area  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I94 EB 1.5 Mi W of Avon  
**City Code:** AVON

**Current Replacement Value:** \$522,884  
**Deferred Maintenance:** \$33,252  
**Ext. Gross Area:** 2,550

**Building Code:** T7935095382  
**Building Name:** Big Spunk Lake - Misc Storage  
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Utility Shed  
**Address:** I94 EB 1.5 Mi W of Avon  
**City Code:** AVON

**Current Replacement Value:** \$109,156  
**Deferred Maintenance:** \$12,447  
**Ext. Gross Area:** 473

**Site: T793BR498680 - Enfield RA**

**Building Code:** T7935095354  
**Building Name:** Enfield - Rest Area  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I94 EB 6 Mi W of Jct TH 25  
**City Code:** MONTICELLO

**Current Replacement Value:** \$802,528  
**Deferred Maintenance:** \$44,243  
**Ext. Gross Area:** 2,892

**Building Code:** T7935095383  
**Building Name:** Enfield - Rest Area - Misc Stg  
**Facility Condition Index:** 0.26 - Average

**Cost Model Name:** Single-story Work Facility  
**Address:** I94 EB 6 Mi W of Jct TH 25  
**City Code:** MONTICELLO

**Current Replacement Value:** \$50,174  
**Deferred Maintenance:** \$13,191  
**Ext. Gross Area:** 266

**Site: T793BR734812 - RUM RIVER RA**

**Building Code:** T7935095361  
**Building Name:** RUM RIVER - REST AREA  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** TH 169, 11.0 Mi N of Milaca  
**City Code:** MILACA

**Current Replacement Value:** \$398,812  
**Deferred Maintenance:** \$62,107  
**Ext. Gross Area:** 1,637

***Site: T793BR837103 - Saint Cloud RA***

**Building Code:** T7935095360  
**Building Name:** Saint Cloud - Rest Area  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** TH 10 .2 Miles East of TH 23  
**City Code:** St. Cloud

**Current Replacement Value:** \$805,323  
**Deferred Maintenance:** \$110,744  
**Ext. Gross Area:** 3,367

***Site: T794A20613 - Pelican Rapids***

**Building Code:** T7940020613  
**Building Name:** PELICAN RAPIDS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 59 N Edge of Town  
**City Code:** Pelican Rapids

**Current Replacement Value:** \$271,194  
**Deferred Maintenance:** \$88,460  
**Ext. Gross Area:** 3,564

***Site: T794A20809 - Barrett***

**Building Code:** T7945020809  
**Building Name:** BARRETT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 55 At Jct TH 59  
**City Code:** BARRETT

**Current Replacement Value:** \$144,955  
**Deferred Maintenance:** \$35,688  
**Ext. Gross Area:** 2,755

***Site: T794A90611 - Breckenridge***

**Building Code:** T7940020611  
**Building Name:** BRECKENRIDGE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 401 South 8th Street  
**City Code:** BRECKENRIDGE

**Current Replacement Value:** \$229,078  
**Deferred Maintenance:** \$45,389  
**Ext. Gross Area:** 2,696

**Building Code:** T7940090611  
**Building Name:** BRECKENRIDGE - TRUCK STATION  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 401 South 8th Street  
**City Code:** BRECKENRIDGE

**Current Replacement Value:** \$1,031,308  
**Deferred Maintenance:** \$271,305  
**Ext. Gross Area:** 5,713

**Building Code:** T7940090641  
**Building Name:** BRECKENRIDGE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 401 South 8th Street  
**City Code:** BRECKENRIDGE

**Current Replacement Value:** \$138,645  
**Deferred Maintenance:** \$17,689  
**Ext. Gross Area:** 1,459

**Building Code:** T7940090669  
**Building Name:** BRECKENRIDGE - BRINE BUILDING  
**Facility Condition Index:** 0.05 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 401 South 8th Street  
**City Code:** BRECKENRIDGE

**Current Replacement Value:** \$25,875  
**Deferred Maintenance:** \$1,318  
**Ext. Gross Area:** 0

***Site: T794A90615 - Fergus Falls***

**Building Code:** T7940020615  
**Building Name:** FERGUS FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 1205 East Douglas Avenue  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$971,196  
**Deferred Maintenance:** \$188,801  
**Ext. Gross Area:** 12,684

**Building Code:** T7940090615  
**Building Name:** FERGUS FALLS - TRUCK STATION  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1205 East Douglas Avenue  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$5,552,456  
**Deferred Maintenance:** \$680,902  
**Ext. Gross Area:** 20,069

**Building Code:** T7940090645  
**Building Name:** FERGUS FALLS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1205 East Douglas Avenue  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$418,638  
**Deferred Maintenance:** \$89,041  
**Ext. Gross Area:** 3,200

**Building Code:** T7940090660  
**Building Name:** FERGUS FALLS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1205 East Douglas Avenue  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$623,556  
**Deferred Maintenance:** \$39,567  
**Ext. Gross Area:** 6,720

**Building Code:** T7940090670  
**Building Name:** FERGUS FALLS - BRINE BUILDING  
**Facility Condition Index:** 0.05 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1205 East Douglas Avenue  
**City Code:** FERGUS FALLS

**Current Replacement Value:** \$25,831  
**Deferred Maintenance:** \$1,414  
**Ext. Gross Area:** 0

**Site: T794A90616 - Detroit Lakes**

**Building Code:** T7940020614  
**Building Name:** DETROIT LAKES - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1000 West TH 10  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$1,040,967  
**Deferred Maintenance:** \$72,182  
**Ext. Gross Area:** 14,120

**Building Code:** T7940090616  
**Building Name:** DETROIT LAKES - DISTRICT HEADQUARTER  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1000 West TH 10  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$40,210,117  
**Deferred Maintenance:** \$4,498,181  
**Ext. Gross Area:** 144,828

**Building Code:** T7940090627  
**Building Name:** DETROIT LAKES - MISC STORAGE  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1000 West TH 10  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$1,092,344  
**Deferred Maintenance:** \$201,365  
**Ext. Gross Area:** 7,508

**Building Code:** T7940090651  
**Building Name:** DETROIT LAKES - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1000 West TH 10  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$691,659  
**Deferred Maintenance:** \$47,939  
**Ext. Gross Area:** 7,200

**Building Code:** T7940090656  
**Building Name:** DETROIT LAKES - EMERGENCY GENERATOR  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1000 West TH 10  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$702,407  
**Deferred Maintenance:** \$68,332  
**Ext. Gross Area:** 413

**Building Code:** T7940090661  
**Building Name:** DETROIT LAKES - HAZ MATRL BLDG  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Utility Shed  
**Address:** 1000 West TH 10  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$17,064  
**Deferred Maintenance:** \$1,706  
**Ext. Gross Area:** 720



**Site: T794A90624 - Barnesville**

**Building Code:** T7940020601  
**Building Name:** BARNESVILLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.23 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1201 Hwy 34  
**City Code:** BARNESVILLE

**Current Replacement Value:** \$229,078  
**Deferred Maintenance:** \$53,479  
**Ext. Gross Area:** 2,696

**Building Code:** T7940090624  
**Building Name:** BARNESVILLE - TRUCK STATION  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1201 Hwy 34  
**City Code:** BARNESVILLE

**Current Replacement Value:** \$1,544,322  
**Deferred Maintenance:** \$439,261  
**Ext. Gross Area:** 8,880

**Building Code:** T7940090630  
**Building Name:** BARNESVILLE - MISC STORAGE  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1201 Hwy 34  
**City Code:** BARNESVILLE

**Current Replacement Value:** \$82,630  
**Deferred Maintenance:** \$5,510  
**Ext. Gross Area:** 625

**Building Code:** T7940090644  
**Building Name:** BARNESVILLE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1201 Hwy 34  
**City Code:** BARNESVILLE

**Current Replacement Value:** \$304,089  
**Deferred Maintenance:** \$20,755  
**Ext. Gross Area:** 3,200

**Building Code:** T7940090668  
**Building Name:** BARNESVILLE - BRINE BUILDING  
**Facility Condition Index:** 0.05 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1201 Hwy 34  
**City Code:** BARNESVILLE

**Current Replacement Value:** \$26,555  
**Deferred Maintenance:** \$1,386  
**Ext. Gross Area:** 0

**Site: T794A90625 - Perham**

**Building Code:** T7940020618  
**Building Name:** PERHAM - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Fabric Structure  
**Address:** RR 3 Box 10  
**City Code:** PERHAM

**Current Replacement Value:** \$488,125  
**Deferred Maintenance:** \$9,762  
**Ext. Gross Area:** 6,375

**Building Code:** T7940090655  
**Building Name:** PERHAM - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 711 3rd Avenue SE  
**City Code:** PERHAM

**Current Replacement Value:** \$296,931  
**Deferred Maintenance:** \$18,841  
**Ext. Gross Area:** 3,200

**Site: T794A90629 - Hawley**

**Building Code:** T7940020605  
**Building Name:** HAWLEY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.31 - *Poor*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 500 US Hwy 10 East  
**City Code:** HAWLEY

**Current Replacement Value:** \$229,078  
**Deferred Maintenance:** \$69,894  
**Ext. Gross Area:** 2,696

**Building Code:** T7940090629  
**Building Name:** HAWLEY - TRUCK STATION  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 500 US Hwy 10 East  
**City Code:** HAWLEY

**Current Replacement Value:** \$700,621  
**Deferred Maintenance:** \$169,709  
**Ext. Gross Area:** 4,261

**Building Code:** T7940090654  
**Building Name:** HAWLEY - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 500 US Hwy 10 East  
**City Code:** HAWLEY

**Current Replacement Value:** \$305,256  
**Deferred Maintenance:** \$20,872  
**Ext. Gross Area:** 3,200

**Building Code:** T7940090671  
**Building Name:** HAWLEY - BRINE BUILDING  
**Facility Condition Index:** 0.05 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 500 US Hwy 10 East  
**City Code:** HAWLEY

**Current Replacement Value:** \$26,555  
**Deferred Maintenance:** \$1,386  
**Ext. Gross Area:** 0

***Site: T794A90636 - Henning***

**Building Code:** T7940020607  
**Building Name:** HENNING - SALT/SAND STORAGE  
**Facility Condition Index:** 0.15 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 100 Douglas Avenue  
**City Code:** HENNING

**Current Replacement Value:** \$254,484  
**Deferred Maintenance:** \$38,832  
**Ext. Gross Area:** 2,702

**Building Code:** T7940090631  
**Building Name:** HENNING - MISC STORAGE  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 100 Douglas Avenue  
**City Code:** HENNING

**Current Replacement Value:** \$48,687  
**Deferred Maintenance:** \$8,993  
**Ext. Gross Area:** 484

**Building Code:** T7940090636  
**Building Name:** HENNING - TRUCK STATION  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 100 Douglas Avenue  
**City Code:** HENNING

**Current Replacement Value:** \$1,010,961  
**Deferred Maintenance:** \$216,239  
**Ext. Gross Area:** 5,337

**Building Code:** T7940090653  
**Building Name:** HENNING - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 100 Douglas Avenue  
**City Code:** HENNING

**Current Replacement Value:** \$296,931  
**Deferred Maintenance:** \$20,303  
**Ext. Gross Area:** 3,200

**Building Code:** T7940090672  
**Building Name:** HENNING - BRINE BUILDING  
**Facility Condition Index:** 0.05 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 100 Douglas Avenue  
**City Code:** HENNING

**Current Replacement Value:** \$25,831  
**Deferred Maintenance:** \$1,348  
**Ext. Gross Area:** 0

***Site: T794A90640 - Mahnomen***

**Building Code:** T7940020612  
**Building Name:** MAHNOMEN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.25 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 311 East Jefferson  
**City Code:** MAHNOMEN

**Current Replacement Value:** \$635,520  
**Deferred Maintenance:** \$157,206  
**Ext. Gross Area:** 6,621

**Building Code:** T7940090640  
**Building Name:** MAHNOMEN - TRUCK STATION  
**Facility Condition Index:** 0.24 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 311 East Jefferson  
**City Code:** MAHNOMEN

**Current Replacement Value:** \$1,196,106  
**Deferred Maintenance:** \$292,751  
**Ext. Gross Area:** 6,309

**Building Code:** T7940090642  
**Building Name:** MAHNOMEN - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 311 East Jefferson  
**City Code:** MAHNOMEN

**Current Replacement Value:** \$294,016  
**Deferred Maintenance:** \$16,652  
**Ext. Gross Area:** 3,094

**Building Code:** T7940090673  
**Building Name:** MAHNOMEN - BRINE BUILDING  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 311 East Jefferson  
**City Code:** MAHNOMEN

**Current Replacement Value:** \$26,656  
**Deferred Maintenance:** \$1,614  
**Ext. Gross Area:** 0

**Site: T794A90646 - Hawley Lift Station**

**Building Code:** T7940090646  
**Building Name:** HAWLEY - LIFT STATION  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 500 Hwy 10  
**City Code:** HAWLEY

**Current Replacement Value:** \$43,311  
**Deferred Maintenance:** \$3,414  
**Ext. Gross Area:** 152

**Building Code:** T7940090650  
**Building Name:** HAWLEY - EMERGENCY GENERATOR  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 500 Hwy 10  
**City Code:** HAWLEY

**Current Replacement Value:** \$44,054  
**Deferred Maintenance:** \$5,513  
**Ext. Gross Area:** 266

**Site: T794A90647 - Moorhead Lift Station I-94**

**Building Code:** T7940090647  
**Building Name:** MOORHEAD I94&TH231 - LIFT STATION  
**Facility Condition Index:** 0.44 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** I94/TH231  
**City Code:** MOORHEAD

**Current Replacement Value:** \$91,329  
**Deferred Maintenance:** \$39,923  
**Ext. Gross Area:** 0

**Site: T794A90658 - Moorhead**

**Building Code:** T7940020617  
**Building Name:** MOORHEAD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 4150 30th Avenue South  
**City Code:** MOORHEAD

**Current Replacement Value:** \$998,426  
**Deferred Maintenance:** \$190,297  
**Ext. Gross Area:** 12,684

**Building Code:** T7940090658  
**Building Name:** MOORHEAD - TRUCK STATION JOINT USE  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 4150 30th Avenue South  
**City Code:** MOORHEAD

**Current Replacement Value:** \$16,375,355  
**Deferred Maintenance:** \$1,924,681  
**Ext. Gross Area:** 62,943

**Building Code:** T7940090659  
**Building Name:** MOORHEAD - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 4150 30th Avenue South  
**City Code:** MOORHEAD

**Current Replacement Value:** \$1,120,778  
**Deferred Maintenance:** \$183,734  
**Ext. Gross Area:** 12,013

**Building Code:** T7940090674  
**Building Name:** MOORHEAD - BRINE BUILDING  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 4150 30th Avenue South  
**City Code:** MOORHEAD

**Current Replacement Value:** \$26,555  
**Deferred Maintenance:** \$585  
**Ext. Gross Area:** 0

**Building Code:** T7940090675  
**Building Name:** MOORHEAD - EMERGENCY GEN BLDG  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 4150 30th Avenue South  
**City Code:** MOORHEAD

**Current Replacement Value:** \$355,230  
**Deferred Maintenance:** \$34,294  
**Ext. Gross Area:** 0

**Site: T794A90662 - Dilworth Bridge Wetting**

**Building Code:** T7940090662  
**Building Name:** DILWORTH ANTI-ICING BLDG  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Utility Shed  
**Address:**  
**City Code:** DILWORTH

**Current Replacement Value:** \$62,210  
**Deferred Maintenance:** \$4,871  
**Ext. Gross Area:** 168

**Site: T794A90664 - TH 10-TH 336 BRIDGE DEICE**

**Building Code:** T7940090664  
**Building Name:** TH10-TH336 ANTI-ICING  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Utility Shed  
**Address:** 22 HWY 336  
**City Code:** GLYNDON

**Current Replacement Value:** \$39,951  
**Deferred Maintenance:** \$4,905  
**Ext. Gross Area:** 168

**Site: T794A90802 - Appleton**

**Building Code:** T7945020808  
**Building Name:** APPLETON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 838 N Hering St  
**City Code:** APPLETON

**Current Replacement Value:** \$98,581  
**Deferred Maintenance:** \$20,528  
**Ext. Gross Area:** 1,037

**Building Code:** T7945020814  
**Building Name:** APPLETON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 838 N Hering St  
**City Code:** APPLETON

**Current Replacement Value:** \$204,392  
**Deferred Maintenance:** \$32,820  
**Ext. Gross Area:** 2,696

**Site: T794A90806 - Wheaton**

**Building Code:** T7945020806  
**Building Name:** WHEATON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.31 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 505 2nd Avenue South  
**City Code:** WHEATON

**Current Replacement Value:** \$155,325  
**Deferred Maintenance:** \$47,391  
**Ext. Gross Area:** 1,828

**Building Code:** T7945090806  
**Building Name:** WHEATON - TRUCK STATION  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 505 2nd Avenue South  
**City Code:** WHEATON

**Current Replacement Value:** \$841,115  
**Deferred Maintenance:** \$187,719  
**Ext. Gross Area:** 3,770

**Building Code:** T7945090814  
**Building Name:** WHEATON - MISC STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 505 2nd Avenue South  
**City Code:** WHEATON

**Current Replacement Value:** \$23,305  
**Deferred Maintenance:** \$4,072  
**Ext. Gross Area:** 0

**Building Code:** T7945090840  
**Building Name:** WHEATON - BRINE BUILDING  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 505 2nd Avenue South  
**City Code:** WHEATON

**Current Replacement Value:** \$26,555  
**Deferred Maintenance:** \$1,542  
**Ext. Gross Area:** 0

**Site: T794A90808 - Glenwood**

**Building Code:** T7945020816  
**Building Name:** GLENWOOD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 70 MN Hwy 55  
**City Code:** GLENWOOD

**Current Replacement Value:** \$747,280  
**Deferred Maintenance:** \$142,749  
**Ext. Gross Area:** 9,197

**Building Code:** T7945090808  
**Building Name:** GLENWOOD - TRUCK STATION  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 70 MN Hwy 55  
**City Code:** GLENWOOD

**Current Replacement Value:** \$1,382,407  
**Deferred Maintenance:** \$287,520  
**Ext. Gross Area:** 6,475

**Building Code:** T7945090829  
**Building Name:** GLENWOOD - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 70 MN Hwy 55  
**City Code:** GLENWOOD

**Current Replacement Value:** \$299,706  
**Deferred Maintenance:** \$20,492  
**Ext. Gross Area:** 3,200

**Site: T794A90816 - EVANSVILLE**

**Building Code:** T7945020803  
**Building Name:** EVANSVILLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.31 - [Poor](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 20874 CO Rd 82 NW  
**City Code:** EVANSVILLE

**Current Replacement Value:** \$377,324  
**Deferred Maintenance:** \$116,645  
**Ext. Gross Area:** 4,341

**Building Code:** T7945090816  
**Building Name:** EVANSVILLE - TRUCK STATION  
**Facility Condition Index:** 0.24 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 20874 CO Rd 82 NW  
**City Code:** EVANSVILLE

**Current Replacement Value:** \$1,444,505  
**Deferred Maintenance:** \$349,711  
**Ext. Gross Area:** 6,108

**Building Code:** T7945090823  
**Building Name:** EVANSVILLE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 20874 CO Rd 82 NW  
**City Code:** EVANSVILLE

**Current Replacement Value:** \$543,247  
**Deferred Maintenance:** \$37,079  
**Ext. Gross Area:** 5,877

**Building Code:** T7945090838  
**Building Name:** EVANSVILLE - BRINE BUILDING  
**Facility Condition Index:** 0.03 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 20874 CO Rd 82 NW  
**City Code:** EVANSVILLE

**Current Replacement Value:** \$16,779  
**Deferred Maintenance:** \$482  
**Ext. Gross Area:** 0

**Site: T794A90818 - Alexandria**

**Building Code:** T7945020813  
**Building Name:** ALEXANDRIA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.25 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1405 Hwy 27 W  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$660,242  
**Deferred Maintenance:** \$166,038  
**Ext. Gross Area:** 9,080

**Building Code:** T7945090818  
**Building Name:** ALEXANDRIA - TRUCK STATION  
**Facility Condition Index:** 0.24 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1405 Hwy 27 W  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$4,103,035  
**Deferred Maintenance:** \$1,000,491  
**Ext. Gross Area:** 20,278

**Building Code:** T7945090835  
**Building Name:** ALEXANDRIA-UNHEATED STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1405 Hwy 27 W  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$577,711  
**Deferred Maintenance:** \$11,554  
**Ext. Gross Area:** 5,100

**Building Code:** T7945090836  
**Building Name:** ALEXANDRIA - UNHEATED STORAGE  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1405 Hwy 27 W  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$266,725  
**Deferred Maintenance:** \$57,165  
**Ext. Gross Area:** 0

**Site: T794A90819 - Ortonville**

**Building Code:** T7945020815  
**Building Name:** ORTONVILLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - *Average*

**Building Code:** T7945090819  
**Building Name:** ORTONVILLE - TRUCK STATION  
**Facility Condition Index:** 0.23 - *Average*

**Building Code:** T7945090831  
**Building Name:** ORTONVILLE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** Ingersoll Ave TH 12  
**City Code:** Ortonville

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Ingersoll Ave TH 12  
**City Code:** Ortonville

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Ingersoll Ave TH 12  
**City Code:** Ortonville

**Current Replacement Value:** \$381,147  
**Deferred Maintenance:** \$64,009  
**Ext. Gross Area:** 3,584

**Current Replacement Value:** \$1,115,619  
**Deferred Maintenance:** \$262,078  
**Ext. Gross Area:** 4,946

**Current Replacement Value:** \$319,132  
**Deferred Maintenance:** \$21,821  
**Ext. Gross Area:** 3,200

**Site: T794A90820 - Morris**

**Building Code:** T7945020820  
**Building Name:** MORRIS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - *Average*

**Building Code:** T7945090820  
**Building Name:** MORRIS - MAINTENANCE HEADQUARTERS  
**Facility Condition Index:** 0.29 - *Average*

**Building Code:** T7945090821  
**Building Name:** MORRIS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.16 - *Average*

**Building Code:** T7945090827  
**Building Name:** MORRIS - HAZARD MATL STORAGE  
**Facility Condition Index:** 0.33 - *Poor*

**Building Code:** T7945090828  
**Building Name:** MORRIS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Building Code:** T7945090832  
**Building Name:** MORRIS - WELLNESS BLDG  
**Facility Condition Index:** 0.13 - *Good*

**Building Code:** T7945090839  
**Building Name:** MORRIS - MISC STORAGE  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Cost Model Name:** Utility Shed  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Cost Model Name:** Utility Shed  
**Address:** 610 MN Hwy 9 South  
**City Code:** MORRIS

**Current Replacement Value:** \$494,851  
**Deferred Maintenance:** \$84,649  
**Ext. Gross Area:** 6,403

**Current Replacement Value:** \$9,901,755  
**Deferred Maintenance:** \$2,853,419  
**Ext. Gross Area:** 46,727

**Current Replacement Value:** \$651,765  
**Deferred Maintenance:** \$105,575  
**Ext. Gross Area:** 5,050

**Current Replacement Value:** \$12,857  
**Deferred Maintenance:** \$4,243  
**Ext. Gross Area:** 72

**Current Replacement Value:** \$973,464  
**Deferred Maintenance:** \$72,812  
**Ext. Gross Area:** 9,408

**Current Replacement Value:** \$115,418  
**Deferred Maintenance:** \$15,174  
**Ext. Gross Area:** 816

**Current Replacement Value:** \$20,467  
**Deferred Maintenance:** \$3,705  
**Ext. Gross Area:** 0

**Site: T794A90822 - Benson**

**Building Code:** T7945020811  
**Building Name:** BENSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.26 - *Average*

**Building Code:** T7945090822  
**Building Name:** BENSON - TRUCK STATION  
**Facility Condition Index:** 0.19 - *Average*

**Building Code:** T7945090825  
**Building Name:** BENSON - POLE STORAGE BLDG  
**Facility Condition Index:** 0.14 - *Good*

**Building Code:** T7945090837  
**Building Name:** BENSON - BRINE BUILDING  
**Facility Condition Index:** 0.05 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 500 22nd Street South  
**City Code:** BENSON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 500 22nd Street South  
**City Code:** BENSON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 500 22nd Street South  
**City Code:** BENSON

**Cost Model Name:** Single-story Work Facility  
**Address:** 500 22nd Street South  
**City Code:** BENSON

**Current Replacement Value:** \$192,211  
**Deferred Maintenance:** \$50,380  
**Ext. Gross Area:** 2,696

**Current Replacement Value:** \$1,185,061  
**Deferred Maintenance:** \$220,528  
**Ext. Gross Area:** 6,195

**Current Replacement Value:** \$145,828  
**Deferred Maintenance:** \$19,921  
**Ext. Gross Area:** 1,563

**Current Replacement Value:** \$25,404  
**Deferred Maintenance:** \$1,294  
**Ext. Gross Area:** 0

***Site: T794A92054 - Red River Scale***

**Building Code:** T7940092054  
**Building Name:** RED RIVER - SCALE - WEIGH  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I94 EB 2 mi west of 34th ave.  
**City Code:** DILWORTH

**Current Replacement Value:** \$1,522,457  
**Deferred Maintenance:** \$56,284  
**Ext. Gross Area:** 6,764

***Site: T794AR015680 - Hansel Lake RA***

**Building Code:** T7940095400  
**Building Name:** HANSEL LAKE - REST AREA  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 11822 I94 WB  
**City Code:** DALTON

**Current Replacement Value:** \$215,198  
**Deferred Maintenance:** \$55,523  
**Ext. Gross Area:** 859

**Building Code:** T7940095430  
**Building Name:** HANSEL LAKE RA MISC STRG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Utility Shed  
**Address:** 11822 I94 WB  
**City Code:** DALTON

**Current Replacement Value:** \$21,169  
**Deferred Maintenance:** \$423  
**Ext. Gross Area:** 174

***Site: T794AR022180 - Lake Latoka RA***

**Building Code:** T7945095452  
**Building Name:** LAKE LATOKA - REST AREA  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I94 EB - 1 MI NW Jct 94/29  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$467,560  
**Deferred Maintenance:** \$49,997  
**Ext. Gross Area:** 1,652

**Building Code:** T7945095481  
**Building Name:** LAKE LATOKA REST AREA - MISC STRG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Utility Shed  
**Address:**  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$17,049  
**Deferred Maintenance:** \$341  
**Ext. Gross Area:** 163

***Site: T794AR051480 - Moorhead RA-TIC***



**Building Code:** T7940090648  
**Building Name:** MOORHEAD - REST AREA - LIFT STATIO  
**Facility Condition Index:** 0.11 - [Good](#)

**Building Code:** T7940095402  
**Building Name:** MOORHEAD - REST AREA - TIC  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2951 11 1/2 ST SOUTH  
**City Code:** MOORHEAD

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2951 11 1/2 ST SOUTH  
**City Code:** MOORHEAD

**Current Replacement Value:** \$71,911  
**Deferred Maintenance:** \$8,095  
**Ext. Gross Area:** 520

**Current Replacement Value:** \$1,274,685  
**Deferred Maintenance:** \$101,054  
**Ext. Gross Area:** 4,031

**Site: T794AR085607 - Frazee RA**

**Building Code:** T7940095411  
**Building Name:** FRAZEE - REST AREA  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US 10, MP 55.25  
**City Code:** FRAZEE

**Current Replacement Value:** \$633,924  
**Deferred Maintenance:** \$47,602  
**Ext. Gross Area:** 2,067

**Site: T794AR152180 - BURGEN LAKE REST AREA**

**Building Code:** T7945095450  
**Building Name:** BURGEN LAKE - REST AREA  
**Facility Condition Index:** 0.26 - [Average](#)

**Building Code:** T7945095480  
**Building Name:** BURGEN LAKE - MISC STRG OLD  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Building Code:** T7945095482  
**Building Name:** BURGEN LAKE - MISC STRG NEW  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-94 WB - 2 MI SW Alex  
**City Code:** ALEXANDRIA

**Cost Model Name:** Utility Shed  
**Address:** I-94 WB - 2 MI SW Alex  
**City Code:** ALEXANDRIA

**Cost Model Name:** Utility Shed  
**Address:** I-94 WB - 2 MI SW Alex  
**City Code:** ALEXANDRIA

**Current Replacement Value:** \$230,202  
**Deferred Maintenance:** \$58,986  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$17,049  
**Deferred Maintenance:** \$341  
**Ext. Gross Area:** 163

**Current Replacement Value:** \$27,103  
**Deferred Maintenance:** \$6,251  
**Ext. Gross Area:** 0

**Site: T794AR535620 - Otter Tail Lake RA**

**Building Code:** T7940095420  
**Building Name:** OTTER TAIL LAKE - REST AREA  
**Facility Condition Index:** 0.12 - [Good](#)

**Building Code:** T7940095431  
**Building Name:** OTTER TAIL LAKE - MISC STORAGE  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Vault Toilet  
**Address:** TH78  
**City Code:** BATTLE LAKE

**Cost Model Name:** Utility Shed  
**Address:** TH 78  
**City Code:** BATTLE LAKE

**Current Replacement Value:** \$130,331  
**Deferred Maintenance:** \$15,076  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$15,936  
**Deferred Maintenance:** \$2,496  
**Ext. Gross Area:** 0

**Site: T794AR540304 - Sauer's Lake RA**

**Building Code:** T7940095421  
**Building Name:** SAUER'S LAKE - REST AREA  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Vault Toilet  
**Address:** TH59  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$130,940  
**Deferred Maintenance:** \$14,550  
**Ext. Gross Area:** 154

**Building Code:** T7940095433  
**Building Name:** SAUERS LAKE - MISC STORAGE  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** TH59  
**City Code:** DETROIT LAKES

**Current Replacement Value:** \$15,936  
**Deferred Maintenance:** \$2,496  
**Ext. Gross Area:** 0

***Site: T795C91194 - Roseville - Watersedge***

**Building Code:** T7990091194  
**Building Name:** ROSEVILLE - WATERSEDGE - DIVISION  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Mid-rise Office Building, 5 to 10 story  
**Address:** 1500 County Rd B2 W  
**City Code:** ROSEVILLE

**Current Replacement Value:** \$27,487,556  
**Deferred Maintenance:** \$4,357,304  
**Ext. Gross Area:** 162,759

**Building Code:** T7990091195  
**Building Name:** ROSEVILLE - WATERSEDGE - TRAFFIC M  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Mid-rise Office Building, 5 to 10 story  
**Address:** 1500 County Rd B2 W  
**City Code:** ROSEVILLE

**Current Replacement Value:** \$11,558,111  
**Deferred Maintenance:** \$946,533  
**Ext. Gross Area:** 56,223

**Building Code:** T7990091196  
**Building Name:** ROSEVILLE - EMERG GEN BLDG  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1500 County Rd B2 W  
**City Code:** ROSEVILLE

**Current Replacement Value:** \$324,304  
**Deferred Maintenance:** \$9,434  
**Ext. Gross Area:** 840

***Site: T795E91111 - HASTINGS ANTI-ICING BLDG***

**Building Code:** T7990091111  
**Building Name:** HASTINGS HWY 61 ANTI-ICING BLDG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** HASTINGS

**Current Replacement Value:** \$149,165  
**Deferred Maintenance:** \$2,983  
**Ext. Gross Area:** 0

***Site: T795E91117 - MAPLEWOOD***

**Building Code:** T7990090918  
**Building Name:** MAPLEWOOD - MISC STRG  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Utility Shed  
**Address:** 1771 MC MENEMY  
**City Code:** MAPLEWOOD

**Current Replacement Value:** \$23,198  
**Deferred Maintenance:** \$4,028  
**Ext. Gross Area:** 0

**Building Code:** T7990090925  
**Building Name:** MAPLEWOOD - HAZARD MATL STORAGE  
**Facility Condition Index:** 0.75 - *Crisis*

**Cost Model Name:** Utility Shed  
**Address:** 1771 MC MENEMY  
**City Code:** MAPLEWOOD

**Current Replacement Value:** \$11,574  
**Deferred Maintenance:** \$8,681  
**Ext. Gross Area:** 0

**Building Code:** T7990091117  
**Building Name:** MAPLEWOOD - METRO FLEET BUILDING  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1779 McMenemy  
**City Code:** MAPLEWOOD

**Current Replacement Value:** \$3,164,044  
**Deferred Maintenance:** \$432,301  
**Ext. Gross Area:** 15,913

**Building Code:** T7990091161  
**Building Name:** MAPLEWOOD - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1779 McMenemy  
**City Code:** MAPLEWOOD

**Current Replacement Value:** \$1,096,694  
**Deferred Maintenance:** \$127,175  
**Ext. Gross Area:** 9,032

**Building Code:** T7990091182  
**Building Name:** MAPLEWOOD - BRIDGE CREW BLDG  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1771 MC MENEMY  
**City Code:** MAPLEWOOD

**Current Replacement Value:** \$4,724,016  
**Deferred Maintenance:** \$163,806  
**Ext. Gross Area:** 0

**Site: T795E91118 - ARDEN HILLS**

**Building Code:** T7990021116  
**Building Name:** ARDEN HILLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1905 W County Rd I  
**City Code:** ARDEN HILLS

**Current Replacement Value:** \$683,833  
**Deferred Maintenance:** \$69,411  
**Ext. Gross Area:** 6,513

**Building Code:** T7990091118  
**Building Name:** ARDEN HILLS - TRUCK STATION  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1905 W County Rd I  
**City Code:** ARDEN HILLS

**Current Replacement Value:** \$5,810,977  
**Deferred Maintenance:** \$1,399,821  
**Ext. Gross Area:** 27,467

**Building Code:** T7990091162  
**Building Name:** ARDEN HILLS - POLE STORAGE BLDG  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1905 W County Rd I  
**City Code:** ARDEN HILLS

**Current Replacement Value:** \$595,984  
**Deferred Maintenance:** \$82,208  
**Ext. Gross Area:** 6,779

**Building Code:** T7990091181  
**Building Name:** ARDEN HILLS-Brine Building  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 1905 W. COUNTY RD. I  
**City Code:** ARDEN HILLS

**Current Replacement Value:** \$217,218  
**Deferred Maintenance:** \$4,344  
**Ext. Gross Area:** 1,581

**Site: T795E91138 - OAKDALE**

**Building Code:** T7990021124  
**Building Name:** OAKDALE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Fabric Structure  
**Address:** 3485 Hadley Avenue North  
**City Code:** OAKDALE

**Current Replacement Value:** \$1,531,931  
**Deferred Maintenance:** \$30,639  
**Ext. Gross Area:** 21,600

**Building Code:** T7990091119  
**Building Name:** OAKDALE - CVRD STRG BINS  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3485 Hadley Avenue North  
**City Code:** OAKDALE

**Current Replacement Value:** \$307,687  
**Deferred Maintenance:** \$6,154  
**Ext. Gross Area:** 0

**Building Code:** T7990091138  
**Building Name:** OAKDALE - DISTRICT HEADQUARTERS  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 3485 Hadley Avenue North  
**City Code:** OAKDALE

**Current Replacement Value:** \$28,526,236  
**Deferred Maintenance:** \$5,586,059  
**Ext. Gross Area:** 150,918

**Building Code:** T7990091150  
**Building Name:** OAKDALE - HAZ MAT STRG  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 3485 Hadley Avenue North  
**City Code:** OAKDALE

**Current Replacement Value:** \$13,241  
**Deferred Maintenance:** \$9,931  
**Ext. Gross Area:** 0

**Building Code:** T7990091155  
**Building Name:** OAKDALE - SIGN SHOP  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3485 Hadley Avenue North  
**City Code:** OAKDALE

**Current Replacement Value:** \$4,365,989  
**Deferred Maintenance:** \$499,408  
**Ext. Gross Area:** 26,528

**Building Code:** T7990091166  
**Building Name:** OAKDALE - EQUIP STORAGE  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3485 Hadley Avenue North  
**City Code:** OAKDALE

**Current Replacement Value:** \$2,646,702  
**Deferred Maintenance:** \$411,031  
**Ext. Gross Area:** 24,036

**Building Code:** T7990091180  
**Building Name:** OAKDALE - UNHEATED STORAGE  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3485 HADLEY AVE NO  
**City Code:** OAKDALE

**Current Replacement Value:** \$1,722,224  
**Deferred Maintenance:** \$34,444  
**Ext. Gross Area:** 7,033

**Site: T795E91139 - Forest Lake**

**Building Code:** T7990021120  
**Building Name:** FOREST LAKE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 22010 Everton Avenue North  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$851,073  
**Deferred Maintenance:** \$175,651  
**Ext. Gross Area:** 0

**Building Code:** T7990091139  
**Building Name:** FOREST LAKE - TRUCK STATION  
**Facility Condition Index:** 0.15 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 22010 Everton Avenue North  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$2,520,765  
**Deferred Maintenance:** \$374,274  
**Ext. Gross Area:** 10,912

**Building Code:** T7990091142  
**Building Name:** FOREST LAKE - EQUIP STORAGE  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 22010 Everton Avenue North  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$1,419,732  
**Deferred Maintenance:** \$155,636  
**Ext. Gross Area:** 8,640

**Building Code:** T7990091154  
**Building Name:** FOREST LAKE - MISC STORAGE  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 22010 Everton Avenue North  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$177,440  
**Deferred Maintenance:** \$15,019  
**Ext. Gross Area:** 0

**Building Code:** T7990091163  
**Building Name:** FOREST LAKE - BRIDGE CREW - EQUIP  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 22010 Everton Avenue North  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$1,316,238  
**Deferred Maintenance:** \$155,418  
**Ext. Gross Area:** 7,680

**Building Code:** T7990091177  
**Building Name:** FOREST LAKE - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 22010 Everton Avenue North  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$469,275  
**Deferred Maintenance:** \$26,405  
**Ext. Gross Area:** 0

**Site: T795E91140 - North Branch**

**Building Code:** T7990021125  
**Building Name:** NORTH BRANCH-SAND/SALT STORAGE  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Fabric Structure  
**Address:** 4841 Saint Croix Trail  
**City Code:** NORTH BRANCH

**Current Replacement Value:** \$1,116,342  
**Deferred Maintenance:** \$22,327  
**Ext. Gross Area:** 10,000

**Building Code:** T7990091140  
**Building Name:** NORTH BRANCH - TRUCK STATION  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4841 Saint Croix Trail  
**City Code:** NORTH BRANCH

**Current Replacement Value:** \$2,936,424  
**Deferred Maintenance:** \$625,260  
**Ext. Gross Area:** 17,931

**Building Code:** T7990091158  
**Building Name:** NORTH BRANCH - MISC STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** T7990091171  
**Building Name:** NORTH BRANCH - Fuel systems bldg  
**Facility Condition Index:** 0.18 - [Average](#)

**Building Code:** T7990091175  
**Building Name:** NORTH BRANCH - UNHEATED STORAGE BLD  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 4841 Saint Croix Trail  
**City Code:** NORTH BRANCH

**Cost Model Name:** Single-story Work Facility  
**Address:** 4841 Saint Croix Trail  
**City Code:** NORTH BRANCH

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4841 Saint Croix Trail  
**City Code:** NORTH BRANCH

**Current Replacement Value:** \$88,874  
**Deferred Maintenance:** \$5,920  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$9,493  
**Deferred Maintenance:** \$1,746  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$247,395  
**Deferred Maintenance:** \$14,581  
**Ext. Gross Area:** 2,531

**Site: T795E91141 - Lakeville**

**Building Code:** T7990021119  
**Building Name:** LAKEVILLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - [Average](#)

**Building Code:** T7990091141  
**Building Name:** LAKEVILLE - TRUCK STATION  
**Facility Condition Index:** 0.09 - [Good](#)

**Building Code:** T7990091164  
**Building Name:** LAKEVILLE - UNHEATED STG  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 16780 Kenrick Avenue  
**City Code:** LAKEVILLE

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 16780 Kenrick Avenue  
**City Code:** LAKEVILLE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 16780 Kenrick Avenue  
**City Code:** LAKEVILLE

**Current Replacement Value:** \$907,494  
**Deferred Maintenance:** \$173,944  
**Ext. Gross Area:** 9,596

**Current Replacement Value:** \$5,203,957  
**Deferred Maintenance:** \$467,464  
**Ext. Gross Area:** 28,432

**Current Replacement Value:** \$265,405  
**Deferred Maintenance:** \$37,871  
**Ext. Gross Area:** 2,560

**Site: T795E91152 - Mendota Heights**

**Building Code:** T7990021118  
**Building Name:** MENDOTA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.27 - [Average](#)

**Building Code:** T7990091152  
**Building Name:** MENDOTA HEIGHTS - TRUCK STATION  
**Facility Condition Index:** 0.13 - [Good](#)

**Building Code:** T7990091167  
**Building Name:** MENDOTA HEIGHTS - UNHEATED STG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2229 Pilot Knob Road  
**City Code:** MENDOTA HEIGHTS

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2229 Pilot Knob Road  
**City Code:** MENDOTA HEIGHTS

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2229 Pilot Knob Road  
**City Code:** MENDOTA HEIGHTS

**Current Replacement Value:** \$1,274,511  
**Deferred Maintenance:** \$343,225  
**Ext. Gross Area:** 13,160

**Current Replacement Value:** \$8,838,606  
**Deferred Maintenance:** \$1,182,155  
**Ext. Gross Area:** 44,573

**Current Replacement Value:** \$850,652  
**Deferred Maintenance:** \$61,763  
**Ext. Gross Area:** 8,529

**Site: T795E91153 - Hastings**

**Building Code:** T7990021121  
**Building Name:** HASTINGS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 951 E. 21st Street  
**City Code:** HASTINGS

**Current Replacement Value:** \$773,615  
**Deferred Maintenance:** \$147,449  
**Ext. Gross Area:** 10,800

**Building Code:** T7990091153  
**Building Name:** HASTINGS - TRUCK STATION  
**Facility Condition Index:** 0.15 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 951 E. 21st Street  
**City Code:** HASTINGS

**Current Replacement Value:** \$7,469,741  
**Deferred Maintenance:** \$1,086,771  
**Ext. Gross Area:** 32,693

**Building Code:** T7990091174  
**Building Name:** HASTINGS - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** HASTINGS

**Current Replacement Value:** \$165,407  
**Deferred Maintenance:** \$5,882  
**Ext. Gross Area:** 1,813

***Site: T795E91159 - Inver Grove Heights***

**Building Code:** T7990091159  
**Building Name:** INVER GROVE HEIGHTS - MISC STORAGE  
**Facility Condition Index:** 0.50 - *Poor*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Near Jct TH 52 and TH55  
**City Code:** INVER GROVE HEIG

**Current Replacement Value:** \$673,470  
**Deferred Maintenance:** \$336,036  
**Ext. Gross Area:** 0

***Site: T795E91165 - St Paul - Maryland Ave***

**Building Code:** T7990021117  
**Building Name:** ST PAUL - MARYLAND AVE - SALT/SAND  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 244 East Maryland Avenue  
**City Code:** ST. PAUL

**Current Replacement Value:** \$1,328,158  
**Deferred Maintenance:** \$439,571  
**Ext. Gross Area:** 14,193

**Building Code:** T7990090919  
**Building Name:** ST PAUL - MARYLAND AVE - POLE STG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 244 East Maryland Avenue  
**City Code:** ST. PAUL

**Current Replacement Value:** \$370,947  
**Deferred Maintenance:** \$27,453  
**Ext. Gross Area:** 3,910

**Building Code:** T7990091165  
**Building Name:** ST PAUL - MARYLAND AVE - TRUCK STA  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 244 East Maryland Avenue  
**City Code:** ST. PAUL

**Current Replacement Value:** \$11,887,001  
**Deferred Maintenance:** \$2,193,626  
**Ext. Gross Area:** 67,435

**Building Code:** T7990091168  
**Building Name:** ST PAUL - MARYLAND AVE - POLE STG  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 244 East Maryland Avenue  
**City Code:** ST. PAUL

**Current Replacement Value:** \$470,009  
**Deferred Maintenance:** \$36,939  
**Ext. Gross Area:** 5,120

**Building Code:** T7990091170  
**Building Name:** ST PAUL - MARYLAND - HAZ MATL STRG  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 244 East Maryland Avenue  
**City Code:** ST. PAUL

**Current Replacement Value:** \$13,241  
**Deferred Maintenance:** \$4,370  
**Ext. Gross Area:** 0

***Site: T795E91178 - MENDOTA 35E ANTI-ICING***

**Building Code:** T7990091178  
**Building Name:** MENDOTA - 35E ANTI-ICING BLDG  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** I35E And TH13  
**City Code:** MENDOTA

**Current Replacement Value:** \$68,766  
**Deferred Maintenance:** \$4,674  
**Ext. Gross Area:** 0

**Site: T795E91179 - Taylors Falls - City Site**

**Building Code:** T7990021123  
**Building Name:** TAYLORS FALLS - city site - SALT/SA  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 776 1ST STREET  
**City Code:** Taylors Falls

**Current Replacement Value:** \$194,077  
**Deferred Maintenance:** \$3,882  
**Ext. Gross Area:** 3,525

**Building Code:** T7990091179  
**Building Name:** TAYLORS FALLS - city site - TRUCK S  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 776 1ST STREET  
**City Code:** Taylors Falls

**Current Replacement Value:** \$284,742  
**Deferred Maintenance:** \$12,888  
**Ext. Gross Area:** 0

**Site: T795E91183 - LAFAYETTE TH52 ANTI-ICING**

**Building Code:** T7990091183  
**Building Name:** LAFAYETTE TH52 BRIDGE ANTI-ICING  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 344 HWY 52  
**City Code:** UNASSIGNED

**Current Replacement Value:** \$185,974  
**Deferred Maintenance:** \$3,719  
**Ext. Gross Area:** 0

**Site: T795E92129 - Saint Croix Scale**

**Building Code:** T7990092121  
**Building Name:** ST CROIX - I94 - WIM BUILDING  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 15800 Hudson Blvd  
**City Code:** WEST LAKELAND TW

**Current Replacement Value:** \$12,289  
**Deferred Maintenance:** \$1,076  
**Ext. Gross Area:** 0

**Building Code:** T7990092129  
**Building Name:** ST CROIX - I94 - WEIGH SCALE BLDG  
**Facility Condition Index:** 0.12 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 15800 Hudson Blvd  
**City Code:** WEST LAKELAND TW

**Current Replacement Value:** \$1,702,627  
**Deferred Maintenance:** \$197,125  
**Ext. Gross Area:** 5,478

**Building Code:** T7990092144  
**Building Name:** St Croix Scale Garage  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 15800 Hudson Blvd  
**City Code:** WEST LAKELAND TW

**Current Replacement Value:** \$54,046  
**Deferred Maintenance:** \$1,081  
**Ext. Gross Area:** 0

**Site: T795ER198280 - Forest Lake RA**

**Building Code:** T7990095900  
**Building Name:** Forest Lake - Rest Area  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 SB - 1 MI SO OF FOREST LAKE  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$594,589  
**Deferred Maintenance:** \$213,171  
**Ext. Gross Area:** 1,871

**Building Code:** T7990095933  
**Building Name:** Forest lake RA- Misc Strg  
**Facility Condition Index:** 0.40 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:**  
**City Code:** FOREST LAKE

**Current Replacement Value:** \$41,779  
**Deferred Maintenance:** \$16,590  
**Ext. Gross Area:** 261



**Site: T795ER708203 - Saint Croix RA-TIC**

**Building Code:** T7990095903  
**Building Name:** Saint Croix - Rest Area - TIC  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 15800 Hudson Blvd  
**City Code:** WEST LAKELAND TW

**Current Replacement Value:** \$1,534,146  
**Deferred Maintenance:** \$492,144  
**Ext. Gross Area:** 4,981

**Building Code:** T7990095931  
**Building Name:** Saint Croix - Rest Area - Misc Stg  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** PO BOX 305  
**City Code:** WEST LAKELAND TW

**Current Replacement Value:** \$70,228  
**Deferred Maintenance:** \$21,224  
**Ext. Gross Area:** 650

**Site: T795W21115 - Hampton**

**Building Code:** T7990021115  
**Building Name:** HAMPTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH56 at JCT 52 And 50  
**City Code:** HAMPTON

**Current Replacement Value:** \$209,816  
**Deferred Maintenance:** \$16,579  
**Ext. Gross Area:** 2,360

**Site: T795W90902 - MAPLE GROVE I94**

**Building Code:** T7990090902  
**Building Name:** MAPLE GROVE - MISC STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$33,844  
**Deferred Maintenance:** \$677  
**Ext. Gross Area:** 0

**Site: T795W90910 - CEDAR AVENUE**

**Building Code:** T7990020921  
**Building Name:** CEDAR AVENUE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.05 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1900 East 66th Street  
**City Code:** Richfield

**Current Replacement Value:** \$2,401,902  
**Deferred Maintenance:** \$115,340  
**Ext. Gross Area:** 27,197

**Building Code:** T7990090904  
**Building Name:** CEDAR AVENUE - HAZ MATERIAL STRG  
**Facility Condition Index:** 0.75 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 1900 East 66th Street  
**City Code:** Richfield

**Current Replacement Value:** \$11,905  
**Deferred Maintenance:** \$8,929  
**Ext. Gross Area:** 0

**Building Code:** T7990090906  
**Building Name:** CEDAR AVENUE - FIRST BUILDING  
**Facility Condition Index:** 0.24 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1900 East 66th Street  
**City Code:** Richfield

**Current Replacement Value:** \$2,084,560  
**Deferred Maintenance:** \$500,400  
**Ext. Gross Area:** 12,680

**Building Code:** T7990090910  
**Building Name:** CEDAR AVENUE - TRUCK STATION  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1900 East 66th Street  
**City Code:** Richfield

**Current Replacement Value:** \$18,815,868  
**Deferred Maintenance:** \$2,530,734  
**Ext. Gross Area:** 77,943

**Building Code:** T7990090917  
**Building Name:** CEDAR AVENUE - POLE STORAGE  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1900 East 66th Street  
**City Code:** RICHFIELD

**Current Replacement Value:** \$902,313  
**Deferred Maintenance:** \$30,618  
**Ext. Gross Area:** 9,120

**Site: T795W90920 - Mpls Lowery Hill Tunnel**

**Building Code:** T7990090920  
**Building Name:** MPLS - LOWERY HILL TUNNEL - SERVICE  
**Facility Condition Index:** 0.32 - **Poor**

**Cost Model Name:** Single-story Work Facility  
**Address:** HENNEPIN AVE AT DOUGLAS AVE  
**City Code:** MINNEAPOLIS

**Current Replacement Value:** \$5,312,536  
**Deferred Maintenance:** \$1,699,873  
**Ext. Gross Area:** 0

**Site: T795W90926 - CHASKA TRUCK STATION**

**Building Code:** T7990020924  
**Building Name:** CHASKA SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Fabric Structure  
**Address:** 4725 Chaska Blvd  
**City Code:** CHASKA

**Current Replacement Value:** \$997,919  
**Deferred Maintenance:** \$19,958  
**Ext. Gross Area:** 11,200

**Building Code:** T7990090926  
**Building Name:** CHASKA TRUCK STATION  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 4725 Chaska Blvd  
**City Code:** CHASKA

**Current Replacement Value:** \$10,502,461  
**Deferred Maintenance:** \$210,049  
**Ext. Gross Area:** 50,834

**Building Code:** T7990090927  
**Building Name:** CHASKA BRINE BUILDING  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** UNASSIGNED

**Current Replacement Value:** \$217,001  
**Deferred Maintenance:** \$4,340  
**Ext. Gross Area:** 1,581

**Building Code:** T7990090951  
**Building Name:** CHASKA UNHEATED STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 4725 Chaska Blvd  
**City Code:** CHASKA

**Current Replacement Value:** \$752,469  
**Deferred Maintenance:** \$15,049  
**Ext. Gross Area:** 7,620

**Site: T795W90929 - Shakopee**

**Building Code:** T7990020915  
**Building Name:** SHAKOPEE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 12550 Chestnut Boulevard  
**City Code:** SHAKOPEE

**Current Replacement Value:** \$513,039  
**Deferred Maintenance:** \$191,021  
**Ext. Gross Area:** 0

**Building Code:** T7990090929  
**Building Name:** SHAKOPEE - TRUCK STATION  
**Facility Condition Index:** 0.28 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 12550 Chestnut Boulevard  
**City Code:** SHAKOPEE

**Current Replacement Value:** \$2,464,710  
**Deferred Maintenance:** \$686,342  
**Ext. Gross Area:** 16,046

**Building Code:** T7990090999  
**Building Name:** SHAKOPEE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 12550 Chestnut Boulevard  
**City Code:** SHAKOPEE

**Current Replacement Value:** \$549,416  
**Deferred Maintenance:** \$95,763  
**Ext. Gross Area:** 0

**Site: T795W90930 - Camden**

**Building Code:** T7990020912  
**Building Name:** CAMDEN - SALT/SAND S  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 3636 Washington Avenue North  
**City Code:** MINNEAPOLIS

**Current Replacement Value:** \$478,907  
**Deferred Maintenance:** \$47,898  
**Ext. Gross Area:** 6,403

**Building Code:** T7990090930  
**Building Name:** CAMDEN - TRUCK STATION  
**Facility Condition Index:** 0.15 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3636 Washington Avenue North  
**City Code:** MINNEAPOLIS

**Current Replacement Value:** \$4,188,663  
**Deferred Maintenance:** \$618,632  
**Ext. Gross Area:** 25,060

***Site: T795W90931 - Golden Valley***

**Building Code:** T7990020919  
**Building Name:** GOLDEN VALLEY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2055 North Lilac Drive  
**City Code:** GOLDEN VALLEY

**Current Replacement Value:** \$804,235  
**Deferred Maintenance:** \$167,370  
**Ext. Gross Area:** 9,007

**Building Code:** T7990090931  
**Building Name:** GOLDEN VALLEY - DISTRICT HEADQUARTE  
**Facility Condition Index:** 0.17 - [Average](#)

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 2055 North Lilac Drive  
**City Code:** GOLDEN VALLEY

**Current Replacement Value:** \$28,981,028  
**Deferred Maintenance:** \$4,948,845  
**Ext. Gross Area:** 121,542

**Building Code:** T7990090938  
**Building Name:** GOLDEN VALLEY - PATROL - MISCELLANIO  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 2055 North Lilac Drive  
**City Code:** GOLDEN VALLEY

**Current Replacement Value:** \$1,191,658  
**Deferred Maintenance:** \$211,925  
**Ext. Gross Area:** 5,333

**Building Code:** T7990090939  
**Building Name:** GOLDEN VALLEY - FUEL STATION - MISC  
**Facility Condition Index:** 0.05 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2055 North Lilac Drive  
**City Code:** GOLDEN VALLEY

**Current Replacement Value:** \$28,264  
**Deferred Maintenance:** \$1,396  
**Ext. Gross Area:** 0

**Building Code:** T7990090991  
**Building Name:** GOLDEN VALLEY - POLE STORAGE BLDG  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2055 North Lilac Drive  
**City Code:** GOLDEN VALLEY

**Current Replacement Value:** \$1,952,350  
**Deferred Maintenance:** \$162,178  
**Ext. Gross Area:** 16,870

***Site: T795W90940 - ANOKA***

**Building Code:** T7990020923  
**Building Name:** ANOKA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Fabric Structure  
**Address:** 3601 - 7TH AVE. N.  
**City Code:** ANOKA

**Current Replacement Value:** \$660,574  
**Deferred Maintenance:** \$13,211  
**Ext. Gross Area:** 9,231

**Building Code:** T7990090940  
**Building Name:** ANOKA - TRUCK STATION  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3601 7th Avenue North  
**City Code:** ANOKA

**Current Replacement Value:** \$2,551,464  
**Deferred Maintenance:** \$465,797  
**Ext. Gross Area:** 12,868

**Building Code:** T7990090997  
**Building Name:** ANOKA - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.03 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3601 7th Avenue North  
**City Code:** ANOKA

**Current Replacement Value:** \$431,197  
**Deferred Maintenance:** \$11,870  
**Ext. Gross Area:** 4,664

***Site: T795W90944 - TH 169/I-494 ANTI-ICING***

**Building Code:** T7990090944  
**Building Name:** TH 169/I-494 ANTI-ICING BLDG  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 8620 WEST 78TH STREET  
**City Code:** BLOOMINGTON

**Current Replacement Value:** \$166,212  
**Deferred Maintenance:** \$3,324  
**Ext. Gross Area:** 0

**Site: T795W90963 - Plymouth**

**Building Code:** T7990020920  
**Building Name:** PLYMOUTH - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 2315 Fernbrook Lane  
**City Code:** Plymouth

**Current Replacement Value:** \$1,222,664  
**Deferred Maintenance:** \$233,037  
**Ext. Gross Area:** 17,086

**Building Code:** T7990090913  
**Building Name:** PLYMOUTH - POLE STORAGE BLDG  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2315 Fernbrook Lane  
**City Code:** Plymouth

**Current Replacement Value:** \$793,498  
**Deferred Maintenance:** \$31,553  
**Ext. Gross Area:** 8,092

**Building Code:** T7990090941  
**Building Name:** PLYMOUTH - TRUCK STATION(NEW)  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2315 Fernbrook Lane  
**City Code:** PLYMOUTH

**Current Replacement Value:** \$10,416,590  
**Deferred Maintenance:** \$208,332  
**Ext. Gross Area:** 0

**Building Code:** T7990090963  
**Building Name:** PLYMOUTH - TRUCK STATION  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2315 Fernbrook Lane  
**City Code:** Plymouth

**Current Replacement Value:** \$4,834,774  
**Deferred Maintenance:** \$1,066,554  
**Ext. Gross Area:** 27,743

**Building Code:** T7990090989  
**Building Name:** PLYMOUTH - MISC STORAGE  
**Facility Condition Index:** 0.53 - **Crisis**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2315 Fernbrook Lane  
**City Code:** Plymouth

**Current Replacement Value:** \$196,475  
**Deferred Maintenance:** \$103,724  
**Ext. Gross Area:** 0

**Site: T795W90979 - Spring Lake Park**

**Building Code:** T7990020917  
**Building Name:** SPRING LAKE PARK - SALT/SAND STORAG  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1530 County Hwy 10  
**City Code:** SPRING LAKE PARK

**Current Replacement Value:** \$1,440,914  
**Deferred Maintenance:** \$165,697  
**Ext. Gross Area:** 9,984

**Building Code:** T7990090979  
**Building Name:** SPRING LAKE PARK - TRUCK STATION  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1530 County Hwy 10  
**City Code:** SPRING LAKE PARK

**Current Replacement Value:** \$6,527,568  
**Deferred Maintenance:** \$1,189,185  
**Ext. Gross Area:** 39,317

**Site: T795W90986 - Eden Prairie**

**Building Code:** T7990020922  
**Building Name:** EDEN PRAIRIE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 7333 Bryant Lake Drive  
**City Code:** EDEN PRAIRIE

**Current Replacement Value:** \$715,523  
**Deferred Maintenance:** \$139,098  
**Ext. Gross Area:** 9,999

**Building Code:** T7990090903  
**Building Name:** EDEN PRAIRIE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7333 Bryant Lake Drive  
**City Code:** EDEN PRAIRIE

**Current Replacement Value:** \$768,354  
**Deferred Maintenance:** \$54,637  
**Ext. Gross Area:** 8,094

**Building Code:** T7990090986  
**Building Name:** EDEN PRAIRIE - TRUCK STATION  
**Facility Condition Index:** 0.17 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 7333 Bryant Lake Drive  
**City Code:** EDEN PRAIRIE

**Current Replacement Value:** \$6,321,196  
**Deferred Maintenance:** \$1,102,664  
**Ext. Gross Area:** 27,593

**Site: T795W90987 - Maple Grove(old site)**

**Building Code:** T7990090928  
**Building Name:** MAPLE GROVE-Unheated Storage  
**Facility Condition Index:** 0.26 - [Average](#)

**Cost Model Name:** Fabric Structure  
**Address:** 10900 77th Avenue North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$511,179  
**Deferred Maintenance:** \$131,930  
**Ext. Gross Area:** 0

**Building Code:** T7990090987  
**Building Name:** MAPLE GROVE - TRUCK STATION OLD  
**Facility Condition Index:** 0.21 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 10900 77th Avenue North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$3,185,961  
**Deferred Maintenance:** \$655,712  
**Ext. Gross Area:** 17,707

**Site: T795W90988 - Bloomington/Penn Lift Station**

**Building Code:** T7990090988  
**Building Name:** BLOOMINGTON/PENN - LIFT STATION  
**Facility Condition Index:** 0.15 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I-494 and Penn Avenue  
**City Code:** BLOOMINGTON

**Current Replacement Value:** \$40,854  
**Deferred Maintenance:** \$5,953  
**Ext. Gross Area:** 226

**Site: T795W90992 - MAPLE GROVE (NEW SITE)**

**Building Code:** T7990020925  
**Building Name:** MAPLE GROVE SAND/SALT STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Fabric Structure  
**Address:** 9501 Hemlock Lane North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$858,713  
**Deferred Maintenance:** \$17,174  
**Ext. Gross Area:** 12,000

**Building Code:** T7990090947  
**Building Name:** MAPLE GROVE UNHEATED STRG #1  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 9501 Hemlock Lane North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$755,572  
**Deferred Maintenance:** \$15,111  
**Ext. Gross Area:** 7,620

**Building Code:** T7990090948  
**Building Name:** MAPLE GROVE UNHEATED STRG #2  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 9501 Hemlock Lane North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$743,132  
**Deferred Maintenance:** \$14,863  
**Ext. Gross Area:** 7,620

**Building Code:** T7990090949  
**Building Name:** MAPLE GROVE BRINE BLDG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 9501 Hemlock Lane North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$217,001  
**Deferred Maintenance:** \$4,340  
**Ext. Gross Area:** 1,580

**Building Code:** T7990090992  
**Building Name:** MAPLE GROVE - TRUCK STATION SUB-ARE  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 9501 Hemlock Lane North  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$24,539,129  
**Deferred Maintenance:** \$810,545  
**Ext. Gross Area:** 105,799

***Site: T795W91148 - Dakota County***

**Building Code:** T7990091176  
**Building Name:** DAKOTA COUNTY - LOADER STORAGE BLDG  
**Facility Condition Index:** 0.04 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** HWY 50/61  
**City Code:** MIESVILLE

**Current Replacement Value:** \$58,483  
**Deferred Maintenance:** \$2,048  
**Ext. Gross Area:** 0

***Site: T795W92001 - Daytonport***

**Building Code:** T7990092139  
**Building Name:** DAYTONPORT - WEIGH SCALE BLDG  
**Facility Condition Index:** 0.21 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US 10 - 6 MI NW OF ANOKA  
**City Code:** ELK RIVER

**Current Replacement Value:** \$271,008  
**Deferred Maintenance:** \$55,997  
**Ext. Gross Area:** 659

***Site: T795WR090202 - Daytonport RA***

**Building Code:** T7990095511  
**Building Name:** DAYTONPORT - REST AREA  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US 10  
**City Code:** RAMSEY

**Current Replacement Value:** \$501,365  
**Deferred Maintenance:** \$48,340  
**Ext. Gross Area:** 1,831

***Site: T795WR201380 - Goose Creek RA***

**Building Code:** T7990095901  
**Building Name:** Goose Creek - Rest Area  
**Facility Condition Index:** 0.35 - **Poor**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 NB - 1.5 MI N of Harris  
**City Code:** HARRIS

**Current Replacement Value:** \$380,276  
**Deferred Maintenance:** \$134,262  
**Ext. Gross Area:** 1,267

***Site: T795WR232780 - Elm Creek RA***

**Building Code:** T7990095500  
**Building Name:** Elm Creek - Rest Area  
**Facility Condition Index:** 0.22 - **Average**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-94 EB - 2 MI NO I-494  
**City Code:** MAPLE GROVE

**Current Replacement Value:** \$896,930  
**Deferred Maintenance:** \$196,515  
**Ext. Gross Area:** 3,191

***Site: T796A21208 - Zumbro Falls***

**Building Code:** T7960021208  
**Building Name:** ZUMBRO FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.36 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** ZUMBRO FALLS

**Current Replacement Value:** \$67,290  
**Deferred Maintenance:** \$23,935  
**Ext. Gross Area:** 898

**Building Code:** T7960091245  
**Building Name:** ZUMBRO FALLS - MISC STORAGE  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** ZUMBRO FALLS

**Current Replacement Value:** \$31,518  
**Deferred Maintenance:** \$4,123  
**Ext. Gross Area:** 395

***Site: T796A21212 - Spring Valley***

**Building Code:** T7960021230  
**Building Name:** SPRING VALLEY- SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 512 East Guzwold Street  
**City Code:** Spring Valley

**Current Replacement Value:** \$723,380  
**Deferred Maintenance:** \$59,552  
**Ext. Gross Area:** 9,542

***Site: T796A21219 - Marion***

**Building Code:** T7960021219  
**Building Name:** MARION - SALT/SAND STORAGE  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** Hwy 52 and Co. Rd 19  
**City Code:** MARION

**Current Replacement Value:** \$43,618  
**Deferred Maintenance:** \$5,495  
**Ext. Gross Area:** 644

**Building Code:** T7960091231  
**Building Name:** MARION - MISC STORAGE  
**Facility Condition Index:** 0.16 - [Average](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** Hwy 52 and Co. Rd 19  
**City Code:** MARION

**Current Replacement Value:** \$38,779  
**Deferred Maintenance:** \$6,361  
**Ext. Gross Area:** 384

***Site: T796A21225 - La Crescent***

**Building Code:** T7960021225  
**Building Name:** LA CRESENT- SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 511 Chestnut Blvd  
**City Code:** LACRESCENT

**Current Replacement Value:** \$1,142,603  
**Deferred Maintenance:** \$114,260  
**Ext. Gross Area:** 11,108

***Site: T796A21295 - Dexter Leased Site***

**Building Code:** T7960021295  
**Building Name:** DEXTER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** COUNTY SITE: OFF TH 16 NEAR I90  
**City Code:** DEXTER

**Current Replacement Value:** \$792,604  
**Deferred Maintenance:** \$78,677  
**Ext. Gross Area:** 7,560

***Site: T796A91206 - Lake City***

**Building Code:** T7960091206  
**Building Name:** LAKE CITY - EQUIP STORAGE  
**Facility Condition Index:** 0.53 - [Crisis](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2101 South Oak  
**City Code:** LAKE CITY

**Current Replacement Value:** \$231,523  
**Deferred Maintenance:** \$123,111  
**Ext. Gross Area:** 2,000

***Site: T796A91216 - Preston***



**Building Code:** T7960021226  
**Building Name:** PRESTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Fabric Structure  
**Address:** TH 52AndTH 16 South  
**City Code:** Preston

**Current Replacement Value:** \$786,973  
**Deferred Maintenance:** \$47,777  
**Ext. Gross Area:** 8,369

**Building Code:** T7960091216  
**Building Name:** PRESTON - TRUCK STATION  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** TH 52 And TH 16 South  
**City Code:** Preston

**Current Replacement Value:** \$1,175,627  
**Deferred Maintenance:** \$130,454  
**Ext. Gross Area:** 6,642

**Building Code:** T7960091274  
**Building Name:** PRESTON - UNHEATED STORAGE  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 52 And TH 16 South  
**City Code:** PRESTON

**Current Replacement Value:** \$125,508  
**Deferred Maintenance:** \$19,576  
**Ext. Gross Area:** 952

**Site: T796A91218 - WINONA**

**Building Code:** T7960021220  
**Building Name:** WINONA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 5420 Highway 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$801,090  
**Deferred Maintenance:** \$65,370  
**Ext. Gross Area:** 7,915

**Building Code:** T7960091218  
**Building Name:** WINONA - TRUCK STATION  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 5420 Highway 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$4,487,509  
**Deferred Maintenance:** \$478,155  
**Ext. Gross Area:** 20,663

**Building Code:** T7960091219  
**Building Name:** WINONA - EQUIP STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5420 Highway 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$449,066  
**Deferred Maintenance:** \$35,771  
**Ext. Gross Area:** 3,306

**Building Code:** T7960091254  
**Building Name:** WINONA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 5420 Highway 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$383,183  
**Deferred Maintenance:** \$21,113  
**Ext. Gross Area:** 3,639

**Building Code:** T7960091261  
**Building Name:** WINONA ( DUNN BLACKTOP) - EQUIP STG  
**Facility Condition Index:** 0.27 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5420 Highway 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$375,260  
**Deferred Maintenance:** \$100,898  
**Ext. Gross Area:** 2,301

**Building Code:** T7960091275  
**Building Name:** WINONA- MISC STORAGE  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5420 Highway 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$211,172  
**Deferred Maintenance:** \$6,840  
**Ext. Gross Area:** 1,995

**Site: T796A91220 - Stewartville**

**Building Code:** T7960021202  
**Building Name:** STEWARTVILLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 401 10th St NW  
**City Code:** STEWARTVILLE

**Current Replacement Value:** \$65,360  
**Deferred Maintenance:** \$21,569  
**Ext. Gross Area:** 829

**Building Code:** T7960021224  
**Building Name:** STEWARTVILLE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** T7960091220  
**Building Name:** STEWARTVILLE - TRUCK STATION  
**Facility Condition Index:** 0.13 - [Good](#)

**Building Code:** T7960091267  
**Building Name:** STEWARTVILLE - POLE STG BLDG  
**Facility Condition Index:** 0.03 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 401 10th St NW  
**City Code:** STEWARTVILLE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 401 10th St NW  
**City Code:** STEWARTVILLE

**Cost Model Name:** Single-story Work Facility  
**Address:** 401 10th St NW  
**City Code:** STEWARTVILLE

**Current Replacement Value:** \$652,696  
**Deferred Maintenance:** \$47,287  
**Ext. Gross Area:** 6,512

**Current Replacement Value:** \$2,861,007  
**Deferred Maintenance:** \$368,307  
**Ext. Gross Area:** 16,187

**Current Replacement Value:** \$684,832  
**Deferred Maintenance:** \$20,765  
**Ext. Gross Area:** 5,831

**Site: T796A91225 - ROCHESTER**

**Building Code:** T7960021235  
**Building Name:** ROCHESTER- SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Building Code:** T7960091225  
**Building Name:** ROCHESTER - DISTRICT HEADQUARTERS  
**Facility Condition Index:** 0.06 - [Good](#)

**Building Code:** T7960091256  
**Building Name:** ROCHESTER - UNHEATED STG  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Building Code:** T7960091259  
**Building Name:** ROCHESTER - UNHEATED STG  
**Facility Condition Index:** 0.14 - [Good](#)

**Building Code:** T7960091260  
**Building Name:** ROCHESTER - HAZARD MATLS  
**Facility Condition Index:** 0.75 - [Crisis](#)

**Building Code:** T7960091266  
**Building Name:** ROCHESTER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Building Code:** T7960091270  
**Building Name:** ROCHESTER-TS(multiuse)  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Building Code:** T7960091271  
**Building Name:** ROCHESTER BRINE BLDG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Fabric Structure  
**Address:** 2900 48TH STREET N.W.  
**City Code:** ROCHESTER

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 2900 48th Street NW  
**City Code:** ROCHESTER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2900 48th Street NW  
**City Code:** ROCHESTER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2900 48th Street NW  
**City Code:** ROCHESTER

**Cost Model Name:** Utility Shed  
**Address:** 2900 48th Street NW  
**City Code:** ROCHESTER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2900 48th Street NW  
**City Code:** ROCHESTER

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 2900 48TH STREET N.W.  
**City Code:** ROCHESTER

**Cost Model Name:** Single-story Work Facility  
**Address:** 2900 48th Street NW  
**City Code:** ROCHESTER

**Current Replacement Value:** \$1,220,517  
**Deferred Maintenance:** \$24,410  
**Ext. Gross Area:** 16,400

**Current Replacement Value:** \$30,019,016  
**Deferred Maintenance:** \$1,661,432  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$348,990  
**Deferred Maintenance:** \$13,197  
**Ext. Gross Area:** 3,240

**Current Replacement Value:** \$426,590  
**Deferred Maintenance:** \$60,437  
**Ext. Gross Area:** 3,840

**Current Replacement Value:** \$13,757  
**Deferred Maintenance:** \$10,318  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$876,808  
**Deferred Maintenance:** \$17,536  
**Ext. Gross Area:** 9,120

**Current Replacement Value:** \$30,378,516  
**Deferred Maintenance:** \$607,570  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$250,181  
**Deferred Maintenance:** \$5,004  
**Ext. Gross Area:** 1,581

**Building Code:** T7960091272  
**Building Name:** ROCHESTER-UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** T7960091273  
**Building Name:** ROCHESTER - CVRD STORAGE BINS  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2900 48TH STREET N.W.  
**City Code:** ROCHESTER

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2900 48TH STREET N.W.  
**City Code:** ROCHESTER

**Current Replacement Value:** \$856,147  
**Deferred Maintenance:** \$17,123  
**Ext. Gross Area:** 9,120

**Current Replacement Value:** \$394,730  
**Deferred Maintenance:** \$7,895  
**Ext. Gross Area:** 7,068

**Site: T796A91229 - Saint Charles**

**Building Code:** T7960021205  
**Building Name:** ST CHARLES - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - **Good**

**Building Code:** T7960021221  
**Building Name:** ST CHARLES - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - **Good**

**Building Code:** T7960091229  
**Building Name:** ST CHARLES - TRUCK STATION  
**Facility Condition Index:** 0.15 - **Good**

**Building Code:** T7960091257  
**Building Name:** ST CHARLES - POLE STORAGE BLDG  
**Facility Condition Index:** 0.08 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** I-90 And TH74  
**City Code:** St. Charles

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** I-90 And TH74  
**City Code:** St. Charles

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** I-90 And TH74  
**City Code:** St. Charles

**Cost Model Name:** Single-story Work Facility  
**Address:** I-90 And TH74  
**City Code:** St. Charles

**Current Replacement Value:** \$142,804  
**Deferred Maintenance:** \$11,575  
**Ext. Gross Area:** 2,010

**Current Replacement Value:** \$608,533  
**Deferred Maintenance:** \$62,666  
**Ext. Gross Area:** 10,399

**Current Replacement Value:** \$1,879,233  
**Deferred Maintenance:** \$277,134  
**Ext. Gross Area:** 11,829

**Current Replacement Value:** \$362,437  
**Deferred Maintenance:** \$28,971  
**Ext. Gross Area:** 3,200

**Site: T796A91230 - CALEDONIA**

**Building Code:** T7960021228  
**Building Name:** CALEDONIA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Building Code:** T7960091269  
**Building Name:** CALEDONIA -TRUCK STATION  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Fabric Structure  
**Address:** 174 Bisson Street  
**City Code:** CALEDONIA

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 174 BISSEN ST N  
**City Code:** CALEDONIA

**Current Replacement Value:** \$494,619  
**Deferred Maintenance:** \$11,774  
**Ext. Gross Area:** 6,403

**Current Replacement Value:** \$1,516,493  
**Deferred Maintenance:** \$34,908  
**Ext. Gross Area:** 8,845

**Site: T796A91233 - Chatfield Loading**

**Building Code:** T7960021229  
**Building Name:** CHATFIELD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 52 South Edge of Chatfield  
**City Code:** CHATFIELD

**Current Replacement Value:** \$457,893  
**Deferred Maintenance:** \$62,583  
**Ext. Gross Area:** 5,788

**Building Code:** T7960091228  
**Building Name:** CHATFIELD - MISC STORAGE  
**Facility Condition Index:** 0.42 - Poor

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 52 South edge of town  
**City Code:** CHATFIELD

**Current Replacement Value:** \$54,184  
**Deferred Maintenance:** \$22,731  
**Ext. Gross Area:** 480

**Building Code:** T7960091233  
**Building Name:** CHATFIELD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.58 - Crisis

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 52 South edge of town  
**City Code:** CHATFIELD

**Current Replacement Value:** \$29,695  
**Deferred Maintenance:** \$17,247  
**Ext. Gross Area:** 586

**Site: T796A91247 - Houston**

**Building Code:** T7960021231  
**Building Name:** HOUSTON LOADING SITE - SALT/SAND ST  
**Facility Condition Index:** 0.06 - Good

**Cost Model Name:** Fabric Structure  
**Address:** 15298 State Hwy 16  
**City Code:** HOUSTON

**Current Replacement Value:** \$340,240  
**Deferred Maintenance:** \$20,548  
**Ext. Gross Area:** 3,615

**Building Code:** T7960091268  
**Building Name:** HOUSTON LOADING SITE - EQUIP STORAG  
**Facility Condition Index:** 0.05 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 15298 State Hwy 16  
**City Code:** HOUSTON

**Current Replacement Value:** \$299,288  
**Deferred Maintenance:** \$15,286  
**Ext. Gross Area:** 1,728

**Site: T796A91249 - Wabasha**

**Building Code:** T7960021236  
**Building Name:** WABASHA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.03 - Excellent

**Cost Model Name:** Fabric Structure  
**Address:** 423 Hiawatha Drive NW  
**City Code:** WABASHA

**Current Replacement Value:** \$259,698  
**Deferred Maintenance:** \$8,317  
**Ext. Gross Area:** 8,640

**Building Code:** T7960091249  
**Building Name:** WABASHA - TRUCK STATION  
**Facility Condition Index:** 0.08 - Good

**Cost Model Name:** Single-story Work Facility  
**Address:** 423 Hiawatha Drive NW  
**City Code:** Wabasha

**Current Replacement Value:** \$971,738  
**Deferred Maintenance:** \$75,963  
**Ext. Gross Area:** 5,294

**Building Code:** T7960091276  
**Building Name:** WABASHA - UNHEATED STORAGE  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 423 Hiawatha Drive NW  
**City Code:** WABASHA

**Current Replacement Value:** \$240,196  
**Deferred Maintenance:** \$4,804  
**Ext. Gross Area:** 3,480

**Site: T796A91252 - Dresbach**

**Building Code:** T7960021218  
**Building Name:** DRESBACH - SALT/SAND STORAGE  
**Facility Condition Index:** 0.14 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 201 Riverview Drive  
**City Code:** DRESBACH

**Current Replacement Value:** \$538,446  
**Deferred Maintenance:** \$77,957  
**Ext. Gross Area:** 5,425

**Building Code:** T7960091252  
**Building Name:** DRESBACH - TRUCK STATION  
**Facility Condition Index:** 0.16 - Average

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 201 Riverview Drive  
**City Code:** DRESBACH

**Current Replacement Value:** \$2,190,750  
**Deferred Maintenance:** \$359,329  
**Ext. Gross Area:** 13,323

**Site: T796A91255 - Wilson**

**Building Code:** T7960021227  
**Building Name:** WILSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** RR2 Box 180-A1  
**City Code:** WINONA

**Current Replacement Value:** \$313,028  
**Deferred Maintenance:** \$31,303  
**Ext. Gross Area:** 4,013

**Building Code:** T7960091255  
**Building Name:** WILSON - TRUCK STATION  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** RR2 Box 180-A1  
**City Code:** WINONA

**Current Replacement Value:** \$498,600  
**Deferred Maintenance:** \$62,982  
**Ext. Gross Area:** 3,926

***Site: T796A91262 - Rushford***

**Building Code:** T7960021223  
**Building Name:** RUSHFORD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Rush Creek Business Park  
**City Code:** Rushford

**Current Replacement Value:** \$585,034  
**Deferred Maintenance:** \$43,162  
**Ext. Gross Area:** 10,000

**Building Code:** T7960091262  
**Building Name:** RUSHFORD - TRUCK STATION  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Rush Creek Business Park  
**City Code:** Rushford

**Current Replacement Value:** \$1,360,921  
**Deferred Maintenance:** \$101,892  
**Ext. Gross Area:** 8,264

**Building Code:** T7960091263  
**Building Name:** RUSHFORD - POLE STORAGE BLDG  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** Rushford

**Current Replacement Value:** \$329,677  
**Deferred Maintenance:** \$11,985  
**Ext. Gross Area:** 3,211

***Site: T796A92138 - Winona Scale***

**Building Code:** T7960092138  
**Building Name:** WINONA - WEIGH SCALE BLDG  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 5420 Hwy 61 West  
**City Code:** GOODVIEW

**Current Replacement Value:** \$49,547  
**Deferred Maintenance:** \$5,061  
**Ext. Gross Area:** 256

***Site: T796AR075080 - High Forest RA***

**Building Code:** T7960095600  
**Building Name:** HIGH FOREST - REST AREA  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-90 3mi. SW of High Forest  
**City Code:** Stewartville

**Current Replacement Value:** \$487,946  
**Deferred Maintenance:** \$64,095  
**Ext. Gross Area:** 2,135

***Site: T796AR188580 - Dresbach RA-TIC***

**Building Code:** T7960095603  
**Building Name:** Dresbach - Rest Area - TIC  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-90 WB/US61  
**City Code:** LACRESCENT

**Current Replacement Value:** \$1,615,141  
**Deferred Maintenance:** \$89,606  
**Ext. Gross Area:** 3,723

**Building Code:** T7960095631  
**Building Name:** Dresbach - RA - TIC - Misc Stg  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** I-90 WB/US61  
**City Code:** LACRESCENT

**Current Replacement Value:** \$8,312  
**Deferred Maintenance:** \$918  
**Ext. Gross Area:** 80

**Site: T796AR225580 - Marion RA**

**Building Code:** T7960095602  
**Building Name:** Marion - Rest Area  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I90 WB,11MI W OF TH74  
**City Code:** St. Charles

**Current Replacement Value:** \$581,511  
**Deferred Maintenance:** \$49,741  
**Ext. Gross Area:** 2,234

**Site: T796AR278580 - Enterprise - Rest Area**

**Building Code:** T7960095602  
**Building Name:** Enterprise - Rest Area  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-90 10 mi E of St. Charles  
**City Code:** St. Charles

**Current Replacement Value:** \$848,258  
**Deferred Maintenance:** \$110,524  
**Ext. Gross Area:** 3,405

**Site: T796B21303 - Ellendale**

**Building Code:** T7965021334  
**Building Name:** ELLENDALE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.09 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1/8 Mi E of Jct I-35 And TH 30  
**City Code:** ELLENDALE

**Current Replacement Value:** \$235,835  
**Deferred Maintenance:** \$20,506  
**Ext. Gross Area:** 2,358

**Site: T796B21304 - Petran**

**Building Code:** T7965021304  
**Building Name:** PETRAN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.50 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 20949 830th Avenue  
**City Code:** HAYWARD

**Current Replacement Value:** \$82,734  
**Deferred Maintenance:** \$40,985  
**Ext. Gross Area:** 957

**Building Code:** T7965091333  
**Building Name:** PETRAN - MISC STORAGE  
**Facility Condition Index:** 0.92 - **Crisis**

**Cost Model Name:** Utility Shed  
**Address:** 20949 830th Avenue  
**City Code:** HAYWARD

**Current Replacement Value:** \$46,884  
**Deferred Maintenance:** \$42,992  
**Ext. Gross Area:** 400

**Site: T796B21309 - Blooming Prairie**

**Building Code:** T7965021309  
**Building Name:** BLOOMING PRAIRIE -SALT/SAND STOR  
**Facility Condition Index:** 0.38 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 30-1Mi E of Jct TH 218  
**City Code:** BLOOMING PRAIRIE

**Current Replacement Value:** \$45,833  
**Deferred Maintenance:** \$17,463  
**Ext. Gross Area:** 943

**Building Code:** T7965021333  
**Building Name:** BLOOMING PRAIRIE - SALT/SAND STORA  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** TH 30-1Mi E of Jct TH 218  
**City Code:** BLOOMING PRAIRIE

**Current Replacement Value:** \$146,176  
**Deferred Maintenance:** \$19,098  
**Ext. Gross Area:** 1,925

**Building Code:** T7965091356  
**Building Name:** BLOOMING PRAIRIE - MISC STORAGE  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** TH 30 - 1 MI E of Jct TH 218  
**City Code:** BLOOMING PRAIRIE

**Current Replacement Value:** \$46,228  
**Deferred Maintenance:** \$6,319  
**Ext. Gross Area:** 497

**Site: T796B21313 - Kasson**

**Building Code:** T7965021313  
**Building Name:** KASSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.57 - **Crisis**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 63767 260th St  
**City Code:** KASSON

**Current Replacement Value:** \$52,463  
**Deferred Maintenance:** \$29,851  
**Ext. Gross Area:** 957

**Building Code:** T7965021332  
**Building Name:** KASSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Single-story Work Facility  
**Address:** 63767 260th St  
**City Code:** KASSON

**Current Replacement Value:** \$298,710  
**Deferred Maintenance:** \$50,358  
**Ext. Gross Area:** 2,360

**Site: T796B21317 - Albert Lea**

**Building Code:** T7965021317  
**Building Name:** ALBERT LEA - WEST - SALT/SAND ST  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 72618 225th  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$209,151  
**Deferred Maintenance:** \$28,966  
**Ext. Gross Area:** 1,951

**Site: T796B21326 - Northfield I-35**

**Building Code:** T7965021326  
**Building Name:** NORTHFIELD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.23 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1765 IONSDALE BLVD WEST  
**City Code:** NORTHFIELD

**Current Replacement Value:** \$308,207  
**Deferred Maintenance:** \$70,901  
**Ext. Gross Area:** 3,605

**Site: T796B21336 - Fillmore County**

**Building Code:** T7965021336  
**Building Name:** Fillmore Co - Salt/Sand Storage  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** Jct TH 56 and TH 63  
**City Code:** OSTRANDER

**Current Replacement Value:** \$435,284  
**Deferred Maintenance:** \$29,334  
**Ext. Gross Area:** 4,544

**Site: T796B91317 - Northfield**

**Building Code:** T7965021318  
**Building Name:** NORTHFIELD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.56 - **Crisis**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 510 West Woodley Street  
**City Code:** NORTHFIELD

**Current Replacement Value:** \$83,779  
**Deferred Maintenance:** \$46,886  
**Ext. Gross Area:** 1,440

**Building Code:** T7965091317  
**Building Name:** NORTHFIELD - TRUCK STATION  
**Facility Condition Index:** 0.37 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 510 West Woodley Street  
**City Code:** NORTHFIELD

**Current Replacement Value:** \$881,066  
**Deferred Maintenance:** \$325,392  
**Ext. Gross Area:** 4,678

**Building Code:** T7965091318  
**Building Name:** NORTHFIELD - MISC STORAGE  
**Facility Condition Index:** 0.38 - **Poor**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 510 West Woodley Street  
**City Code:** NORTHFIELD

**Current Replacement Value:** \$250,133  
**Deferred Maintenance:** \$94,203  
**Ext. Gross Area:** 2,304

**Site: T796B91319 - Albert Lea**



**Building Code:** T7965021321  
**Building Name:** ALBERT LEA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 22231 - 770th Avenue  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$122,918  
**Deferred Maintenance:** \$21,192  
**Ext. Gross Area:** 2,356

**Building Code:** T7965021331  
**Building Name:** ALBERT LEA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 22231 - 770th Avenue  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$530,306  
**Deferred Maintenance:** \$58,163  
**Ext. Gross Area:** 7,505

**Building Code:** T7965091319  
**Building Name:** ALBERT LEA - TRUCK STATION  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 22231 - 770th Avenue  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$3,337,640  
**Deferred Maintenance:** \$183,993  
**Ext. Gross Area:** 18,999

**Building Code:** T7965091319  
**Building Name:** ALBERT LEA - TRUCK STATION  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 22231 - 770th Avenue  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$201,765  
**Deferred Maintenance:** \$25,799  
**Ext. Gross Area:** 18,999

**Building Code:** T7965091346  
**Building Name:** ALBERT LEA - MISC STORAGE  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 22231 - 770th Avenue  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$50,067  
**Deferred Maintenance:** \$6,890  
**Ext. Gross Area:** 680

**Building Code:** T7965091353  
**Building Name:** ALBERT LEA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 22231 - 770th Avenue  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$238,848  
**Deferred Maintenance:** \$8,698  
**Ext. Gross Area:** 2,560

**Site: T796B91327 - OWATONNA**

**Building Code:** T7965021322  
**Building Name:** OWATONNA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.48 - *Poor*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Current Replacement Value:** \$107,274  
**Deferred Maintenance:** \$51,151  
**Ext. Gross Area:** 1,824

**Building Code:** T7965021327  
**Building Name:** OWATONNA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Current Replacement Value:** \$680,325  
**Deferred Maintenance:** \$143,973  
**Ext. Gross Area:** 6,715

**Building Code:** T7965091327  
**Building Name:** OWATONNA - MAINTENANCE HEADQUARTERS  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Current Replacement Value:** \$15,831,941  
**Deferred Maintenance:** \$3,121,448  
**Ext. Gross Area:** 72,924

**Building Code:** T7965091329  
**Building Name:** OWATONNA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Current Replacement Value:** \$1,277,759  
**Deferred Maintenance:** \$170,599  
**Ext. Gross Area:** 9,041

**Building Code:** T7965091347  
**Building Name:** OWATONNA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Current Replacement Value:** \$980,909  
**Deferred Maintenance:** \$274,267  
**Ext. Gross Area:** 10,162

**Building Code:** T7965091352  
**Building Name:** OWATONNA - MISC STORAGE  
**Facility Condition Index:** 0.17 - Average

**Building Code:** T7965091358  
**Building Name:** OWATONNA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.08 - Good

**Building Code:** T7965091367  
**Building Name:** OWATONNA UNHEATED STORAGE  
**Facility Condition Index:** 0.02 - Excellent

**Cost Model Name:** Single-story Work Facility  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1010 - 21st Avenue NW  
**City Code:** Owatonna

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1010 21ST AVENUE NW  
**City Code:** OWATONNA

**Current Replacement Value:** \$53,815  
**Deferred Maintenance:** \$9,088  
**Ext. Gross Area:** 783

**Current Replacement Value:** \$256,662  
**Deferred Maintenance:** \$19,834  
**Ext. Gross Area:** 2,560

**Current Replacement Value:** \$363,570  
**Deferred Maintenance:** \$7,271  
**Ext. Gross Area:** 7,560

**Site: T796B91331 - Cannon Falls**

**Building Code:** T7965021310  
**Building Name:** CANNON FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.73 - Crisis

**Building Code:** T7965021325  
**Building Name:** CANNON FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - Average

**Building Code:** T7965091331  
**Building Name:** CANNON FALLS - TRUCK STATION  
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 31664 County Road 24  
**City Code:** CANNON FALLS

**Cost Model Name:** Open Air Storage Structure  
**Address:** 31664 County Road 24  
**City Code:** CANNON FALLS

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 31664 County Road 24  
**City Code:** CANNON FALLS

**Current Replacement Value:** \$68,488  
**Deferred Maintenance:** \$50,133  
**Ext. Gross Area:** 896

**Current Replacement Value:** \$558,075  
**Deferred Maintenance:** \$107,511  
**Ext. Gross Area:** 5,538

**Current Replacement Value:** \$660,099  
**Deferred Maintenance:** \$71,634  
**Ext. Gross Area:** 3,707

**Site: T796B91335 - Albert Lea Cty Rd 5**

**Building Code:** T7965091335  
**Building Name:** ALBERT LEA - MISC STORAGE  
**Facility Condition Index:** 0.76 - Crisis

**Cost Model Name:** Single-story Work Facility  
**Address:** 75458 125TH ST  
**City Code:** ALBERT LEA

**Current Replacement Value:** \$39,918  
**Deferred Maintenance:** \$30,210  
**Ext. Gross Area:** 288

**Site: T796B91339 - Zumbrota**

**Building Code:** T7965021316  
**Building Name:** ZUMBROTA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.50 - Poor

**Building Code:** T7965021329  
**Building Name:** ZUMBROTA-SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - Good

**Cost Model Name:** Open Air Storage Structure  
**Address:** 940 West 8th Street  
**City Code:** ZUMBROTA

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 940 West 8th Street  
**City Code:** ZUMBROTA

**Current Replacement Value:** \$158,487  
**Deferred Maintenance:** \$78,453  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$293,615  
**Deferred Maintenance:** \$36,312  
**Ext. Gross Area:** 4,409

**Building Code:** T7965091324  
**Building Name:** ZUMBROTA - MISC STORAGE  
**Facility Condition Index:** 0.35 - **Poor**

**Building Code:** T7965091339  
**Building Name:** ZUMBROTA - TRUCK STATION  
**Facility Condition Index:** 0.10 - **Good**

**Building Code:** T7965091355  
**Building Name:** ZUMBROTA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 940 West 8th Street  
**City Code:** ZUMBROTA

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 940 West 8th Street  
**City Code:** ZUMBROTA

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 940 West 8th Street  
**City Code:** ZUMBROTA

**Current Replacement Value:** \$16,503  
**Deferred Maintenance:** \$5,712  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$778,373  
**Deferred Maintenance:** \$77,763  
**Ext. Gross Area:** 5,241

**Current Replacement Value:** \$240,005  
**Deferred Maintenance:** \$22,901  
**Ext. Gross Area:** 2,560

**Site: T796B91344 - Dodge Center (Old Site)**

**Building Code:** T7965021319  
**Building Name:** DODGE CENTER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Building Code:** T7965091344  
**Building Name:** DODGE CENTER - STORAGE FACILITY  
**Facility Condition Index:** 0.20 - **Average**

**Building Code:** T7965091351  
**Building Name:** DODGE CENTER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 61923 MN Hwy 56  
**City Code:** DODGE CENTER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 61923 MN Hwy 56  
**City Code:** DODGE CENTER

**Cost Model Name:** Single-story Work Facility  
**Address:** 61923 MN Hwy 56  
**City Code:** DODGE CENTER

**Current Replacement Value:** \$248,521  
**Deferred Maintenance:** \$41,228  
**Ext. Gross Area:** 3,060

**Current Replacement Value:** \$747,336  
**Deferred Maintenance:** \$145,953  
**Ext. Gross Area:** 5,406

**Current Replacement Value:** \$170,687  
**Deferred Maintenance:** \$23,313  
**Ext. Gross Area:** 1,536

**Site: T796B91349 - Austin**

**Building Code:** T7965021323  
**Building Name:** AUSTIN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Building Code:** T7965091349  
**Building Name:** AUSTIN - TRUCK STATION  
**Facility Condition Index:** 0.07 - **Good**

**Building Code:** T7965091350  
**Building Name:** AUSTIN - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1500 - 11th Drive NE  
**City Code:** AUSTIN

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1500 - 11th Drive NE  
**City Code:** AUSTIN

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1500 - 11th Drive NE  
**City Code:** AUSTIN

**Current Replacement Value:** \$846,703  
**Deferred Maintenance:** \$144,962  
**Ext. Gross Area:** 8,261

**Current Replacement Value:** \$2,645,068  
**Deferred Maintenance:** \$191,711  
**Ext. Gross Area:** 15,611

**Current Replacement Value:** \$427,203  
**Deferred Maintenance:** \$26,701  
**Ext. Gross Area:** 4,177

**Site: T796B91354 - Red Wing**

**Building Code:** T7965021328  
**Building Name:** RED WING - TRUCK STATION  
**Facility Condition Index:** 0.10 - [Good](#)

**Building Code:** T7965091354  
**Building Name:** RED WING - TRUCK STATION  
**Facility Condition Index:** 0.12 - [Good](#)

**Building Code:** T7965091359  
**Building Name:** RED WING - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3890 Pepin Avenue  
**City Code:** Red Wing

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3890 Pepin Avenue  
**City Code:** Red Wing

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 3890 Pepin Avenue  
**City Code:** Red Wing

**Current Replacement Value:** \$691,226  
**Deferred Maintenance:** \$69,598  
**Ext. Gross Area:** 7,457

**Current Replacement Value:** \$1,290,855  
**Deferred Maintenance:** \$155,717  
**Ext. Gross Area:** 7,457

**Current Replacement Value:** \$226,667  
**Deferred Maintenance:** \$14,383  
**Ext. Gross Area:** 2,560

**Site: T796B91361 - Dodge Center (New Site)**

**Building Code:** T7965021337  
**Building Name:** DODGE CENTER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Building Code:** T7965091361  
**Building Name:** DODGE CENTER - TRUCK STATION  
**Facility Condition Index:** 0.09 - [Good](#)

**Building Code:** T7965091364  
**Building Name:** DODGE CENTER - BRINE BLDG  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Fabric Structure  
**Address:** 201 Airport Road  
**City Code:** DODGE CENTER

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 201 Airport Road  
**City Code:** DODGE CENTER

**Cost Model Name:** Single-story Work Facility  
**Address:** 201 Airport Road  
**City Code:** DODGE CENTER

**Current Replacement Value:** \$446,206  
**Deferred Maintenance:** \$44,621  
**Ext. Gross Area:** 6,899

**Current Replacement Value:** \$1,586,564  
**Deferred Maintenance:** \$149,980  
**Ext. Gross Area:** 10,170

**Current Replacement Value:** \$75,039  
**Deferred Maintenance:** \$9,145  
**Ext. Gross Area:** 378

**Site: T796B91365 - Faribault**

**Building Code:** T7965021306  
**Building Name:** FARIBAULT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.57 - [Crisis](#)

**Building Code:** T7965021324  
**Building Name:** FARIBAULT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.24 - [Average](#)

**Building Code:** T7965091328  
**Building Name:** FARIBAULT - EQUIP STORAGE  
**Facility Condition Index:** 0.27 - [Average](#)

**Building Code:** T7965091362  
**Building Name:** FARIBAULT - POLE STORAGE BLDG  
**Facility Condition Index:** 0.04 - [Excellent](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 555 NW 14th Street  
**City Code:** FARIBAULT

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 555 NW 24th Street  
**City Code:** FARIBAULT

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 555 NW 24th Street  
**City Code:** FARIBAULT

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 555 NW 24th Street  
**City Code:** FARIBAULT

**Current Replacement Value:** \$105,016  
**Deferred Maintenance:** \$60,201  
**Ext. Gross Area:** 1,522

**Current Replacement Value:** \$557,874  
**Deferred Maintenance:** \$132,893  
**Ext. Gross Area:** 5,436

**Current Replacement Value:** \$1,070,714  
**Deferred Maintenance:** \$290,049  
**Ext. Gross Area:** 8,000

**Current Replacement Value:** \$289,598  
**Deferred Maintenance:** \$10,298  
**Ext. Gross Area:** 3,067

**Building Code:** T7965091365  
**Building Name:** FARIBAULT - TRUCK STATION  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 555 NW 14th Street  
**City Code:** FARIBAULT

**Current Replacement Value:** \$1,626,949  
**Deferred Maintenance:** \$128,855  
**Ext. Gross Area:** 9,949

***Site: T796BR242480 - Albert Lea RA-TIC***

**Building Code:** T7965095662  
**Building Name:** Albert Lea - Rest Area - TIC  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 NB - 1 MI NO IA/MN BORDER  
**City Code:** GLENVILLE

**Current Replacement Value:** \$1,088,564  
**Deferred Maintenance:** \$102,230  
**Ext. Gross Area:** 4,132

**Building Code:** T7965095681  
**Building Name:** ALBERT LEA - MISC STRG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Utility Shed  
**Address:** I-35 NB - 1 MI NO IA/MN BORDER  
**City Code:** GLENVILLE

**Current Replacement Value:** \$10,926  
**Deferred Maintenance:** \$219  
**Ext. Gross Area:** 128

***Site: T796BR587480 - Straight River South RA***

**Building Code:** T7965095659  
**Building Name:** Straight River South - Rest Area  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 SB - 6 MI S. OF OWATONNA  
**City Code:** OWATONNA

**Current Replacement Value:** \$696,817  
**Deferred Maintenance:** \$57,243  
**Ext. Gross Area:** 0

**Building Code:** T7965095685  
**Building Name:** Staight River South - RA-Misc Strg  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Utility Shed  
**Address:** I-35 SB - 6 MI S. OF OWATONNA  
**City Code:** Owatonna

**Current Replacement Value:** \$10,838  
**Deferred Maintenance:** \$217  
**Ext. Gross Area:** 0

***Site: T796BR596680 - Heath Creek RA***

**Building Code:** T7965095657  
**Building Name:** Heath Creek - Rest Area  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 NB - 10 MI NO OF FARIBAULT  
**City Code:** NORTHFIELD

**Current Replacement Value:** \$710,701  
**Deferred Maintenance:** \$67,361  
**Ext. Gross Area:** 2,765

**Building Code:** T7965095688  
**Building Name:** HEATH CREEK - MISC STRG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I-35 NB - 10 MI NO OF FARIBAULT  
**City Code:** NORTHFIELD

**Current Replacement Value:** \$77,596  
**Deferred Maintenance:** \$1,552  
**Ext. Gross Area:** 567

***Site: T796BR607080 - NEW MARKET REST AREA***

**Building Code:** T7965095658  
**Building Name:** NEW MARKET - REST AREA  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-35 SB - SO OF ELKO EXIT  
**City Code:** NEW MARKET

**Current Replacement Value:** \$794,014  
**Deferred Maintenance:** \$74,428  
**Ext. Gross Area:** 2,765

**Building Code:** T7965095687  
**Building Name:** NEW MARKET - MISC STORAGE BLDG  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Open Air Shelter  
**Address:** I-35 SB - SO OF ELKO EXIT  
**City Code:** NEW MARKET

**Current Replacement Value:** \$37,534  
**Deferred Maintenance:** \$751  
**Ext. Gross Area:** 567

**Site: T796BR612482 - Hayward RA**

**Building Code:** T7965095655  
**Building Name:** Hayward - Rest Area  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I90 EB-2.2 MI E OF I35  
**City Code:** HAYWARD

**Current Replacement Value:** \$238,375  
**Deferred Maintenance:** \$19,998  
**Ext. Gross Area:** 1,637

**Building Code:** T7965095684  
**Building Name:** Hayward - Rest Area Misc Stor  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I90 EB-2.2 MI E OF I35  
**City Code:** HAYWARD

**Current Replacement Value:** \$39,603  
**Deferred Maintenance:** \$2,594  
**Ext. Gross Area:** 268

**Site: T796BR622482 - Oakland Woods RA**

**Building Code:** T7965095656  
**Building Name:** Oakland Woods - Rest Area  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-90 WB - 1 MI WEST JCT CO RD 34  
**City Code:** OAKLAND WOODS

**Current Replacement Value:** \$301,879  
**Deferred Maintenance:** \$29,172  
**Ext. Gross Area:** 1,648

**Building Code:** T7965095683  
**Building Name:** Oakland Woods - RA-Misc Strg  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I-90 WB - 1 MI WEST JCT CO RD 34  
**City Code:** OAKLAND WOODS

**Current Replacement Value:** \$32,673  
**Deferred Maintenance:** \$2,718  
**Ext. Gross Area:** 268

**Site: T796BR842513 - Lake Pepin RA**

**Building Code:** T7965095661  
**Building Name:** Lake Pepin - Rest Area  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US 61 - 5 MI NO OF LAKE CITY  
**City Code:** LAKE CITY

**Current Replacement Value:** \$352,957  
**Deferred Maintenance:** \$24,708  
**Ext. Gross Area:** 1,555

**Building Code:** T7965095686  
**Building Name:** LAKE PEPIN - MISC STRG  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Utility Shed  
**Address:** US 61 - 5 MI NO OF LAKE CITY  
**City Code:** LAKE CITY

**Current Replacement Value:** \$16,647  
**Deferred Maintenance:** \$1,467  
**Ext. Gross Area:** 128

**Site: T797E21429 - Alden**

**Building Code:** T7970021429  
**Building Name:** ALDEN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.18 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 64446 CO RD 46  
**City Code:** ALDEN

**Current Replacement Value:** \$237,279  
**Deferred Maintenance:** \$41,531  
**Ext. Gross Area:** 2,496

**Building Code:** T7970091440  
**Building Name:** ALDEN - MISC STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 64446 CO RD 46  
**City Code:** ALDEN

**Current Replacement Value:** \$56,690  
**Deferred Maintenance:** \$4,870  
**Ext. Gross Area:** 490

**Site: T797E21431 - Waterville**

**Building Code:** T7970021431  
**Building Name:** WATERVILLE YARD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** Waterville

**Current Replacement Value:** \$235,082  
**Deferred Maintenance:** \$19,753  
**Ext. Gross Area:** 2,496

**Site: T797E91415 - Blue Earth**

**Building Code:** T7970021437  
**Building Name:** BLUE EARTH - SAND/SALT STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Fabric Structure  
**Address:** 38379 115th STREET  
**City Code:** BLUE EARTH

**Current Replacement Value:** \$365,709  
**Deferred Maintenance:** \$7,314  
**Ext. Gross Area:** 4,732

**Building Code:** T7970091415  
**Building Name:** BLUE EARTH - TRUCK STATION  
**Facility Condition Index:** 0.27 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 38379 115TH STREET  
**City Code:** BLUE EARTH

**Current Replacement Value:** \$1,217,179  
**Deferred Maintenance:** \$325,309  
**Ext. Gross Area:** 6,983

**Building Code:** T7970091441  
**Building Name:** BLUE EARTH - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 38379 115TH STREET  
**City Code:** BLUE EARTH

**Current Replacement Value:** \$285,096  
**Deferred Maintenance:** \$19,744  
**Ext. Gross Area:** 3,044

**Site: T797E91416 - WELLS**

**Building Code:** T7970021438  
**Building Name:** WELLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Fabric Structure  
**Address:** 585 7th Avenue SE  
**City Code:** WELLS

**Current Replacement Value:** \$325,189  
**Deferred Maintenance:** \$6,504  
**Ext. Gross Area:** 5,400

**Building Code:** T7970091416  
**Building Name:** WELLS - TRUCK STATION  
**Facility Condition Index:** 0.23 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 585 7th Avenue SE  
**City Code:** WELLS

**Current Replacement Value:** \$800,496  
**Deferred Maintenance:** \$184,413  
**Ext. Gross Area:** 4,680

**Building Code:** T7970091429  
**Building Name:** WELLS - UNHEATED STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 585 7th Avenue SE  
**City Code:** WELLS

**Current Replacement Value:** \$321,136  
**Deferred Maintenance:** \$28,996  
**Ext. Gross Area:** 3,072

**Building Code:** T7970091450  
**Building Name:** WELLS - BRINE BUILDING  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 585 7th Avenue SE  
**City Code:** WELLS

**Current Replacement Value:** \$51,974  
**Deferred Maintenance:** \$3,481  
**Ext. Gross Area:** 402

**Site: T797E91418 - Saint Peter**

**Building Code:** T7970021417  
**Building Name:** ST PETER - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 415 Ritt Street  
**City Code:** St. Peter

**Current Replacement Value:** \$370,612  
**Deferred Maintenance:** \$45,852  
**Ext. Gross Area:** 3,935



**Building Code:** T7970091418  
**Building Name:** ST PETER - TRUCK STATION  
**Facility Condition Index:** 0.19 - *Average*

**Building Code:** T7970091435  
**Building Name:** ST PETER - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - *Good*

**Building Code:** T7970091446  
**Building Name:** ST PETER - BRINE BUILDING  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 415 Ritt Street  
**City Code:** St. Peter

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 415 Ritt Street  
**City Code:** St. Peter

**Cost Model Name:** Single-story Work Facility  
**Address:** 415 Ritt Street  
**City Code:** St. Peter

**Current Replacement Value:** \$862,193  
**Deferred Maintenance:** \$165,013  
**Ext. Gross Area:** 5,856

**Current Replacement Value:** \$283,941  
**Deferred Maintenance:** \$18,267  
**Ext. Gross Area:** 3,060

**Current Replacement Value:** \$51,493  
**Deferred Maintenance:** \$6,206  
**Ext. Gross Area:** 402

**Site: T797E91423 - Mapleton**

**Building Code:** T7970021421  
**Building Name:** MAPLETON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.20 - *Average*

**Building Code:** T7970091423  
**Building Name:** MAPLETON - TRUCK STATION  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** T7970091427  
**Building Name:** MAPLETON - MISC STORAGE  
**Facility Condition Index:** 0.21 - *Average*

**Building Code:** T7970091428  
**Building Name:** MAPLETON - POLE STORAGE BLDG  
**Facility Condition Index:** 0.18 - *Average*

**Building Code:** T7970091447  
**Building Name:** MAPLETON - MISC STORAGE  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 403 8th Avenue SE  
**City Code:** MAPLETON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 403 8th Avenue SE  
**City Code:** MAPLETON

**Cost Model Name:** Single-story Work Facility  
**Address:** 403 8th Avenue SE  
**City Code:** MAPLETON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 403 8th Avenue SE  
**City Code:** MAPLETON

**Cost Model Name:** Single-story Work Facility  
**Address:** 403 8th Avenue SE  
**City Code:** MAPLETON

**Current Replacement Value:** \$257,310  
**Deferred Maintenance:** \$52,726  
**Ext. Gross Area:** 2,733

**Current Replacement Value:** \$1,031,758  
**Deferred Maintenance:** \$218,775  
**Ext. Gross Area:** 5,838

**Current Replacement Value:** \$29,575  
**Deferred Maintenance:** \$6,254  
**Ext. Gross Area:** 384

**Current Replacement Value:** \$318,361  
**Deferred Maintenance:** \$55,974  
**Ext. Gross Area:** 3,088

**Current Replacement Value:** \$50,215  
**Deferred Maintenance:** \$6,079  
**Ext. Gross Area:** 402

**Site: T797E91424 - New Ulm**

**Building Code:** T7970021402  
**Building Name:** NEW ULM - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - *Good*

**Building Code:** T7970091424  
**Building Name:** NEW ULM - TRUCK STATION  
**Facility Condition Index:** 0.24 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 58418 County Road 21  
**City Code:** NEW ULM

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 58418 County Road 21  
**City Code:** NEW ULM

**Current Replacement Value:** \$289,520  
**Deferred Maintenance:** \$34,969  
**Ext. Gross Area:** 3,074

**Current Replacement Value:** \$1,023,370  
**Deferred Maintenance:** \$248,559  
**Ext. Gross Area:** 6,257

**Building Code:** T7970091436  
**Building Name:** NEW ULM - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Building Code:** T7970091449  
**Building Name:** NEW ULM - MISC STORAGE  
**Facility Condition Index:** 0.17 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 58418 County Road 21  
**City Code:** NEW ULM

**Cost Model Name:** Single-story Work Facility  
**Address:** 58418 County Road 21  
**City Code:** NEW ULM

**Current Replacement Value:** \$285,054  
**Deferred Maintenance:** \$19,491  
**Ext. Gross Area:** 3,072

**Current Replacement Value:** \$50,064  
**Deferred Maintenance:** \$8,318  
**Ext. Gross Area:** 402

**Site: T797E91430 - Le Sueur**

**Building Code:** T7970021427  
**Building Name:** LE SUEUR - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Building Code:** T7970091430  
**Building Name:** LE SUEUR - TRUCK STATION SUB-AREA  
**Facility Condition Index:** 0.16 - [Average](#)

**Building Code:** T7970091433  
**Building Name:** LE SUEUR - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 201 Minnesota Avenue  
**City Code:** LE SUEUR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 201 Minnesota Avenue  
**City Code:** LE SUEUR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 201 Minnesota Avenue  
**City Code:** LE SUEUR

**Current Replacement Value:** \$248,268  
**Deferred Maintenance:** \$28,997  
**Ext. Gross Area:** 2,635

**Current Replacement Value:** \$1,349,981  
**Deferred Maintenance:** \$218,861  
**Ext. Gross Area:** 8,473

**Current Replacement Value:** \$307,431  
**Deferred Maintenance:** \$35,260  
**Ext. Gross Area:** 3,476

**Site: T797E91437 - Montgomery**

**Building Code:** T7970021428  
**Building Name:** MONTGOMERY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Building Code:** T7970091405  
**Building Name:** MONTGOMERY - EQUIP STORAGE  
**Facility Condition Index:** 0.22 - [Average](#)

**Building Code:** T7970091437  
**Building Name:** MONTGOMERY - TRUCK STATION  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 201 Boulevard Avenue West  
**City Code:** MONTGOMERY

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 201 Boulevard Avenue West  
**City Code:** MONTGOMERY

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 201 Boulevard Avenue West  
**City Code:** MONTGOMERY

**Current Replacement Value:** \$248,268  
**Deferred Maintenance:** \$29,986  
**Ext. Gross Area:** 2,636

**Current Replacement Value:** \$371,085  
**Deferred Maintenance:** \$83,001  
**Ext. Gross Area:** 2,698

**Current Replacement Value:** \$758,146  
**Deferred Maintenance:** \$88,626  
**Ext. Gross Area:** 4,722

**Site: T797E91438 - Gaylord**

**Building Code:** T7970021434  
**Building Name:** GAYLORD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 330 Railroad Avenue  
**City Code:** GAYLORD

**Current Replacement Value:** \$501,425  
**Deferred Maintenance:** \$59,015  
**Ext. Gross Area:** 6,513

**Building Code:** T7970091438  
**Building Name:** GAYLORD - TRUCK STATION  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 330 Railroad Avenue  
**City Code:** GAYLORD

**Current Replacement Value:** \$1,232,921  
**Deferred Maintenance:** \$224,129  
**Ext. Gross Area:** 8,366

**Building Code:** T7970091439  
**Building Name:** GAYLORD - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 330 Railroad Avenue  
**City Code:** GAYLORD

**Current Replacement Value:** \$273,105  
**Deferred Maintenance:** \$17,429  
**Ext. Gross Area:** 3,072

**Site: T797E91445 - MANKATO HEADQUARTERS**

**Building Code:** T7970021435  
**Building Name:** MANKATO - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Fabric Structure  
**Address:** 2151 Bassett Drive  
**City Code:** MANKATO

**Current Replacement Value:** \$1,179,156  
**Deferred Maintenance:** \$23,583  
**Ext. Gross Area:** 15,400

**Building Code:** T7970091442  
**Building Name:** MANKATO - UNHEATED STORAGE BLDG  
**Facility Condition Index:** 0.04 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2151 Bassett Drive  
**City Code:** MANKATO

**Current Replacement Value:** \$1,263,560  
**Deferred Maintenance:** \$55,956  
**Ext. Gross Area:** 9,120

**Building Code:** T7970091445  
**Building Name:** MANKATO - DISTRICT HEADQUARTERS  
**Facility Condition Index:** 0.05 - *Good*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 2151 Bassett Drive  
**City Code:** MANKATO

**Current Replacement Value:** \$41,625,468  
**Deferred Maintenance:** \$2,224,878  
**Ext. Gross Area:** 175,808

**Building Code:** T7970091453  
**Building Name:** MANKATO - HAZ MAT Bldg  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Utility Shed  
**Address:** 2151 Bassett Drive  
**City Code:** MANKATO

**Current Replacement Value:** \$28,307  
**Deferred Maintenance:** \$2,831  
**Ext. Gross Area:** 160

**Site: T797E91452 - Waseca**

**Building Code:** T7970021436  
**Building Name:** WASECA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Fabric Structure  
**Address:** 1500 State Street South  
**City Code:** Waseca

**Current Replacement Value:** \$765,686  
**Deferred Maintenance:** \$130,978  
**Ext. Gross Area:** 10,000

**Building Code:** T7970091444  
**Building Name:** WASECA - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1500 State Street South  
**City Code:** Waseca

**Current Replacement Value:** \$372,520  
**Deferred Maintenance:** \$24,764  
**Ext. Gross Area:** 3,072

**Building Code:** T7970091452  
**Building Name:** WASECA - TRUCK STATION  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1500 State Street South  
**City Code:** Waseca

**Current Replacement Value:** \$1,365,767  
**Deferred Maintenance:** \$42,159  
**Ext. Gross Area:** 8,845

**Site: T797ER632280 - Blue Earth East RA**

**Building Code:** T7970095702  
**Building Name:** Blue Earth East - Rest Area  
**Facility Condition Index:** 0.14 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I90 EB - BLUE EARTH  
**City Code:** BLUE EARTH

**Current Replacement Value:** \$499,654  
**Deferred Maintenance:** \$71,192  
**Ext. Gross Area:** 1,736

***Site: T797ER642280 - Blue Earth West RA***

**Building Code:** T7970095703  
**Building Name:** Blue Earth West - Rest Area  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-90 WB - BLUE EARTH  
**City Code:** BLUE EARTH

**Current Replacement Value:** \$494,348  
**Deferred Maintenance:** \$45,808  
**Ext. Gross Area:** 1,738

**Building Code:** T7970095730  
**Building Name:** Blue Earth West - Rest Area - Misc  
**Facility Condition Index:** 0.08 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** I90 WB - BLUE EARTH  
**City Code:** BLUE EARTH

**Current Replacement Value:** \$93,350  
**Deferred Maintenance:** \$7,783  
**Ext. Gross Area:** 765

***Site: T797ER804013 - Minnesota Valley RA***

**Building Code:** T7970095710  
**Building Name:** Minnesota Valley - Rest Area  
**Facility Condition Index:** 0.15 - [Average](#)

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** US 169 - NO OF LE SUEUR  
**City Code:** LE SUEUR

**Current Replacement Value:** \$522,508  
**Deferred Maintenance:** \$80,886  
**Ext. Gross Area:** 1,913

***Site: T797W21614 - Springfield***

**Building Code:** T7975021614  
**Building Name:** SPRINGFIELD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.44 - [Poor](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** SPRINGFIELD  
**City Code:** Springfield

**Current Replacement Value:** \$88,788  
**Deferred Maintenance:** \$39,290  
**Ext. Gross Area:** 814

***Site: T797W21633 - Madelia***

**Building Code:** T7975021633  
**Building Name:** MADELIA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - [Average](#)

**Cost Model Name:** Fabric Structure  
**Address:** 19 EAGER AV. NE  
**City Code:** MADELIA

**Current Replacement Value:** \$265,199  
**Deferred Maintenance:** \$50,546  
**Ext. Gross Area:** 3,400

**Building Code:** T7975091644  
**Building Name:** MADELIA - LOADER STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 19 EAGER AV NE  
**City Code:** MADELIA

**Current Replacement Value:** \$190,443  
**Deferred Maintenance:** \$11,417  
**Ext. Gross Area:** 560

***Site: T797W91609 - Luverne***

**Building Code:** T7975021622  
**Building Name:** LUVERNE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 301 W KOEHN AVENUE  
**City Code:** LUVERNE

**Current Replacement Value:** \$203,161  
**Deferred Maintenance:** \$20,752  
**Ext. Gross Area:** 1,462

**Building Code:** T7975021626  
**Building Name:** LUVERNE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 301 W KOEHN AVENUE  
**City Code:** LUVERNE

**Current Replacement Value:** \$93,901  
**Deferred Maintenance:** \$9,938  
**Ext. Gross Area:** 944

**Building Code:** T7975021632  
**Building Name:** LUVERNE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Fabric Structure  
**Address:** 301 W KOEHN AVENUE  
**City Code:** LUVERNE

**Current Replacement Value:** \$323,577  
**Deferred Maintenance:** \$61,673  
**Ext. Gross Area:** 3,932

**Building Code:** T7975091609  
**Building Name:** LUVERNE - TRUCK STATION  
**Facility Condition Index:** 0.19 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 301 W KOEHN AVENUE  
**City Code:** LUVERNE

**Current Replacement Value:** \$2,199,131  
**Deferred Maintenance:** \$410,874  
**Ext. Gross Area:** 10,307

**Building Code:** T7975091642  
**Building Name:** LUVERNE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 301 W KOEHN AVENUE  
**City Code:** LUVERNE

**Current Replacement Value:** \$384,255  
**Deferred Maintenance:** \$24,382  
**Ext. Gross Area:** 3,853

**Building Code:** T7975091646  
**Building Name:** LUVERNE - BRINE BLDG  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 301 W KOEHN AVENUE  
**City Code:** LUVERNE

**Current Replacement Value:** \$27,381  
**Deferred Maintenance:** \$9,036  
**Ext. Gross Area:** 0

**Site: T797W91613 - Worthington**

**Building Code:** T7975021627  
**Building Name:** WORTHINGTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1475 SPRING AVENUE  
**City Code:** WORTHINGTON

**Current Replacement Value:** \$246,067  
**Deferred Maintenance:** \$44,049  
**Ext. Gross Area:** 2,496

**Building Code:** T7975091613  
**Building Name:** WORTHINGTON - TRUCK STATION  
**Facility Condition Index:** 0.15 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1475 SPRING AVENUE  
**City Code:** WORTHINGTON

**Current Replacement Value:** \$2,621,067  
**Deferred Maintenance:** \$384,049  
**Ext. Gross Area:** 15,414

**Building Code:** T7975091634  
**Building Name:** WORTHINGTON - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1475 SPRING AVENUE  
**City Code:** WORTHINGTON

**Current Replacement Value:** \$306,491  
**Deferred Maintenance:** \$21,167  
**Ext. Gross Area:** 3,087

**Site: T797W91614 - Windom**

**Building Code:** T7975021608  
**Building Name:** WINDOM - SALT/SAND STORAGE  
**Facility Condition Index:** 0.30 - **Poor**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$110,695  
**Deferred Maintenance:** \$33,556  
**Ext. Gross Area:** 1,595

**Building Code:** T7975021624  
**Building Name:** WINDOM - SALT/SAND STORAGE  
**Facility Condition Index:** 0.14 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$241,673  
**Deferred Maintenance:** \$33,417  
**Ext. Gross Area:** 2,496

**Building Code:** T7975091614  
**Building Name:** WINDOM - MAINTENANCE HEADQUARTERS  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$15,519,620  
**Deferred Maintenance:** \$3,465,696  
**Ext. Gross Area:** 56,213

**Building Code:** T7975091619  
**Building Name:** WINDOM - MISC STORAGE  
**Facility Condition Index:** 0.22 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$20,534  
**Deferred Maintenance:** \$4,505  
**Ext. Gross Area:** 227

**Building Code:** T7975091628  
**Building Name:** WINDOM - POLE STORAGE BLDG  
**Facility Condition Index:** 0.15 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$673,170  
**Deferred Maintenance:** \$103,321  
**Ext. Gross Area:** 5,877

**Building Code:** T7975091641  
**Building Name:** WINDOM - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$1,123,178  
**Deferred Maintenance:** \$75,624  
**Ext. Gross Area:** 11,520

**Building Code:** T7975091645  
**Building Name:** WINDOM - MISC STORAGE  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 180 County Road 26  
**City Code:** WINDOM

**Current Replacement Value:** \$486,612  
**Deferred Maintenance:** \$12,943  
**Ext. Gross Area:** 3,460

**Site: T797W91616 - Jackson**

**Building Code:** T7975021607  
**Building Name:** JACKSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.23 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 149 County Road 34 East  
**City Code:** JACKSON

**Current Replacement Value:** \$95,651  
**Deferred Maintenance:** \$21,885  
**Ext. Gross Area:** 1,335

**Building Code:** T7975021629  
**Building Name:** JACKSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 149 County Road 34 East  
**City Code:** JACKSON

**Current Replacement Value:** \$265,784  
**Deferred Maintenance:** \$21,274  
**Ext. Gross Area:** 2,696

**Building Code:** T7975091616  
**Building Name:** JACKSON - TRUCK STATION  
**Facility Condition Index:** 0.20 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 149 County Road 34 East  
**City Code:** JACKSON

**Current Replacement Value:** \$1,724,412  
**Deferred Maintenance:** \$337,486  
**Ext. Gross Area:** 8,803

**Building Code:** T7975091643  
**Building Name:** JACKSON - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 149 County Road 34 East  
**City Code:** JACKSON

**Current Replacement Value:** \$357,280  
**Deferred Maintenance:** \$19,694  
**Ext. Gross Area:** 3,500

**Site: T797W91620 - Fairmont**

**Building Code:** T7975021621  
**Building Name:** FAIRMONT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.15 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1300 Marcus Street  
**City Code:** FAIRMONT

**Current Replacement Value:** \$164,842  
**Deferred Maintenance:** \$23,999  
**Ext. Gross Area:** 1,935

**Building Code:** T7975021628  
**Building Name:** FAIRMONT - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1300 Marcus Street  
**City Code:** FAIRMONT

**Current Replacement Value:** \$131,344  
**Deferred Maintenance:** \$13,555  
**Ext. Gross Area:** 944

**Building Code:** T7975091620  
**Building Name:** FAIRMONT - TRUCK STATION  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1300 Marcus Street  
**City Code:** FAIRMONT

**Current Replacement Value:** \$1,105,207  
**Deferred Maintenance:** \$221,342  
**Ext. Gross Area:** 6,983

**Building Code:** T7975091640  
**Building Name:** FAIRMONT - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1300 Marcus Street  
**City Code:** FAIRMONT

**Current Replacement Value:** \$295,710  
**Deferred Maintenance:** \$20,219  
**Ext. Gross Area:** 3,072

**Site: T797W91627 - Sleepy Eye**

**Building Code:** T7975021619  
**Building Name:** SLEEPY EYE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 900 Cedar Street NE  
**City Code:** Sleepy Eye

**Current Replacement Value:** \$87,369  
**Deferred Maintenance:** \$14,424  
**Ext. Gross Area:** 944

**Building Code:** T7975021630  
**Building Name:** SLEEPY EYE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.18 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 900 Cedar Street NE  
**City Code:** Sleepy Eye

**Current Replacement Value:** \$248,268  
**Deferred Maintenance:** \$43,454  
**Ext. Gross Area:** 2,636

**Building Code:** T7975091627  
**Building Name:** SLEEPY EYE - TRUCK STATION  
**Facility Condition Index:** 0.25 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 900 Cedar Street NE  
**City Code:** Sleepy Eye

**Current Replacement Value:** \$694,612  
**Deferred Maintenance:** \$174,670  
**Ext. Gross Area:** 4,338

**Building Code:** T7975091631  
**Building Name:** SLEEPY EYE - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 900 Cedar Street NE  
**City Code:** Sleepy Eye

**Current Replacement Value:** \$285,443  
**Deferred Maintenance:** \$36,418  
**Ext. Gross Area:** 3,088

**Building Code:** T7975091647  
**Building Name:** SLEEPY EYE - BRINE BLDG  
**Facility Condition Index:** 0.33 - **Poor**

**Cost Model Name:** Utility Shed  
**Address:** 900 Cedar Street NE  
**City Code:** SLEEPY EYE

**Current Replacement Value:** \$25,477  
**Deferred Maintenance:** \$8,407  
**Ext. Gross Area:** 0

**Site: T797W91629 - Adrian**

**Building Code:** T7975021623  
**Building Name:** ADRIAN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 504 County Road 35  
**City Code:** ADRIAN

**Current Replacement Value:** \$241,805  
**Deferred Maintenance:** \$39,061  
**Ext. Gross Area:** 2,496

**Building Code:** T7975091629  
**Building Name:** ADRIAN - TRUCK STATION  
**Facility Condition Index:** 0.20 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 504 County Road 35  
**City Code:** ADRIAN

**Current Replacement Value:** \$1,053,788  
**Deferred Maintenance:** \$213,975  
**Ext. Gross Area:** 6,224



**Building Code:** T7975091630  
**Building Name:** ADRIAN - POLE STORAGE BLDG  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 504 County Road 35  
**City Code:** ADRIAN

**Current Replacement Value:** \$399,751  
**Deferred Maintenance:** \$67,191  
**Ext. Gross Area:** 4,177

***Site: T797W91632 - Saint James***

**Building Code:** T7975021625  
**Building Name:** ST JAMES - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1513 - 7th Avenue South  
**City Code:** St. James

**Current Replacement Value:** \$394,123  
**Deferred Maintenance:** \$33,356  
**Ext. Gross Area:** 3,952

**Building Code:** T7975091632  
**Building Name:** ST JAMES - TRUCK STATION  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1513 - 7th Avenue South  
**City Code:** St. James

**Current Replacement Value:** \$2,479,936  
**Deferred Maintenance:** \$458,692  
**Ext. Gross Area:** 14,144

**Building Code:** T7975091633  
**Building Name:** ST JAMES - POLE STORAGE BLDG  
**Facility Condition Index:** 0.09 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1513 - 7th Avenue South  
**City Code:** ST. JAMES

**Current Replacement Value:** \$423,737  
**Deferred Maintenance:** \$36,547  
**Ext. Gross Area:** 4,500

**Building Code:** T7975091648  
**Building Name:** ST JAMES - BRINE BUILDING  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 1513 - 7th Avenue South  
**City Code:** ST. JAMES

**Current Replacement Value:** \$26,674  
**Deferred Maintenance:** \$8,802  
**Ext. Gross Area:** 0

***Site: T797W91694 - Sherburn***

**Building Code:** T7975021631  
**Building Name:** SHERBURN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 221 FAIRMONT AVENUE  
**City Code:** SHERBURN

**Current Replacement Value:** \$102,980  
**Deferred Maintenance:** \$7,514  
**Ext. Gross Area:** 1,054

***Site: T797W91698 - Storden***

**Building Code:** T7975021618  
**Building Name:** STORDEN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 100 MN Hwy 30  
**City Code:** Storden

**Current Replacement Value:** \$87,094  
**Deferred Maintenance:** \$15,073  
**Ext. Gross Area:** 1,025

***Site: T797W92119 - Worthington***

**Building Code:** T7975092119  
**Building Name:** WORTHINGTON - WEIGH SCALE BLDG  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** I-90 EAST OF WORTHINGTON  
**City Code:** WORTHINGTON

**Current Replacement Value:** \$429,192  
**Deferred Maintenance:** \$122,072  
**Ext. Gross Area:** 2,747

**Building Code:** T7975092145  
**Building Name:** WORTHINGTON WS - MISC STORAGE  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:**  
**City Code:** WORTHINGTON

**Current Replacement Value:** \$93,558  
**Deferred Maintenance:** \$1,871  
**Ext. Gross Area:** 960

**Site: T797WR136780 - Beaver Creek RA-TIC**

**Building Code:** T7975095750  
**Building Name:** BEAVER CREEK - REST AREA - TIC  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** BOX 90  
**City Code:** BEAVER CREEK

**Current Replacement Value:** \$1,144,735  
**Deferred Maintenance:** \$237,698  
**Ext. Gross Area:** 3,655

**Building Code:** T7975095782  
**Building Name:** BEAVER CREEK - RA - TIC - MISC STG  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Single-story Work Facility  
**Address:** BOX 90  
**City Code:** BEAVER CREEK

**Current Replacement Value:** \$32,054  
**Deferred Maintenance:** \$6,703  
**Ext. Gross Area:** 320

**Building Code:** T7975095787  
**Building Name:** BBEAVER CREEK - RA - TIC - MISC STG  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** BOX 90  
**City Code:** BEAVER CREEK

**Current Replacement Value:** \$38,752  
**Deferred Maintenance:** \$2,133  
**Ext. Gross Area:** 320

**Site: T797WR165380 - Adrian West RA**

**Building Code:** T7975095751  
**Building Name:** Adrian West - Rest Area  
**Facility Condition Index:** 0.26 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 14396 I-90 WESTBOUND  
**City Code:** ADRIAN

**Current Replacement Value:** \$375,807  
**Deferred Maintenance:** \$97,758  
**Ext. Gross Area:** 1,150

**Building Code:** T7975095785  
**Building Name:** ARIAN WB -MISC STORAGE  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 14396 I-90 WESTBOUND  
**City Code:** ADRIAN

**Current Replacement Value:** \$37,741  
**Deferred Maintenance:** \$755  
**Ext. Gross Area:** 225

**Site: T797WR175380 - Adrian East RA**

**Building Code:** T7975095752  
**Building Name:** Adrian East - Rest Area  
**Facility Condition Index:** 0.25 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 13605 I-90 EASTBOUND  
**City Code:** ADRIAN

**Current Replacement Value:** \$375,807  
**Deferred Maintenance:** \$94,024  
**Ext. Gross Area:** 1,150

**Building Code:** T7975095784  
**Building Name:** ADRIAN EAST - MISC STRG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 13605 I-90 EASTBOUND  
**City Code:** ADRIAN

**Current Replacement Value:** \$37,741  
**Deferred Maintenance:** \$755  
**Ext. Gross Area:** 225

**Site: T797WR283280 - Clear Lake RA**

**Building Code:** T7975095753  
**Building Name:** Clear Lake - Rest Area  
**Facility Condition Index:** 0.30 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 49567 I-90 EASTBOUND  
**City Code:** JACKSON

**Current Replacement Value:** \$384,280  
**Deferred Maintenance:** \$114,958  
**Ext. Gross Area:** 1,150

**Building Code:** T7975095786  
**Building Name:** CLEAR LAKE - REST AREA - MISC STRG  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 49567 I-90 EASTBOUND  
**City Code:** JACKSON

**Current Replacement Value:** \$37,741  
**Deferred Maintenance:** \$755  
**Ext. Gross Area:** 205

**Site: T797WR293280 - Des Moines RA**

**Building Code:** T7975095754  
**Building Name:** Des Moines - Rest Area  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 52688 I-90 WESTBOUND  
**City Code:** JACKSON

**Current Replacement Value:** \$724,017  
**Deferred Maintenance:** \$150,799  
**Ext. Gross Area:** 2,927

**Site: T797WR669723 - Watonwan RA**

**Building Code:** T7975095771  
**Building Name:** Watonwan - Rest Area  
**Facility Condition Index:** 0.38 - *Poor*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 77588 MN HWY 60  
**City Code:** St. James

**Current Replacement Value:** \$399,942  
**Deferred Maintenance:** \$153,905  
**Ext. Gross Area:** 1,576

**Site: T797WR795305 - Worthington RA**

**Building Code:** T7975095770  
**Building Name:** Worthington - Rest Area - TIC  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Single-story Office/Public Access Facility  
**Address:** 29328 MN HWY 59  
**City Code:** WORTHINGTON

**Current Replacement Value:** \$731,355  
**Deferred Maintenance:** \$126,392  
**Ext. Gross Area:** 2,457

**Site: T798A21001 - Willmar Southwest**

**Building Code:** T7980021001  
**Building Name:** WILLMAR - SW - SALT/SAND STORAGE  
**Facility Condition Index:** 0.59 - *Crisis*

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** WILLMAR

**Current Replacement Value:** \$168,933  
**Deferred Maintenance:** \$99,788  
**Ext. Gross Area:** 1,803

**Site: T798A21016 - New London**

**Building Code:** T7980021016  
**Building Name:** NEW LONDON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** JCT TH23 And CO RD31 2MI N  
**City Code:** NEW LONDON

**Current Replacement Value:** \$235,986  
**Deferred Maintenance:** \$23,840  
**Ext. Gross Area:** 2,219

**Site: T798A21516 - Florence**

**Building Code:** T7980021516  
**Building Name:** FLORENCE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** JCT TH23 And TH14  
**City Code:** FLORENCE

**Current Replacement Value:** \$166,327  
**Deferred Maintenance:** \$26,284  
**Ext. Gross Area:** 1,614

**Site: T798A91015 - Olivia**

**Building Code:** T7980021006  
**Building Name:** OLIVIA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1509 LINCOLN ST. W.  
**City Code:** OLIVIA

**Current Replacement Value:** \$100,308  
**Deferred Maintenance:** \$14,508  
**Ext. Gross Area:** 1,080

**Building Code:** T7980021519  
**Building Name:** OLIVIA - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1509 LINCOLN ST. W.  
**City Code:** OLIVIA

**Current Replacement Value:** \$844,644  
**Deferred Maintenance:** \$61,440  
**Ext. Gross Area:** 9,166

**Building Code:** T7980091015  
**Building Name:** OLIVIA - TRUCK STATION  
**Facility Condition Index:** 0.19 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1509 LINCOLN ST. W.  
**City Code:** OLIVIA

**Current Replacement Value:** \$1,541,796  
**Deferred Maintenance:** \$297,144  
**Ext. Gross Area:** 7,619

**Site: T798A91020 - Clara City**

**Building Code:** T7980021007  
**Building Name:** CLARA CITY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.15 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 20 - 1st Ave NE  
**City Code:** CHISHOLM

**Current Replacement Value:** \$87,596  
**Deferred Maintenance:** \$13,180  
**Ext. Gross Area:** 1,050

**Building Code:** T7980091020  
**Building Name:** CLARA CITY - TRUCK STATION  
**Facility Condition Index:** 0.20 - [Average](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 20 - 1ST AVE NE  
**City Code:** CLARA CITY

**Current Replacement Value:** \$655,285  
**Deferred Maintenance:** \$132,497  
**Ext. Gross Area:** 4,320

**Site: T798A91023 - Willmar**

**Building Code:** T7980021012  
**Building Name:** WILLMAR - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$1,009,175  
**Deferred Maintenance:** \$105,082  
**Ext. Gross Area:** 10,923

**Building Code:** T7980021017  
**Building Name:** WILLMAR - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$226,202  
**Deferred Maintenance:** \$25,114  
**Ext. Gross Area:** 2,328

**Building Code:** T7980091023  
**Building Name:** WILLMAR - DISTRICT HEADQUARTERS  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$19,539,086  
**Deferred Maintenance:** \$2,524,583  
**Ext. Gross Area:** 106,870

**Building Code:** T7980091024  
**Building Name:** WILLMAR - POLE STORAGE BLDG  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$334,745  
**Deferred Maintenance:** \$37,949  
**Ext. Gross Area:** 8,493

**Building Code:** T7980091027  
**Building Name:** WILLMAR - POLE STORAGE BLDG  
**Facility Condition Index:** 0.13 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$414,350  
**Deferred Maintenance:** \$53,656  
**Ext. Gross Area:** 4,184

**Building Code:** T7980091029  
**Building Name:** WILLMAR - HAZARD MATL STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Utility Shed  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$23,750  
**Deferred Maintenance:** \$475  
**Ext. Gross Area:** 133

**Building Code:** T7980091032  
**Building Name:** WILLMAR - MISC STORAGE  
**Facility Condition Index:** 0.05 - [Good](#)

**Building Code:** T7980091034  
**Building Name:** WILLMAR - MISC STORAGE  
**Facility Condition Index:** 0.08 - [Good](#)

**Building Code:** T7980091038  
**Building Name:** WILLMAR - MISC STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Building Code:** T7980091042  
**Building Name:** WILLMAR - MISC STORAGE  
**Facility Condition Index:** 0.05 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Cost Model Name:** Single-story Work Facility  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 2505 TRANSPORTATION RD  
**City Code:** WILLMAR

**Current Replacement Value:** \$27,038  
**Deferred Maintenance:** \$1,411  
**Ext. Gross Area:** 513

**Current Replacement Value:** \$81,874  
**Deferred Maintenance:** \$6,529  
**Ext. Gross Area:** 779

**Current Replacement Value:** \$170,245  
**Deferred Maintenance:** \$3,688  
**Ext. Gross Area:** 0

**Current Replacement Value:** \$259,420  
**Deferred Maintenance:** \$12,034  
**Ext. Gross Area:** 0

***Site: T798A91025 - Milan***

**Building Code:** T7980021019  
**Building Name:** MILAN - SALT/SAND STORAGE  
**Facility Condition Index:** 0.05 - [Good](#)

**Building Code:** T7980091025  
**Building Name:** MILAN - MISC STORAGE  
**Facility Condition Index:** 0.05 - [Excellent](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** JCT TH7 And TH59  
**City Code:** MILAN

**Cost Model Name:** Single-story Work Facility  
**Address:** JCT TH7 And TH59  
**City Code:** MILAN

**Current Replacement Value:** \$51,379  
**Deferred Maintenance:** \$2,755  
**Ext. Gross Area:** 550

**Current Replacement Value:** \$87,099  
**Deferred Maintenance:** \$3,948  
**Ext. Gross Area:** 773

***Site: T798A91028 - Montevideo***

**Building Code:** T7980021009  
**Building Name:** MONTEVIDEO - SALT/SAND STORAGE  
**Facility Condition Index:** 0.10 - [Good](#)

**Building Code:** T7980091028  
**Building Name:** MONTEVIDEO - TRUCK STATION  
**Facility Condition Index:** 0.15 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 35 1ST ST W  
**City Code:** MONTEVIDEO

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 35 1ST ST W  
**City Code:** MONTEVIDEO

**Current Replacement Value:** \$843,489  
**Deferred Maintenance:** \$83,651  
**Ext. Gross Area:** 8,794

**Current Replacement Value:** \$1,234,304  
**Deferred Maintenance:** \$182,407  
**Ext. Gross Area:** 6,457

***Site: T798A91030 - Hutchinson***

**Building Code:** T7980021014  
**Building Name:** HUTCHINSON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1400 Adams Street SE  
**City Code:** HUTCHINSON

**Current Replacement Value:** \$1,272,339  
**Deferred Maintenance:** \$147,615  
**Ext. Gross Area:** 12,497

**Building Code:** T7980091030  
**Building Name:** HUTCHINSON - JOINT - TRUCK STATION  
**Facility Condition Index:** 0.10 - [Good](#)

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1400 Adams Street SE  
**City Code:** HUTCHINSON

**Current Replacement Value:** \$12,595,932  
**Deferred Maintenance:** \$1,254,212  
**Ext. Gross Area:** 26,161

**Building Code:** T7980091033  
**Building Name:** HUTCHINSON - POLE STORAGE BLDG  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1400 Adams Street SE  
**City Code:** HUTCHINSON

**Current Replacement Value:** \$810,846  
**Deferred Maintenance:** \$44,695  
**Ext. Gross Area:** 8,722

**Building Code:** T7980091035  
**Building Name:** HUTCHINSON - SALT BRINE BLDG - MISC  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1400 Adams Street SE  
**City Code:** HUTCHINSON

**Current Replacement Value:** \$299,725  
**Deferred Maintenance:** \$17,429  
**Ext. Gross Area:** 1,860

**Site: T798A91031 - Glencoe**

**Building Code:** T7980021003  
**Building Name:** GLENCOE - OLD SALT/SAND STORAGE  
**Facility Condition Index:** 0.24 - [Average](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:**  
**City Code:** GLENCOE

**Current Replacement Value:** \$135,292  
**Deferred Maintenance:** \$31,958  
**Ext. Gross Area:** 1,050

**Building Code:** T7980021015  
**Building Name:** GLENCOE - JOINT - SALT/SAND  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 109 8th STREET EAST  
**City Code:** GLENCOE

**Current Replacement Value:** \$795,104  
**Deferred Maintenance:** \$54,410  
**Ext. Gross Area:** 9,907

**Building Code:** T7980091003  
**Building Name:** GLENCOE - OLD TRUCK STATION  
**Facility Condition Index:** 0.33 - [Poor](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:**  
**City Code:** GLENCOE

**Current Replacement Value:** \$274,808  
**Deferred Maintenance:** \$90,102  
**Ext. Gross Area:** 10,118

**Building Code:** T7980091031  
**Building Name:** GLENCOE - JOINT - TRUCK ST  
**Facility Condition Index:** 0.11 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 310 13th Street West  
**City Code:** GLENCOE

**Current Replacement Value:** \$1,773,596  
**Deferred Maintenance:** \$197,204  
**Ext. Gross Area:** 9,422

**Building Code:** T7980091039  
**Building Name:** GLENCOE - LOADER STORAGE BLDG  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 310 13th Street West  
**City Code:** GLENCOE

**Current Replacement Value:** \$76,558  
**Deferred Maintenance:** \$5,213  
**Ext. Gross Area:** 640

**Building Code:** T7980091040  
**Building Name:** GLENCOE - MISC STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 310 13th Street West  
**City Code:** GLENCOE

**Current Replacement Value:** \$23,180  
**Deferred Maintenance:** \$464  
**Ext. Gross Area:** 0

**Site: T798A91036 - LITCHFIELD**

**Building Code:** T7980021018  
**Building Name:** LITCHFIELD - SALT/SAND STORAGE  
**Facility Condition Index:** 0.02 - [Excellent](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 422 South Johnson Drive  
**City Code:** LITCHFIELD

**Current Replacement Value:** \$792,790  
**Deferred Maintenance:** \$16,783  
**Ext. Gross Area:** 12,120

**Building Code:** T7980091036  
**Building Name:** LITCHFIELD - TRUCK STATION  
**Facility Condition Index:** 0.07 - **Good**

**Building Code:** T7980091041  
**Building Name:** LITCHFIELD-Unheated Storage Bldg.  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 422 South Johnson Drive  
**City Code:** LITCHFIELD

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 422 South Johnson Drive  
**City Code:** LITCHFIELD

**Current Replacement Value:** \$8,683,994  
**Deferred Maintenance:** \$604,411  
**Ext. Gross Area:** 35,882

**Current Replacement Value:** \$1,079,168  
**Deferred Maintenance:** \$21,583  
**Ext. Gross Area:** 10,220

**Site: T798A91514 - IVANHOE**

**Building Code:** T7980021503  
**Building Name:** IVANHOE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - **Good**

**Building Code:** T7980021520  
**Building Name:** IVANHOE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - **Good**

**Building Code:** T7980091514  
**Building Name:** IVANHOE - EQUIPMENT STORAGE  
**Facility Condition Index:** 0.30 - **Poor**

**Building Code:** T7980091549  
**Building Name:** IVANHOE - BRINE BLDG  
**Facility Condition Index:** 0.06 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 513 WEST DIVISION  
**City Code:** IVANHOE

**Cost Model Name:** Open Air Storage Structure  
**Address:** 513 WEST DIVISION  
**City Code:** IVANHOE

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 513 WEST DIVISION  
**City Code:** IVANHOE

**Cost Model Name:** Single-story Work Facility  
**Address:** 513 WEST DIVISION  
**City Code:** IVANHOE

**Current Replacement Value:** \$89,456  
**Deferred Maintenance:** \$5,643  
**Ext. Gross Area:** 1,080

**Current Replacement Value:** \$794,391  
**Deferred Maintenance:** \$54,361  
**Ext. Gross Area:** 8,200

**Current Replacement Value:** \$513,696  
**Deferred Maintenance:** \$155,355  
**Ext. Gross Area:** 2,695

**Current Replacement Value:** \$51,829  
**Deferred Maintenance:** \$3,083  
**Ext. Gross Area:** 361

**Site: T798A91517 - Lake Benton**

**Building Code:** T7980021505  
**Building Name:** LAKE BENTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.24 - **Average**

**Building Code:** T7980091517  
**Building Name:** LAKE BENTON - STORAGE FACILITY  
**Facility Condition Index:** 0.24 - **Average**

**Building Code:** T7980091551  
**Building Name:** LAKE BENTON - TRUCK STATION  
**Facility Condition Index:** 0.06 - **Good**

**Building Code:** T7980091555  
**Building Name:** LAKE BENTON - MISC STORAGE  
**Facility Condition Index:** 0.03 - **Excellent**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 308 West Benton  
**City Code:** LAKE BENTON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 308 West Benton  
**City Code:** LAKE BENTON

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 308 West Benton  
**City Code:** LAKE BENTON

**Cost Model Name:** Utility Shed  
**Address:** 308 West Benton  
**City Code:** LAKE BENTON

**Current Replacement Value:** \$93,436  
**Deferred Maintenance:** \$22,600  
**Ext. Gross Area:** 1,080

**Current Replacement Value:** \$346,640  
**Deferred Maintenance:** \$83,370  
**Ext. Gross Area:** 2,000

**Current Replacement Value:** \$463,667  
**Deferred Maintenance:** \$28,361  
**Ext. Gross Area:** 3,000

**Current Replacement Value:** \$24,700  
**Deferred Maintenance:** \$719  
**Ext. Gross Area:** 236



**Site: T798A91521 - Madison**

**Building Code:** T7980021013  
**Building Name:** MADISON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.16 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 696 1ST ST E  
**City Code:** MADISON

**Current Replacement Value:** \$916,154  
**Deferred Maintenance:** \$148,795  
**Ext. Gross Area:** 8,855

**Building Code:** T7980091506  
**Building Name:** MADISON - MISC STORAGE  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 696 1ST ST E  
**City Code:** MADISON

**Current Replacement Value:** \$115,381  
**Deferred Maintenance:** \$16,098  
**Ext. Gross Area:** 1,024

**Building Code:** T7980091521  
**Building Name:** MADISON - TRUCK STATION  
**Facility Condition Index:** 0.14 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 696 1ST ST E  
**City Code:** MADISON

**Current Replacement Value:** \$1,067,995  
**Deferred Maintenance:** \$144,440  
**Ext. Gross Area:** 5,818

**Building Code:** T7980091547  
**Building Name:** MADISON - MISC STORAGE  
**Facility Condition Index:** 0.11 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 696 1ST ST E  
**City Code:** MADISON

**Current Replacement Value:** \$62,347  
**Deferred Maintenance:** \$6,871  
**Ext. Gross Area:** 440

**Site: T798A91523 - Marshall**

**Building Code:** T7980021507  
**Building Name:** MARSHALL - SALT/SAND STORAGE  
**Facility Condition Index:** 0.21 - *Average*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$163,512  
**Deferred Maintenance:** \$33,623  
**Ext. Gross Area:** 1,890

**Building Code:** T7980021523  
**Building Name:** MARSHALL - SALT/SAND STORAGE  
**Facility Condition Index:** 0.06 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$1,288,818  
**Deferred Maintenance:** \$79,429  
**Ext. Gross Area:** 14,942

**Building Code:** T7980091523  
**Building Name:** MARSHALL - TRUCK STATION MULTI-USE  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Joint Office/Warehouse Facility  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$14,716,257  
**Deferred Maintenance:** \$2,503,348  
**Ext. Gross Area:** 61,562

**Building Code:** T7980091524  
**Building Name:** MARSHALL - MISC STORAGE  
**Facility Condition Index:** 0.38 - *Poor*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$58,569  
**Deferred Maintenance:** \$22,403  
**Ext. Gross Area:** 560

**Building Code:** T7980091532  
**Building Name:** MARSHALL - MISC STORAGE  
**Facility Condition Index:** 0.28 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$318,489  
**Deferred Maintenance:** \$90,590  
**Ext. Gross Area:** 3,120

**Building Code:** T7980091535  
**Building Name:** MARSHALL - MISC STORAGE  
**Facility Condition Index:** 0.19 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$1,440,298  
**Deferred Maintenance:** \$273,242  
**Ext. Gross Area:** 8,167

**Building Code:** T7980091537  
**Building Name:** MARSHALL - MISC STORAGE  
**Facility Condition Index:** 0.17 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$197,913  
**Deferred Maintenance:** \$33,626  
**Ext. Gross Area:** 1,600

**Building Code:** T7980091543  
**Building Name:** MARSHALL - POLE STORAGE BLDG  
**Facility Condition Index:** 0.07 - *Good*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$252,627  
**Deferred Maintenance:** \$17,273  
**Ext. Gross Area:** 2,601

**Building Code:** T7980091548  
**Building Name:** MARSHALL - BRINE BLDG  
**Facility Condition Index:** 0.05 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$259,112  
**Deferred Maintenance:** \$12,352  
**Ext. Gross Area:** 1,757

**Building Code:** T7980091556  
**Building Name:** MARSHALL -HAZMAT BLDG  
**Facility Condition Index:** 0.33 - *Poor*

**Cost Model Name:** Utility Shed  
**Address:** 1800 EAST COLLEGE DRIVE  
**City Code:** MARSHALL

**Current Replacement Value:** \$25,000  
**Deferred Maintenance:** \$8,250  
**Ext. Gross Area:** 135

**Site: T798A91534 - SLAYTON**

**Building Code:** T7980021508  
**Building Name:** SLAYTON - SALT/SAND STORAGE  
**Facility Condition Index:** 0.12 - *Good*

**Cost Model Name:** Open Air Storage Structure  
**Address:** 891 US Hwy 59  
**City Code:** SLAYTON

**Current Replacement Value:** \$435,870  
**Deferred Maintenance:** \$54,016  
**Ext. Gross Area:** 4,284

**Building Code:** T7980091550  
**Building Name:** SLAYTON - MISC STORAGE  
**Facility Condition Index:** 0.03 - *Excellent*

**Cost Model Name:** Single-story Work Facility  
**Address:** 891 US Hwy 59  
**City Code:** SLAYTON

**Current Replacement Value:** \$161,947  
**Deferred Maintenance:** \$4,144  
**Ext. Gross Area:** 1,210

**Building Code:** T7980091553  
**Building Name:** SLAYTON-TRUCK STATION(NEW)  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 891 US Hwy 59  
**City Code:** SLAYTON

**Current Replacement Value:** \$958,745  
**Deferred Maintenance:** \$20,688  
**Ext. Gross Area:** 5,888

**Site: T798A91536 - REDWOOD FALLS**

**Building Code:** T7980021512  
**Building Name:** REDWOOD FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.08 - *Good*

**Cost Model Name:** Single-story Work Facility  
**Address:** 217 QUALITY DRIVE  
**City Code:** REDWOOD FALLS

**Current Replacement Value:** \$241,971  
**Deferred Maintenance:** \$19,204  
**Ext. Gross Area:** 1,440

**Building Code:** T7980021525  
**Building Name:** REDWOOD FALLS-Salt/Sand Storage  
**Facility Condition Index:** 0.02 - *Excellent*

**Cost Model Name:** Fabric Structure  
**Address:** 217 QUALITY DRIVE  
**City Code:** REDWOOD FALLS

**Current Replacement Value:** \$498,058  
**Deferred Maintenance:** \$9,961  
**Ext. Gross Area:** 6,403

**Building Code:** T7980091536  
**Building Name:** REDWOOD FALLS - TRUCK STATION  
**Facility Condition Index:** 0.18 - *Average*

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 217 QUALITY DRIVE  
**City Code:** REDWOOD FALLS

**Current Replacement Value:** \$861,992  
**Deferred Maintenance:** \$151,196  
**Ext. Gross Area:** 5,305

**Building Code:** T7980091538  
**Building Name:** REDWOOD FALLS - MISC STORAGE  
**Facility Condition Index:** 0.10 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 217 QUALITY DRIVE  
**City Code:** REDWOOD FALLS

**Current Replacement Value:** \$46,497  
**Deferred Maintenance:** \$4,797  
**Ext. Gross Area:** 411

**Building Code:** T7980091546  
**Building Name:** REDWOOD FALLS - MISC STORAGE  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 217 QUALITY DRIVE  
**City Code:** REDWOOD FALLS

**Current Replacement Value:** \$74,602  
**Deferred Maintenance:** \$5,159  
**Ext. Gross Area:** 610

**Site: T798A91539 - Granite Falls**

**Building Code:** T7980021513  
**Building Name:** GRANITE FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 5530 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$256,584  
**Deferred Maintenance:** \$44,246  
**Ext. Gross Area:** 2,650

**Building Code:** T7980021521  
**Building Name:** GRANITE FALLS - SALT/SAND STORAGE  
**Facility Condition Index:** 0.11 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 5530 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$983,004  
**Deferred Maintenance:** \$110,119  
**Ext. Gross Area:** 9,734

**Building Code:** T7980091539  
**Building Name:** GRANITE FALLS - TRUCK STATION  
**Facility Condition Index:** 0.17 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 5530 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$1,079,684  
**Deferred Maintenance:** \$183,716  
**Ext. Gross Area:** 6,155

**Building Code:** T7980091544  
**Building Name:** GRANITE FALLS - MISC STORAGE  
**Facility Condition Index:** 0.07 - **Good**

**Cost Model Name:** Single-story Work Facility  
**Address:** 5530 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$44,627  
**Deferred Maintenance:** \$3,081  
**Ext. Gross Area:** 256

**Building Code:** T7980091557  
**Building Name:** GRANITE FALLS - MISC STORAGE  
**Facility Condition Index:** 0.02 - **Excellent**

**Cost Model Name:** Utility Shed  
**Address:** 5530 HWY 67  
**City Code:** GRANITE FALLS

**Current Replacement Value:** \$25,527  
**Deferred Maintenance:** \$511  
**Ext. Gross Area:** 0

**Site: T798A91541 - Tracy**

**Building Code:** T7980021517  
**Building Name:** TRACY - SALT/SAND STORAGE  
**Facility Condition Index:** 0.13 - **Good**

**Cost Model Name:** Open Air Storage Structure  
**Address:** 1040 - 4TH STREET E  
**City Code:** TRACY

**Current Replacement Value:** \$669,042  
**Deferred Maintenance:** \$87,427  
**Ext. Gross Area:** 6,905

**Building Code:** T7980091541  
**Building Name:** TRACY - TRUCK STATION  
**Facility Condition Index:** 0.16 - **Average**

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 1040 - 4TH STREET E  
**City Code:** TRACY

**Current Replacement Value:** \$966,110  
**Deferred Maintenance:** \$154,095  
**Ext. Gross Area:** 5,111

**Site: T798A91542 - Pipestone**

**Building Code:** T7980021518  
**Building Name:** PIPESTONE - SALT/SAND STORAGE  
**Facility Condition Index:** 0.07 - [Good](#)

**Cost Model Name:** Open Air Storage Structure  
**Address:** 604 - 4TH ST W  
**City Code:** PIPESTONE

**Current Replacement Value:** \$825,658  
**Deferred Maintenance:** \$54,987  
**Ext. Gross Area:** 8,200

**Building Code:** T7980091542  
**Building Name:** PIPESTONE - TRUCK STATION  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 604 - 4TH ST W  
**City Code:** PIPESTONE

**Current Replacement Value:** \$1,505,693  
**Deferred Maintenance:** \$131,519  
**Ext. Gross Area:** 8,808

**Building Code:** T7980091545  
**Building Name:** PIPESTONE - MISC STORAGE  
**Facility Condition Index:** 0.09 - [Good](#)

**Cost Model Name:** Single-story Work Facility  
**Address:** 604 - 4TH ST W  
**City Code:** PIPESTONE

**Current Replacement Value:** \$82,000  
**Deferred Maintenance:** \$7,122  
**Ext. Gross Area:** 625

***Site: T798A91552 - Ivanhoe Joint Use***

**Building Code:** T7980091552  
**Building Name:** IVANHOE - JOINT USE-TRUCK STATION  
**Facility Condition Index:** 0.06 - [Good](#)

**Cost Model Name:** Butler-style Warehouse Building  
**Address:** 319 NO REBECCA ST  
**City Code:** IVANHOE

**Current Replacement Value:** \$1,353,197  
**Deferred Maintenance:** \$81,873  
**Ext. Gross Area:** 19,983