# MINNESOTA ENTERPRISE REAL PROPERTY FACILITY CONDITION ASSESSMENT (FCA) REPORT

## 2018

DEPARTMENT OF ADMINISTRATION
ENTERPRISE REAL PROPERTY

## ABSTRACT:

The Minnesota Enterprise Real Property Facility Condition Assessment Report is a comprehensive report depicting the conditions of all of Minnesota State's owned buildings in a standardized and objective means. This report is intended to be used to compare agency to agency buildings, and to justify bonding projects and asset preservation funding.

The report is derived from a single enterprise database and application (ARCHIBUS). All assessment data is gathered using the standardized Minnesota Facility Condition Assessment (FCA) Process. This process was a combined effort developed by the Enterprise Real Property Program (ERPP), Facility Engineering Associates (FEA), and a steering team led by key agency representatives in 2013.


## MINNESOTA FCA PROCESS:

The standardized Minnesota FCA Process is based on the Backlog of Maintenance and Repair (BMAR) FCA Process approach.

> *"The "BMAR FCA Process" is named after the process developed by NASA in the 1990s in response to the need to develop a more reliable FCA process with a reasonable level of effort."*
>
> *(FEA, 2013)*

All costs generated by the Minnesota FCA Process and ARCHIBUS application are derived from up-to-date RS-Means Construction Costs. The BMAR approach requires the following to develop and implement the process:

- **Development of 23 Cost Models;**
- **Standardizing how Current Replacement Value (CRV) will be calculated;**
- **An agreed upon 1-5 scoring method;**
- **Standardizing how Deferred Maintenance (DM) will be calculated;**
- **Standardizing how Adjusted Deferred Maintenance (ADM) will be calculated;**
- **Standardizing a Facility Condition Index (FCI) calculation and ratings;**
- **Standardizing a Reference Field Guide.**

## 23 Cost Models:

Developed to address the majority of agency's buildings. The cost models are numbered M01 through M23 and each is based on a combination of type of construction and potential uses. The models are designed based on Level 3 UniFormat II building classification systems. All costs were produced from RS-Means Construction Cost data. Cost data was applied to the cost model's UniFormat classification system ids called cost model matrix ids, or also referred to as system unit costs. The cost model matrix id costs/system unit costs are used to calculate CRV, DM and FCI.

## Current Replacement Value (CRV):

Calculated dollar amount representing the estimated cost to replace a building. CRV is based on RS-Means construction costs for basic Labor, Materials, and Equipment. (CRV costs are estimates and DO NOT depict actual construction project costs.) A system quantity is needed from the building being assessed and is applied as a multiplying factor to the system unit cost. Example: a system quantity for a building's foundation would be 100,000 square feet which is the building's footprint square footage. CRV is calculated as…

**BUILDING CRV = (SUM OF SYSTEMS CRV)**

**SYSTEMS CRV = (SYSTEM UNIT COST * SYSTEM QUANTITY)**

## 1-5 scoring method:

Systems are scored from 5 (best) to 1 (worst). The score is determined from a combination of conditions based on the established deficiency ranges and the rules established in the MN Field Reference Guide.

## Deferred Maintenance (DM):

Based on the standardization of cost models and the adoption of a rule-based rating system. The DM for a given system is algorithm-based, as required of a 'best practice' FCA process. (DM costs are estimates and DO NOT depict actual construction project costs.) Applied to each system for a given building, the process yields justifiable, repeatable results. DM is calculated as…

**BUILDING DM = (SUM OF SYSTEMS DM)**

**SYSTEMS DM = (SYSTEM CRV * %DM)**

*Condition rating 1 = 100% DM*
*Condition rating 2 = 75% DM*
*Condition rating 3 = 33% DM*
*Condition rating 4 = 10% DM*
*Condition rating 5 = 2% DM*

## Adjusted Deferred Maintenance (ADM):

The ADM is a lower and more reasonable value than the DM value. It is intended to derive only the local condition rating 1 and 2 items (Crisis and Poor) from all systems regardless of the system rating. The ADM value is perceived as the backlog needed to be taken care of to bring a building's overall condition rating to an acceptable Fair rating. (ADM costs are estimates and DO NOT depict actual construction project costs.) ADM is calculated as…

**BUILDING ADM = (SUM OF SYSTEMS ADM)**

**SYSTEMS ADM = (SYSTEM CRV * %CRV)**

*Condition rating 1 = 100% CRV*
*Condition rating 2 = 100% CRV*
*Condition rating 3 = 3.75% CRV*
*Condition rating 4 = 1.00% CRV*
*Condition rating 5 = 0.25% CRV*

## Facility Condition Index (FCI) calculation and ratings:

The industry-standard FCI is the condition metric calculated for each building. The FCI provides an excellent means for maintenance prioritization based on overall building conditions, and provides insight to problem areas, neglected building systems, or where maintenance needs to be applied based on limited funds. FCI is calculated as…

**BUILDING FCI = (SUM OF BUILDING DM) / (SUM OF BUILDING CRV)**

**Rating Scale:**

*Excellent* = *Building FCI < 0.05*
*Good* = *0.05 < Building FCI < 0.15*
*Fair* = *0.15 < Building FCI < 0.30*
*Poor* = *0.30 < Building FCI < 0.50*
*Crisis* = *Building FCI > 0.50*

## Reference Field Guide:

Each assessor receives a Reference Field Guide in which they are trained to use throughout the entire assessment process. The Reference Field Guide along with calibration training maintains objectivity to the FCA process. The guide contains all UniFormat systems that should be evaluated with clear criteria for rating the condition of each system.

# SUMMARY

## MINNESOTA OWNED BUILDINGS:

- 19 State Agencies with custodial control
- 6,073 buildings
- 36,873,373 square feet

## FCA DATA:

- 89% of buildings assessed
- $8,861,371,148 Current Replacement Value
- $1,592,902,995 Deferred Maintenance Value
- $689,329,343 Adjusted Deferred Maintenance Value
- 41 years of age (average age of buildings)
- 45% buildings over the age of 40 years

## REPORT DETAILS

| Agency | Percentage of Completed FCA Square Footage | Totals for agency | | Totals for Completed FCAs | |
|---|---|---|---|---|---|
| B04-Department of Agriculture | 100% | Total Building Count: | 1 | Total Completed Building FCA Count: | 1 |
| | | Total Gross Square Footage: | 8,304 | Total Completed FCA Square Footage: | 8,304 |
| B13-Department of Commerce | 100% | Total Building Count: | 1 | Total Completed Building FCA Count: | 1 |
| | | Total Gross Square Footage: | 3,216 | Total Completed FCA Square Footage: | 3,216 |
| B22-Employment and Economic Development | 100% | Total Building Count: | 2 | Total Completed Building FCA Count: | 2 |
| | | Total Gross Square Footage: | 27,051 | Total Completed FCA Square Footage: | 27,051 |
| B43-Iron Range Resources | 84% | Total Building Count: | 65 | Total Completed Building FCA Count: | 61 |
| | | Total Gross Square Footage: | 290,851 | Total Completed FCA Square Footage: | 244,453 |
| B9D-Amateur Sports Commission | 100% | Total Building Count: | 24 | Total Completed Building FCA Count: | 24 |
| | | Total Gross Square Footage: | 807,054 | Total Completed FCA Square Footage: | 807,054 |
| E25-Perpich Center | 100% | Total Building Count: | 5 | Total Completed Building FCA Count: | 5 |
| | | Total Gross Square Footage: | 176,361 | Total Completed FCA Square Footage: | 176,361 |
| E40-Historical Society | 71% | Total Building Count: | 154 | Total Completed Building FCA Count: | 137 |
| | | Total Gross Square Footage: | 1,801,653 | Total Completed FCA Square Footage: | 1,275,097 |

| Agency | Percentage of Completed FCA Square Footage | Totals for agency | | Totals for Completed FCAs | |
|---|---|---|---|---|---|
| E44-Minnesota State Academies | 0% | Total Building Count: | 19 | Total Completed Building FCA Count: | - |
| | | Total Gross Square Footage: | 397,834 | Total Completed FCA Square Footage: | - |
| E77-MN Zoological Garden | 100% | Total Building Count: | 124 | Total Completed Building FCA Count: | 124 |
| | | Total Gross Square Footage: | 648,413 | Total Completed FCA Square Footage: | 648,413 |
| G02-Department of Administration | 100% | Total Building Count: | 30 | Total Completed Building FCA Count: | 30 |
| | | Total Gross Square Footage: | 5,531,893 | Total Completed FCA Square Footage: | 5,531,893 |
| G62-MN State Retirement Systems | 100% | Total Building Count: | 2 | Total Completed Building FCA Count: | 2 |
| | | Total Gross Square Footage: | 259,837 | Total Completed FCA Square Footage: | 259,837 |
| H55-Department of Human Services | 100% | Total Building Count: | 153 | Total Completed Building FCA Count: | 152 |
| | | Total Gross Square Footage: | 2,504,026 | Total Completed FCA Square Footage: | 2,503,666 |
| H75-MN Veterans Homes | 100% | Total Building Count: | 63 | Total Completed Building FCA Count: | 63 |
| | | Total Gross Square Footage: | 1,243,421 | Total Completed FCA Square Footage: | 1,243,421 |
| P01-Military Affairs | 47% | Total Building Count: | 1,325 | Total Completed Building FCA Count: | 68 |
| | | Total Gross Square Footage: | 5,667,364 | Total Completed FCA Square Footage: | 2,660,359 |
| P07-Department of Public Safety | 100% | Total Building Count: | 6 | Total Completed Building FCA Count: | 6 |
| | | Total Gross Square Footage: | 20,360 | Total Completed FCA Square Footage: | 20,360 |

| Agency | Percentage of Completed FCA Square Footage | Totals for agency | | Totals for Completed FCAs | |
|---|---|---|---|---|---|
| **P78-Department of Corrections** | 100% | Total Building Count: | 329 | Total Completed Building FCA Count: | 329 |
| | | Total Gross Square Footage: | 7,481,526 | Total Completed FCA Square Footage: | 7,481,526 |
| **R29-Department of Natural Resources** | 100% | Total Building Count: | 2,856 | Total Completed Building FCA Count: | 2,856 |
| | | Total Gross Square Footage: | 3,328,712 | Total Completed FCA Square Footage: | 3,328,712 |
| **R32-Pollution Control Agency** | 100% | Total Building Count: | 18 | Total Completed Building FCA Count: | 18 |
| | | Total Gross Square Footage: | 25,198 | Total Completed FCA Square Footage: | 25,198 |
| **T79-Department of Transportation** | 100% | Total Building Count: | 896 | Total Completed Building FCA Count: | 886 |
| | | Total Gross Square Footage: | 6,650,299 | Total Completed FCA Square Footage: | 6,617,735 |
| **Totals** | 89% | Total Building Count: | 6,073 | Total Completed Building FCA Count: | 4,765 |
| | | Total Gross Square Footage: | 36,873,373 | Total Completed FCA Square Footage: | 32,862,655 |

This report was run on 9/28/2018

All totals include buildings in a status of '1 Active-Owned', '6 Inactive-Owned, and '10 Active Under-Construction'.

P01-Military Affairs quantities for completed FCA square footage only includes State supported Armories.

T79-Department of Transportation quantities for completed FCA square footage does not include radio tower equipment facilities.

# Number of Owned Buildings by Agency

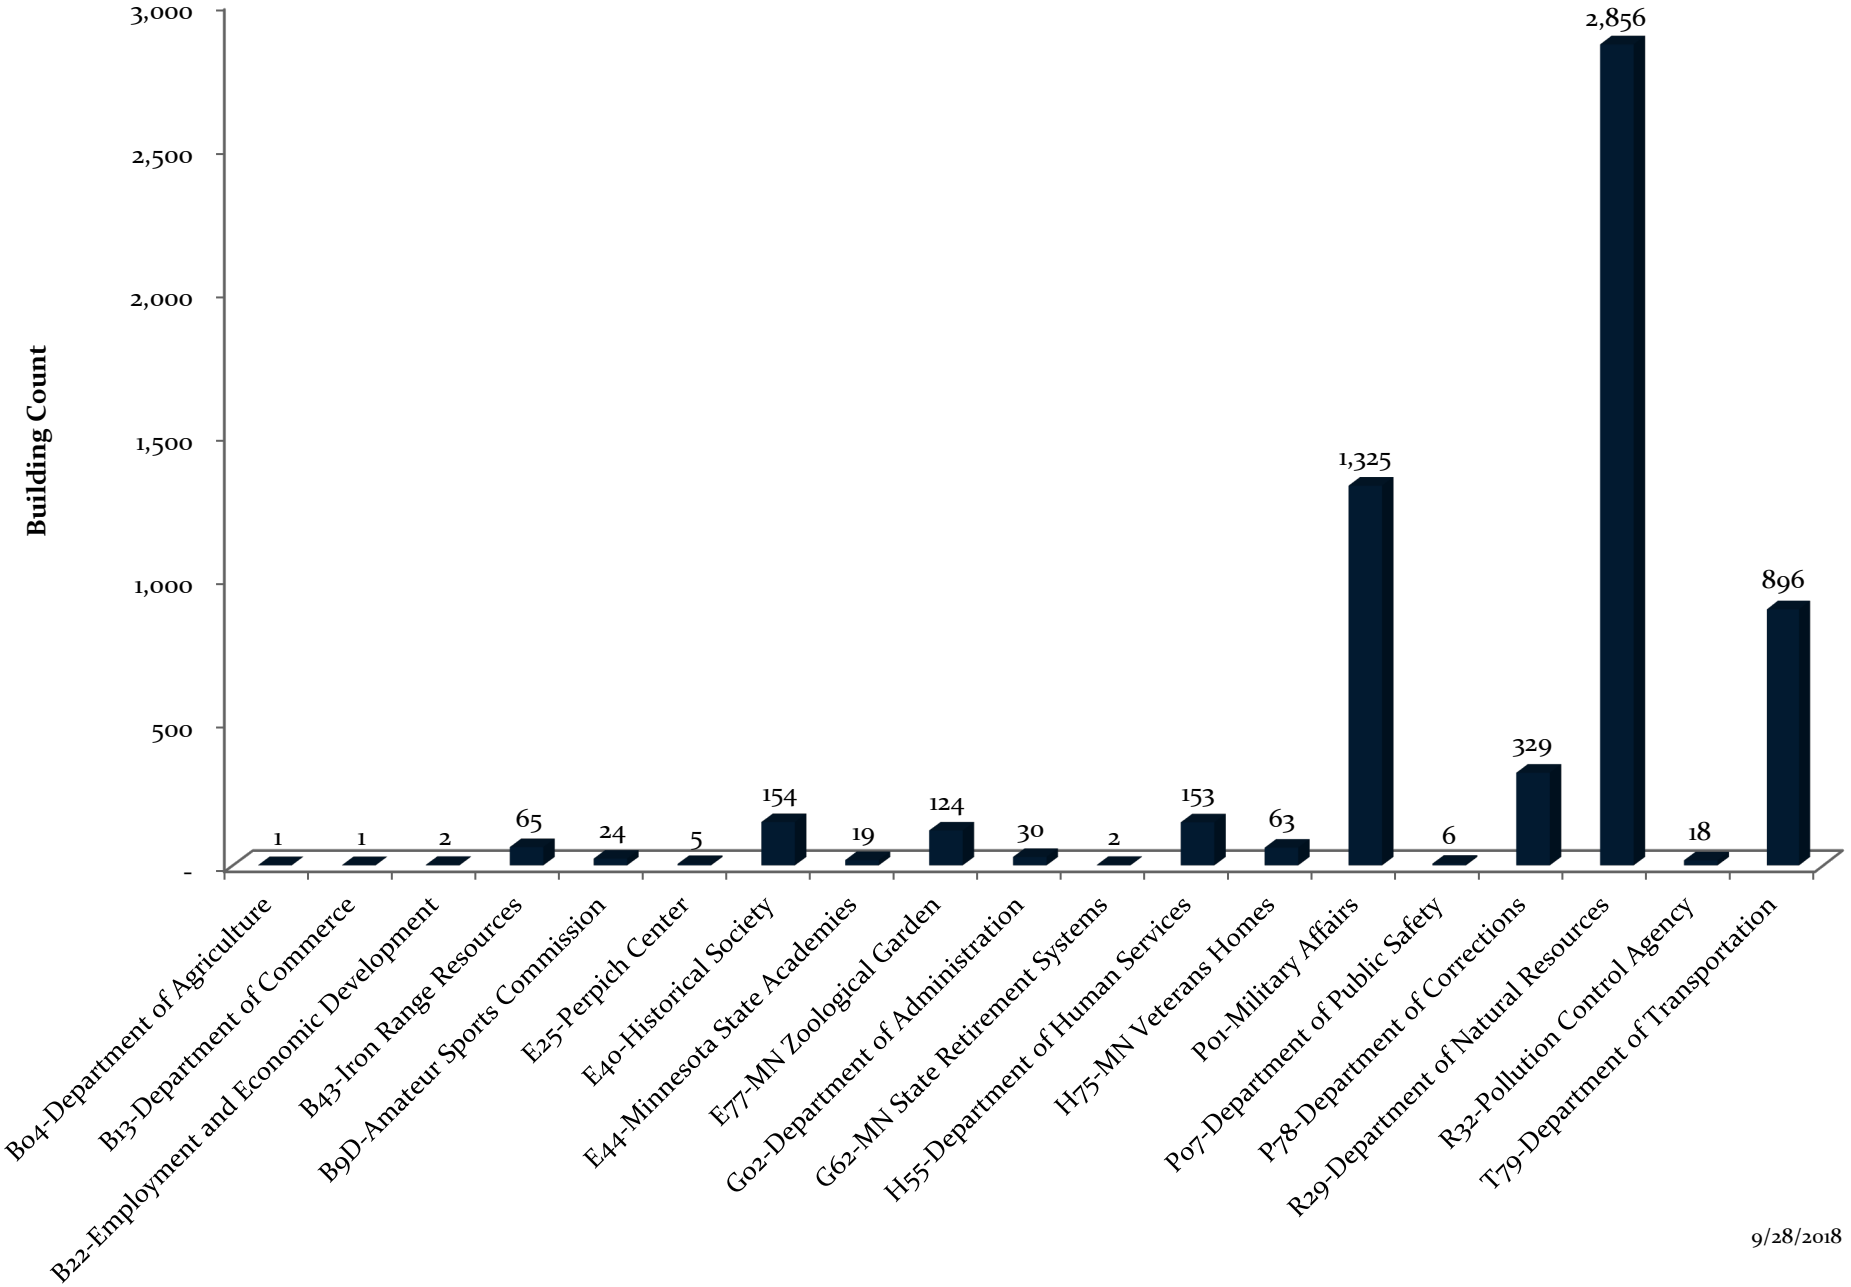

# Square Footage of Owned Buildings and Assessed Buildings by Agency

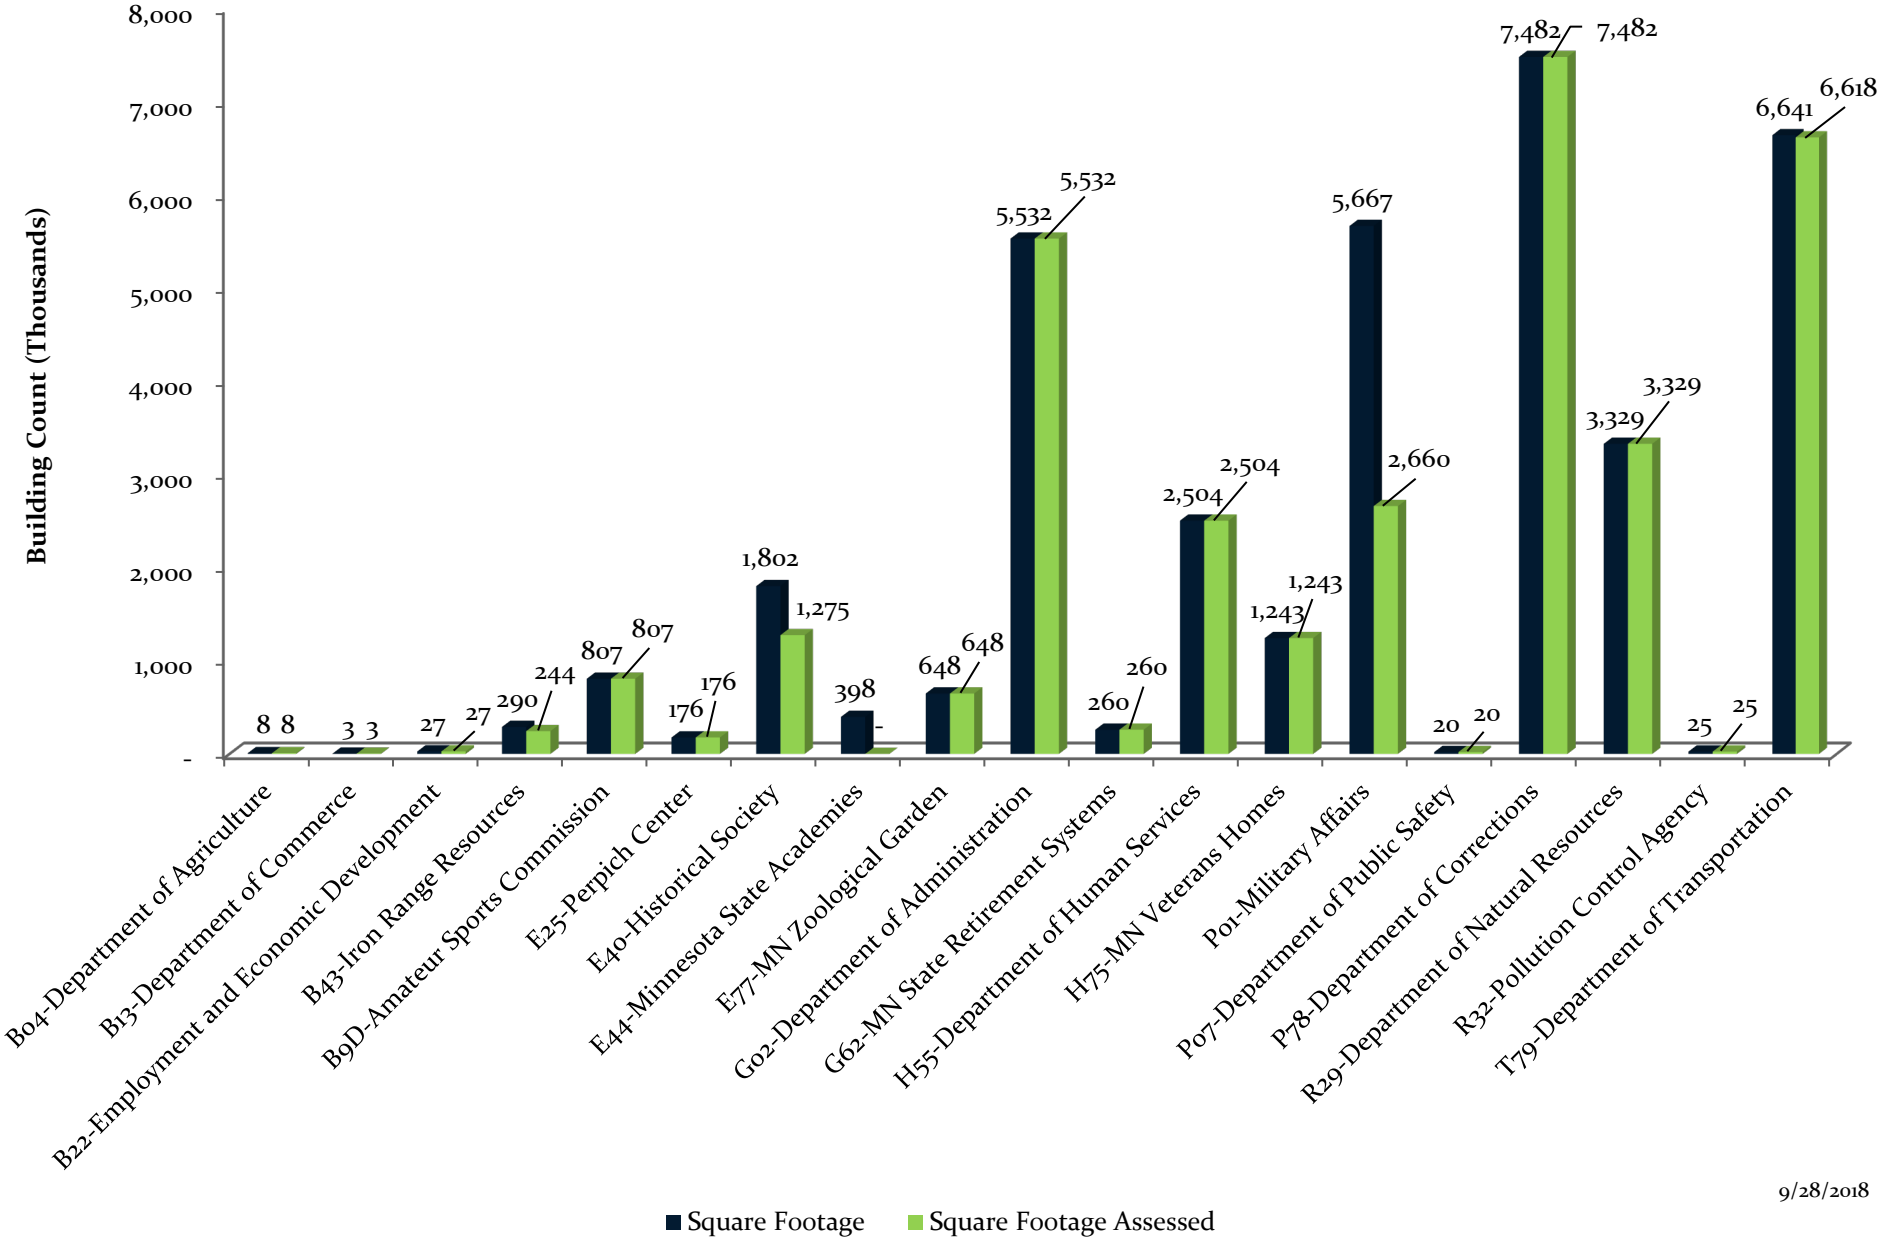

# Replacement Value by Agency

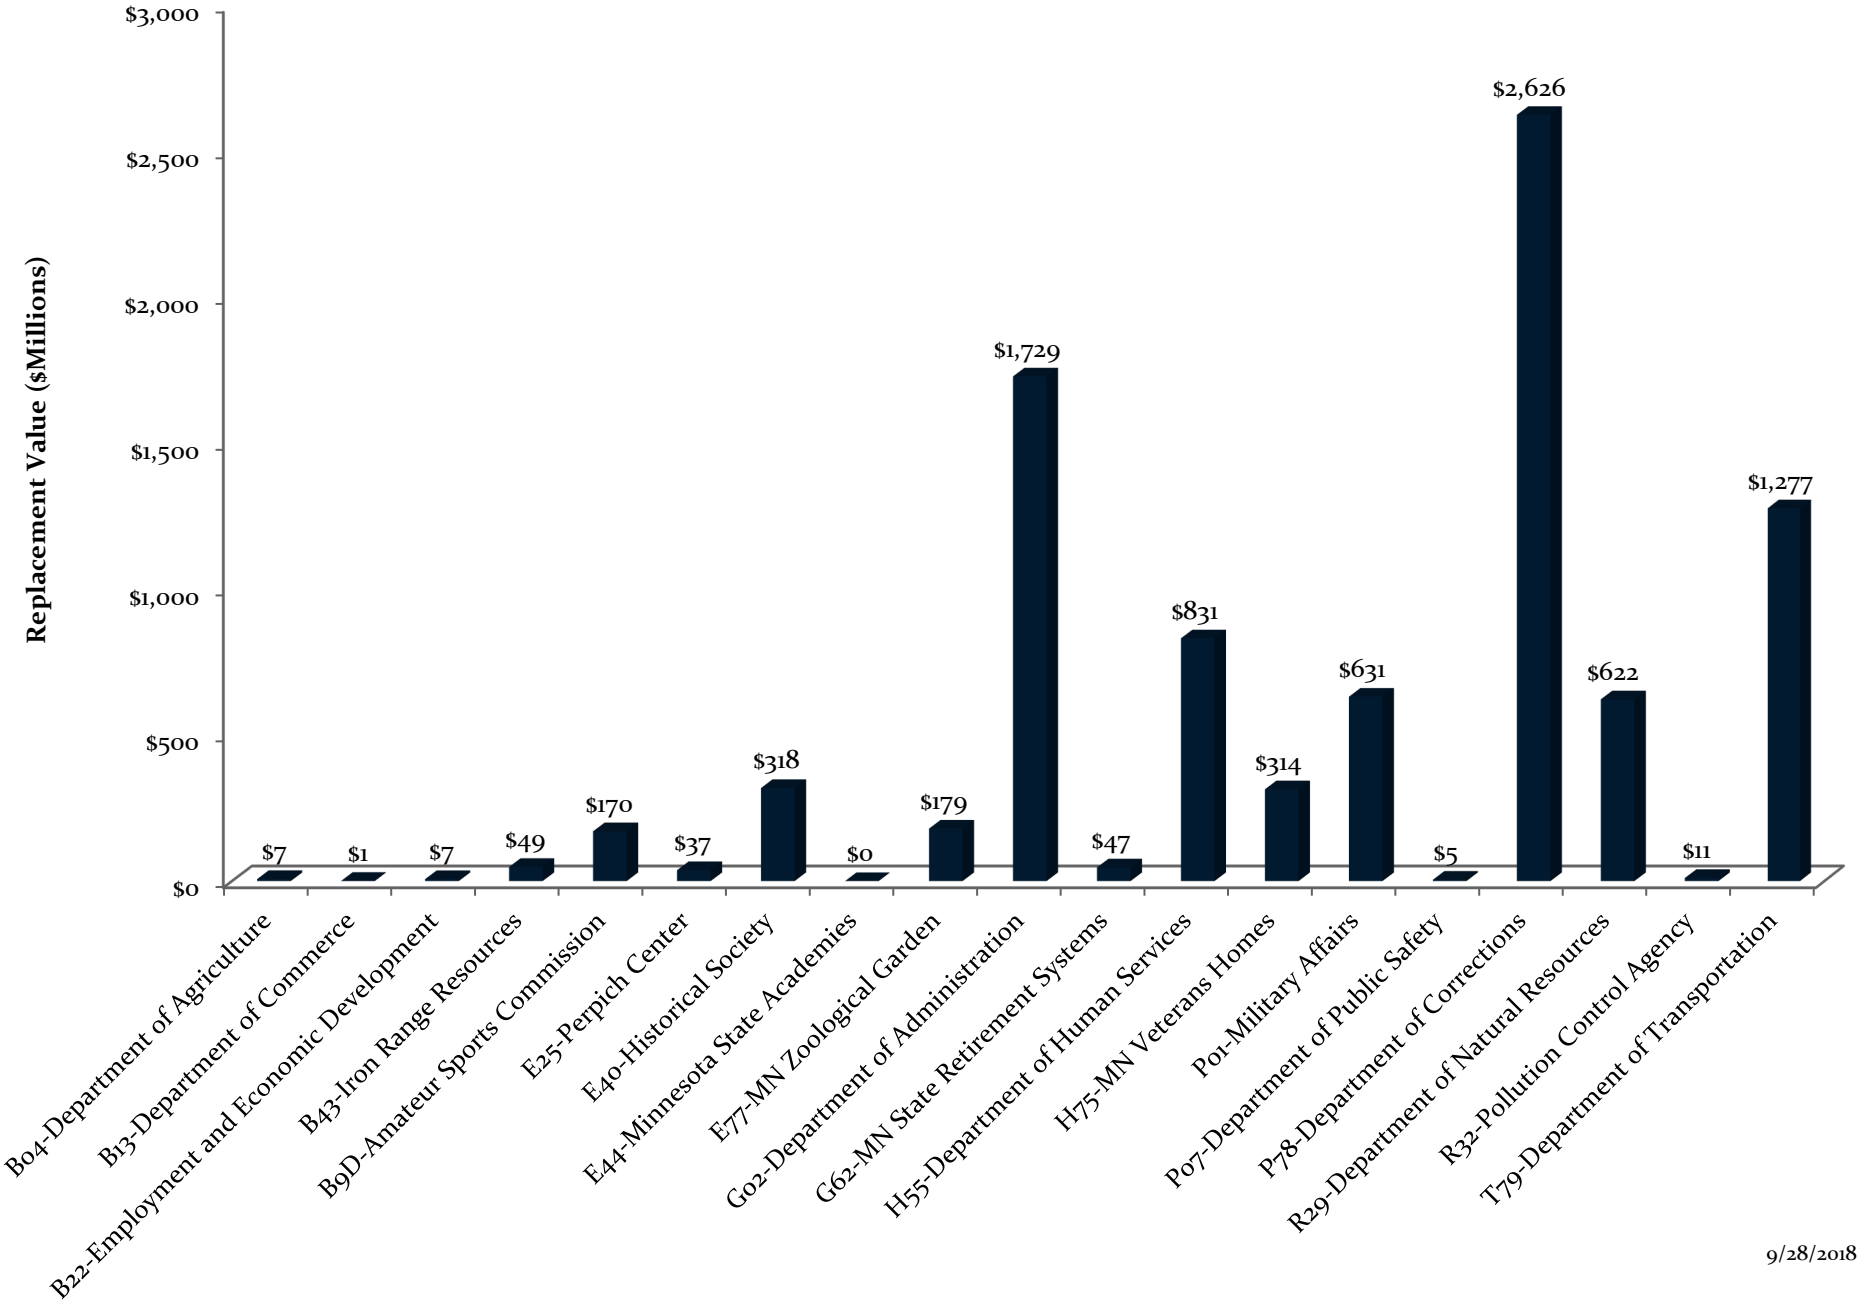


9/28/2018

# Deferred Maintenance by Agency

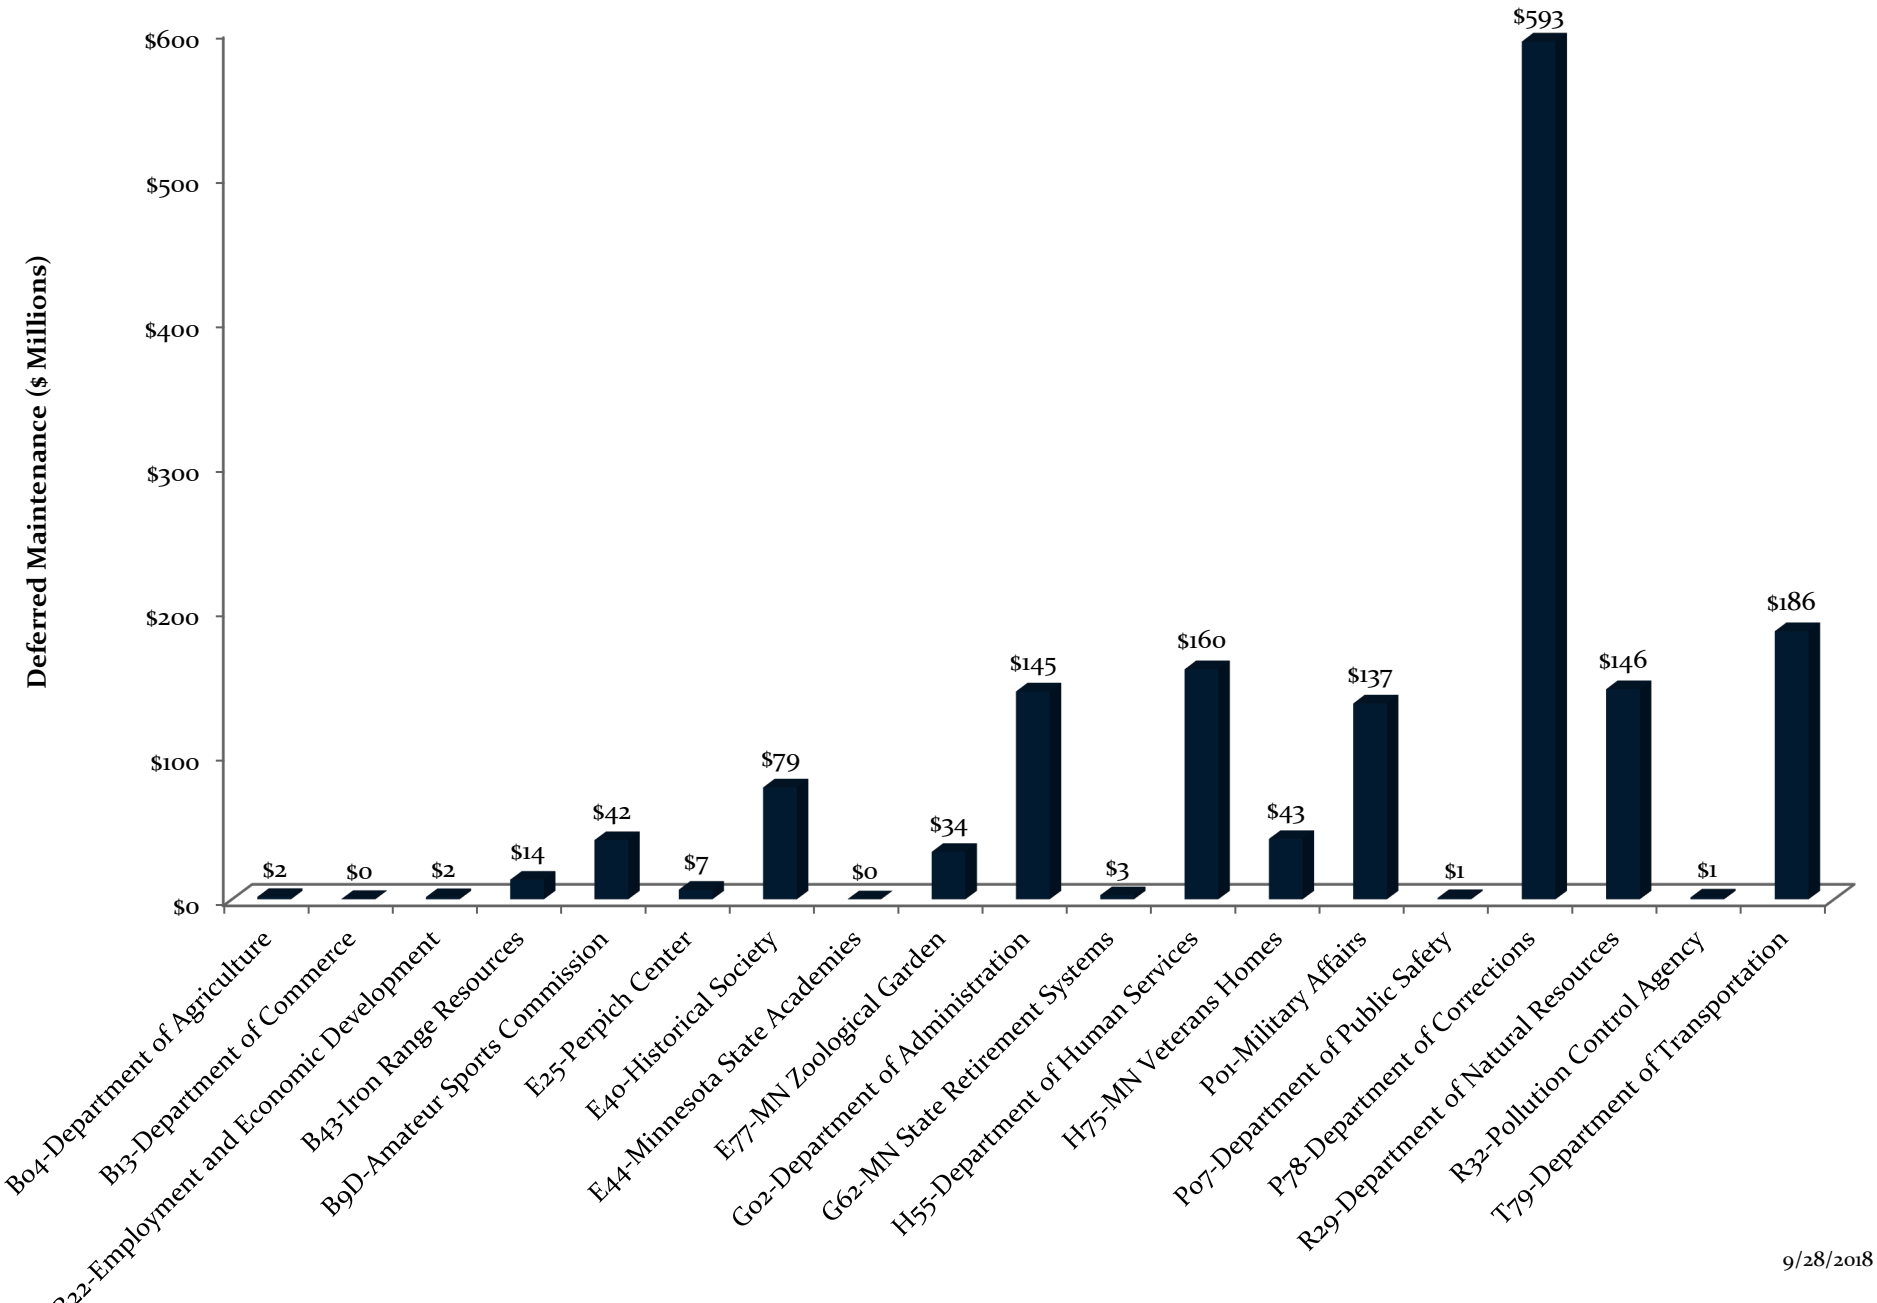


9/28/2018

The State Of Minnesota currently has a building portfolio with an **<u>average age of 41 years</u>**.

"The largest and most expensive of all asset renewal projects tend to occur during the 4th life stage. As a result, significant funds will need to be reinvested in the building and the standard operating and maintenance budgets will need to be revisited. Some of the assets have been replaced over the preceding 30-40 years and the owners and manager are now operating a building with assets at a variety of different ages. There is no longer a single baseline and the facility managers are tasked with tracking the different assets." (https://www.rdh.com/long-buildings-last/)

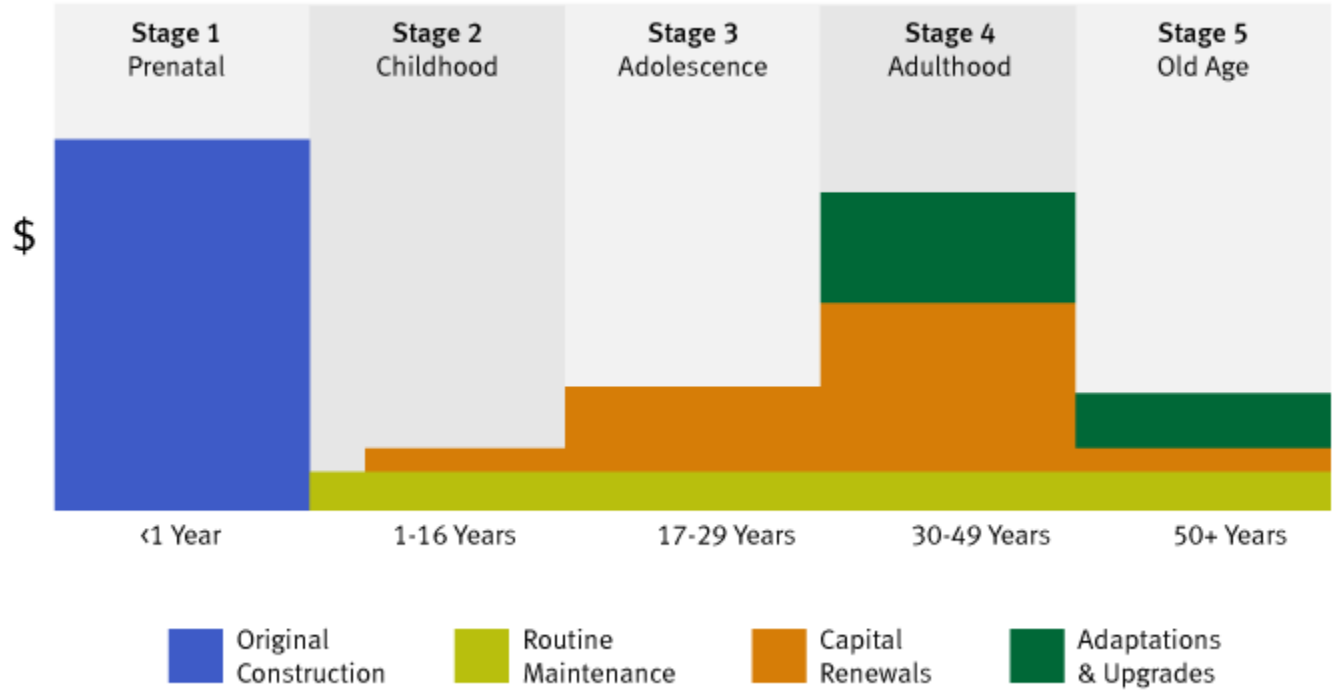

# Number of Owned Buildings by Age

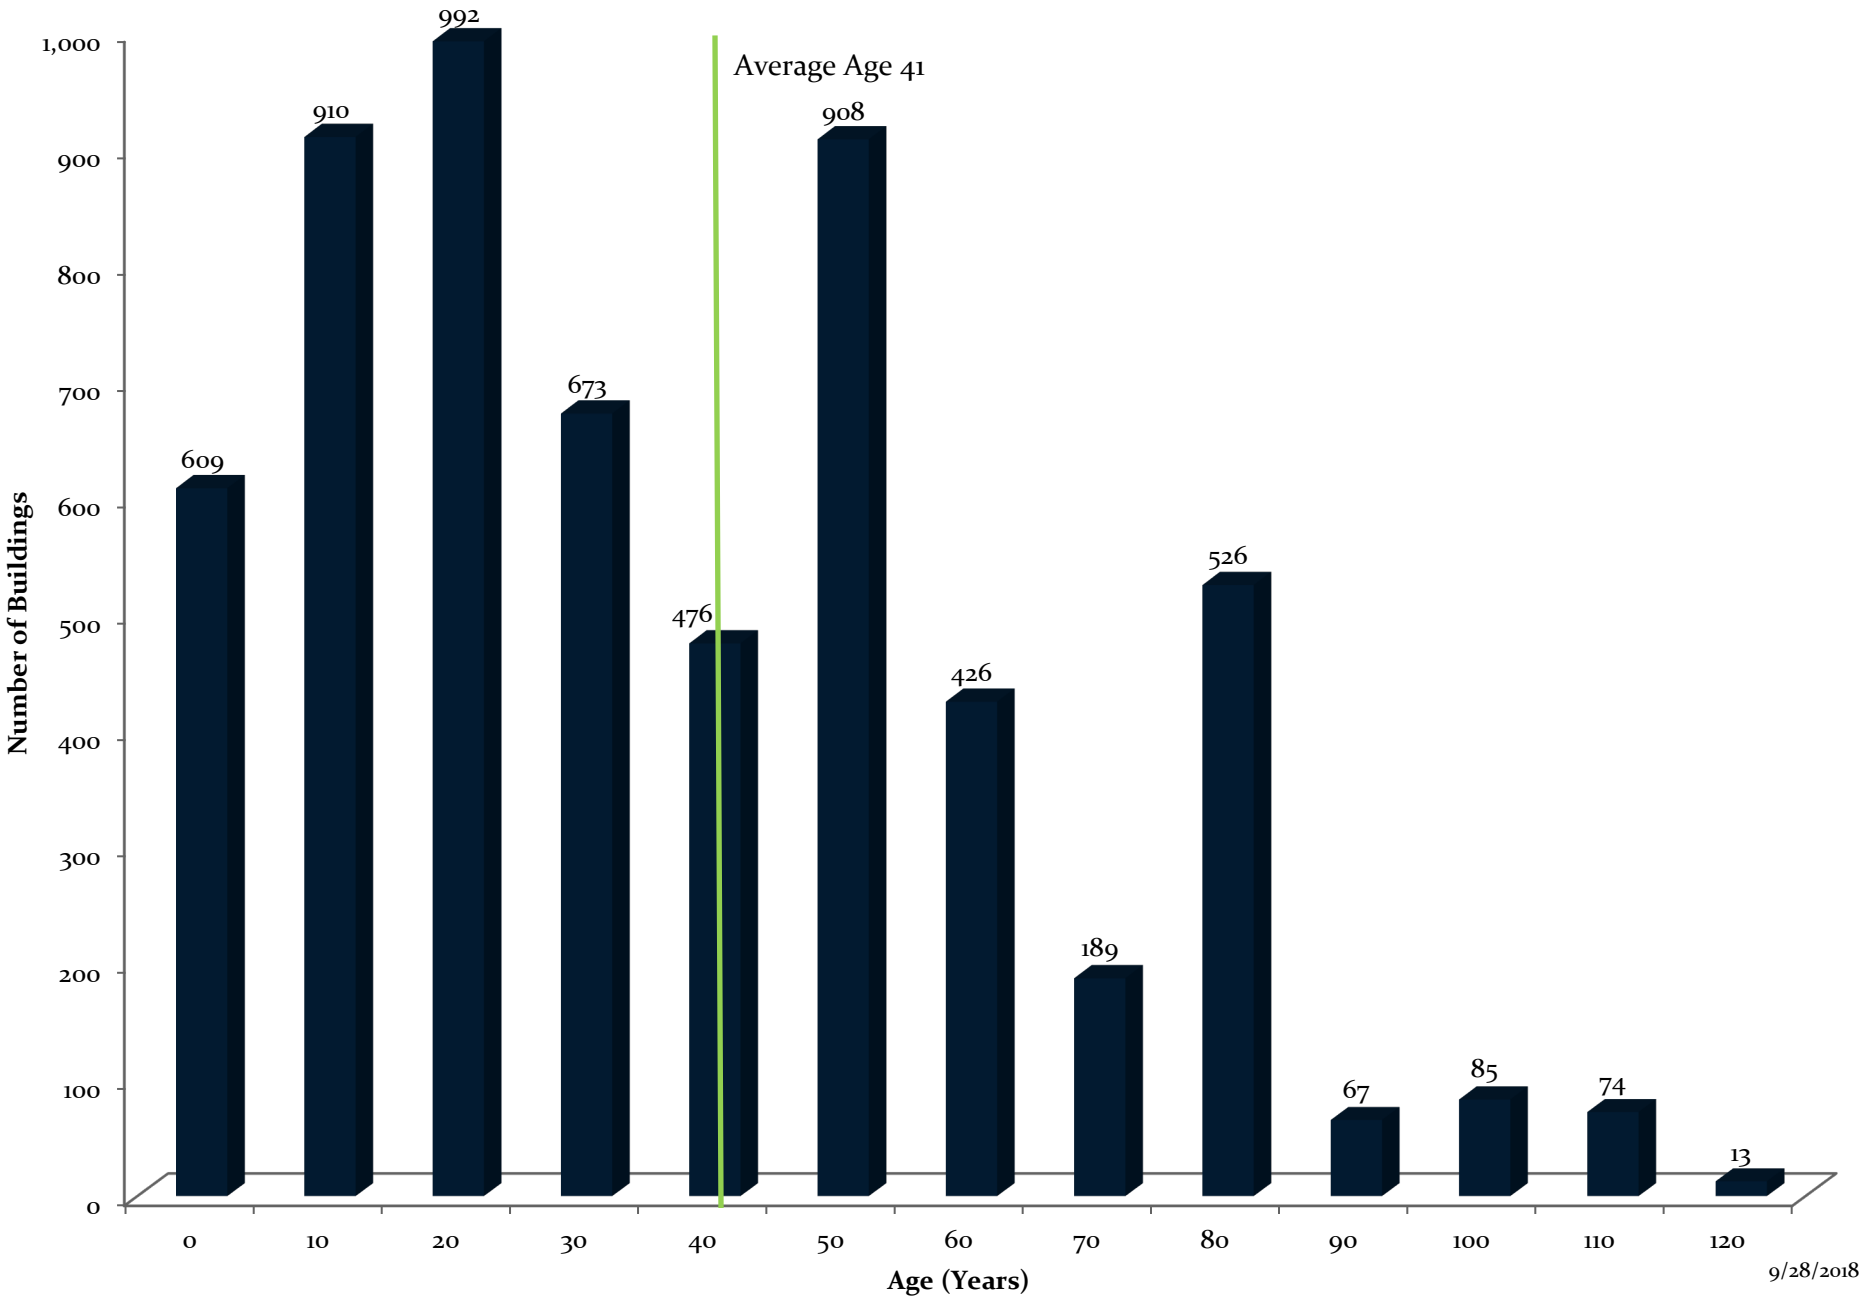

# Number of Structures by FCI Rating

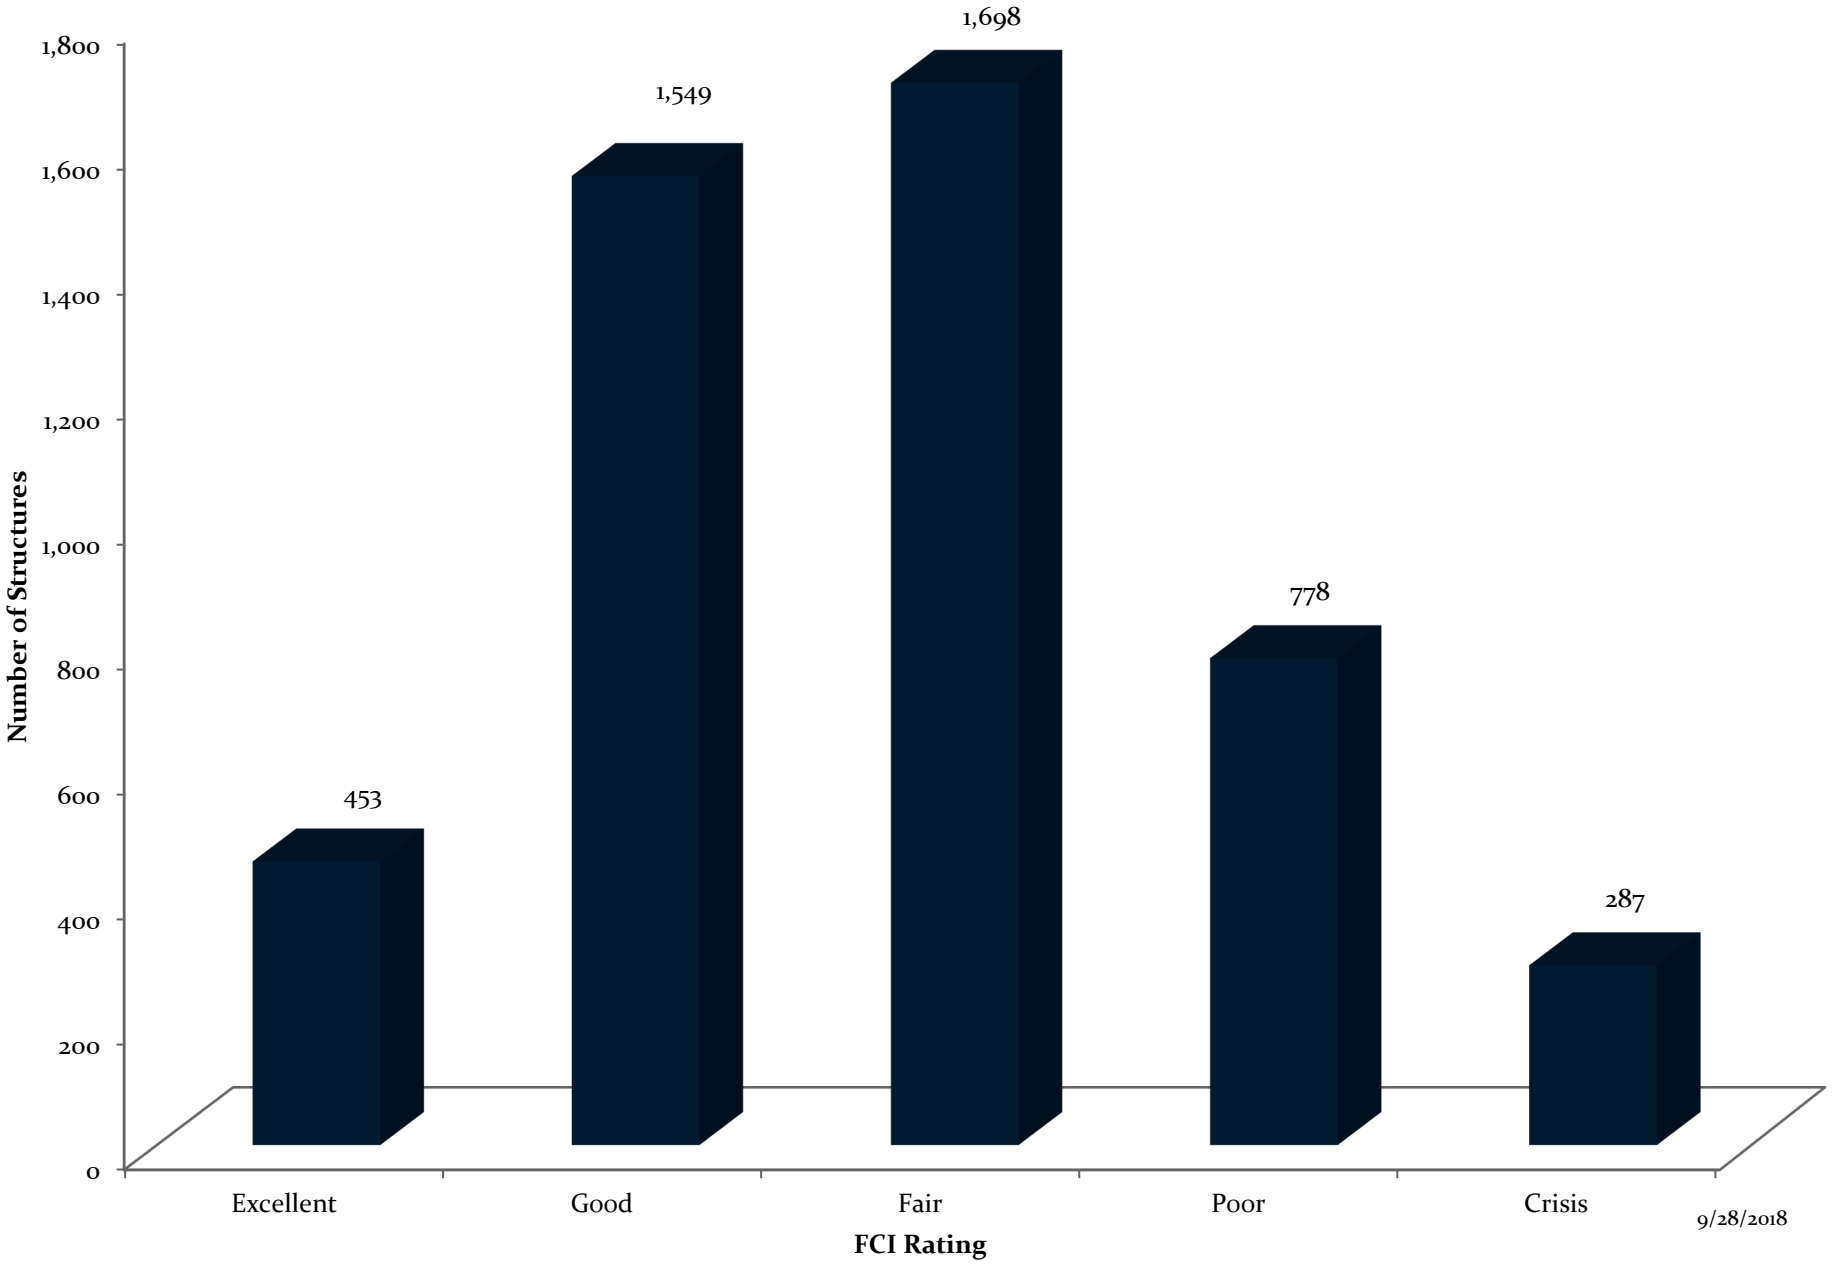

## *LOCATION OF 287 CRISIS CONDITION BUILDINGS*

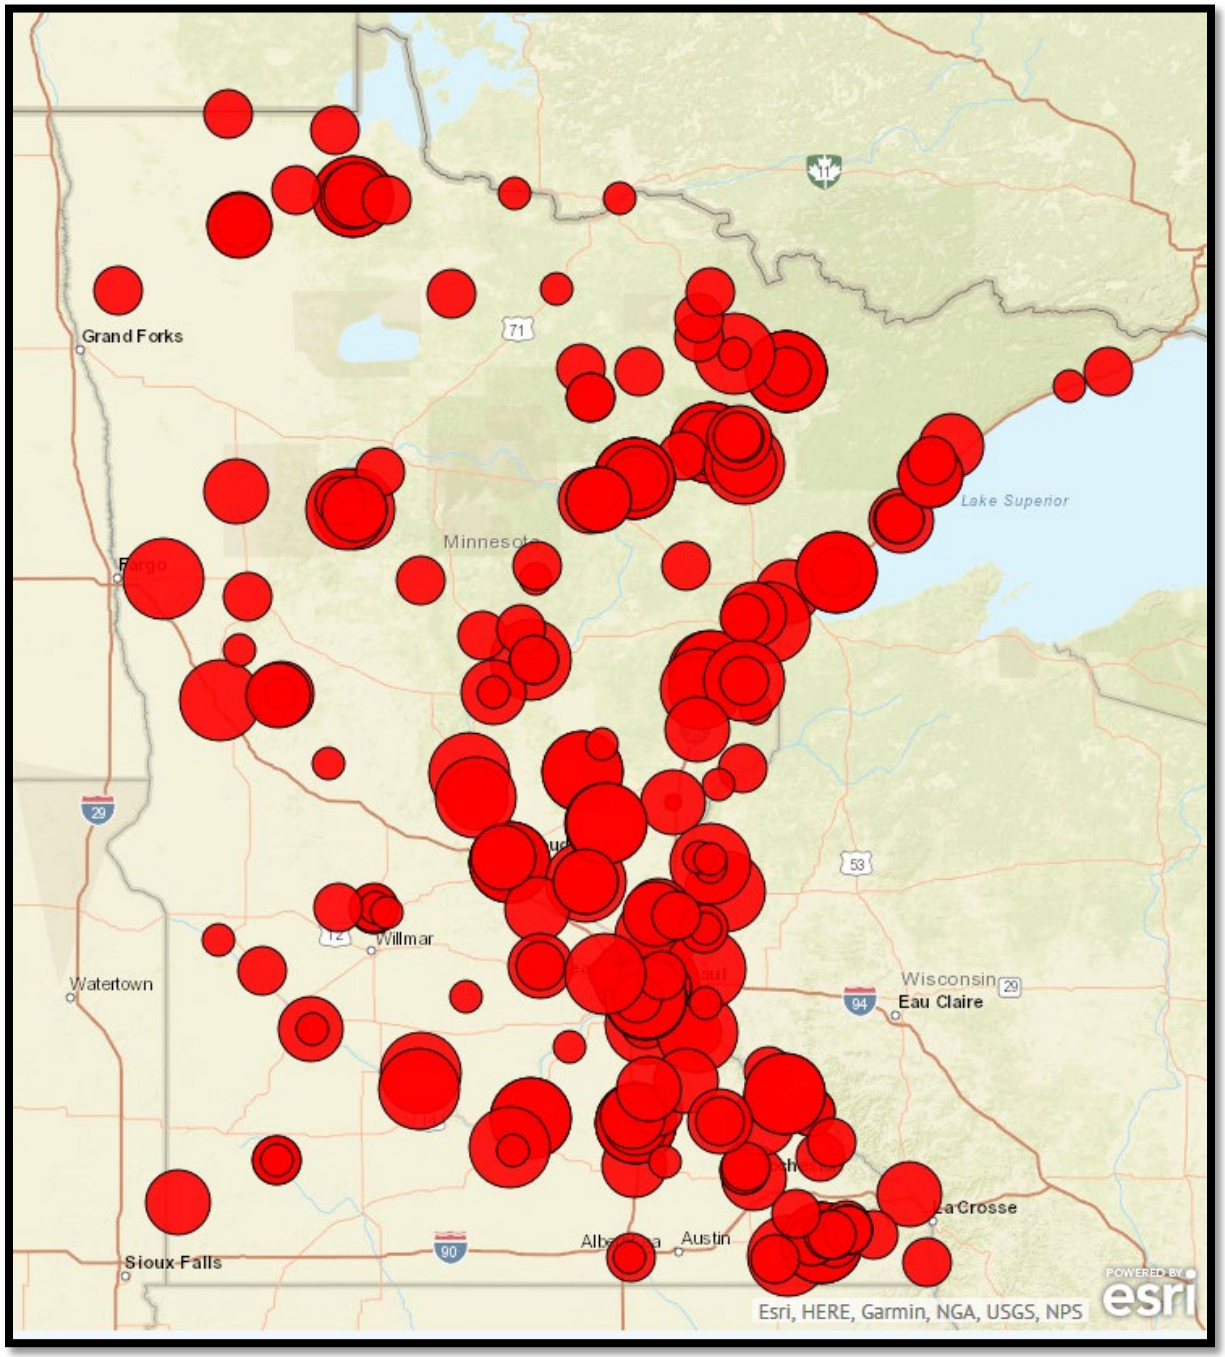

## *LOCATION OF 778 POOR CONDITION BUILDINGS*

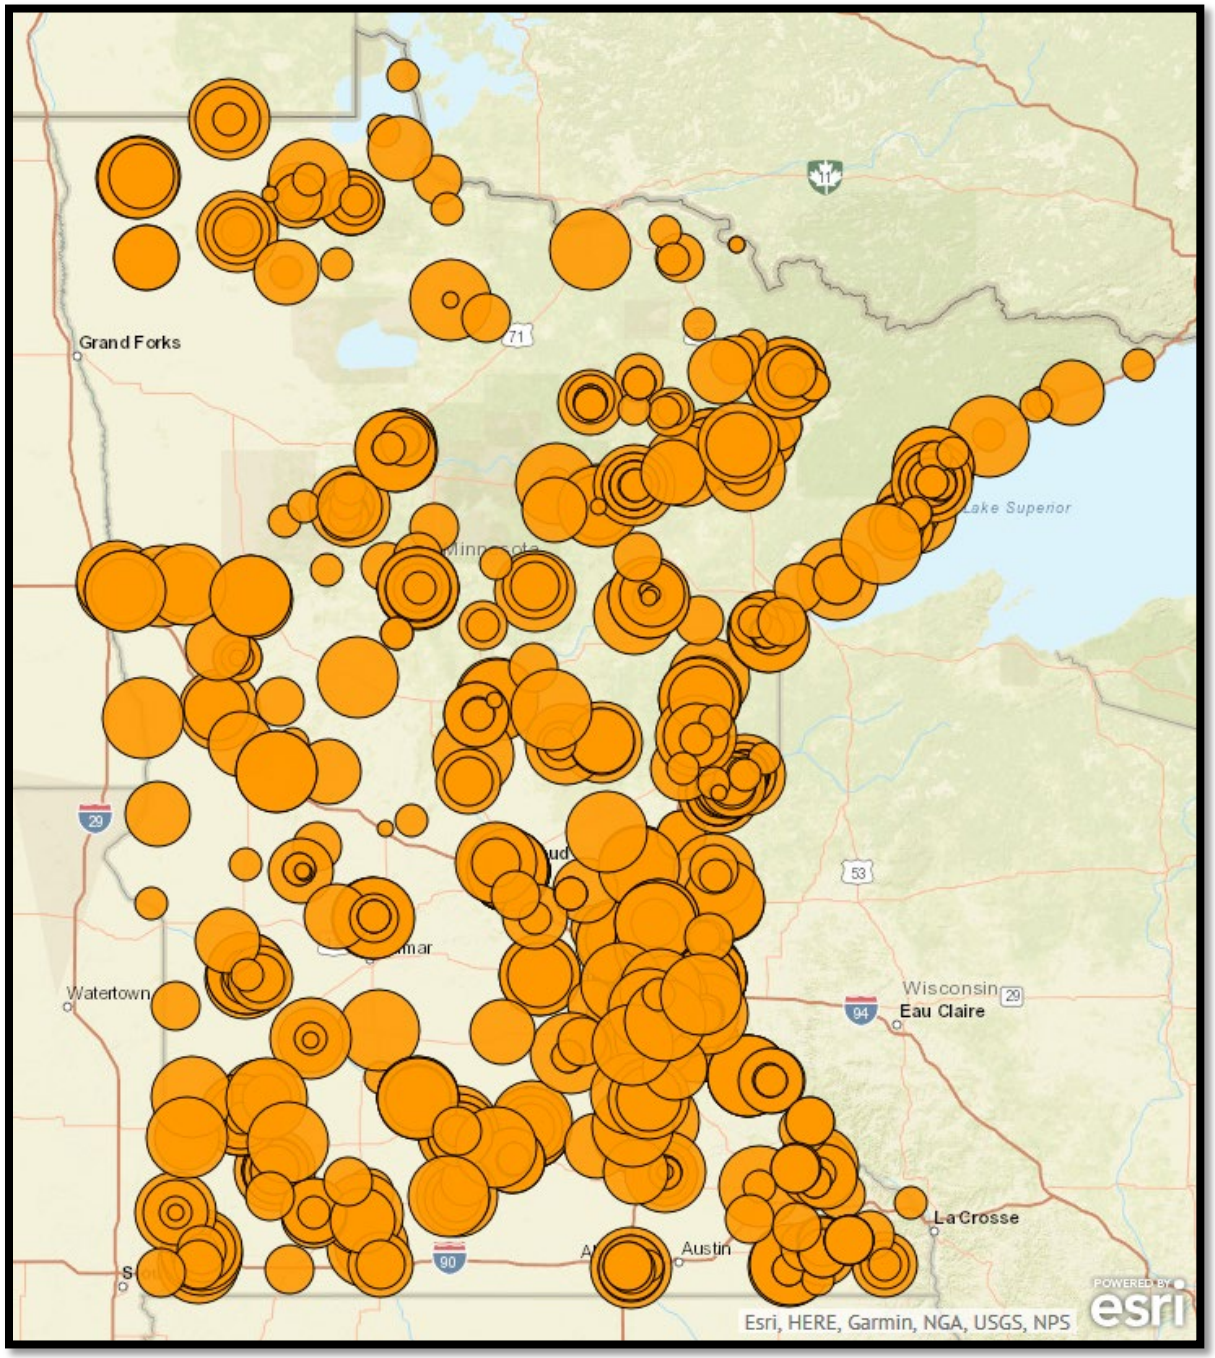

# Value of Deferred Maintenance by FCI Rating

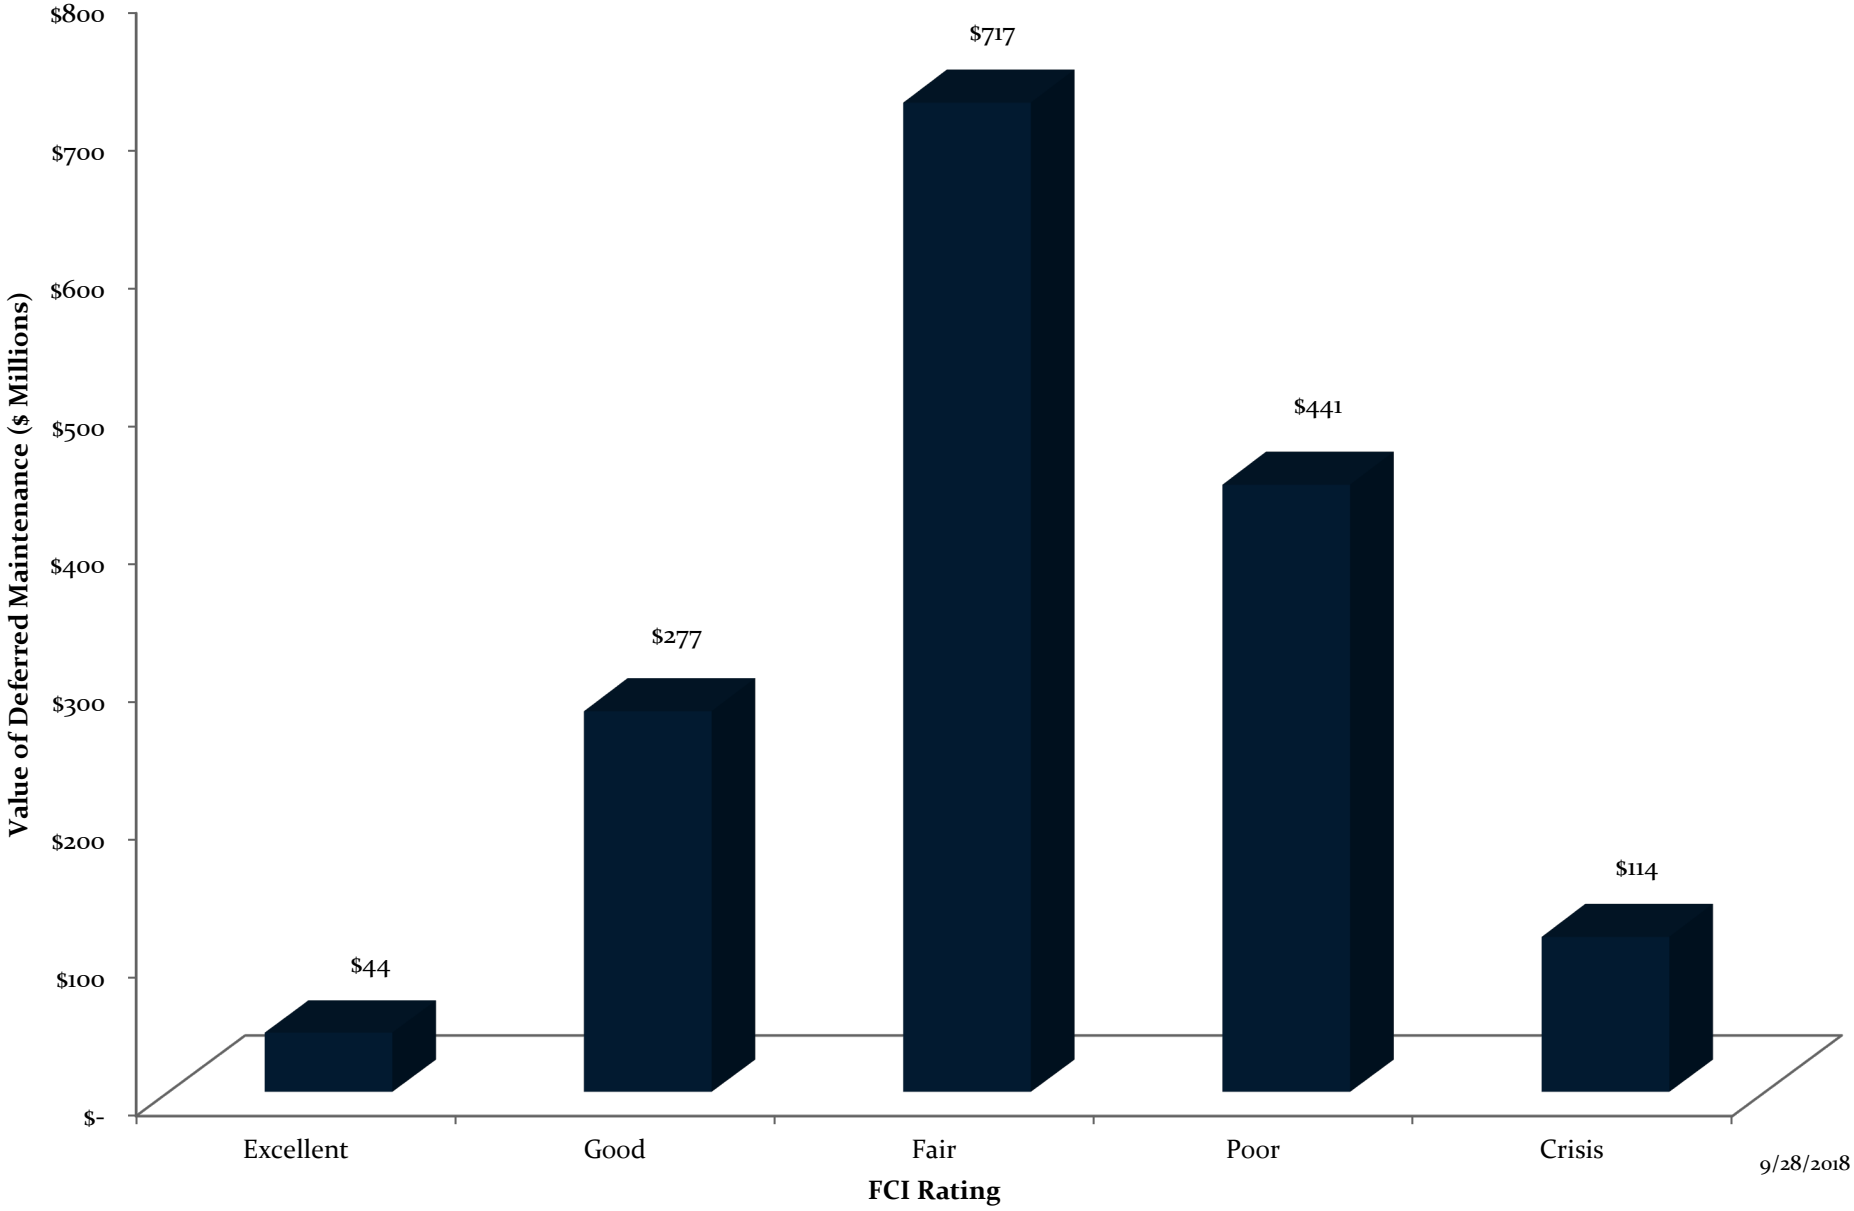

# Number of Buildings and Value of Deferred Maintenance by FCI Rating

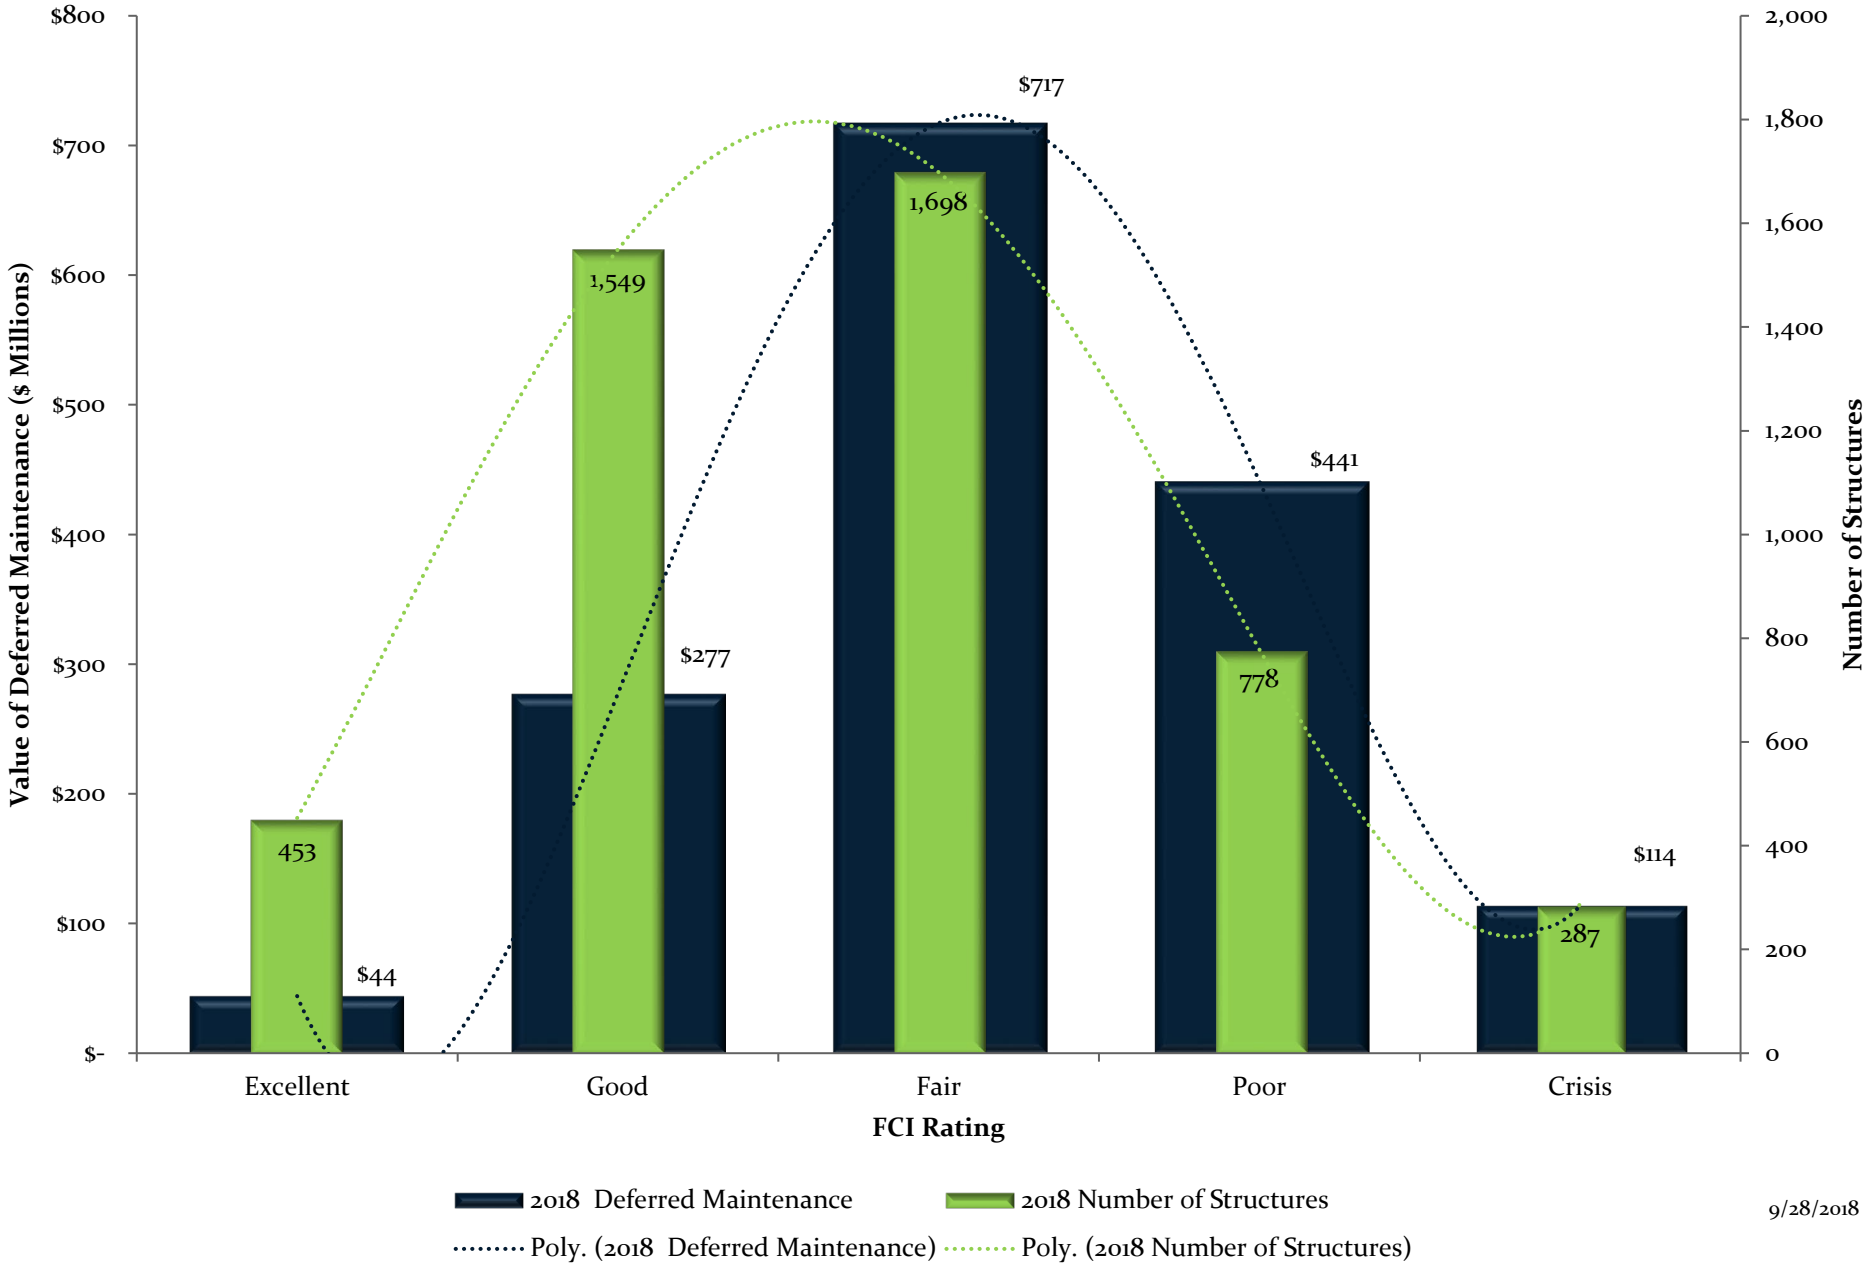


9/28/2018

# Square Footage and Value of Deferred Maintenance by FCI Rating

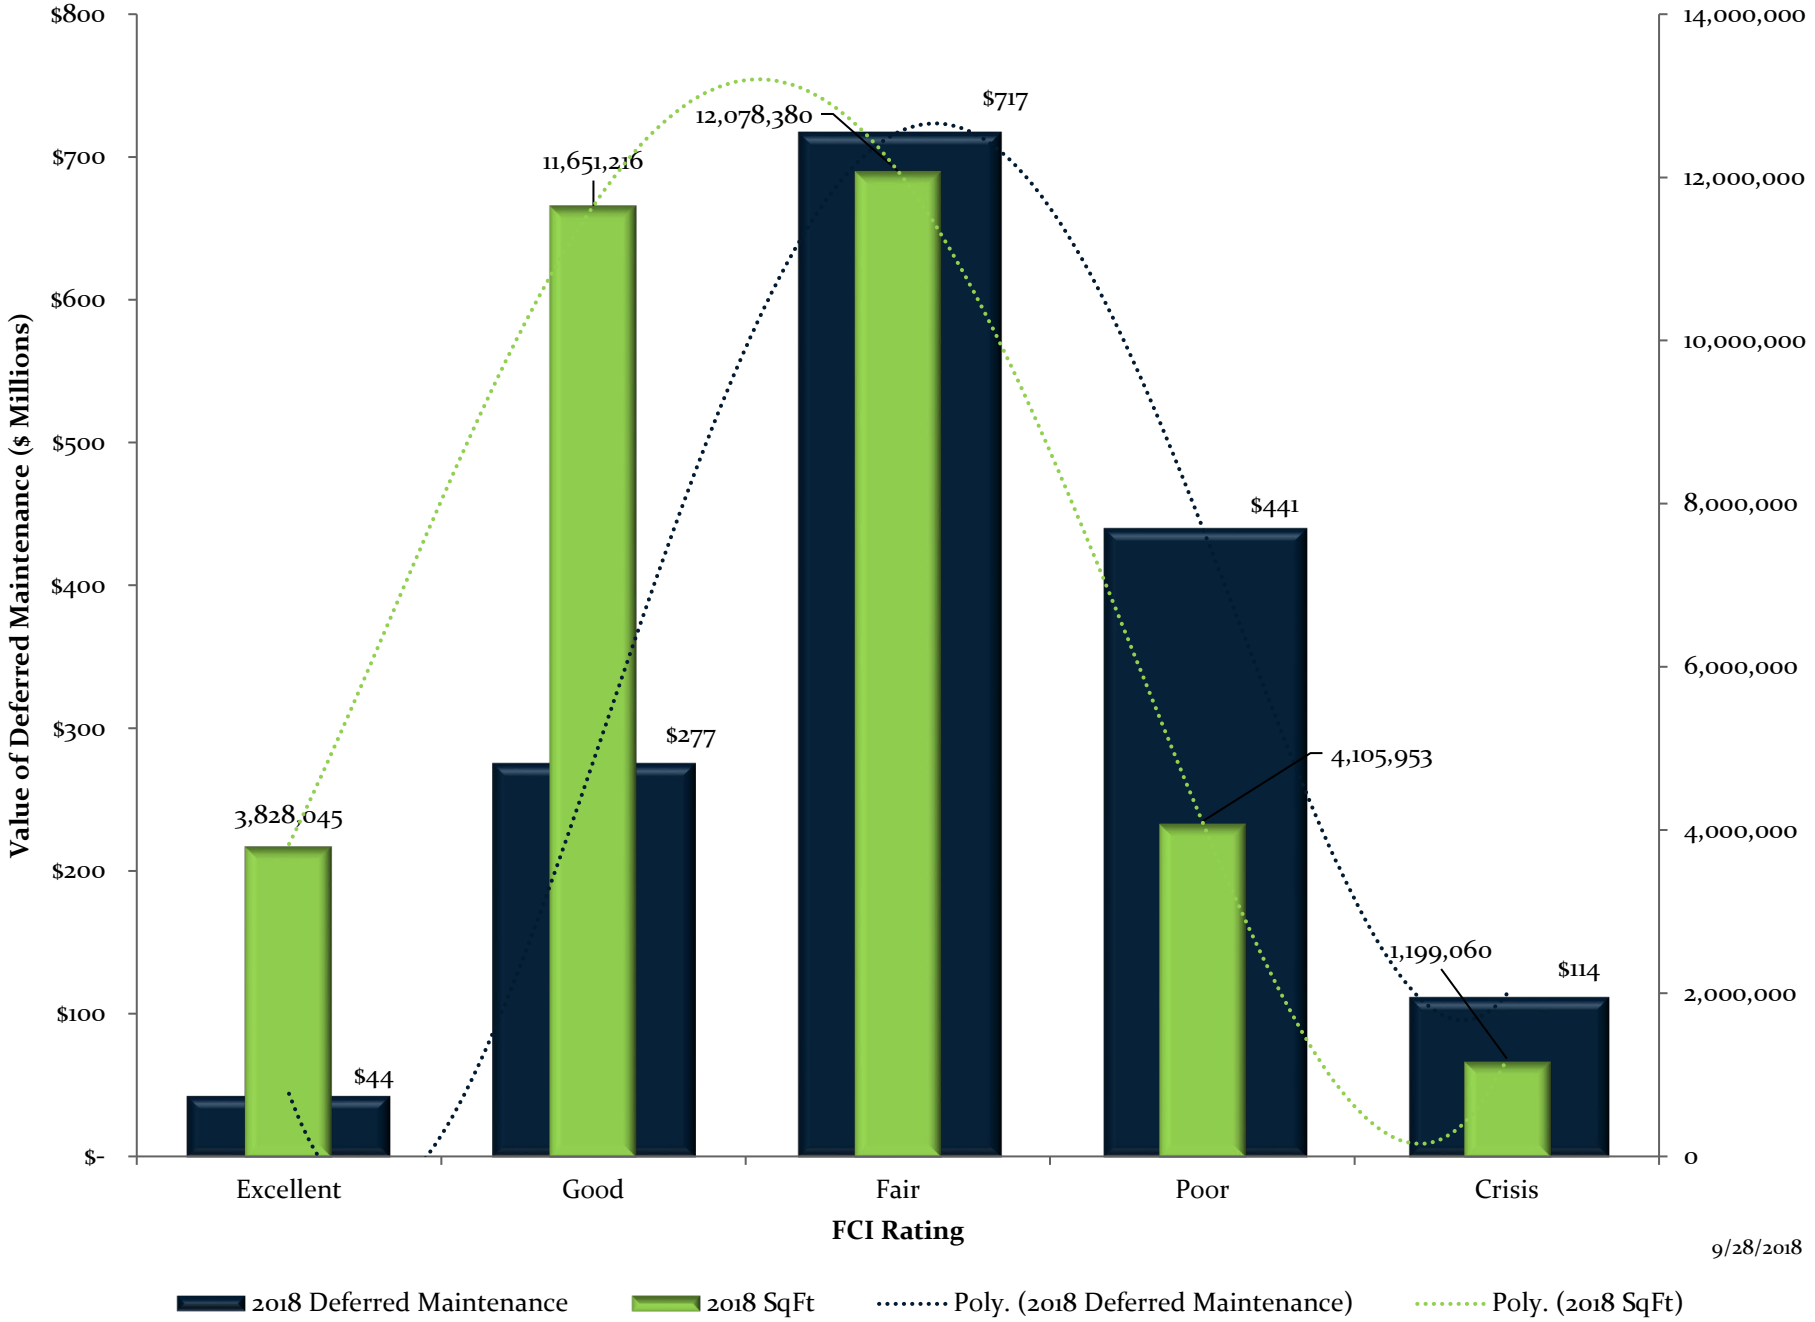

# Number of Buildings by FCI Rating 2015-2018

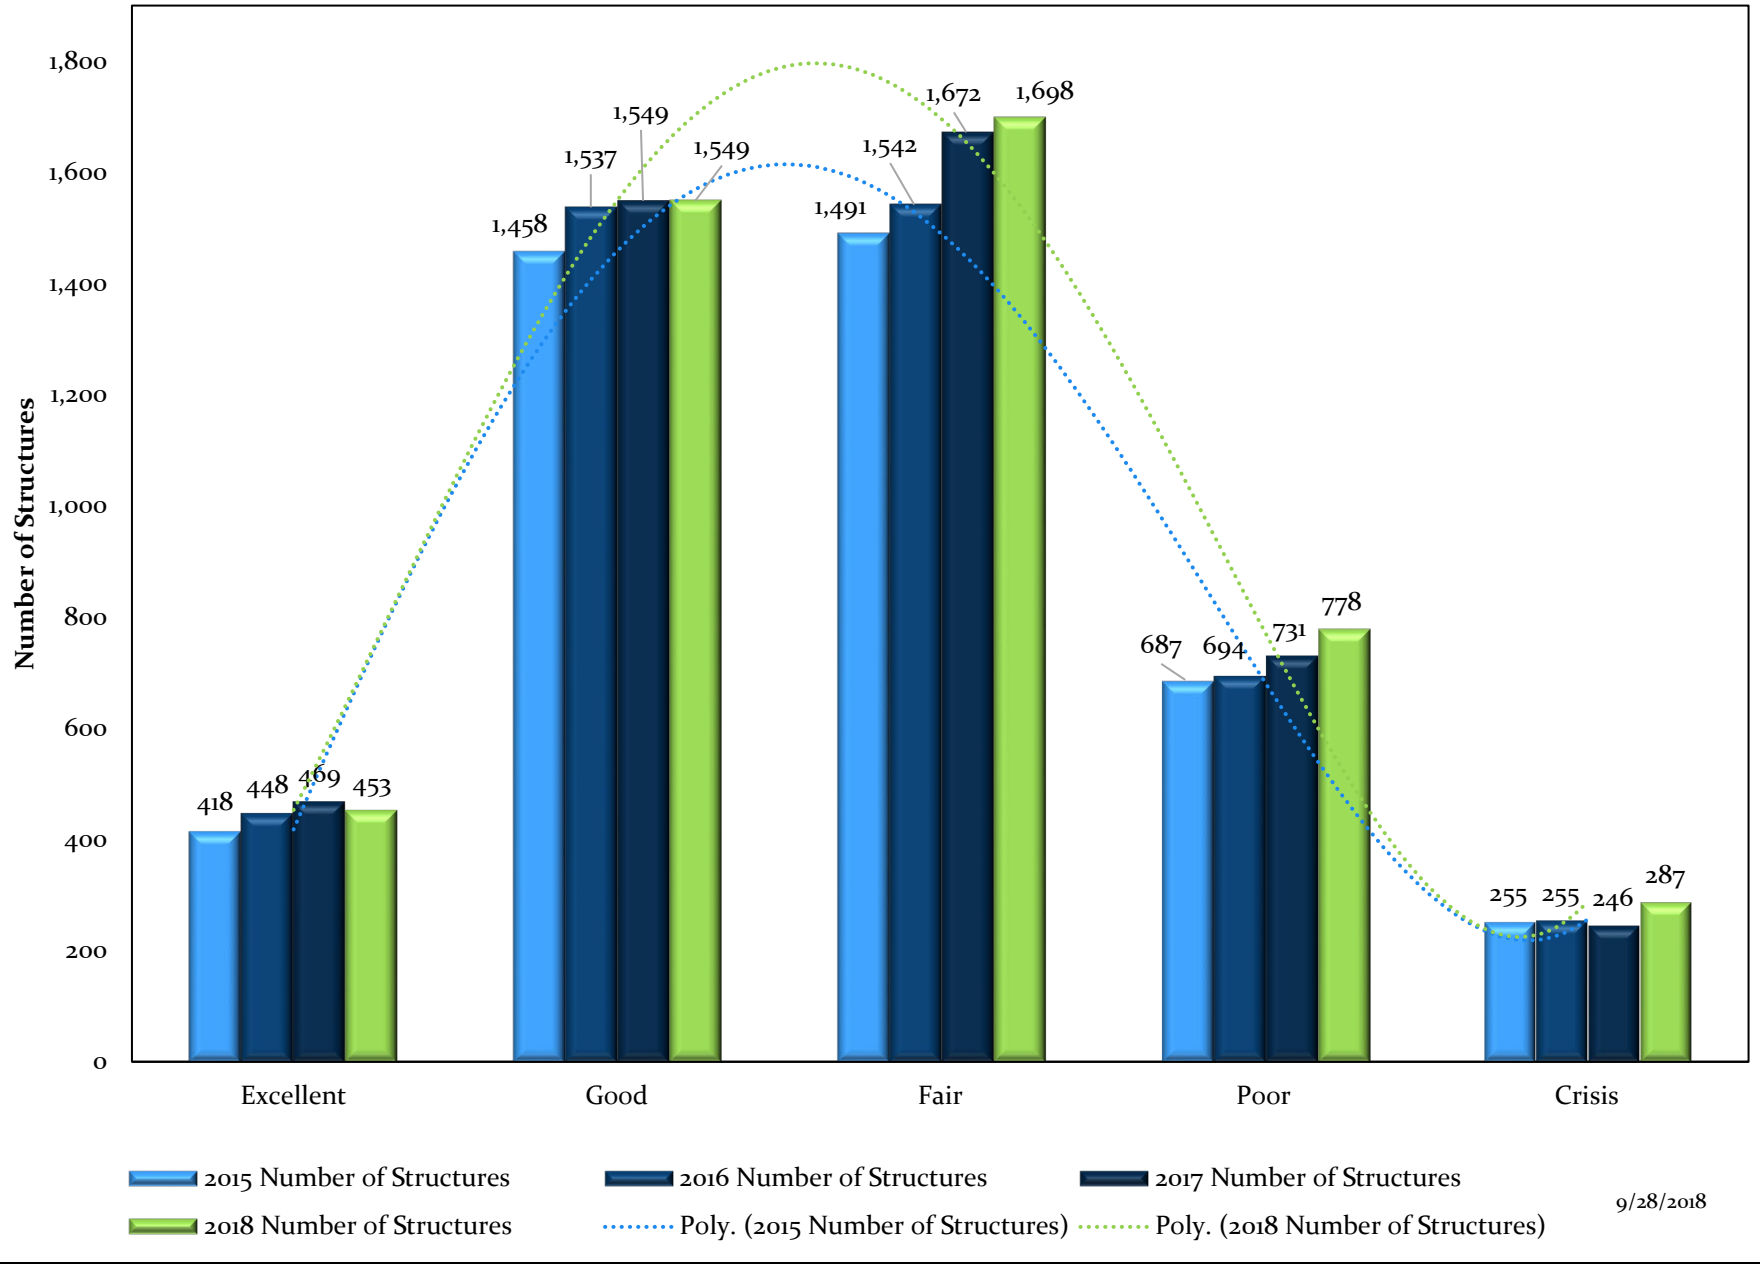

# Square Footage by FCI Rating 2015-2018

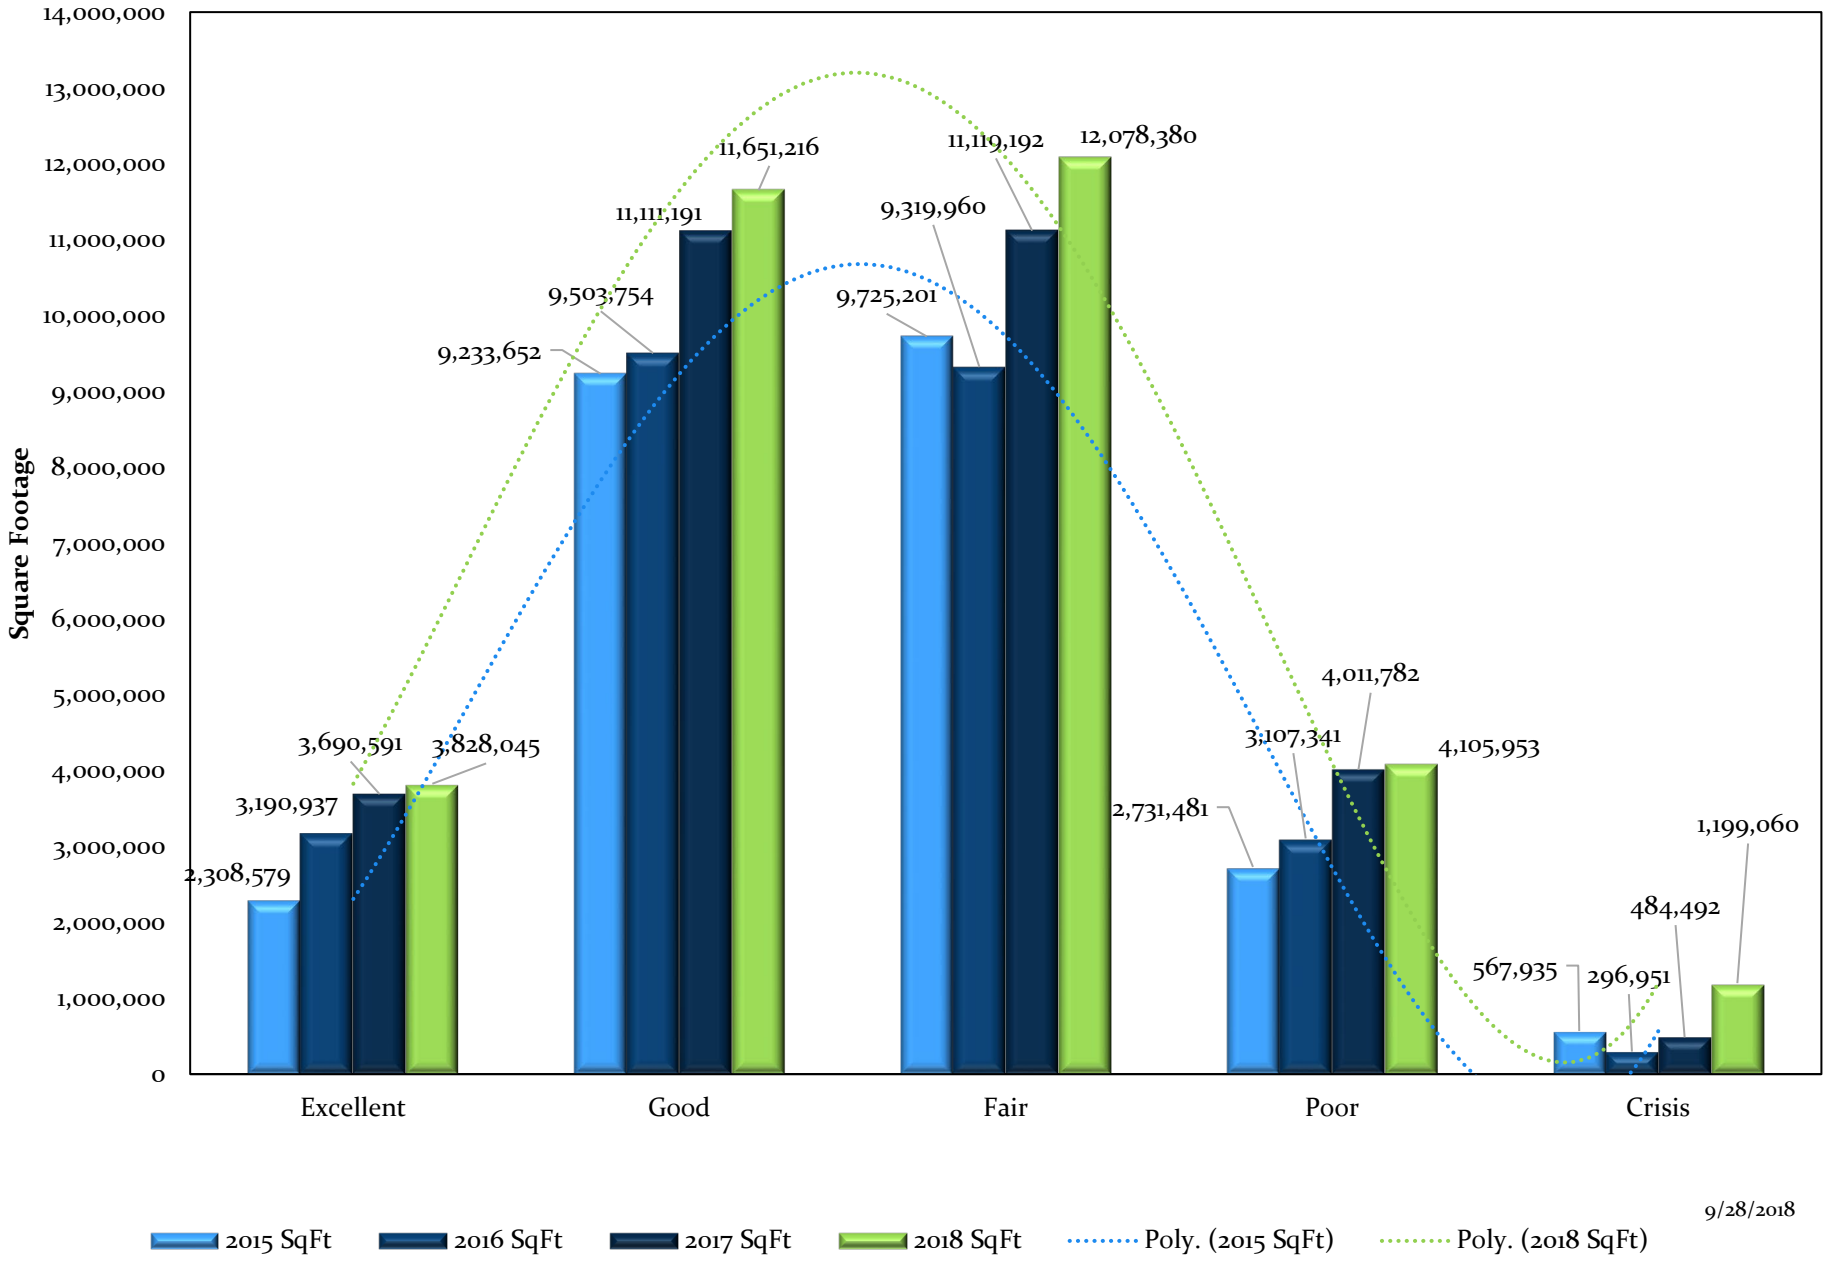

# Value of Deferred Maintenance by FCI Rating 2015-2018

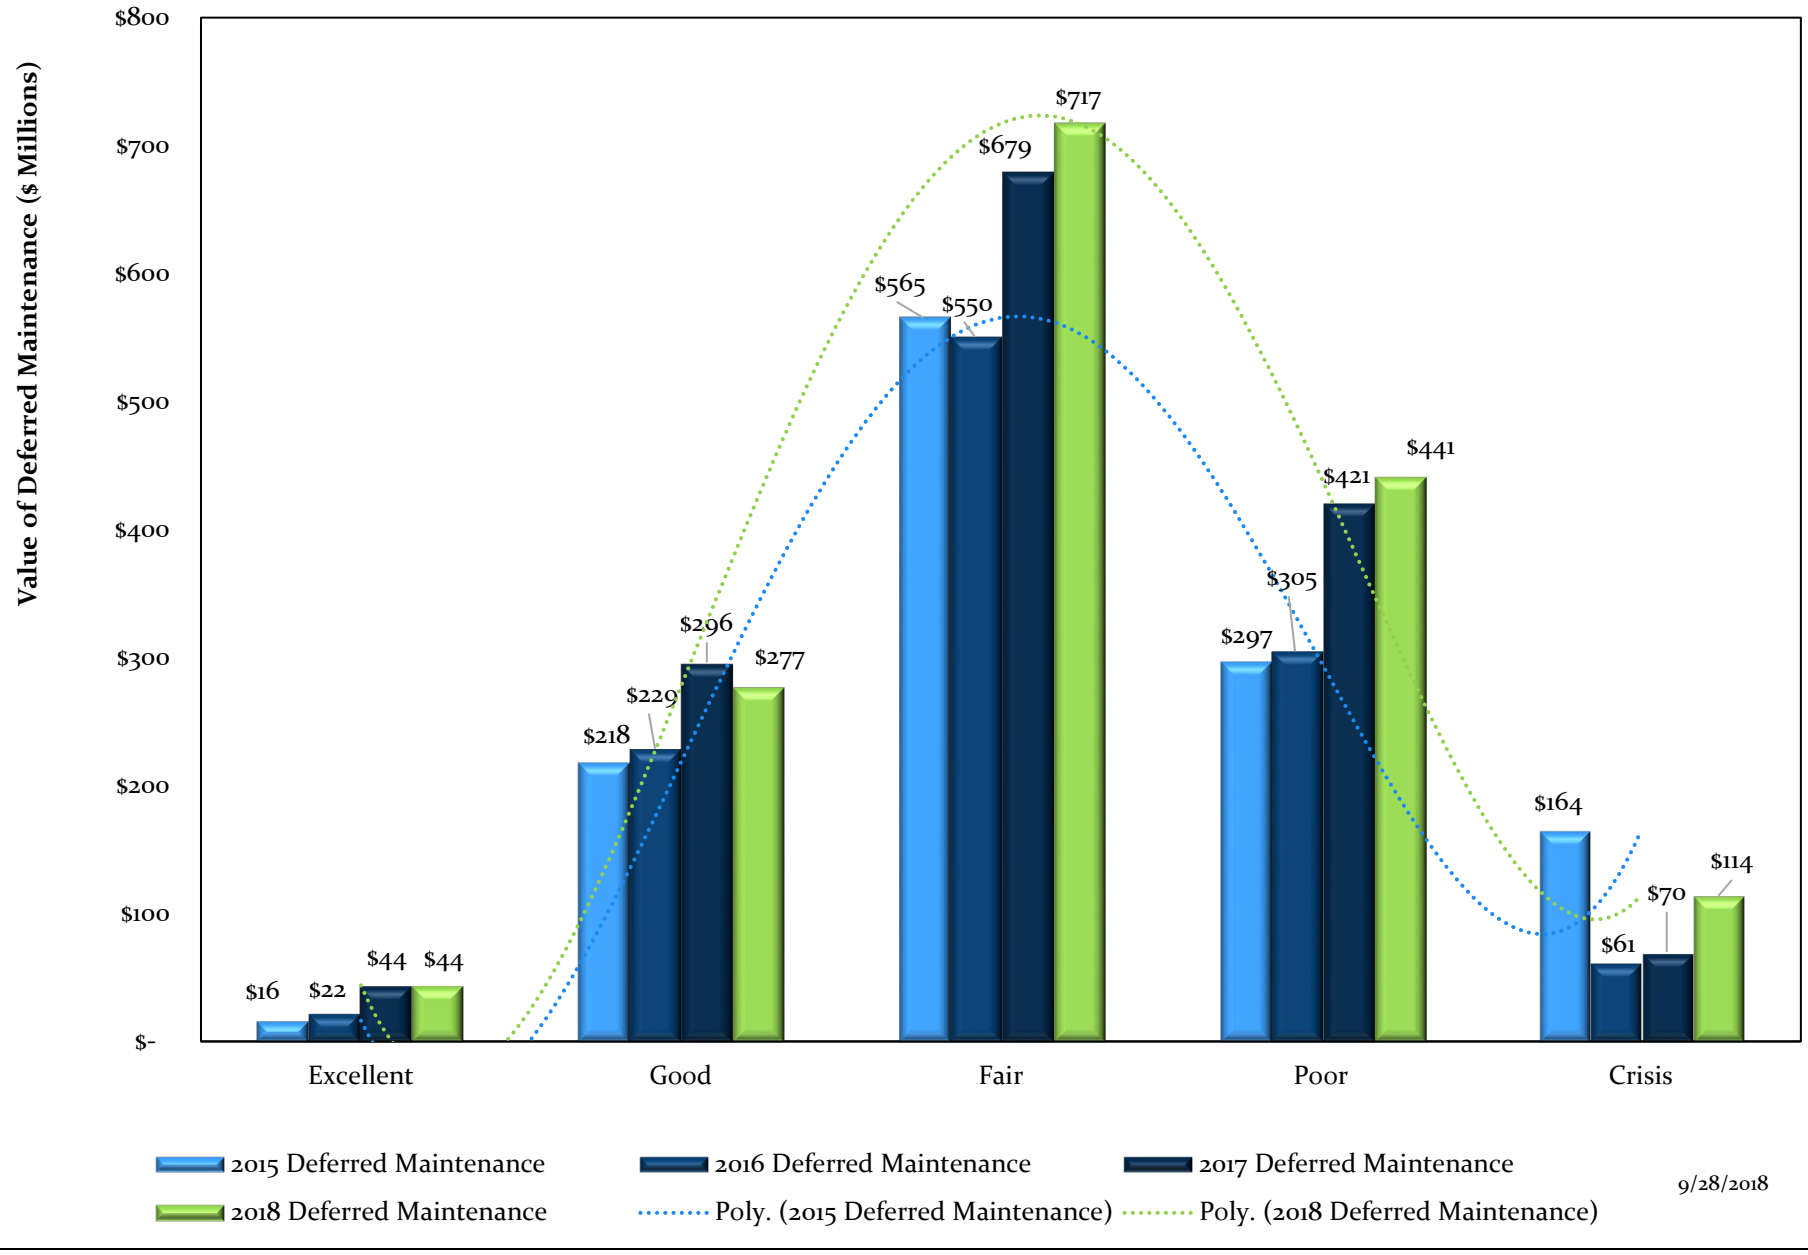

# Average Cost of Deferred Maintenance/Per SqFt by FCI Rating

| | | FCI Rating Scoreboard | | | | | |
|---|---|---|---|---|---|---|---|
| Agency ID | | Total | Crisis | Poor | Fair | Good | Excellent |
| Total | Project - Count | 4,765 | 287 | 778 | 1,698 | 1,549 | 453 |
| | Exterior Gross SqFt | 32,862,654 | 1,199,060 | 4,105,953 | 12,078,380 | 11,651,216 | 3,828,045 |
| | Current Replacement Value | $ 8,861,371,148 | $ 175,112,740 | $ 1,237,169,589 | $ 3,291,855,986 | $ 2,788,672,696 | $ 1,368,560,137 |
| | Deferred Maintenance | $ 1,592,902,995 | $ 113,779,767 | $ 440,893,163 | $ 717,254,608 | $ 277,009,201 | $ 43,966,256 |
| B04-Department of Agriculture | Project - Count | 1 | | | 1 | | |
| | Exterior Gross SqFt | 8,304 | | | 8,304 | | |
| | Current Replacement Value | $ 7,079,845 | | | $ 7,079,845 | | |
| | Deferred Maintenance | $ 1,746,542 | | | $ 1,746,542 | | |
| B13-Department of Commerce | Project - Count | 1 | | 1 | | | |
| | Exterior Gross SqFt | 3,216 | | 3,216 | | | |
| | Current Replacement Value | $ 793,588 | | $ 793,588 | | | |
| | Deferred Maintenance | $ 323,360 | | $ 323,360 | | | |
| B22-Employment and Economic Development | Project - Count | 2 | | | 1 | 1 | |
| | Exterior Gross SqFt | 27,051 | | | 20,726 | 6,325 | |
| | Current Replacement Value | $ 6,819,591 | | | $ 4,987,582 | $ 1,832,009 | |
| | Deferred Maintenance | $ 1,603,394 | | | $ 1,491,540 | $ 111,854 | |
| B43-Iron Range Resources | Project - Count | 61 | 5 | 18 | 22 | 13 | 3 |
| | Exterior Gross SqFt | 244,453 | 66,809 | 64,499 | 75,539 | 37,064 | 541.92 |
| | Current Replacement Value | $ 48,509,696 | $ 5,717,609 | $ 13,457,482 | $ 19,235,502 | $ 10,024,424 | $ 74,679 |
| | Deferred Maintenance | $ 13,855,310 | $ 3,810,673 | $ 4,662,539 | $ 4,362,786 | $ 1,015,963 | $ 3,349 |
| B9D-Amateur Sports Commission | Project - Count | 24 | | 5 | 5 | 14 | |
| | Exterior Gross SqFt | 807,054 | | 296,080 | 475,508 | 35,465 | |
| | Current Replacement Value | $ 170,280,044 | | $ 63,718,118 | $ 99,200,786 | $ 7,361,140 | |
| | Deferred Maintenance | $ 41,793,274 | | $ 20,551,325 | $ 20,774,178 | $ 467,772 | |
| E25-Perpich Center | Project - Count | 5 | | | 3 | 1 | 1 |
| | Exterior Gross SqFt | 176,361 | | | 124,953 | 46,968 | 4,440 |
| | Current Replacement Value | $ 37,351,824 | | | $ 25,905,136 | $ 10,791,163 | $ 655,525 |
| | Deferred Maintenance | $ 6,815,736 | | | $ 6,042,344 | $ 760,281 | $ 13,110 |
| E40-Historical Society | Project - Count | 137 | 12 | 23 | 59 | 33 | 10 |
| | Exterior Gross SqFt | 1,275,097 | 83294.89 | 133,872 | 420,930 | 604,832 | 32,168 |
| | Current Replacement Value | $ 318,222,063 | $ 31,794,682 | $ 44,244,653 | $ 123,332,499 | $ 110,215,757 | $ 8,634,471 |
| | Deferred Maintenance | $ 78,631,244 | $ 19,630,842 | $ 15,725,561 | $ 28,078,737 | $ 14,989,016 | $ 207,088 |
| E44-Minnesota State Academies | Project - Count | 0 | | | | | |
| | Exterior Gross SqFt | 0 | | | | | |
| | Current Replacement Value | $ - | | | | | |
| | Deferred Maintenance | $ - | | | | | |
| E77-MN Zoological Garden | Project - Count | 124 | 2 | 10 | 39 | 57 | 16 |
| | Exterior Gross SqFt | 648,413 | 3,792 | 34,081 | 413,231 | 185,715 | 11,594 |
| | Current Replacement Value | $ 179,415,066 | $ 1,329,959 | $ 15,739,030 | $ 113,607,034 | $ 45,141,649 | $ 3,597,393 |
| | Deferred Maintenance | $ 33,512,659 | $ 914,379 | $ 5,032,887 | $ 23,946,807 | $ 3,532,025 | $ 86,560 |
| G02-Department of Administration | Project - Count | 30 | 1 | 1 | 8 | 15 | 5 |
| | Exterior Gross SqFt | 5,531,893 | 57,143 | 22,001 | 1,478,921 | 2,523,916 | 1,449,912 |
| | Current Replacement Value | $ 1,729,319,518 | $ 14,079,041 | $ 12,515,706 | $ 237,386,816 | $ 578,634,921 | $ 886,703,034 |
| | Deferred Maintenance | $ 144,812,735 | $ 9,542,069 | $ 5,493,285 | $ 54,740,889 | $ 45,181,663 | $ 29,854,829 |

| Agency ID | | Total | Crisis | Poor | Fair | Good | Excellent |
|---|---|---|---|---|---|---|---|
| G62-MN State Retirement Systems | Project - Count | 2 | | | | 2 | |
| | Exterior Gross SqFt | 259,837 | | | | 259,837 | |
| | Current Replacement Value | $ 46,787,116 | | | | $ 46,787,116 | |
| | Deferred Maintenance | $ 2,929,618 | | | | $ 2,929,618 | |
| H55-Department of Human Services | Project - Count | 152 | 6 | 21 | 63 | 53 | 9 |
| | Exterior Gross SqFt | 2,503,666 | 74439.88 | 448,157 | 873,900 | 1,059,770 | 47398.47 |
| | Current Replacement Value | $ 831,325,918 | $ 15,268,679 | $ 134,992,233 | $ 298,431,413 | $ 369,783,442 | $ 12,850,151 |
| | Deferred Maintenance | $ 160,106,017 | $ 8,474,286 | $ 50,508,951 | $ 59,550,483 | $ 41,172,919 | $ 399,377 |
| H75-MN Veterans Homes | Project - Count | 63 | 5 | 7 | 14 | 22 | 15 |
| | Exterior Gross SqFt | 1,243,421 | 18,374 | 98,734 | 458,311 | 240,986 | 427,016 |
| | Current Replacement Value | $ 313,818,411 | $ 3,216,327 | $ 22,632,186 | $ 117,964,970 | $ 65,235,215 | $ 104,769,712 |
| | Deferred Maintenance | $ 42,601,406 | $ 2,132,510 | $ 7,904,667 | $ 23,026,072 | $ 5,509,287 | $ 4,028,871 |
| P01-Military Affairs | Project - Count | 68 | | 23 | 22 | 20 | 3 |
| | Exterior Gross SqFt | 2,660,359 | | 931,373 | 679,779 | 639,389 | 409,819 |
| | Current Replacement Value | $ 631,176,526 | | $ 216,360,551 | $ 166,078,839 | $ 177,214,831 | $ 71,522,305 |
| | Deferred Maintenance | $ 136,511,687 | | $ 79,184,784 | $ 37,160,047 | $ 18,298,312 | $ 1,868,543 |
| P07-Department of Public Safety | Project - Count | 6 | | | 3 | 3 | |
| | Exterior Gross SqFt | 20,360 | | | 18,933 | 1,427 | |
| | Current Replacement Value | $ 4,611,357 | | | $ 4,477,514 | $ 133,842 | |
| | Deferred Maintenance | $ 940,821 | | | $ 926,561 | $ 14,259 | |
| P78-Department of Corrections | Project - Count | 329 | 19 | 53 | 153 | 97 | 7 |
| | Exterior Gross SqFt | 7,481,526 | 352,381 | 1,325,148 | 3,033,215 | 2,543,572 | 227,210 |
| | Current Replacement Value | $ 2,625,984,833 | $ 54,926,466 | $ 577,002,375 | $ 1,235,129,925 | $ 711,129,615 | $ 47,796,453 |
| | Deferred Maintenance | $ 592,726,311 | $ 33,616,849 | $ 202,387,157 | $ 280,029,104 | $ 75,504,970 | $ 1,188,231 |
| R29-Department of Natural Resources | Project - Count | 2,856 | 217 | 558 | 1,038 | 790 | 253 |
| | Exterior Gross SqFt | 3,328,712 | 522,787 | 520,657 | 1,184,652 | 913,860 | 186,756 |
| | Current Replacement Value | $ 622,232,471 | $ 46,492,230 | $ 101,596,686 | $ 250,589,988 | $ 184,273,951 | $ 39,279,616 |
| | Deferred Maintenance | $ 146,365,460 | $ 33,962,447 | $ 37,147,097 | $ 53,835,546 | $ 20,440,345 | $ 980,026 |
| R32-Pollution Control Agency | Project - Count | 18 | | | 4 | 13 | 1 |
| | Exterior Gross SqFt | 25,198 | | | 17,501 | 7,597 | 100 |
| | Current Replacement Value | $ 10,523,744 | | | $ 2,102,701 | $ 8,411,574 | $ 9,468 |
| | Deferred Maintenance | $ 1,303,785 | | | $ 459,287 | $ 844,309 | $ 189 |
| T79-Department of Transportation | Project - Count | 886 | 20 | 58 | 263 | 415 | 130 |
| | Exterior Gross SqFt | 6,617,735 | 20,039 | 228,136 | 2,793,975 | 2,544,493 | 1,031,091 |
| | Current Replacement Value | $ 1,277,119,540 | $ 2,287,747 | $ 34,116,981 | $ 586,345,435 | $ 461,702,047 | $ 192,667,331 |
| | Deferred Maintenance | $ 186,323,637 | $ 1,695,711 | $ 11,971,551 | $ 121,083,684 | $ 46,236,608 | $ 5,336,082 |

This report was created on 9/28/2018.

| | | System Rating Scoreboard | | | | | |
|---|---|---|---|---|---|---|---|
| Agency ID | | Total | Crisis | Poor | Fair | Good | Excellent |
| Total | System - Count | 59,992 | 700 | 3,720 | 19,480 | 23,673 | 12,419 |
| | Current Replacement Value | $8,861,371,148 | $98,634,845 | $463,953,601 | $2,373,344,729 | $3,056,916,595 | $2,868,521,377 |
| | Deferred Maintenance | $1,592,902,995 | $98,634,845 | $347,968,183 | $783,206,402 | $305,718,491 | $57,375,074 |
| | Adjusted DM | $689,329,343 | $98,634,845 | $463,953,601 | $89,000,427 | $30,569,166 | $7,171,303 |
| B04-Department of Agriculture | System - Count | 19 | | 3 | 8 | 7 | 1 |
| | Current Replacement Value | $7,079,845 | | $497,651 | $3,151,820 | $3,307,450 | $122,924 |
| | Deferred Maintenance | $1,746,542 | | $373,238 | $1,040,101 | $330,745 | $2,458 |
| | Adjusted DM | $649,226 | | $497,651 | $118,193 | $33,074 | $307 |
| B13-Department of Commerce | System - Count | 26 | 3 | 8 | 6 | 6 | 3 |
| | Current Replacement Value | $793,588 | $68,272 | $214,399 | $230,846 | $156,345 | $123,725 |
| | Deferred Maintenance | $323,360 | $68,272 | $160,799 | $76,179 | $15,635 | $2,474 |
| | Adjusted DM | $293,201 | $68,272 | $214,399 | $8,657 | $1,563 | $309 |
| B22-Employment and Economic Development | System - Count | 49 | 2 | 3 | 8 | 20 | 16 |
| | Current Replacement Value | $6,819,591 | $299,554 | $801,554 | $1,101,601 | $3,085,105 | $1,531,776 |
| | Deferred Maintenance | $1,603,394 | $299,554 | $601,165 | $363,528 | $308,511 | $30,636 |
| | Adjusted DM | $1,177,099 | $299,554 | $801,554 | $41,310 | $30,851 | $3,829 |
| B43-Iron Range Resources | System - Count | 729 | 4 | 71 | 292 | 188 | 174 |
| | Current Replacement Value | $48,509,696 | $22,727 | $8,570,172 | $18,259,010 | $11,829,055 | $9,828,731 |
| | Deferred Maintenance | $13,855,310 | $22,727 | $6,427,629 | $6,025,473 | $1,182,906 | $196,575 |
| | Adjusted DM | $9,420,475 | $22,727 | $8,570,172 | $684,713 | $118,291 | $24,572 |
| B9D-Amateur Sports Commission | System - Count | 371 | 8 | 36 | 57 | 150 | 120 |
| | Current Replacement Value | $170,280,044 | $1,865,398 | $17,442,905 | $67,274,726 | $37,138,714 | $46,558,300 |
| | Deferred Maintenance | $41,793,274 | $1,865,398 | $13,082,179 | $22,200,660 | $3,713,871 | $931,166 |
| | Adjusted DM | $22,318,888 | $1,865,398 | $17,442,905 | $2,522,802 | $371,387 | $116,396 |
| E25-Perpich Center | System - Count | 146 | 2 | 4 | 39 | 43 | 58 |
| | Current Replacement Value | $37,351,824 | $687,710 | $1,202,723 | $11,795,680 | $10,751,187 | $12,914,524 |
| | Deferred Maintenance | $6,815,736 | $687,710 | $902,042 | $3,892,574 | $1,075,119 | $258,290 |
| | Adjusted DM | $2,472,569 | $687,710 | $1,202,723 | $442,338 | $107,512 | $32,286 |
| E40-Historical Society | System - Count | 2,044 | 45 | 159 | 595 | 987 | 258 |
| | Current Replacement Value | $318,222,063 | $9,720,447 | $37,751,031 | $75,321,547 | $147,910,410 | $47,518,627 |
| | Deferred Maintenance | $78,631,244 | $9,720,447 | $28,313,273 | $24,856,110 | $14,791,041 | $950,373 |
| | Adjusted DM | $51,893,937 | $9,720,447 | $37,751,031 | $2,824,558 | $1,479,104 | $118,797 |
| E44-Minnesota State Academies | System - Count | 123 | 3 | 14 | 52 | 52 | 2 |
| | Current Replacement Value | $0 | $0 | $0 | $0 | $0 | $0 |
| | Deferred Maintenance | $0 | $0 | $0 | $0 | $0 | $0 |
| | Adjusted DM | $0 | $0 | $0 | $0 | $0 | $0 |
| E77-MN Zoological Garden | System - Count | 1,593 | 5 | 99 | 428 | 566 | 495 |
| | Current Replacement Value | $179,415,066 | $223,810 | $5,999,220 | $64,187,858 | $67,841,962 | $41,162,215 |
| | Deferred Maintenance | $33,512,659 | $223,810 | $4,499,415 | $21,181,993 | $6,784,196 | $823,244 |
| | Adjusted DM | $9,411,400 | $223,810 | $5,999,220 | $2,407,045 | $678,420 | $102,906 |
| G02-Department of Administration | System - Count | 850 | 18 | 29 | 140 | 302 | 361 |
| | Current Replacement Value | $1,729,319,518 | $8,249,759 | $30,604,560 | $133,263,196 | $481,108,263 | $1,076,093,739 |
| | Deferred Maintenance | $144,812,735 | $8,249,759 | $22,953,420 | $43,976,855 | $48,110,826 | $21,521,875 |
| | Adjusted DM | $51,353,006 | $8,249,759 | $30,604,560 | $4,997,370 | $4,811,083 | $2,690,234 |

| Agency ID | | Total | Crisis | Poor | Fair | Good | Excellent |
|---|---|---|---|---|---|---|---|
| G62-MN State Retirement Systems | System - Count | 52 | | 1 | 2 | 26 | 23 |
| | Current Replacement Value | $46,787,116 | | $456,034 | $252,898 | $19,782,154 | $26,296,030 |
| | Deferred Maintenance | $2,929,618 | | $342,026 | $83,456 | $1,978,215 | $525,921 |
| | Adjusted DM | $729,079 | | $456,034 | $9,484 | $197,822 | $65,740 |
| H55-Department of Human Services | System - Count | 3167 | 60 | 203 | 974 | 1062 | 868 |
| | Current Replacement Value | $831,325,918 | $11,619,458 | $63,137,773 | $207,254,765 | $271,910,972 | $277,402,950 |
| | Deferred Maintenance | $160,106,017 | $11,619,458 | $47,353,330 | $68,394,073 | $27,191,097 | $5,548,059 |
| | Adjusted DM | $85,941,902 | $11,619,458 | $63,137,773 | $7,772,054 | $2,719,110 | $693,507 |
| H75-MN Veterans Homes | System - Count | 1,176 | 34 | 101 | 205 | 368 | 468 |
| | Current Replacement Value | $313,818,411 | $1,521,273 | $17,352,835 | $46,015,270 | $98,773,588 | $150,155,444 |
| | Deferred Maintenance | $42,601,406 | $1,521,273 | $13,014,626 | $15,185,039 | $9,877,359 | $3,003,109 |
| | Adjusted DM | $21,962,805 | $1,521,273 | $17,352,835 | $1,725,573 | $987,736 | $375,389 |
| P01-Military Affairs | System - Count | 2,536 | 11 | 155 | 660 | 1,324 | 386 |
| | Current Replacement Value | $631,176,526 | $1,947,429 | $51,724,516 | $214,367,466 | $221,867,846 | $141,269,268 |
| | Deferred Maintenance | $136,511,687 | $1,947,429 | $38,793,387 | $70,741,264 | $22,199,682 | $2,829,924 |
| | Adjusted DM | $64,282,577 | $1,947,429 | $51,724,516 | $8,038,780 | $2,218,678 | $353,173 |
| P07-Department of Public Safety | System - Count | 78 | | 1 | 32 | 26 | 19 |
| | Current Replacement Value | $4,611,357 | | $379,744 | $1,459,138 | $1,488,096 | $1,284,379 |
| | Deferred Maintenance | $940,821 | | $284,808 | $481,515 | $148,810 | $25,688 |
| | Adjusted DM | $452,554 | | $379,744 | $54,718 | $14,881 | $3,211 |
| P78-Department of Corrections | System - Count | 6,199 | 108 | 329 | 2,244 | 2,340 | 1,178 |
| | Current Replacement Value | $2,625,984,833 | $35,287,432 | $137,886,346 | $1,076,044,535 | $892,426,159 | $484,340,362 |
| | Deferred Maintenance | $592,726,311 | $35,287,432 | $103,414,759 | $355,094,697 | $89,242,616 | $9,686,807 |
| | Adjusted DM | $223,660,560 | $35,287,432 | $137,886,346 | $40,351,670 | $8,924,262 | $1,210,851 |
| R29-Department of Natural Resources | System - Count | 29,066 | 348 | 1,959 | 10,888 | 11,636 | 4,235 |
| | Current Replacement Value | $622,232,471 | $20,138,936 | $43,362,540 | $199,523,948 | $258,395,566 | $100,811,480 |
| | Deferred Maintenance | $146,365,460 | $20,138,936 | $32,524,887 | $65,845,544 | $25,839,756 | $2,016,337 |
| | Adjusted DM | $73,819,609 | $20,138,936 | $43,362,540 | $7,482,148 | $2,583,956 | $252,029 |
| R32-Pollution Control Agency | System - Count | 165 | | 2 | 11 | 142 | 10 |
| | Current Replacement Value | $10,523,744 | | $183,924 | $585,507 | $9,719,229 | $35,083 |
| | Deferred Maintenance | $1,303,785 | | $137,943 | $193,217 | $971,923 | $702 |
| | Adjusted DM | $303,161 | | $183,924 | $21,957 | $97,192 | $88 |
| T79-Department of Transportation | System - Count | 11,603 | 49 | 543 | 2,839 | 4,428 | 3,744 |
| | Current Replacement Value | $1,277,119,540 | $6,982,639 | $46,385,673 | $253,254,917 | $519,424,492 | $451,071,819 |
| | Deferred Maintenance | $186,323,637 | $6,982,639 | $34,789,255 | $83,574,123 | $51,956,184 | $9,021,436 |
| | Adjusted DM | $69,187,296 | $6,982,639 | $46,385,673 | $9,497,059 | $5,194,245 | $1,127,680 |

This report was created on 9/28/2018.

# Facility Condition Assessments (FCA) by Agency

DEPARTMENT OF ADMINISTRATION
ENTERPRISE REAL PROPERTY

**Report Note:** This report includes all agency facility condition assessment totals for all agencies with assessed buildings. This report is intended to be used for Enterprise FCA reporting. Report is grouped by agency name and ordered by ascending agency code.

**STATE OF MINNESOTA - 9/28/2018**

## Agency: B04 - Agriculture

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $7,079,845 | **Ext. Gross Area:** | 8,304 |
| **Facility Condition Index:** | 0.25 | **Deferred Maintenance:** | $1,746,542 | **Building Count:** | 1 |

## Agency: B13 - Department of Commerce

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Poor | **Current Replacement Value:** | $793,588 | **Ext. Gross Area:** | 3,216 |
| **Facility Condition Index:** | 0.41 | **Deferred Maintenance:** | $323,360 | **Building Count:** | 1 |

## Agency: B22 - Department of Employment & Economic Development

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $6,819,591 | **Ext. Gross Area:** | 27,051 |
| **Facility Condition Index:** | 0.24 | **Deferred Maintenance:** | $1,603,394 | **Building Count:** | 2 |

## Agency: B43 - Iron Range Resource

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $48,509,696 | **Ext. Gross Area:** | 244,453 |
| **Facility Condition Index:** | 0.29 | **Deferred Maintenance:** | $13,855,310 | **Building Count:** | 61 |

## Agency: B9D - Amateur Sports Commission

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $170,280,044 | **Ext. Gross Area:** | 807,054 |
| **Facility Condition Index:** | 0.25 | **Deferred Maintenance:** | $41,793,274 | **Building Count:** | 24 |

## Agency: E25 - Perpich Center

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $37,351,824 | **Ext. Gross Area:** | 176,361 |
| **Facility Condition Index:** | 0.18 | **Deferred Maintenance:** | $6,815,736 | **Building Count:** | 5 |

## Agency: E40 - Historical Society

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $318,222,063 | **Ext. Gross Area:** | 1,275,097 |
| **Facility Condition Index:** | 0.25 | **Deferred Maintenance:** | $78,631,244 | **Building Count:** | 137 |

## Agency: E77 - Minnesota Zoological Garden

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $179,415,066 | **Ext. Gross Area:** | 648,413 |
| **Facility Condition Index:** | 0.19 | **Deferred Maintenance:** | $33,512,659 | **Building Count:** | 124 |

## Agency: G02 - Department of Administration

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $1,729,319,518 | **Ext. Gross Area:** | 5,531,893 |
| **Facility Condition Index:** | 0.08 | **Deferred Maintenance:** | $144,812,735 | **Building Count:** | 30 |

## Agency: G62 - MN State Retirement Systems

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $46,787,116 | **Ext. Gross Area:** | 259,837 |
| **Facility Condition Index:** | 0.06 | **Deferred Maintenance:** | $2,929,618 | **Building Count:** | 2 |

## Agency: H55 - Department of Human Services

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $831,325,918 | **Ext. Gross Area:** | 2,503,666 |
| **Facility Condition Index:** | 0.19 | **Deferred Maintenance:** | $160,106,017 | **Building Count:** | 152 |

## Agency: H75 - Minnesota Veterans Affairs

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $313,818,411 | **Ext. Gross Area:** | 1,243,421 |
| **Facility Condition Index:** | 0.14 | **Deferred Maintenance:** | $42,601,406 | **Building Count:** | 63 |

## Agency: P01 - Military Affairs

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $631,176,526 | **Ext. Gross Area:** | 2,660,359 |
| **Facility Condition Index:** | 0.22 | **Deferred Maintenance:** | $136,511,687 | **Building Count:** | 68 |

## Agency: P07 - Public Safety

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $4,611,357 | **Ext. Gross Area:** | 20,360 |
| **Facility Condition Index:** | 0.20 | **Deferred Maintenance:** | $940,821 | **Building Count:** | 6 |

## Agency: P78 - Department of Corrections

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $2,625,984,833 | **Ext. Gross Area:** | 7,481,526 |
| **Facility Condition Index:** | 0.23 | **Deferred Maintenance:** | $592,726,311 | **Building Count:** | 329 |

## Agency: R29 - Department of Natural Resources

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $622,232,471 | **Ext. Gross Area:** | 3,328,712 |
| **Facility Condition Index:** | 0.24 | **Deferred Maintenance:** | $146,365,460 | **Building Count:** | 2,856 |

## Agency: R32 - Pollution Control Agency

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $10,523,744 | **Ext. Gross Area:** | 25,198 |
| **Facility Condition Index:** | 0.12 | **Deferred Maintenance:** | $1,303,785 | **Building Count:** | 18 |

## Agency: T79 - Department of Transportation

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $1,277,119,540 | **Ext. Gross Area:** | 6,617,735 |
| **Facility Condition Index:** | 0.15 | **Deferred Maintenance:** | $186,323,637 | **Building Count:** | 886 |

# Facility Condition Assessments (FCA) by Building

DEPARTMENT OF ADMINISTRATION
ENTERPRISE REAL PROPERTY

**Report Note:** This report includes all agency facility condition assessment totals for each agency and each building assessed. This report is intended to be used for Enterprise FCA reporting. Report is grouped by agency name and site code, and ordered by ascending building code.

**STATE OF MINNESOTA - 9/28/2018**

## Agency: B04 - Agriculture

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $7,079,845 | **Ext. Gross Area:** | 8,304 |
| **Facility Condition Index:** | 0.25 | **Deferred Maintenance:** | $1,746,542 | **Building Count:** | 1 |

### *Site: B04100 - East Grand Forks*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B0410000312 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $7,079,845 |
| **Building Name:** | East Grand Forks Potato Inspection | **Address:** | 312 4th Ave NE | **Deferred Maintenance:** | $1,746,542 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 8,304 |

## Agency: B13 - Department of Commerce

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Poor | **Current Replacement Value:** | $793,588 | **Ext. Gross Area:** | 3,216 |
| **Facility Condition Index:** | 0.41 | **Deferred Maintenance:** | $323,360 | **Building Count:** | 1 |

### *Site: B13000 - Master Scale*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B1300000001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $793,588 |
| **Building Name:** | Master Scale | **Address:** | 475 Prior Ave | **Deferred Maintenance:** | $323,360 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,216 |

# Agency: B22 - Department of Employment & Economic Development

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $6,819,591 | **Ext. Gross Area:** | 27,051 |
| **Facility Condition Index:** | 0.24 | **Deferred Maintenance:** | $1,603,394 | **Building Count:** | 2 |

## *Site: B22000 - St. Cloud UI Call Center*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B2200000427 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,832,009 |
| **Building Name:** | Unemployment Call Center | **Address:** | 111 Lincoln Ave | **Deferred Maintenance:** | $111,854 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | St. Cloud | **Ext. Gross Area:** | 6,325 |

## *Site: B22001 - Minneapolis South WFC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B2200000227 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,987,582 |
| **Building Name:** | Mpls South Service Office | **Address:** | 777 East Lake Street | **Deferred Maintenance:** | $1,491,540 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 20,726 |

# Agency: B43 - Iron Range Resource

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $48,509,696 | **Ext. Gross Area:** | 244,453 |
| **Facility Condition Index:** | 0.29 | **Deferred Maintenance:** | $13,855,310 | **Building Count:** | 61 |

## *Site: B43000 - Mineland Reclamation & Ironworld*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300000269 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $33,718 |
| **Building Name:** | Fest Park/Grounds | **Address:** | Hwy 169 | **Deferred Maintenance:** | $17,011 |
| **Facility Condition Index:** | 0.50 - Crisis | **City Code:** | Chisholm | **Ext. Gross Area:** | 400 |
| **Building Code:** | B4300000469 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $5,244,092 |
| **Building Name:** | Amphitheatre | **Address:** | Hwy 169 | **Deferred Maintenance:** | $1,778,438 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 23,542 |
| **Building Code:** | B4300000669 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $3,657,414 |
| **Building Name:** | Interp Ctr | **Address:** | Hwy 169 | **Deferred Maintenance:** | $2,555,340 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | Chisholm | **Ext. Gross Area:** | 41,410 |
| **Building Code:** | B4300000769 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $180,092 |
| **Building Name:** | Geology Wing | **Address:** | Hwy 169 | **Deferred Maintenance:** | $87,201 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 2,000 |
| **Building Code:** | B4300000869 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $3,409,058 |
| **Building Name:** | Control Bldg | **Address:** | Hwy 169 | **Deferred Maintenance:** | $1,081,337 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 9,573 |
| **Building Code:** | B4300001069 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $914,059 |
| **Building Name:** | Energy Bldg | **Address:** | Hwy 169 | **Deferred Maintenance:** | $231,769 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Chisholm | **Ext. Gross Area:** | 5,640 |
| **Building Code:** | B4300001469 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $334,988 |
| **Building Name:** | Railroad Maint Bldg | **Address:** | Hwy 169 | **Deferred Maintenance:** | $139,616 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 4,400 |
| **Building Code:** | B4300001569 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $927,224 |
| **Building Name:** | Research Library | **Address:** | Hwy 169 | **Deferred Maintenance:** | $531,171 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | Chisholm | **Ext. Gross Area:** | 14,798 |
| **Building Code:** | B4300001669 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $62,089 |
| **Building Name:** | CCC Building | **Address:** | Hwy 169 | **Deferred Maintenance:** | $21,899 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 1,064 |
| **Building Code:** | B4300002069 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $921,584 |
| **Building Name:** | Ethnic Arts Center | **Address:** | Hwy 169 | **Deferred Maintenance:** | $610,577 |
| **Facility Condition Index:** | 0.66 - Crisis | **City Code:** | Chisholm | **Ext. Gross Area:** | 8,600 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300002169 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $231,528 |
| **Building Name:** | Amph Maint | **Address:** | Hwy 169 | **Deferred Maintenance:** | $93,587 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 1,827 |
| **Building Code:** | B4300002669 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $318,133 |
| **Building Name:** | Pavilion | **Address:** | Hwy 169 | **Deferred Maintenance:** | $55,415 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Chisholm | **Ext. Gross Area:** | 6,112 |
| **Building Code:** | B4300002869 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $7,277 |
| **Building Name:** | Warehouse | **Address:** | Hwy 169 | **Deferred Maintenance:** | $2,402 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 6,794 |
| **Building Code:** | B4300003069 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,580,590 |
| **Building Name:** | Mineland Recreation | **Address:** | Hwy 169 | **Deferred Maintenance:** | $1,303,495 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 8,626 |
| **Building Code:** | B4300003269 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $177,669 |
| **Building Name:** | Children Play Area Bldg | **Address:** | Hwy 169 | **Deferred Maintenance:** | $96,574 |
| **Facility Condition Index:** | 0.54 - Crisis | **City Code:** | Chisholm | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | B4300003369 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $49,335 |
| **Building Name:** | Wilpen Depot | **Address:** | Hwy 169 | **Deferred Maintenance:** | $16,281 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 540 |
| **Building Code:** | B4300003469 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $86,066 |
| **Building Name:** | Depot Bathrooms | **Address:** | Hwy 169 | **Deferred Maintenance:** | $38,082 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 180 |
| **Building Code:** | B4300003569 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $93,094 |
| **Building Name:** | Exhibit Storage | **Address:** | Hwy 169 | **Deferred Maintenance:** | $30,721 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 4,726 |
| **Building Code:** | B4300003769 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $75,758 |
| **Building Name:** | Bunk House | **Address:** | Hwy 169 | **Deferred Maintenance:** | $15,753 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Chisholm | **Ext. Gross Area:** | 433 |
| **Building Code:** | B4300003869 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $636 |
| **Building Name:** | Trappers Shack | **Address:** | Hwy 169 | **Deferred Maintenance:** | $210 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Chisholm | **Ext. Gross Area:** | 240 |
| **Building Code:** | B4300003969 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $2,093 |
| **Building Name:** | Gazebo | **Address:** | | **Deferred Maintenance:** | $691 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CHISHOLM | **Ext. Gross Area:** | 200 |

***Site: B43001 - Giants Ridge***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300100168 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,065 |
| **Building Name:** | Calgary Lift Bldg - Bottom | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $15,567 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | Biwabik | **Ext. Gross Area:** | 55 |
| **Building Code:** | B4300100169 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,740 |
| **Building Name:** | Calgary Lift Bldg - Top | **Address:** | | **Deferred Maintenance:** | $6,113 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 55 |
| **Building Code:** | B4300100170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $42,402 |
| **Building Name:** | Chamonix Lift Bldg. - Bottom | **Address:** | | **Deferred Maintenance:** | $17,975 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | Biwabik | **Ext. Gross Area:** | 68 |
| **Building Code:** | B4300100171 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,065 |
| **Building Name:** | Chamonix Lift Bldg - Top | **Address:** | | **Deferred Maintenance:** | $11,170 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 55 |
| **Building Code:** | B4300100172 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,912 |
| **Building Name:** | Helsinki Lift Bldg - Bottom | **Address:** | | **Deferred Maintenance:** | $9,876 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | Biwabik | **Ext. Gross Area:** | 55 |
| **Building Code:** | B4300100173 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,912 |
| **Building Name:** | Helsinki Lift Bldg - Top | **Address:** | | **Deferred Maintenance:** | $9,876 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | Biwabik | **Ext. Gross Area:** | 55 |
| **Building Code:** | B4300100174 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,018 |
| **Building Name:** | Rocky Top Lift Bldg-Bottom | **Address:** | | **Deferred Maintenance:** | $6,790 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 75 |
| **Building Code:** | B4300100175 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,943 |
| **Building Name:** | Rocky Top Lift Bldg-Top | **Address:** | | **Deferred Maintenance:** | $7,234 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 75 |
| **Building Code:** | B4300100176 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,799 |
| **Building Name:** | Sarejavo Lift Bldg-Bottom | **Address:** | | **Deferred Maintenance:** | $7,768 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 68 |
| **Building Code:** | B4300100177 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,778 |
| **Building Name:** | Sarejavo Lift Bldg-Top | **Address:** | | **Deferred Maintenance:** | $5,416 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 55 |
| **Building Code:** | B4300100178 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,360 |
| **Building Name:** | J-Bar Lift Bldg | **Address:** | | **Deferred Maintenance:** | $1,845 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 57 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300101869 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,873,673 |
| **Building Name:** | Maintenance Bldg | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $422,197 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 8,061 |
| **Building Code:** | B4300102569 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $3,037,384 |
| **Building Name:** | Ski Chalet | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $564,246 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 23,883 |
| **Building Code:** | B4300103969 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $123,318 |
| **Building Name:** | Bunker Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $25,928 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 324 |
| **Building Code:** | B4300104069 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,114 |
| **Building Name:** | Quarry Pump House | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $4,459 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 405 |
| **Building Code:** | B4300104169 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,260,059 |
| **Building Name:** | Quarry Maint. Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $1,843,270 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 6,105 |
| **Building Code:** | B4300104269 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $49,253 |
| **Building Name:** | Soil Bin Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $15,284 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Biwabik | **Ext. Gross Area:** | 554 |
| **Building Code:** | B4300104369 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,372,804 |
| **Building Name:** | Burnt Onion Maint. Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $208,731 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 14,565 |
| **Building Code:** | B4300104469 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,843 |
| **Building Name:** | Legend Pump House | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $2,655 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | Biwabik | **Ext. Gross Area:** | 390 |
| **Building Code:** | B4300104569 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,263,703 |
| **Building Name:** | Golf General Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $71,429 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 6,152 |
| **Building Code:** | B4300104570 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,828 |
| **Building Name:** | Legend Golf Starter Bldg | **Address:** | | **Deferred Maintenance:** | $1,700 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 53 |
| **Building Code:** | B4300104769 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,540 |
| **Building Name:** | Ski Patrol Shelter Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $1,411 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 99 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300104770 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,821 |
| **Building Name:** | Ski Patrol Sarejavo Upper | **Address:** | | **Deferred Maintenance:** | $465 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | Biwabik | **Ext. Gross Area:** | 99 |
| **Building Code:** | B4300104771 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,487 |
| **Building Name:** | Ski Patrol Rocky Top Upper | **Address:** | | **Deferred Maintenance:** | $1,744 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 67 |
| **Building Code:** | B4300104869 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $12,949 |
| **Building Name:** | GR Pod Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $930 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 195 |
| **Building Code:** | B4300104969 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,257,863 |
| **Building Name:** | Storage Bldg | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $78,371 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 6,181 |
| **Building Code:** | B4300104970 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,014 |
| **Building Name:** | The Quarry Golf Starter Bldg | **Address:** | | **Deferred Maintenance:** | $230 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Biwabik | **Ext. Gross Area:** | 53 |
| **Building Code:** | B4300104971 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,356,570 |
| **Building Name:** | The Quarry Clubhouse | **Address:** | | **Deferred Maintenance:** | $599,109 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 3,895 |
| **Building Code:** | B4300104972 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $264,220 |
| **Building Name:** | The Quarry Fertilizer Bldg | **Address:** | | **Deferred Maintenance:** | $14,072 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 1,687 |
| **Building Code:** | B4300105069 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $100,920 |
| **Building Name:** | Alpine Timing Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $7,938 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 1,147 |
| **Building Code:** | B4300105169 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $114,617 |
| **Building Name:** | Nordic Timing Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $11,260 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 1,284 |
| **Building Code:** | B4300105269 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $8,509 |
| **Building Name:** | Alpine Starter Bldg. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $1,507 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 56 |
| **Building Code:** | B4300105270 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,880 |
| **Building Name:** | Helsinki Starter Bldg-North | **Address:** | | **Deferred Maintenance:** | $5,096 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 52 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300105271 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,329 |
| **Building Name:** | Helsinki Starter Bldg-South | **Address:** | | **Deferred Maintenance:** | $6,282 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 56 |
| **Building Code:** | B4300105272 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,442 |
| **Building Name:** | Magic Carpet Bldg | **Address:** | | **Deferred Maintenance:** | $2,358 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Biwabik | **Ext. Gross Area:** | 44 |
| **Building Code:** | B4300105369 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $23,272 |
| **Building Name:** | GR Driving Range Storage. | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $3,430 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 201 |
| **Building Code:** | B4300105569 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $160,961 |
| **Building Name:** | GR Pump House | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $10,852 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 1,044 |
| **Building Code:** | B4300105669 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $30,892 |
| **Building Name:** | GR Valve House | **Address:** | Co. Road 138 | **Deferred Maintenance:** | $3,970 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Biwabik | **Ext. Gross Area:** | 209 |

### *Site: B43002 - Administration*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B4300200169 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $749,857 |
| **Building Name:** | Morton Storage Bldg | **Address:** | HWY 53 South | **Deferred Maintenance:** | $183,471 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Eveleth | **Ext. Gross Area:** | 6,247 |
| **Building Code:** | B4300201169 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $5,621,084 |
| **Building Name:** | Administration Bldg | **Address:** | HWY 53 South | **Deferred Maintenance:** | $955,712 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Eveleth | **Ext. Gross Area:** | 17,965 |

# Agency: B9D - Amateur Sports Commission

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $170,280,044 | **Ext. Gross Area:** | 807,054 |
| **Facility Condition Index:** | 0.25 | **Deferred Maintenance:** | $41,793,274 | **Building Count:** | 24 |

## *Site: B9D170 - Amateur Sports Blaine*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B9D17000100 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $24,717,247 |
| **Building Name:** | Sports Hall | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $4,252,963 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BLAINE | **Ext. Gross Area:** | 146,884 |
| **Building Code:** | B9D17000101 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $5,006,457 |
| **Building Name:** | Stadium | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,682,943 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | BLAINE | **Ext. Gross Area:** | 40,407 |
| **Building Code:** | B9D17000102 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $4,262,851 |
| **Building Name:** | Dormitory | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $787,636 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BLAINE | **Ext. Gross Area:** | 20,514 |
| **Building Code:** | B9D17000103 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $5,580,525 |
| **Building Name:** | Bike Track | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,170,718 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BLAINE | **Ext. Gross Area:** | 23,056 |
| **Building Code:** | B9D17000104 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $338,650 |
| **Building Name:** | Maintenance Shed | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $49,224 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 2,445 |
| **Building Code:** | B9D17000105 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,576 |
| **Building Name:** | Pump House #1 | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $7,848 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | BLAINE | **Ext. Gross Area:** | 441 |
| **Building Code:** | B9D17000107 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $11,258,645 |
| **Building Name:** | Event Center | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,722,117 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | BLAINE | **Ext. Gross Area:** | 42,108 |
| **Building Code:** | B9D17000108 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $57,504,085 |
| **Building Name:** | Super Rink | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $18,367,860 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | BLAINE | **Ext. Gross Area:** | 250,000 |
| **Building Code:** | B9D17000109 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $53,381,518 |
| **Building Name:** | Super Rink Addition | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $12,840,743 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | BLAINE | **Ext. Gross Area:** | 242,947 |
| **Building Code:** | B9D17000110 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $1,093,472 |
| **Building Name:** | Club House | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $77,403 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 5,850 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B9D17000111 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,171,715 |
| **Building Name:** | Turf Maintenance | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $486,962 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | BLAINE | **Ext. Gross Area:** | 5,006 |
| **Building Code:** | B9D17000112 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $105,279 |
| **Building Name:** | Pump House #2 | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $13,975 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 121 |
| **Building Code:** | B9D17000113 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $160,414 |
| **Building Name:** | Club House Concession | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $20,019 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 474 |
| **Building Code:** | B9D17000115 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,285 |
| **Building Name:** | Velodrome Concessions | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $5,712 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | BLAINE | **Ext. Gross Area:** | 226 |
| **Building Code:** | B9D17000116 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,069 |
| **Building Name:** | Velodrome Press Box | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $2,699 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 560 |
| **Building Code:** | B9D17000117 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $5,406,904 |
| **Building Name:** | Event Center Expansion | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $284,657 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 22,296 |
| **Building Code:** | B9D17000118 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $50,897 |
| **Building Name:** | Picnic Shelter D | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $6,709 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 1,092 |
| **Building Code:** | B9D17000119 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $50,897 |
| **Building Name:** | Picnic Shelter E | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $4,405 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 1,092 |
| **Building Code:** | B9D17000120 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $16,951 |
| **Building Name:** | Picnic Shelter H | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,437 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 256 |
| **Building Code:** | B9D17000121 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $16,951 |
| **Building Name:** | Picnic Shelter I | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,437 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 256 |
| **Building Code:** | B9D17000122 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $16,951 |
| **Building Name:** | Picnic Shelter J | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,437 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 256 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | B9D17000123 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,901 |
| **Building Name:** | Picnic Shelter K | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,456 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 256 |
| **Building Code:** | B9D17000124 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,901 |
| **Building Name:** | Picnic Shelter L | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,456 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 256 |
| **Building Code:** | B9D17000125 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,901 |
| **Building Name:** | Picnic Shelter M | **Address:** | 1700 105th Ave NE | **Deferred Maintenance:** | $1,456 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLAINE | **Ext. Gross Area:** | 256 |

# Agency: E25 - Perpich Center

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $37,351,824 | **Ext. Gross Area:** | 176,361 |
| **Facility Condition Index:** | 0.18 | **Deferred Maintenance:** | $6,815,736 | **Building Count:** | 5 |

## *Site: E25000 - Perpich Center for Arts Education*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E2500000327 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,654,367 |
| **Building Name:** | Gaia - PDI/RAC | **Address:** | 6105 Olson Memorial Highway | **Deferred Maintenance:** | $1,124,235 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Golden Valley | **Ext. Gross Area:** | 14,771 |
| **Building Code:** | E2500000427 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $8,494,122 |
| **Building Name:** | Delta - Dormitory | **Address:** | 6135 Olson Memorial Highway | **Deferred Maintenance:** | $2,149,669 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Golden Valley | **Ext. Gross Area:** | 44,342 |
| **Building Code:** | E2500000627 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $12,756,646 |
| **Building Name:** | Administration-East | **Address:** | 6125 Olson Memorial Highway | **Deferred Maintenance:** | $2,768,440 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Golden Valley | **Ext. Gross Area:** | 65,840 |
| **Building Code:** | E2500000727 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $10,791,163 |
| **Building Name:** | Administration-West | **Address:** | 6125 Olson Memorial Highway | **Deferred Maintenance:** | $760,281 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Golden Valley | **Ext. Gross Area:** | 46,968 |
| **Building Code:** | E2500000827 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $655,525 |
| **Building Name:** | Warehouse | **Address:** | 6153 Olson Memorial Highway | **Deferred Maintenance:** | $13,110 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 4,440 |

# Agency: E40 - Historical Society

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $318,222,063 | **Ext. Gross Area:** | 1,275,097 |
| **Facility Condition Index:** | 0.25 | **Deferred Maintenance:** | $78,631,244 | **Building Count:** | 137 |

## *Site: E40001 - Solomon Comstock House*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000100101 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $119,121 |
| **Building Name:** | Ice House | **Address:** | 508 8th Street South | **Deferred Maintenance:** | $23,730 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Moorhead | **Ext. Gross Area:** | 957 |
| **Building Code:** | E4000100102 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,235,985 |
| **Building Name:** | Comstock House | **Address:** | 508 8th Street South | **Deferred Maintenance:** | $832,992 |
| **Facility Condition Index:** | 0.67 - Crisis | **City Code:** | Moorhead | **Ext. Gross Area:** | 3,660 |

## *Site: E40002 - W. H. Folsom House*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000200201 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $58,410 |
| **Building Name:** | Folsom Garage | **Address:** | 272 West Government Street | **Deferred Maintenance:** | $12,056 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Taylors Falls | **Ext. Gross Area:** | 470 |
| **Building Code:** | E4000200202 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $861,012 |
| **Building Name:** | Folsom House | **Address:** | 272 West Government Street | **Deferred Maintenance:** | $326,758 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | Taylors Falls | **Ext. Gross Area:** | 3,710 |
| **Building Code:** | E4000200203 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,436 |
| **Building Name:** | Well House | **Address:** | 272 West Government Street | **Deferred Maintenance:** | $1,885 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Taylors Falls | **Ext. Gross Area:** | 64 |

## *Site: E40003 - Forest History Center*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000300302 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $137,015 |
| **Building Name:** | Rest Room Building | **Address:** | 2609 County Road 76 | **Deferred Maintenance:** | $82,750 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | Grand Rapids | **Ext. Gross Area:** | 414 |
| **Building Code:** | E4000300303 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,817,492 |
| **Building Name:** | Visitors Center | **Address:** | 2609 County Road 76 | **Deferred Maintenance:** | $316,602 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Grand Rapids | **Ext. Gross Area:** | 7,835 |
| **Building Code:** | E4000300304 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $22,168 |
| **Building Name:** | Ranger Tower, MFS Complex | **Address:** | 2609 County Road 76 | **Deferred Maintenance:** | $2,217 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Grand Rapids | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000300310 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $621,913 |
| **Building Name:** | Maintenance Building | **Address:** | 2609 County Road 76 | **Deferred Maintenance:** | $121,282 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Grand Rapids | **Ext. Gross Area:** | 3,000 |
| **Building Code:** | E4000300317 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $47,594 |
| **Building Name:** | Picnic Pavilion | **Address:** | 2609 County Road 76 | **Deferred Maintenance:** | $5,479 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Grand Rapids | **Ext. Gross Area:** | 840 |

### *Site: E40004 - Fort Ridgely*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000400401 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,929,980 |
| **Building Name:** | Commissary | **Address:** | Rt. 1, Box 65 | **Deferred Maintenance:** | $320,921 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Fairfax | **Ext. Gross Area:** | 4,700 |
| **Building Code:** | E4000400402 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $57,141 |
| **Building Name:** | Powder Magazine | **Address:** | Rt. 1, Box 65 | **Deferred Maintenance:** | $5,714 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Fairfax | **Ext. Gross Area:** | 360 |

### *Site: E40005 - Grand Mound*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000500501 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $740,534 |
| **Building Name:** | Visitor Center | **Address:** | 6749 Highway 11 | **Deferred Maintenance:** | $466,408 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 4,195 |
| **Building Code:** | E4000500503 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,527 |
| **Building Name:** | Storage Shed | **Address:** | 6749 Highway 11 | **Deferred Maintenance:** | $3,701 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 80 |

### *Site: E40007 - Harkin Store*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000700701 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $187,629 |
| **Building Name:** | Harkin Store | **Address:** | Box 112 | **Deferred Maintenance:** | $50,541 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | New Ulm | **Ext. Gross Area:** | 895 |
| **Building Code:** | E4000700702 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,030,276 |
| **Building Name:** | Harkin Residence | **Address:** | Box 112 | **Deferred Maintenance:** | $307,044 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | New Ulm | **Ext. Gross Area:** | 3,403 |

### *Site: E40008 - Historic Forestville*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000800801 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $89,647 |
| **Building Name:** | Wagon Barn | **Address:** | Forestville State Park | **Deferred Maintenance:** | $31,881 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | Preston | **Ext. Gross Area:** | 800 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000800802 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $128,797 |
| **Building Name:** | Granary | **Address:** | Forestville State Park | **Deferred Maintenance:** | $33,234 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Preston | **Ext. Gross Area:** | 468 |
| **Building Code:** | E4000800803 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $2,673,324 |
| **Building Name:** | Store/Residence | **Address:** | Forestville State Park | **Deferred Maintenance:** | $690,988 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Preston | **Ext. Gross Area:** | 5,288 |
| **Building Code:** | E4000800804 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $267,041 |
| **Building Name:** | Barn | **Address:** | Forestville State Park | **Deferred Maintenance:** | $111,425 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | Preston | **Ext. Gross Area:** | 4,640 |
| **Building Code:** | E4000800806 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $643 |
| **Building Name:** | Outhouse | **Address:** | Forestville State Park | **Deferred Maintenance:** | $151 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Preston | **Ext. Gross Area:** | 10 |
| **Building Code:** | E4000800807 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,420 |
| **Building Name:** | Chicken Coop | **Address:** | Forestville State Park | **Deferred Maintenance:** | $342 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Preston | **Ext. Gross Area:** | 50 |
| **Building Code:** | E4000800808 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $388,125 |
| **Building Name:** | Visitor Services Building | **Address:** | Forestville State Park | **Deferred Maintenance:** | $45,418 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Preston | **Ext. Gross Area:** | 2,500 |
| **Building Code:** | E4000800809 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $71,676 |
| **Building Name:** | Weigh House | **Address:** | Forestville State Park | **Deferred Maintenance:** | $14,869 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 450 |
| **Building Code:** | E4000800810 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $2,250 |
| **Building Name:** | Lift Station Shanty | **Address:** | 21899 COUNTY ROAD 118 | **Deferred Maintenance:** | $467 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 64 |

### *Site: E40009 - Historic Fort Snelling*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000900901 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,860,201 |
| **Building Name:** | Round Tower | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $532,715 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,929 |
| **Building Code:** | E4000900902 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $69,611 |
| **Building Name:** | Building 31 (Powder Mag) | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $52,208 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 169 |
| **Building Code:** | E4000900903 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,512,010 |
| **Building Name:** | Building 22 | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $1,108,808 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 8,307 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000900904 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,157,505 |
| **Building Name:** | Hospital | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $101,799 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 8,141 |
| **Building Code:** | E4000900905 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $2,472,637 |
| **Building Name:** | Commandant's House | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $505,146 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 5,334 |
| **Building Code:** | E4000900906 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $882,124 |
| **Building Name:** | Shops | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $183,706 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,673 |
| **Building Code:** | E4000900907 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $166,250 |
| **Building Name:** | School | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $10,858 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 842 |
| **Building Code:** | E4000900908 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $5,734,688 |
| **Building Name:** | Building 30,  Barn | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $1,204,882 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 18,051 |
| **Building Code:** | E4000900909 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $8,872,342 |
| **Building Name:** | History (Visitor) Center | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $4,553,465 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 30,835 |
| **Building Code:** | E4000900910 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $917,575 |
| **Building Name:** | Powder Magazine | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $30,914 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,092 |
| **Building Code:** | E4000900911 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $32,663 |
| **Building Name:** | Gun Shed | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $3,846 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 427 |
| **Building Code:** | E4000900912 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,299,307 |
| **Building Name:** | Long Barracks (Wood) | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $245,012 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 11,675 |
| **Building Code:** | E4000900913 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $349,452 |
| **Building Name:** | Guard House | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $29,190 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,949 |
| **Building Code:** | E4000900914 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,148,497 |
| **Building Name:** | Pentagonal Tower (N. Batt | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $31,231 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 822 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000900915 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $240,789 |
| **Building Name:** | Gate House | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $71,821 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 398 |
| **Building Code:** | E4000900916 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,490,265 |
| **Building Name:** | Commissary | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $211,667 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 6,619 |
| **Building Code:** | E4000900917 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $180,819 |
| **Building Name:** | Sutler Store | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $18,739 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 824 |
| **Building Code:** | E4000900918 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,804,606 |
| **Building Name:** | Hexagonal Tower (S. Batte | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $1,286,571 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,686 |
| **Building Code:** | E4000900919 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,868,722 |
| **Building Name:** | Short Barracks (Stone) | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $269,691 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 7,963 |
| **Building Code:** | E4000900920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,717,365 |
| **Building Name:** | Officers Quarters' | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $406,208 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 15,499 |
| **Building Code:** | E4000900921 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $895,888 |
| **Building Name:** | Semi-Circular Bat. (Half | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $31,494 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,963 |
| **Building Code:** | E4000900924 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $12,697,552 |
| **Building Name:** | Building 17 | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $3,629,479 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 52,150 |
| **Building Code:** | E4000900925 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $12,496,841 |
| **Building Name:** | Building 18 and Link | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $3,155,241 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 54,972 |
| **Building Code:** | E4000900926 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,709 |
| **Building Name:** | Well House | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $471 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 34 |
| **Building Code:** | E4000900927 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $627,799 |
| **Building Name:** | Wall Line, Limestone | **Address:** | Historic Fort Snelling | **Deferred Maintenance:** | $168,735 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,818 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4000900928 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $142,183 |
| **Building Name:** | Storage Bunker by #17/18 | **Address:** | | **Deferred Maintenance:** | $26,101 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | | **Ext. Gross Area:** | 300 |

### *Site: E40010 - James J. Hill House*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001001001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,131 |
| **Building Name:** | Garage | **Address:** | 240 Summit Ave. | **Deferred Maintenance:** | $4,144 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 342 |
| **Building Code:** | E4001001002 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $21,539,309 |
| **Building Name:** | James J. Hill House | **Address:** | 240 Summit Ave. | **Deferred Maintenance:** | $8,108,310 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 35,948 |
| **Building Code:** | E4001001003 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $353,958 |
| **Building Name:** | James J. Hill Gate House | **Address:** | 242 Summit Ave. | **Deferred Maintenance:** | $139,577 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 867 |

### *Site: E40011 - Jeffers Petroglyphs*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001101104 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $965,717 |
| **Building Name:** | Visitor Center | **Address:** | County Road 2 | **Deferred Maintenance:** | $144,660 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Jeffers | **Ext. Gross Area:** | 4,540 |
| **Building Code:** | E4001101105 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $46,270 |
| **Building Name:** | Storage Shed | **Address:** | County Road 2 | **Deferred Maintenance:** | $15,269 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JEFFERS | **Ext. Gross Area:** | 144 |

### *Site: E40012 - Lac Qui Parle Mission*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001201201 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $285,591 |
| **Building Name:** | Mission Chapel | **Address:** | 151 Pioneer Dr., Box 303 | **Deferred Maintenance:** | $53,320 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Montevideo | **Ext. Gross Area:** | 900 |

### *Site: E40014 - Charles A. Lindbergh House*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001401401 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,472,711 |
| **Building Name:** | Visitor Center | **Address:** | 1200 Lindbergh Drive South | **Deferred Maintenance:** | $714,611 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Little Falls | **Ext. Gross Area:** | 10,700 |
| **Building Code:** | E4001401402 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,483,952 |
| **Building Name:** | Lindbergh House | **Address:** | 1200 Lindbergh Drive South | **Deferred Maintenance:** | $170,914 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Little Falls | **Ext. Gross Area:** | 4,426 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001401403 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $42,433 |
| **Building Name:** | Ice House | **Address:** | 1200 Lindbergh Drive South | **Deferred Maintenance:** | $7,699 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Little Falls | **Ext. Gross Area:** | 300 |
| **Building Code:** | E4001401405 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,136 |
| **Building Name:** | Storage Shed | **Address:** | 1200 Lindbergh Drive South | **Deferred Maintenance:** | $5,113 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Little Falls | **Ext. Gross Area:** | 192 |
| **Building Code:** | E4001401406 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,112 |
| **Building Name:** | WPA Stone Wall Shelter | **Address:** | 1200 Lindbergh Drive South | **Deferred Maintenance:** | $142 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | Little Falls | **Ext. Gross Area:** | 100 |

### *Site: E40015 - Lower Sioux Agency*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001501501 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,142,296 |
| **Building Name:** | Visitor Center | **Address:** | Rt. 1, Box 125 | **Deferred Maintenance:** | $276,616 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Morton | **Ext. Gross Area:** | 3,850 |
| **Building Code:** | E4001501502 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $78,250 |
| **Building Name:** | Garage | **Address:** | Rt. 1, Box 125 | **Deferred Maintenance:** | $23,632 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Morton | **Ext. Gross Area:** | 700 |
| **Building Code:** | E4001501503 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $924,446 |
| **Building Name:** | Stone Warehouse | **Address:** | Rt. 1, Box 125 | **Deferred Maintenance:** | $143,878 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Morton | **Ext. Gross Area:** | 1,806 |

### *Site: E40016 - Mille Lacs Indian Museum*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001600001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,340 |
| **Building Name:** | Storage Building | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $1,034 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Onamia | **Ext. Gross Area:** | 165 |
| **Building Code:** | E4001601601 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,122,893 |
| **Building Name:** | Trading Post | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $146,073 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Onamia | **Ext. Gross Area:** | 4,400 |
| **Building Code:** | E4001601602 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $6,665,724 |
| **Building Name:** | Museum | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $1,452,276 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Onamia | **Ext. Gross Area:** | 28,000 |
| **Building Code:** | E4001601603 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $668,922 |
| **Building Name:** | Ayers House | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $40,222 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Onamia | **Ext. Gross Area:** | 2,460 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001601604 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $35,272 |
| **Building Name:** | Ayer Storage Shed | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $8,850 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Onamia | **Ext. Gross Area:** | 485 |
| **Building Code:** | E4001601605 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $13,160 |
| **Building Name:** | Cabin #1 | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $3,968 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Onamia | **Ext. Gross Area:** | 165 |
| **Building Code:** | E4001601606 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $13,160 |
| **Building Name:** | Cabin #2 | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $2,709 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Onamia | **Ext. Gross Area:** | 165 |
| **Building Code:** | E4001601607 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $13,399 |
| **Building Name:** | Cabin #3 / Shed | **Address:** | 43411 Oodena Drive | **Deferred Maintenance:** | $2,758 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Onamia | **Ext. Gross Area:** | 168 |

### *Site: E40017 - Minnehaha Depot*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001701701 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $145,503 |
| **Building Name:** | Minnehaha Depot | **Address:** | Minnehaha Park | **Deferred Maintenance:** | $19,863 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Minneapolis | **Ext. Gross Area:** | 461 |

### *Site: E40018 - Snake River Fur Post*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001801801 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,524 |
| **Building Name:** | Women's Outhouse | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $1,445 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | Pine City | **Ext. Gross Area:** | 16 |
| **Building Code:** | E4001801802 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,524 |
| **Building Name:** | Men's Outhouse | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $1,445 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | Pine City | **Ext. Gross Area:** | 16 |
| **Building Code:** | E4001801803 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $320,235 |
| **Building Name:** | Fur Post | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $57,009 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Pine City | **Ext. Gross Area:** | 1,367 |
| **Building Code:** | E4001801804 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $114,958 |
| **Building Name:** | Picnic Shelter | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $75,465 |
| **Facility Condition Index:** | 0.66 - Crisis | **City Code:** | Pine City | **Ext. Gross Area:** | 1,275 |
| **Building Code:** | E4001801806 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,217 |
| **Building Name:** | Tractor Shed | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $5,188 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Pine City | **Ext. Gross Area:** | 200 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001801807 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $113,983 |
| **Building Name:** | Maintenance Shop | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $23,510 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Pine City | **Ext. Gross Area:** | 1,008 |
| **Building Code:** | E4001801808 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,625,400 |
| **Building Name:** | Visitor Center | **Address:** | 12551 Voyageur Lane | **Deferred Maintenance:** | $578,182 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Pine City | **Ext. Gross Area:** | 10,460 |

### *Site: E40019 - Oliver H. Kelley Farm*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001901901 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $5,382 |
| **Building Name:** | Corn Crib | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $1,776 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 84 |
| **Building Code:** | E4001901902 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $1,542 |
| **Building Name:** | Outhouse | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $679 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 16 |
| **Building Code:** | E4001901905 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $8,509 |
| **Building Name:** | Pig Shed / Pen (South) | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $2,808 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 120 |
| **Building Code:** | E4001901907 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $578,458 |
| **Building Name:** | Barn | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $57,846 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Elk River | **Ext. Gross Area:** | 2,583 |
| **Building Code:** | E4001901908 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $2,553 |
| **Building Name:** | Pig Shed / Pen (North) | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $842 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 36 |
| **Building Code:** | E4001901909 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,255,594 |
| **Building Name:** | Farm House | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $294,910 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Elk River | **Ext. Gross Area:** | 4,809 |
| **Building Code:** | E4001901910 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $4,538 |
| **Building Name:** | Calf Shed / Pen | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $1,498 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 64 |
| **Building Code:** | E4001901911 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $20,232 |
| **Building Name:** | Chicken House | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $5,414 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Elk River | **Ext. Gross Area:** | 128 |
| **Building Code:** | E4001901912 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $8,509 |
| **Building Name:** | Sheep Shed / Pen | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $2,808 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 120 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4001901913 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $34,038 |
| **Building Name:** | Animal Shelter | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $11,232 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Elk River | **Ext. Gross Area:** | 480 |
| **Building Code:** | E4001901914 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $37,362 |
| **Building Name:** | Machine Shed | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $6,433 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Elk River | **Ext. Gross Area:** | 474 |
| **Building Code:** | E4001901917 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $388,007 |
| **Building Name:** | Multipurpose Building | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $7,760 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 2,720 |
| **Building Code:** | E4001901918 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,552,476 |
| **Building Name:** | Visitor Center | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $91,050 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 20,575 |
| **Building Code:** | E4001901919 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $370,537 |
| **Building Name:** | Maintenance Building | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $7,411 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | E4001901920 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $234,916 |
| **Building Name:** | Animal Barn | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $4,698 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 1,568 |
| **Building Code:** | E4001901921 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $65,724 |
| **Building Name:** | Guest Animal Shelter | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $1,314 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 576 |
| **Building Code:** | E4001901922 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $53,740 |
| **Building Name:** | Picnic Shelter | **Address:** | 15788 Kelley Farm Road | **Deferred Maintenance:** | $1,075 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 736 |

### *Site: E40020 - Alexander Ramsey House*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002002001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $445,265 |
| **Building Name:** | Carriage Barn | **Address:** | 265 S. Exchange St. | **Deferred Maintenance:** | $97,396 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 2,648 |
| **Building Code:** | E4002002002 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $4,915,140 |
| **Building Name:** | Ramsey House | **Address:** | 265 S. Exchange St. | **Deferred Maintenance:** | $1,650,744 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 12,487 |
| **Building Code:** | E4002002004 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,492 |
| **Building Name:** | Equipment Shed | **Address:** | 265 S. Exchange St. | **Deferred Maintenance:** | $1,019 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 120 |

## *Site: E40021 - Split Rock Lighthouse*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002102101 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,255,943 |
| **Building Name:** | Dwelling #3 | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $376,665 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 2,124 |
| **Building Code:** | E4002102102 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $126,269 |
| **Building Name:** | Oil House/Storage | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $31,928 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 311 |
| **Building Code:** | E4002102103 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $272,615 |
| **Building Name:** | Fog Signal Building | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $38,949 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Two Harbors | **Ext. Gross Area:** | 991 |
| **Building Code:** | E4002102104 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,706 |
| **Building Name:** | Pump House | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $6,147 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | Two Harbors | **Ext. Gross Area:** | 80 |
| **Building Code:** | E4002102105 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $32,519 |
| **Building Name:** | Tram House | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $9,906 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Two Harbors | **Ext. Gross Area:** | 144 |
| **Building Code:** | E4002102106 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,276,086 |
| **Building Name:** | Dwelling #2 | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $179,311 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Two Harbors | **Ext. Gross Area:** | 2,124 |
| **Building Code:** | E4002102107 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $135,573 |
| **Building Name:** | Storage Barn #2 | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $26,336 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 768 |
| **Building Code:** | E4002102108 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $127,347 |
| **Building Name:** | Storage Barn #3 | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $25,513 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 768 |
| **Building Code:** | E4002102109 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,383,006 |
| **Building Name:** | Visitor Center | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $1,217,936 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 14,013 |
| **Building Code:** | E4002102110 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $444,896 |
| **Building Name:** | Lighthouse | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $121,777 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 733 |
| **Building Code:** | E4002102111 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,252,840 |
| **Building Name:** | Dwelling #1 | **Address:** | Split Rock Lighthouse | **Deferred Maintenance:** | $303,160 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 2,124 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002102113 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $129,205 |
| **Building Name:** | Storage Garage - Maintena | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $8,916 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Two Harbors | **Ext. Gross Area:** | 576 |
| **Building Code:** | E4002102114 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $85,172 |
| **Building Name:** | Storage Garage | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $6,978 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Two Harbors | **Ext. Gross Area:** | 576 |
| **Building Code:** | E4002102115 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $8,397 |
| **Building Name:** | Well House | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $1,361 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 36 |
| **Building Code:** | E4002102116 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,679 |
| **Building Name:** | Vending Hut | **Address:** | 3713 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $468 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Two Harbors | **Ext. Gross Area:** | 80 |

### *Site: E40022 - Upper Sioux Agency*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002202201 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $272,441 |
| **Building Name:** | House/Duplex | **Address:** | Rt. 2, Box 92 | **Deferred Maintenance:** | $55,199 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Granite Falls | **Ext. Gross Area:** | 1,871 |

### *Site: E40023 - W. W. Mayo House*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002302301 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $589,100 |
| **Building Name:** | W. W. Mayo House | **Address:** | 118 N. Main Street | **Deferred Maintenance:** | $137,613 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Le Sueur | **Ext. Gross Area:** | 2,275 |

### *Site: E40024 - Sibley House Historic Site*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002402401 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,651,348 |
| **Building Name:** | DuPuis House | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $464,553 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | Mendota | **Ext. Gross Area:** | 4,909 |
| **Building Code:** | E4002402402 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $2,234,050 |
| **Building Name:** | Sibley House | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $433,294 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Mendota | **Ext. Gross Area:** | 5,373 |
| **Building Code:** | E4002402403 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,963,022 |
| **Building Name:** | Faribault House | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $277,668 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Mendota | **Ext. Gross Area:** | 4,650 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002402404 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $186,987 |
| **Building Name:** | Cold Store | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $19,028 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Mendota | **Ext. Gross Area:** | 372 |
| **Building Code:** | E4002402405 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $116,682 |
| **Building Name:** | Well House | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $14,523 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Mendota | **Ext. Gross Area:** | 344 |
| **Building Code:** | E4002402406 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $286,985 |
| **Building Name:** | Caretaker's Cottage | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $69,057 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Mendota | **Ext. Gross Area:** | 772 |
| **Building Code:** | E4002402407 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $34,775 |
| **Building Name:** | Caretaker's Garage | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $8,745 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Mendota | **Ext. Gross Area:** | 532 |
| **Building Code:** | E4002402409 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $29,518 |
| **Building Name:** | Powderhouse | **Address:** | 1357 Sibley Memorial Highway | **Deferred Maintenance:** | $9,449 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | Mendota | **Ext. Gross Area:** | 246 |

### *Site: E40026 - 1500 Mississippi Street*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002602601 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $14,539,052 |
| **Building Name:** | 1500 Mississippi | **Address:** | 1500 Mississippi Street | **Deferred Maintenance:** | $3,856,165 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 68,272 |

### *Site: E40027 - Birch Coulee Battlefield*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4002702701 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $20,095 |
| **Building Name:** | Picnic Shelter | **Address:** | | **Deferred Maintenance:** | $2,009 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | | **Ext. Gross Area:** | 400 |
| **Building Code:** | E4002702702 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $1,816 |
| **Building Name:** | Porta-potty Shelter | **Address:** | | **Deferred Maintenance:** | $599 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | | **Ext. Gross Area:** | 24 |

### *Site: E40032 - Kellogg Center*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4003203201 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $10,779,375 |
| **Building Name:** | Kellogg Center | **Address:** | 328 Kellogg Boulevard West | **Deferred Maintenance:** | $3,343,598 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 60,000 |

### *Site: E40033 - Mill City Museum*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E4003303301 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $33,572,930 |
| **Building Name:** | Mill - Engine Houses - Wheat House | **Address:** | | **Deferred Maintenance:** | $5,801,655 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 75,000 |
| **Building Code:** | E4003303302 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $137,313 |
| **Building Name:** | Mill Office | **Address:** | | **Deferred Maintenance:** | $35,594 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | | **Ext. Gross Area:** | 960 |
| **Building Code:** | E4003303303 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $4,961,978 |
| **Building Name:** | Mill Ruins Courtyard | **Address:** | | **Deferred Maintenance:** | $4,314,935 |
| **Facility Condition Index:** | 0.87 - Crisis | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 9,512 |
| **Building Code:** | E4003303304 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $610,243 |
| **Building Name:** | Wheel House | **Address:** | | **Deferred Maintenance:** | $454,022 |
| **Facility Condition Index:** | 0.74 - Crisis | **City Code:** | | **Ext. Gross Area:** | 3,904 |
| **Building Code:** | E4003303305 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $2,647,851 |
| **Building Name:** | Feed Elevator | **Address:** | | **Deferred Maintenance:** | $813,847 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 4,690 |
| **Building Code:** | E4003303306 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $13,242,363 |
| **Building Name:** | Elevator #1 - Train Shed - Conveyor | **Address:** | | **Deferred Maintenance:** | $7,509,136 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 25,613 |

### *Site: G02310 - Capitol Complex*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | G0231011562 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $88,353,793 |
| **Building Name:** | History Center | **Address:** | 345 Kellogg Blvd. West | **Deferred Maintenance:** | $12,499,757 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 517,555 |

# Agency: E77 - Minnesota Zoological Garden

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $179,415,066 | **Ext. Gross Area:** | 648,413 |
| **Facility Condition Index:** | 0.19 | **Deferred Maintenance:** | $33,512,659 | **Building Count:** | 124 |

## *Site: E77700 - MN ZOO*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770000220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $554,805 |
| **Building Name:** | Isolation Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $134,463 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,982 |
| **Building Code:** | E7770000305 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $19,073,735 |
| **Building Name:** | MBC - Section -A-B- Admin-Education | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $2,910,102 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 80,139 |
| **Building Code:** | E7770000520 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,818,848 |
| **Building Name:** | Central Plaza Office - Tiger Hold | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $283,651 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 10,754 |
| **Building Code:** | E7770000625 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $10,837,176 |
| **Building Name:** | Bldg A - Animal Health | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $3,309,664 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 18,781 |
| **Building Code:** | E7770000755 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $165,543 |
| **Building Name:** | Replay Park Restroom | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $22,607 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 585 |
| **Building Code:** | E7770000855 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $702,271 |
| **Building Name:** | Conservation Carousel | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $14,045 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 5,236 |
| **Building Code:** | E7770000865 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $1,043,100 |
| **Building Name:** | Fire Suppression Building | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $20,862 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 50 |
| **Building Code:** | E7770000875 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $5,823 |
| **Building Name:** | Carousel Token Shelter | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $116 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 97 |
| **Building Code:** | E7770001220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $220,224 |
| **Building Name:** | Bldg H - Camel Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $64,744 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,683 |
| **Building Code:** | E7770001625 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $4,625,681 |
| **Building Name:** | Bldg B - Internal Services | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,341,667 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 16,681 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770001945 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $591,878 |
| **Building Name:** | Generator Discovery Bay | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $60,293 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 149 |
| **Building Code:** | E7770002220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $128,957 |
| **Building Name:** | Bldg J - Horse Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $36,516 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,204 |
| **Building Code:** | E7770002625 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $903,818 |
| **Building Name:** | Pole Bldg - Vehicle Maint | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $204,903 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 7,172 |
| **Building Code:** | E7770002725 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $703,489 |
| **Building Name:** | Bldg C - Vehicle Maint Garage | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $177,362 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,912 |
| **Building Code:** | E7770003220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $157,284 |
| **Building Name:** | Bldg K - Camel Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $50,470 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,202 |
| **Building Code:** | E7770003625 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $436,366 |
| **Building Name:** | Greenhouse Headhouse | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $176,777 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,890 |
| **Building Code:** | E7770003725 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,317,342 |
| **Building Name:** | Greenhouse | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $904,945 |
| **Facility Condition Index:** | 0.69 - Crisis | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 3,666 |
| **Building Code:** | E7770004220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $190,077 |
| **Building Name:** | Bldg L - Moose Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $43,497 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | E7770004625 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $852,764 |
| **Building Name:** | Bldg EF - Large Animal Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $244,967 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,735 |
| **Building Code:** | E7770005230 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,316,802 |
| **Building Name:** | Bldg M - Monorail Maint | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $299,789 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 7,561 |
| **Building Code:** | E7770005240 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,617 |
| **Building Name:** | Monorail Maint Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $9,434 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 126 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770005625 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $573,649 |
| **Building Name:** | Bldg G - Hay Storage | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $205,589 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 7,852 |
| **Building Code:** | E7770005720 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $167,835 |
| **Building Name:** | Dhole Gazebo | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $16,506 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,102 |
| **Building Code:** | E7770006230 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $119,577 |
| **Building Name:** | Bldg N - Monorail Switch Gear | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $54,249 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 236 |
| **Building Code:** | E7770006310 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $65,281,270 |
| **Building Name:** | MBC - Section -C-D-E-F- Tropics | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $13,810,859 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 192,142 |
| **Building Code:** | E7770006320 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $322,880 |
| **Building Name:** | Butterfly Tent | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $25,833 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 4,539 |
| **Building Code:** | E7770006330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,207 |
| **Building Name:** | Butterfly Containment Building | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $5,225 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 102 |
| **Building Code:** | E7770006340 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $20,481 |
| **Building Name:** | Endangered Butterfly Tent | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $4,815 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 336 |
| **Building Code:** | E7770006635 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,526,922 |
| **Building Name:** | Bldg H - Central Heat Plant | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,201,258 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 3,165 |
| **Building Code:** | E7770007240 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,394,037 |
| **Building Name:** | Bison - Pronghorn Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $127,819 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 22,229 |
| **Building Code:** | E7770007320 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $159,711 |
| **Building Name:** | Bison Garage | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $6,576 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 952 |
| **Building Code:** | E7770007420 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $148,483 |
| **Building Name:** | Bison Holding Hay Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $37,492 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 729 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770007520 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $12,404 |
| **Building Name:** | Bison Holding Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $5,188 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 220 |
| **Building Code:** | E7770007625 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,239,868 |
| **Building Name:** | Warehouse-Maintenance Support | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $310,981 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 11,317 |
| **Building Code:** | E7770008220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $376,191 |
| **Building Name:** | Caribou Barn A | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $85,713 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,649 |
| **Building Code:** | E7770008225 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $145,925 |
| **Building Name:** | Caribou Barn B | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $41,879 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,121 |
| **Building Code:** | E7770008320 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $61,872 |
| **Building Name:** | Giraffe Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $6,522 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 517 |
| **Building Code:** | E7770008420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,122 |
| **Building Name:** | Zebra Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $3,563 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 387 |
| **Building Code:** | E7770008520 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,122 |
| **Building Name:** | Gazelle Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $2,813 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 387 |
| **Building Code:** | E7770008620 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,333 |
| **Building Name:** | Oryx Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $3,314 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 387 |
| **Building Code:** | E7770008720 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,500 |
| **Building Name:** | Africa Holding Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $14,256 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 346 |
| **Building Code:** | E7770008820 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $12,404 |
| **Building Name:** | Africa Holding Hay Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $943 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 220 |
| **Building Code:** | E7770009220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $355,751 |
| **Building Name:** | Musk Ox Bldg A | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $105,183 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,608 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770009225 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $265,020 |
| **Building Name:** | Musk Ox Bldg B | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $50,459 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,515 |
| **Building Code:** | E7770009320 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $27,945 |
| **Building Name:** | Musk Ox Viewing Shelter | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $10,212 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 287 |
| **Building Code:** | E7770009420 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,776 |
| **Building Name:** | Dinos Ticket Booth | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,518 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 50 |
| **Building Code:** | E7770009430 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,005 |
| **Building Name:** | Dinos Ticket Booth 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $705 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 33 |
| **Building Code:** | E7770009440 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $40,071 |
| **Building Name:** | Dinos Gift Tent | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $6,949 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 995 |
| **Building Code:** | E7770009450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $76,240 |
| **Building Name:** | Bug House | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $8,614 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 721 |
| **Building Code:** | E7770010510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $206,747 |
| **Building Name:** | East Entrance | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $21,428 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 469 |
| **Building Code:** | E7770011220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $318,032 |
| **Building Name:** | Bldg V - Takin Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $86,826 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,335 |
| **Building Code:** | E7770012245 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $849,170 |
| **Building Name:** | Bird Holding - Galaxie Ave | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $151,192 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,990 |
| **Building Code:** | E7770013255 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $740,245 |
| **Building Name:** | Amphitheater Bird Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $164,356 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 3,127 |
| **Building Code:** | E7770013355 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,777,076 |
| **Building Name:** | Amphitheater | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $359,686 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 11,980 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770013365 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $87,847 |
| **Building Name:** | Lancer Tiger Treats | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $24,111 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 621 |
| **Building Code:** | E7770013375 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $721,673 |
| **Building Name:** | Tiger Lair | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $90,097 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,773 |
| **Building Code:** | E7770013455 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $319,536 |
| **Building Name:** | Amphitheater Restroom | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $30,754 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,098 |
| **Building Code:** | E7770013555 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $62,223 |
| **Building Name:** | Summit - Lancer Vending Booth | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $15,555 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 269 |
| **Building Code:** | E7770013655 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $119,109 |
| **Building Name:** | Picnic Tent 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $24,073 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,954 |
| **Building Code:** | E7770013755 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $119,109 |
| **Building Name:** | Picnic Tent 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $11,911 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,954 |
| **Building Code:** | E7770013855 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $34,956 |
| **Building Name:** | Picnic Tent 3 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $4,946 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 800 |
| **Building Code:** | E7770015235 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $71,105 |
| **Building Name:** | Cement Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $14,974 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 494 |
| **Building Code:** | E7770015315 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $7,947,461 |
| **Building Name:** | MBC - Section -G- MN Trail | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $2,234,411 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 27,265 |
| **Building Code:** | E7770016150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $846,074 |
| **Building Name:** | Black Bear Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $45,317 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,123 |
| **Building Code:** | E7770017340 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $382,135 |
| **Building Name:** | Monorail Station | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $42,193 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,824 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770019640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,194,717 |
| **Building Name:** | Life Support Discovery Bay | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $520,642 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 13,677 |
| **Building Code:** | E7770019740 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $347,662 |
| **Building Name:** | Marketing Trailer | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $79,741 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,381 |
| **Building Code:** | E7770020145 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,517,403 |
| **Building Name:** | Farm House | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $222,326 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 7,264 |
| **Building Code:** | E7770020245 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $208,320 |
| **Building Name:** | Goat - Sheep Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $38,410 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,168 |
| **Building Code:** | E7770020345 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $365,486 |
| **Building Name:** | Granary | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $45,446 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,149 |
| **Building Code:** | E7770020445 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $499,346 |
| **Building Name:** | Grain Elevator | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $48,067 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,524 |
| **Building Code:** | E7770020545 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $187,860 |
| **Building Name:** | Machine Shed | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $13,658 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,586 |
| **Building Code:** | E7770020645 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $90,475 |
| **Building Name:** | Chicken House | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $6,887 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,499 |
| **Building Code:** | E7770020745 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $174,918 |
| **Building Name:** | Swine Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $16,398 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 877 |
| **Building Code:** | E7770020845 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $801,933 |
| **Building Name:** | Dairy Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $58,610 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 5,494 |
| **Building Code:** | E7770020945 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $146,040 |
| **Building Name:** | Horse Barn | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $20,880 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,267 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770021015 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $710 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021025 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $710 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021035 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 3 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $983 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021045 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 4 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $511 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021055 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 5 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $983 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021065 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 6 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $983 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021075 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,101 |
| **Building Name:** | Farm Shelter 7 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $983 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021085 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,501 |
| **Building Name:** | Farm Shelter 8 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,011 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 154 |
| **Building Code:** | E7770021095 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,970 |
| **Building Name:** | Farm Loading Shelter | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $185 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 127 |
| **Building Code:** | E7770021105 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $13,019 |
| **Building Name:** | Pony Shed 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $596 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 185 |
| **Building Code:** | E7770021115 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $13,019 |
| **Building Name:** | Pony Shed 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $596 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 185 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770022145 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $112,116 |
| **Building Name:** | Concrete - Stave Silo | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $12,332 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 185 |
| **Building Code:** | E7770022245 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $41,567 |
| **Building Name:** | Metal Silo | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $6,077 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 181 |
| **Building Code:** | E7770029640 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $21,840,218 |
| **Building Name:** | Discovery Bay | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,406,855 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 73,585 |
| **Building Code:** | E7770030050 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $13,622 |
| **Building Name:** | Lakeside Terrace | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $272 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 355 |
| **Building Code:** | E7770030150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,248,221 |
| **Building Name:** | Bear - Otter Life Support | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $108,573 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 4,183 |
| **Building Code:** | E7770030250 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,093,147 |
| **Building Name:** | Bear - Otter Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $120,596 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 4,485 |
| **Building Code:** | E7770030350 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $982,470 |
| **Building Name:** | Leopard Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $88,309 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,828 |
| **Building Code:** | E7770030450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $163,180 |
| **Building Name:** | Wild Boar Holding | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $12,849 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 734 |
| **Building Code:** | E7770030550 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $138,566 |
| **Building Name:** | RGC Log Cabin | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $12,949 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 992 |
| **Building Code:** | E7770030650 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $869,401 |
| **Building Name:** | Education Event Center | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $75,595 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,670 |
| **Building Code:** | E7770030750 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $351,740 |
| **Building Name:** | Lancer  Central Plaza | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $30,818 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,173 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770030850 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,774 |
| **Building Name:** | SSA Gift Outlet | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,203 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 365 |
| **Building Code:** | E7770030950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $135,753 |
| **Building Name:** | Plaza Restroom Facilities | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $7,845 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 862 |
| **Building Code:** | E7770031050 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $30,562 |
| **Building Name:** | Takin Viewing Shelter 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $3,093 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 268 |
| **Building Code:** | E7770031150 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $30,562 |
| **Building Name:** | Takin Viewing Shelter 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $3,965 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 268 |
| **Building Code:** | E7770031350 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $36,407 |
| **Building Name:** | Tiger Base Camp | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $3,743 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 406 |
| **Building Code:** | E7770032050 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $751,441 |
| **Building Name:** | Leopard Viewing | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $19,707 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 738 |
| **Building Code:** | E7770032150 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $36,538 |
| **Building Name:** | Boar Viewing | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $886 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 336 |
| **Building Code:** | E7770032250 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $645,165 |
| **Building Name:** | Bear Viewing 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $15,859 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 665 |
| **Building Code:** | E7770032350 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,094,475 |
| **Building Name:** | Bear Viewing 2 - Cave | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $91,332 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 3,160 |
| **Building Code:** | E7770032450 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $177,185 |
| **Building Name:** | Otter Viewing 1 - Entry | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $9,218 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 677 |
| **Building Code:** | E7770032550 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $970,193 |
| **Building Name:** | Otter Viewing 2 - Primary | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $72,284 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,448 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770032650 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $84,972 |
| **Building Name:** | Bear Tunnel | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $7,659 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 531 |
| **Building Code:** | E7770040050 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $76,486 |
| **Building Name:** | Lancer Pavilion | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $2,548 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,400 |
| **Building Code:** | E7770040155 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,039 |
| **Building Name:** | Tattoo Cabin | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $1,859 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 127 |
| **Building Code:** | E7770050135 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $458,643 |
| **Building Name:** | Classroom Unit 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $84,531 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,248 |
| **Building Code:** | E7770050235 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $458,643 |
| **Building Name:** | Classroom Unit 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $101,582 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 2,326 |
| **Building Code:** | E7770050335 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $137,565 |
| **Building Name:** | Classroom Storage | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $35,571 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 821 |
| **Building Code:** | E7770070135 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,353,512 |
| **Building Name:** | Lancer - SSA - Maint Warehouse | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $188,259 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 5,297 |
| **Building Code:** | E7770070136 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,913 |
| **Building Name:** | Parking Storage Bldg | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $9,185 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 490 |
| **Building Code:** | E7770075050 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,865 |
| **Building Name:** | Cars for Courage Booth | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $2,331 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 63 |
| **Building Code:** | E7770080135 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $171,088 |
| **Building Name:** | Water's Edge Picnic Shelter | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $49,073 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,654 |
| **Building Code:** | E7770080235 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $163,572 |
| **Building Name:** | Shady Oaks Picnic Shelter 1 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $18,026 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,702 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | E7770080335 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $155,933 |
| **Building Name:** | Shady Oaks Picnic Shelter 2 | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $37,511 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 1,654 |
| **Building Code:** | E7770080435 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,752 |
| **Building Name:** | Chrysalis Building | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $2,054 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 231 |
| **Building Code:** | E7770080535 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $26,429 |
| **Building Name:** | Hoop House B | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $529 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 337 |
| **Building Code:** | E7770080635 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $26,273 |
| **Building Name:** | Hoop House A | **Address:** | 13000 Zoo Boulevard | **Deferred Maintenance:** | $525 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLE VALLEY | **Ext. Gross Area:** | 335 |

# Agency: G02 - Department of Administration

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $1,729,319,518 | **Ext. Gross Area:** | 5,531,893 |
| **Facility Condition Index:** | 0.08 | **Deferred Maintenance:** | $144,812,735 | **Building Count:** | 30 |

## *Site: G02310 - Capitol Complex*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | G0231010062 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $679,770,085 |
| **Building Name:** | Capitol Building | **Address:** | 75 Rev. Dr Martin Luther King | **Deferred Maintenance:** | $23,785,700 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 374,561 |
| **Building Code:** | G0231010162 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $19,668,725 |
| **Building Name:** | Administration Building | **Address:** | 50 Sherburne Avenue | **Deferred Maintenance:** | $1,616,461 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 80,100 |
| **Building Code:** | G0231010362 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $86,547,540 |
| **Building Name:** | Minnesota Senate Building | **Address:** | 95 University Avenue West | **Deferred Maintenance:** | $1,873,366 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 296,589 |
| **Building Code:** | G0231010462 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $73,421,200 |
| **Building Name:** | State Office Bldg | **Address:** | 100 Rev. Dr Martin Luther King | **Deferred Maintenance:** | $19,610,173 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 290,138 |
| **Building Code:** | G0231010562 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $65,745,857 |
| **Building Name:** | Transportation Building | **Address:** | 395 John Ireland Blvd | **Deferred Maintenance:** | $6,361,515 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 374,649 |
| **Building Code:** | G0231010662 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $20,039,480 |
| **Building Name:** | Veterans Service Building | **Address:** | 20 West 12th Street | **Deferred Maintenance:** | $1,563,751 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 87,648 |
| **Building Code:** | G0231010762 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $80,401,106 |
| **Building Name:** | Centennial Office Building | **Address:** | 658 Cedar Avenue | **Deferred Maintenance:** | $15,766,037 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 317,893 |
| **Building Code:** | G0231010962 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $6,165,000 |
| **Building Name:** | Maintenance Building | **Address:** | 691 N. Robert Street | **Deferred Maintenance:** | $998,977 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 28,118 |
| **Building Code:** | G0231011062 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $12,515,706 |
| **Building Name:** | Powerhouse | **Address:** | 9 East  Aurora | **Deferred Maintenance:** | $5,493,285 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 22,001 |
| **Building Code:** | G0231011462 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $14,079,041 |
| **Building Name:** | Ford Building | **Address:** | 117 University Avenue | **Deferred Maintenance:** | $9,542,069 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 57,143 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | G0231011862 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $5,357,137 |
| **Building Name:** | Governor's Residence | **Address:** | 1006 Summit Avenue | **Deferred Maintenance:** | $1,313,884 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 16,935 |
| **Building Code:** | G0231012462 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $54,349,561 |
| **Building Name:** | Judicial Center | **Address:** | 25 Rev Dr Martin Luther King Jr Blv | **Deferred Maintenance:** | $5,860,057 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 336,639 |
| **Building Code:** | G0231023762 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $11,500,331 |
| **Building Name:** | 321 Grove St. #1 | **Address:** | 321 Grove | **Deferred Maintenance:** | $3,076,999 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 49,498 |
| **Building Code:** | G0231023862 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,162,935 |
| **Building Name:** | 321 Grove St. #2 | **Address:** | 603 Pine | **Deferred Maintenance:** | $96,778 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 7,709 |
| **Building Code:** | G0231023962 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $105,081,365 |
| **Building Name:** | Stassen Building | **Address:** | 600 North Robert | **Deferred Maintenance:** | $9,055,678 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 470,317 |
| **Building Code:** | G0231025569 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,361,667 |
| **Building Name:** | Ely Revenue Services Building | **Address:** | 760 East Minor Drive | **Deferred Maintenance:** | $394,571 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Ely | **Ext. Gross Area:** | 15,931 |
| **Building Code:** | G0231025792 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $5,378,010 |
| **Building Name:** | BCA Bemidji | **Address:** | 3700 North Norris Court NW | **Deferred Maintenance:** | $413,239 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Bemidji | **Ext. Gross Area:** | 26,854 |
| **Building Code:** | G0231025862 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,594,458 |
| **Building Name:** | Carriage House | **Address:** | 1006 Summit Avenue | **Deferred Maintenance:** | $202,925 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,269 |
| **Building Code:** | G0231026362 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $69,270,039 |
| **Building Name:** | BCA Maryland | **Address:** | 1430 Maryland Ave East | **Deferred Maintenance:** | $3,966,944 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 239,524 |
| **Building Code:** | G0231026962 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $255,466 |
| **Building Name:** | Governor's Storage Bldg | **Address:** | 1006 Summit Ave | **Deferred Maintenance:** | $44,368 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,487 |
| **Building Code:** | G0231027162 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $84,741,345 |
| **Building Name:** | MDA/MDH Lab | **Address:** | 601 North Robert Street | **Deferred Maintenance:** | $5,886,992 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 181,019 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | G0231027262 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $80,583,951 |
| **Building Name:** | Freeman Office Building | **Address:** | 625 North Robert Street | **Deferred Maintenance:** | $3,201,218 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 374,746 |
| **Building Code:** | G0231027362 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $111,416,119 |
| **Building Name:** | Andersen Office Building | **Address:** | 540 Cedar Street | **Deferred Maintenance:** | $6,368,891 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 414,068 |
| **Building Code:** | G0231028862 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $9,312,612 |
| **Building Name:** | Surplus Services Warehouse | **Address:** | 5420 Old Highway 8 | **Deferred Maintenance:** | $790,590 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Arden Hills | **Ext. Gross Area:** | 46,395 |
| **Building Code:** | G0231040262 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $9,523,103 |
| **Building Name:** | Administration Ramp | **Address:** | 504 Capitol Blvd | **Deferred Maintenance:** | $1,262,193 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 98,634 |
| **Building Code:** | G0231040862 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $38,542,707 |
| **Building Name:** | Centennial Ramp | **Address:** | W. Central Pk Pl & Columbus | **Deferred Maintenance:** | $10,408,241 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 504,879 |
| **Building Code:** | G0231040962 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $17,045,574 |
| **Building Name:** | Ramp F | **Address:** | 424 Rice Street | **Deferred Maintenance:** | $340,911 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 179,126 |
| **Building Code:** | G0231042562 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $16,989,645 |
| **Building Name:** | State Office Ramp | **Address:** | 106 Aurora Avenue | **Deferred Maintenance:** | $1,341,079 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 141,162 |
| **Building Code:** | G0231044162 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $21,743,868 |
| **Building Name:** | 14th Street Ramp | **Address:** | 135 East 14th Street | **Deferred Maintenance:** | $3,522,210 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 269,974 |
| **Building Code:** | G0231047462 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $22,755,884 |
| **Building Name:** | Andersen Ramp | **Address:** | 540 Cedar Street | **Deferred Maintenance:** | $653,634 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 224,890 |

## Agency: G62 - MN State Retirement Systems

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $46,787,116 | **Ext. Gross Area:** | 259,837 |
| **Facility Condition Index:** | 0.06 | **Deferred Maintenance:** | $2,929,618 | **Building Count:** | 2 |

### *Site: G02310 - Capitol Complex*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | G6231025162 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $36,787,534 |
| **Building Name:** | Retirement Systems | **Address:** | 60 Empire Drive | **Deferred Maintenance:** | $2,120,802 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 145,147 |
| **Building Code:** | G6231046262 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $9,999,581 |
| **Building Name:** | Retirement Systems Ramp | **Address:** | 60 Empire Drive | **Deferred Maintenance:** | $808,816 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 114,690 |

# Agency: H55 - Department of Human Services

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $831,325,918 | **Ext. Gross Area:** | 2,503,666 |
| **Facility Condition Index:** | 0.19 | **Deferred Maintenance:** | $160,106,017 | **Building Count:** | 152 |

## *Site: H55200 - ANOKA METRO R.T.C.*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5520000690 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $1,736,144 |
| **Building Name:** | Como Apartment | **Address:** | 690 Como Ave | **Deferred Maintenance:** | $509,182 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 12,662 |
| **Building Code:** | H552033010A | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $32,428,838 |
| **Building Name:** | A - Building | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $4,154,454 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ANOKA | **Ext. Gross Area:** | 116,227 |
| **Building Code:** | H5520330111 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $23,822,271 |
| **Building Name:** | Miller Building | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $8,274,101 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | ANOKA | **Ext. Gross Area:** | 85,340 |
| **Building Code:** | H5520330117 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $19,633,993 |
| **Building Name:** | Food Service | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $9,319,481 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | ANOKA | **Ext. Gross Area:** | 68,106 |
| **Building Code:** | H5520330125 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,549 |
| **Building Name:** | Miller Lift Station - MC7 | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $10,018 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 91 |
| **Building Code:** | H5520330138 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $334,622 |
| **Building Name:** | Pole Barn/Storage Bldg. | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $8,431 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ANOKA | **Ext. Gross Area:** | 2,420 |
| **Building Code:** | H5520330139 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $270,340 |
| **Building Name:** | Grounds Shop/Storage | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $102,467 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | ANOKA | **Ext. Gross Area:** | 2,594 |
| **Building Code:** | H5520330140 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $223,111 |
| **Building Name:** | Metal Pole Barn | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $43,888 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 1,949 |
| **Building Code:** | H55203301BC | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $9,506,247 |
| **Building Name:** | B & C Building | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $1,914,812 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 35,311 |
| **Building Code:** | H55203301DE | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $9,594,829 |
| **Building Name:** | D & E Building | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $1,949,499 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 36,115 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H55203301GH | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $11,153,016 |
| **Building Name:** | G & H Building | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $2,711,646 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 35,417 |
| **Building Code:** | H55203301LK | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $877,412 |
| **Building Name:** | Connecting Link | **Address:** | 3301 7TH Ave. N. | **Deferred Maintenance:** | $133,257 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 3,139 |

### *Site: H55300 - BRAINERD REGIONAL H.S.C.*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5530000018 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $387,573 |
| **Building Name:** | Storage Building 18 | **Address:** | 11690 State Avenue | **Deferred Maintenance:** | $83,837 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 2,600 |
| **Building Code:** | H5530000020 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $8,859,227 |
| **Building Name:** | MNCARE Building 20 | **Address:** | 11630 State Avenue | **Deferred Maintenance:** | $994,130 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 31,654 |
| **Building Code:** | H5530000021 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $9,039,386 |
| **Building Name:** | MSHS Building 21 | **Address:** | 11615 State Avenue | **Deferred Maintenance:** | $1,762,066 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 49,371 |
| **Building Code:** | H5530000022 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $11,684,068 |
| **Building Name:** | Office Building 22 | **Address:** | 11600 State Avenue | **Deferred Maintenance:** | $2,490,462 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 67,455 |
| **Building Code:** | H5530000041 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $271,635 |
| **Building Name:** | Screened Building | **Address:** | 11600 State Avenue | **Deferred Maintenance:** | $24,584 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,681 |
| **Building Code:** | H5530000042 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $2,917,038 |
| **Building Name:** | Tunnel System - BRHSC | **Address:** | 11600 State Avenue | **Deferred Maintenance:** | $688,860 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 16,330 |

### *Site: H55400 - MSHS - Cambridge*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5540000001 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $730,597 |
| **Building Name:** | Home 1 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $117,354 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 3,381 |
| **Building Code:** | H5540000002 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,116,741 |
| **Building Name:** | Home 2 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $190,434 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 5,965 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5540000003 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $731,226 |
| **Building Name:** | Home 3 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $110,792 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 3,384 |
| **Building Code:** | H5540000004 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,117,749 |
| **Building Name:** | Home 4 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $162,357 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 5,967 |
| **Building Code:** | H5540000005 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $732,582 |
| **Building Name:** | Home 5 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $110,994 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 3,390 |
| **Building Code:** | H5540000006 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,116,183 |
| **Building Name:** | Home 6 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $157,499 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 5,959 |
| **Building Code:** | H5540000007 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,055,647 |
| **Building Name:** | Home 7 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $154,602 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 4,775 |
| **Building Code:** | H5540000008 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $895,472 |
| **Building Name:** | Home 8 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $133,007 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 4,134 |
| **Building Code:** | H5540000017 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $6,066,470 |
| **Building Name:** | Rec./Maintenance | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $1,362,867 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 29,542 |
| **Building Code:** | H5540000018 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $11,037,892 |
| **Building Name:** | Admin.& Program Support | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $3,389,173 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 52,228 |
| **Building Code:** | H5540000024 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,911 |
| **Building Name:** | Lift Station - Mc24 | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $123 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 28 |
| **Building Code:** | H5540000027 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $6,121,775 |
| **Building Name:** | Vocational Train-Mshs | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $2,505,761 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 24,872 |
| **Building Code:** | H5540000028 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $7,263,882 |
| **Building Name:** | MSHS - Power Plant | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $1,600,612 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 13,265 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5540000031 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $249,944 |
| **Building Name:** | Paint Storage Bldg. | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $56,161 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 1,929 |
| **Building Code:** | H5540000046 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $1,588,370 |
| **Building Name:** | Tunnel System - Mshs | **Address:** | 1425 E Rum River Drive So | **Deferred Maintenance:** | $443,927 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 8,958 |

### *Site: H55500 - CBS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5550004DP1 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $823,701 |
| **Building Name:** | Kenyon - Blaine | **Address:** | 12949 Kenyon St NE | **Deferred Maintenance:** | $147,283 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BLAINE | **Ext. Gross Area:** | 4,851 |
| **Building Code:** | H5550004DP2 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $663,831 |
| **Building Name:** | 6th Ave - Pine City | **Address:** | 215 6Th Ave East | **Deferred Maintenance:** | $111,729 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PINE CITY | **Ext. Gross Area:** | 3,363 |
| **Building Code:** | H5550005123 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $704,907 |
| **Building Name:** | Dean - Champlin | **Address:** | 310 Dean Ave E | **Deferred Maintenance:** | $120,705 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CHAMPLIN | **Ext. Gross Area:** | 2,572 |
| **Building Code:** | H5550005125 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $836,566 |
| **Building Name:** | Rosewood - Dayton | **Address:** | 14080 Rosewood Ln N | **Deferred Maintenance:** | $120,890 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | DAYTON | **Ext. Gross Area:** | 4,266 |
| **Building Code:** | H5550005139 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $587,865 |
| **Building Name:** | 220th Street - Scandia | **Address:** | 15565 220Th Street | **Deferred Maintenance:** | $66,884 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SCANDIA | **Ext. Gross Area:** | 3,225 |
| **Building Code:** | H5550005143 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $608,258 |
| **Building Name:** | Iverson - Forest Lake | **Address:** | 22500 Iverson Ave | **Deferred Maintenance:** | $133,725 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 3,460 |
| **Building Code:** | H5550005302 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $653,639 |
| **Building Name:** | W 6th St - West Concord | **Address:** | 406 West 6Th St | **Deferred Maintenance:** | $107,774 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WEST CONCORD | **Ext. Gross Area:** | 3,629 |
| **Building Code:** | H5550005331 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $818,474 |
| **Building Name:** | Old Shakopee - Bloomington | **Address:** | 10101 1St Ave S | **Deferred Maintenance:** | $82,296 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BLOOMINGTON | **Ext. Gross Area:** | 3,524 |
| **Building Code:** | H5550005367 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $609,133 |
| **Building Name:** | Summerset - Rochester | **Address:** | 5405 Hwy63 So | **Deferred Maintenance:** | $155,636 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 3,387 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5550005658 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $846,085 |
| **Building Name:** | Park Avenue - Faribault | **Address:** | 2307 Park Ave NW | **Deferred Maintenance:** | $111,382 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 4,268 |
| **Building Code:** | H5550005659 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $853,895 |
| **Building Name:** | Highland - Northfield | **Address:** | 300 Highland Ave | **Deferred Maintenance:** | $101,077 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 4,496 |
| **Building Code:** | H5550005660 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $766,465 |
| **Building Name:** | 3rd Street - Faribault | **Address:** | 1011 3Rd Street SE | **Deferred Maintenance:** | $136,650 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 4,446 |
| **Building Code:** | H5550005661 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $851,576 |
| **Building Name:** | Donnelly - Farmington | **Address:** | 20345 Donnelly Ave | **Deferred Maintenance:** | $56,468 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | FARMINGTON | **Ext. Gross Area:** | 5,010 |
| **Building Code:** | H5550005662 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $877,502 |
| **Building Name:** | Crystal - Burnsville | **Address:** | 1101 W Crystal Lake Rd | **Deferred Maintenance:** | $135,633 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | BURNSVILLE | **Ext. Gross Area:** | 5,573 |
| **Building Code:** | H5550005663 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $957,569 |
| **Building Name:** | Sciota - Northfield | **Address:** | 1375 310Th St E (Sciota | **Deferred Maintenance:** | $141,208 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 4,234 |
| **Building Code:** | H5550005664 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $700,448 |
| **Building Name:** | Sibley - Eagan | **Address:** | 3034 Sibley Memorial Hwy | **Deferred Maintenance:** | $118,504 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | EAGAN | **Ext. Gross Area:** | 2,963 |
| **Building Code:** | H5550005665 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $816,685 |
| **Building Name:** | Scott Ave.- Golden Valley | **Address:** | 3220 Scott Ave | **Deferred Maintenance:** | $134,592 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 4,190 |
| **Building Code:** | H5550005666 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $816,685 |
| **Building Name:** | 19Th Avenue - Mpls. | **Address:** | 3740 19Th Ave So | **Deferred Maintenance:** | $119,275 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 4,347 |
| **Building Code:** | H5550005667 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $816,685 |
| **Building Name:** | 41St Avenue - Mpls. | **Address:** | 3740 41St Ave So | **Deferred Maintenance:** | $114,714 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 4,349 |
| **Building Code:** | H5550005668 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $828,502 |
| **Building Name:** | Prestwick - Brooklyn Pk | **Address:** | 8920 Prestwick Circle N | **Deferred Maintenance:** | $138,597 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BROOKLYN PARK | **Ext. Gross Area:** | 4,313 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5550005669 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $828,502 |
| **Building Name:** | 89Th Crescent-Brooklyn Pk | **Address:** | 5422 89Th Crescent No | **Deferred Maintenance:** | $122,214 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | BROOKLYN PARK | **Ext. Gross Area:** | 4,322 |
| **Building Code:** | H5550005671 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $816,685 |
| **Building Name:** | Newton - Mpls | **Address:** | 4401 Newton Ave N | **Deferred Maintenance:** | $96,076 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 4,524 |
| **Building Code:** | H5550005673 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $816,685 |
| **Building Name:** | 4th Ave - Richfield | **Address:** | 6637 4Th Ave So | **Deferred Maintenance:** | $69,937 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 3,809 |
| **Building Code:** | H5550005674 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $862,248 |
| **Building Name:** | 91St Crescent-Brooklyn Pk | **Address:** | 5209 91St Crescent | **Deferred Maintenance:** | $77,932 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BROOKLYN PARK | **Ext. Gross Area:** | 4,317 |
| **Building Code:** | H5550005682 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $803,590 |
| **Building Name:** | Eaves Way - Farmington | **Address:** | 20359 Eaves Way | **Deferred Maintenance:** | $122,447 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | FARMINGTON | **Ext. Gross Area:** | 2,920 |
| **Building Code:** | H5550005708 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $677,783 |
| **Building Name:** | 7th Avenue - Faribault | **Address:** | 813 SW 7Th Ave | **Deferred Maintenance:** | $110,422 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 3,367 |
| **Building Code:** | H5550005709 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $823,869 |
| **Building Name:** | Second Street - Morristown | **Address:** | 400 Sw Second St | **Deferred Maintenance:** | $106,328 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MORRISTOWN | **Ext. Gross Area:** | 3,713 |
| **Building Code:** | H5550005710 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $871,457 |
| **Building Name:** | Ableman - Warsaw | **Address:** | 23450 Falls Ave | **Deferred Maintenance:** | $93,724 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WARSAW | **Ext. Gross Area:** | 3,675 |
| **Building Code:** | H5550005711 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $907,698 |
| **Building Name:** | Jefferson - Northfield | **Address:** | 1904 Jefferson Rd | **Deferred Maintenance:** | $126,816 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 3,031 |
| **Building Code:** | H5550005713 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $927,401 |
| **Building Name:** | Allen Path - Faribault | **Address:** | 54 Allen Path | **Deferred Maintenance:** | $194,668 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 3,521 |
| **Building Code:** | H5550005714 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $815,264 |
| **Building Name:** | Canby Court - Northfield | **Address:** | 8631 Canby Court | **Deferred Maintenance:** | $152,430 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 3,544 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5550005715 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $551,388 |
| **Building Name:** | 8Th Avenue - Owatonna | **Address:** | 2020 8Th Ave NE | **Deferred Maintenance:** | $81,313 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 3,432 |
| **Building Code:** | H5550005716 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $568,559 |
| **Building Name:** | 32Nd Avenue - Owatonna | **Address:** | 300 SW 32Nd Ave | **Deferred Maintenance:** | $110,447 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 3,153 |
| **Building Code:** | H5550005717 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $836,728 |
| **Building Name:** | Bethesda - Alexandria | **Address:** | 123 Bethesda St Nw | **Deferred Maintenance:** | $97,024 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 4,429 |
| **Building Code:** | H5550005718 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,703,152 |
| **Building Name:** | Old Hwy 4 - Biwabik | **Address:** | 101 Old Hwy 4 - Po#205 | **Deferred Maintenance:** | $446,963 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | BIWABIK | **Ext. Gross Area:** | 9,265 |
| **Building Code:** | H5550005719 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,336,165 |
| **Building Name:** | 13th Ave - East Grand Forks | **Address:** | 2134/2132 13Th Ave Nw | **Deferred Maintenance:** | $171,933 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 6,437 |
| **Building Code:** | H5550005721 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $481,352 |
| **Building Name:** | 140th Avenue - Mahnomen | **Address:** | 2559 140Th Avenue | **Deferred Maintenance:** | $77,071 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 2,521 |
| **Building Code:** | H5550005722 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,145,329 |
| **Building Name:** | 63rd Avenue - Moorhead | **Address:** | 820 63Rd Avenue N | **Deferred Maintenance:** | $154,317 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 6,012 |
| **Building Code:** | H5550005723 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $944,478 |
| **Building Name:** | 4th Street - Moose Lake | **Address:** | 305 4Th Street - Po#495 | **Deferred Maintenance:** | $171,484 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 4,891 |
| **Building Code:** | H5550005724 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,249,326 |
| **Building Name:** | Baker - Redwood Falls | **Address:** | 205 Baker Drive | **Deferred Maintenance:** | $150,405 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 4,870 |
| **Building Code:** | H5550005725 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,118,095 |
| **Building Name:** | Swan Lake - Duluth | **Address:** | 1423 Swan Lake Road | **Deferred Maintenance:** | $165,142 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,852 |
| **Building Code:** | H5550005726 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,076,837 |
| **Building Name:** | 7th Ave - Virginia | **Address:** | 700 S 7Th Avenue | **Deferred Maintenance:** | $237,639 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 4,807 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5550005727 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $720,883 |
| **Building Name:** | Jennifer - Hermantown | **Address:** | 5668 W Arrowhead Road | **Deferred Maintenance:** | $100,201 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HERMANTOWN | **Ext. Gross Area:** | 2,617 |
| **Building Code:** | H5550005728 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $730,522 |
| **Building Name:** | Maple Grove - Hermantown | **Address:** | 5223 Maple Grove Road | **Deferred Maintenance:** | $199,688 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HERMANTOWN | **Ext. Gross Area:** | 3,201 |
| **Building Code:** | H5550005729 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $463,651 |
| **Building Name:** | Loon Dr - Pine City | **Address:** | 12433 Loon Drive | **Deferred Maintenance:** | $126,552 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | PINE CITY | **Ext. Gross Area:** | 2,340 |
| **Building Code:** | H5550005731 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $736,168 |
| **Building Name:** | Middle River-Redwood Falls | **Address:** | 630 Middle Street | **Deferred Maintenance:** | $85,739 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 2,965 |
| **Building Code:** | H5550005732 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $736,168 |
| **Building Name:** | Falls Place - Redwood Falls | **Address:** | 628 Middle Street | **Deferred Maintenance:** | $79,226 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 2,961 |
| **Building Code:** | H5550005DP1 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $667,595 |
| **Building Name:** | Hershey - Lakeville | **Address:** | 20086 Hershey Ave W(#1) | **Deferred Maintenance:** | $112,784 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | LAKEVILLE | **Ext. Gross Area:** | 3,422 |
| **Building Code:** | H5550005DP2 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $632,916 |
| **Building Name:** | 17Th Street - Rochester | **Address:** | 448 17Th St SW | **Deferred Maintenance:** | $124,745 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 3,401 |
| **Building Code:** | H5550005DP3 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,462,582 |
| **Building Name:** | 12th Street - Austin | **Address:** | 1000 12Th St SW | **Deferred Maintenance:** | $124,628 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | AUSTIN | **Ext. Gross Area:** | 4,308 |
| **Building Code:** | H5550005DP4 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $841,179 |
| **Building Name:** | 1st Ave - Kasson | **Address:** | 1101 1St Ave NE | **Deferred Maintenance:** | $126,084 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | KASSON | **Ext. Gross Area:** | 4,864 |
| **Building Code:** | H5550005DP5 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,190,710 |
| **Building Name:** | Shumway - Faribault | **Address:** | 1805 Shumway | **Deferred Maintenance:** | $203,411 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 4,876 |
| **Building Code:** | H5550005DP6 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,059,907 |
| **Building Name:** | Jonquil - Lakeville | **Address:** | 17041 Jonquil Ave (#2) | **Deferred Maintenance:** | $191,876 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | LAKEVILLE | **Ext. Gross Area:** | 4,445 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5550005DP7 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,149,334 |
| **Building Name:** | Dell Road - Eden Prairie | **Address:** | 7198 Dell Rd (A) | **Deferred Maintenance:** | $129,691 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | EDEN PRAIRIE | **Ext. Gross Area:** | 4,889 |
| **Building Code:** | H5550005DP8 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $986,217 |
| **Building Name:** | Oakland - Bloomington | **Address:** | 8634 Oakland Ave | **Deferred Maintenance:** | $105,931 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BLOOMINGTON | **Ext. Gross Area:** | 4,900 |
| **Building Code:** | H5550005DP9 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,165,184 |
| **Building Name:** | Chatham Way- Eden Prairie | **Address:** | 6204 Chatham Way (B) | **Deferred Maintenance:** | $133,806 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | EDEN PRAIRIE | **Ext. Gross Area:** | 4,903 |
| **Building Code:** | H55500G5139 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $79,844 |
| **Building Name:** | 220th St - Scandia-Garage/Shed | **Address:** | 15565 220Th Street | **Deferred Maintenance:** | $33,206 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | SCANDIA | **Ext. Gross Area:** | 854 |
| **Building Code:** | H55500G5143 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $70,550 |
| **Building Name:** | Iverson -Forest Lake - Garage | **Address:** | 22500 Iverson Ave | **Deferred Maintenance:** | $14,059 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 578 |
| **Building Code:** | H55500G5367 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,348 |
| **Building Name:** | Summerset - Rochester - Garage | **Address:** | 5405 Hwy63 So | **Deferred Maintenance:** | $2,548 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 672 |
| **Building Code:** | H55500G5662 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,239 |
| **Building Name:** | Crystal - Burnsville - Garage | **Address:** | 1101 W Crystal Lake Rd | **Deferred Maintenance:** | $6,056 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | BURNSVILLE | **Ext. Gross Area:** | 256 |
| **Building Code:** | H55500G5708 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $37,414 |
| **Building Name:** | 7th Ave - Faribault - Garage | **Address:** | 813 SW 7Th Ave | **Deferred Maintenance:** | $11,237 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 294 |
| **Building Code:** | H55500G5711 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $42,790 |
| **Building Name:** | Jeferson - Northfield -Garage | **Address:** | 1904 Jefferson Rd | **Deferred Maintenance:** | $36,910 |
| **Facility Condition Index:** | 0.86 - Crisis | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 472 |
| **Building Code:** | H55500G5721 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $155,449 |
| **Building Name:** | 140th Avenue - Mahnomen-Garage | **Address:** | 2559 140Th Avenue | **Deferred Maintenance:** | $20,225 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 1,292 |
| **Building Code:** | H55500G5727 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $133,161 |
| **Building Name:** | Jennifer - Hermantown - Garage | **Address:** | 5668 W Arrowhead Road | **Deferred Maintenance:** | $91,069 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | HERMANTOWN | **Ext. Gross Area:** | 1,188 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H55500G5728 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $101,882 |
| **Building Name:** | Maple Grove-Hermantown-Garage | **Address:** | 5223 Maple Grove Road | **Deferred Maintenance:** | $55,839 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | HERMANTOWN | **Ext. Gross Area:** | 909 |
| **Building Code:** | H55500S5367 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $160,103 |
| **Building Name:** | Summerset - Rochester - Shed | **Address:** | 5405 Hwy63 So | **Deferred Maintenance:** | $109,536 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 1,762 |
| **Building Code:** | H55500S5716 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $37,430 |
| **Building Name:** | 32nd Ave-Owatonna-Garage/Shop | **Address:** | 300 SW 32Nd Ave | **Deferred Maintenance:** | $4,443 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 329 |
| **Building Code:** | H5550SS5716 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,024 |
| **Building Name:** | 32nd Ave - Owatonna-Shed | **Address:** | 300 SW 32Nd Ave | **Deferred Maintenance:** | $7,089 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 114 |

### *Site: H55700 - MOOSE LAKE MSOP*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5570000001 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $74,819,838 |
| **Building Name:** | MSOP Main | **Address:** | 1111 Highway 73 | **Deferred Maintenance:** | $12,751,517 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 186,477 |
| **Building Code:** | H5570000002 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $72,468,573 |
| **Building Name:** | MSOP Complex | **Address:** | 1111 Highway 73 | **Deferred Maintenance:** | $4,573,615 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 158,096 |
| **Building Code:** | H5570000005 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $4,422,412 |
| **Building Name:** | Loading Dock Building | **Address:** | 1111 Highway 73 | **Deferred Maintenance:** | $136,751 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 13,968 |
| **Building Code:** | H5570000006 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $35,228,722 |
| **Building Name:** | MSOP Support Building | **Address:** | 1111 Highway 73 | **Deferred Maintenance:** | $2,152,580 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 98,481 |
| **Building Code:** | H5570000007 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $753,500 |
| **Building Name:** | Vehicle Garage | **Address:** | 1111 Highway 73 | **Deferred Maintenance:** | $25,256 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 3,960 |
| **Building Code:** | H5570000008 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $210,016 |
| **Building Name:** | Maintenance Garage | **Address:** | 1111 Highway 73 | **Deferred Maintenance:** | $7,611 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 1,147 |

### *Site: H55800 - ST. PETER R.T.C.*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5580000001 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $30,081,745 |
| **Building Name:** | Shantz | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $3,571,067 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 80,776 |
| **Building Code:** | H5580000002 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $33,061,985 |
| **Building Name:** | Pexton Hall | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $8,855,276 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 91,029 |
| **Building Code:** | H5580000003 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $34,774,260 |
| **Building Name:** | Bartlett Hall | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $12,910,070 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 88,309 |
| **Building Code:** | H5580000004 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $7,957,733 |
| **Building Name:** | Tomlinson Hall | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $4,037,322 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | ST. PETER | **Ext. Gross Area:** | 23,255 |
| **Building Code:** | H5580000005 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $401,659 |
| **Building Name:** | Gluek Building | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $102,274 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 1,742 |
| **Building Code:** | H5580000007 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,355 |
| **Building Name:** | Storage Shed - Mc8 | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $7,879 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 168 |
| **Building Code:** | H5580000008 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $89,839 |
| **Building Name:** | Gazebo/Paula Olson | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $18,406 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 648 |
| **Building Code:** | H5580000010 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $12,606,258 |
| **Building Name:** | Administration Bldg-Sprtc | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $2,946,246 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 45,532 |
| **Building Code:** | H5580000016 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,094 |
| **Building Name:** | Liberty Hall Garage | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $2,507 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 660 |
| **Building Code:** | H5580000017 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $75,730 |
| **Building Name:** | Carpenter Garage | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $17,628 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 896 |
| **Building Code:** | H5580000020 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $57,433 |
| **Building Name:** | Rec. Van Garage (Left) | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $23,640 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 528 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5580000021 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $58,018 |
| **Building Name:** | Rec. Van Garage (Right) | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $20,760 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 528 |
| **Building Code:** | H5580000022 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $41,552 |
| **Building Name:** | Garden Center/Garage | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $5,069 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 484 |
| **Building Code:** | H5580000025 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,099,288 |
| **Building Name:** | Green Acres | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $1,832,055 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 40,299 |
| **Building Code:** | H5580000026 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,863,226 |
| **Building Name:** | Sunrise | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $4,539,356 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 40,294 |
| **Building Code:** | H5580000037 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $5,984,951 |
| **Building Name:** | Johnson Hall | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $1,688,880 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 23,822 |
| **Building Code:** | H5580000051 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $16,359,352 |
| **Building Name:** | Old Center Building | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $5,565,038 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 47,156 |
| **Building Code:** | H5580000060 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,382,584 |
| **Building Name:** | Kitchen/Warehouse | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $8,423,550 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 48,659 |
| **Building Code:** | H5580000061 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $106,477 |
| **Building Name:** | Garage | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $31,663 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 974 |
| **Building Code:** | H5580000062 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $148,996 |
| **Building Name:** | Bedrock Car Wash | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $48,942 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 905 |
| **Building Code:** | H5580000063 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $317,425 |
| **Building Name:** | Grounds Garage (Office) | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $144,814 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | H5580000065 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $7,754,832 |
| **Building Name:** | Vocational Building | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $1,298,503 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 24,724 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5580000069 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $48,539 |
| **Building Name:** | Gas Control Building | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $9,138 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 217 |
| **Building Code:** | H5580000070 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $15,077,193 |
| **Building Name:** | Power Plant | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $2,685,894 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 8,564 |
| **Building Code:** | H5580000071 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $6,873,009 |
| **Building Name:** | Tunnel System | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $4,143,611 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | ST. PETER | **Ext. Gross Area:** | 46,854 |
| **Building Code:** | H5580000072 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $4,357,662 |
| **Building Name:** | Maintenance Shop | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $1,770,960 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 12,862 |
| **Building Code:** | H5580000076 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $43,549 |
| **Building Name:** | Pump House South | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $9,976 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 228 |
| **Building Code:** | H5580000082 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $820,984 |
| **Building Name:** | Root Cellar | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $338,187 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 5,532 |
| **Building Code:** | H5580000090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,089,039 |
| **Building Name:** | Dairy Barn | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $1,449,766 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 15,119 |
| **Building Code:** | H5580000098 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,112,894 |
| **Building Name:** | Mechanics Garage | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $322,049 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 6,463 |
| **Building Code:** | H5580000099 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $127,493,280 |
| **Building Name:** | Minn. Security Hospital | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $18,223,847 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 331,082 |
| **Building Code:** | H5580000101 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $227,429 |
| **Building Name:** | Vehicle Storage Shed | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $20,165 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | H5580000103 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $145,166 |
| **Building Name:** | Upper Access Point | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $15,728 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5580000104 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $302,556 |
| **Building Name:** | Lower Access Point | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $48,640 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 64 |
| **Building Code:** | H5580000105 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $144,942 |
| **Building Name:** | Pexton Access Point | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $13,440 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 64 |
| **Building Code:** | H5580000106 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,385,622 |
| **Building Name:** | Forensic Nursing Home | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $1,284,888 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 36,349 |
| **Building Code:** | H5580000107 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $4,124,500 |
| **Building Name:** | Activity Building | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $359,148 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 11,200 |
| **Building Code:** | H5580000108 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $23,765 |
| **Building Name:** | Salt Storage | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $6,600 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 351 |
| **Building Code:** | H5580000109 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $7,057,951 |
| **Building Name:** | Forestview | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $218,371 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ST. PETER | **Ext. Gross Area:** | 25,007 |
| **Building Code:** | H5580000110 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,233 |
| **Building Name:** | J.H. South Storage Shed 1 | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $478 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 148 |
| **Building Code:** | H5580000111 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,378 |
| **Building Name:** | J.H. North Storage Shed 2 | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $368 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 99 |
| **Building Code:** | H5580000112 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,196 |
| **Building Name:** | F.V. South Storage Shed 1 | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $144 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ST. PETER | **Ext. Gross Area:** | 99 |
| **Building Code:** | H5580000113 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,196 |
| **Building Name:** | F.V. North Storage Shed 2 | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $144 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ST. PETER | **Ext. Gross Area:** | 99 |
| **Building Code:** | H5580000114 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $78,946 |
| **Building Name:** | Gluek Screen Gazebo | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $37,461 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 523 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H5580000115 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $25,981 |
| **Building Name:** | Gluek Storage Shed | **Address:** | 100 Freeman Drive | **Deferred Maintenance:** | $9,565 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 331 |

# Agency: H75 - Minnesota Veterans Affairs

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $313,818,411 | **Ext. Gross Area:** | 1,243,421 |
| **Facility Condition Index:** | 0.14 | **Deferred Maintenance:** | $42,601,406 | **Building Count:** | 63 |

## *Site: H75FVH - Fergus Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75FVH00001 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $29,457,978 |
| **Building Name:** | Fergus Vets Home | **Address:** | 1821 N. Park St. | **Deferred Maintenance:** | $2,537,917 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Fergus Falls | **Ext. Gross Area:** | 127,684 |
| **Building Code:** | H75FVH00102 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,002,922 |
| **Building Name:** | FVH 102 Bldg. 2 | **Address:** | 1821 North Park St B2 | **Deferred Maintenance:** | $574,081 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | Fergus Falls | **Ext. Gross Area:** | 4,032 |
| **Building Code:** | H75FVH00103 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $550,182 |
| **Building Name:** | FVH 103 Bldg. 3 | **Address:** | 1821 North Park St B3 | **Deferred Maintenance:** | $46,809 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Fergus Falls | **Ext. Gross Area:** | 4,000 |

## *Site: H75HVH - Hastings*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75HVH00018 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $31,924 |
| **Building Name:** | Building 18 - Pavillion | **Address:** | 1200 E. 18th St. B18 | **Deferred Maintenance:** | $7,875 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Hastings | **Ext. Gross Area:** | 800 |
| **Building Code:** | H75HVH00019 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $10,090,411 |
| **Building Name:** | Building 19 - Water Tower | **Address:** | 1200 East 18th Street B19 | **Deferred Maintenance:** | $577,567 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 1,790 |
| **Building Code:** | H75HVH10319 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $6,073,141 |
| **Building Name:** | Building 20 | **Address:** | 1200 East 18th Street B20 | **Deferred Maintenance:** | $1,296,513 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Hastings | **Ext. Gross Area:** | 26,276 |
| **Building Code:** | H75HVH10819 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $3,204,817 |
| **Building Name:** | Building 24 | **Address:** | 1200 East 18th Street B24 | **Deferred Maintenance:** | $237,390 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 9,868 |
| **Building Code:** | H75HVH11019 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $19,473,063 |
| **Building Name:** | Building 23 | **Address:** | 1200 East 18th Street B23 | **Deferred Maintenance:** | $3,951,210 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Hastings | **Ext. Gross Area:** | 99,348 |
| **Building Code:** | H75HVH11319 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $35,333 |
| **Building Name:** | Building 22 - Park Toilet | **Address:** | 1200 E. 18th St B22 | **Deferred Maintenance:** | $4,673 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 248 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75HVH11519 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,716 |
| **Building Name:** | Building 35 - Tool Shed | **Address:** | 1200 East 18th St B35 | **Deferred Maintenance:** | $6,613 |
| **Facility Condition Index:** | 0.62 - Crisis | **City Code:** | Hastings | **Ext. Gross Area:** | 241 |
| **Building Code:** | H75HVH11619 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $4,382,384 |
| **Building Name:** | Building 25 | **Address:** | 1200 East 18th Street B25 | **Deferred Maintenance:** | $1,550,532 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Hastings | **Ext. Gross Area:** | 18,746 |
| **Building Code:** | H75HVH11719 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,306,123 |
| **Building Name:** | Building 33 - Garage | **Address:** | 1200  East 18th Street B33 | **Deferred Maintenance:** | $182,125 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 5,740 |
| **Building Code:** | H75HVH12019 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $11,775,941 |
| **Building Name:** | Building 30 - Power House | **Address:** | 1200E. 18th St. B30 | **Deferred Maintenance:** | $2,480,878 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Hastings | **Ext. Gross Area:** | 15,036 |
| **Building Code:** | H75HVH12119 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $70,079 |
| **Building Name:** | Screen House | **Address:** | 1200 E. 18th St B SH | **Deferred Maintenance:** | $7,477 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 672 |
| **Building Code:** | H75HVH12319 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $278,965 |
| **Building Name:** | Building 36 | **Address:** | 1200 East 18th Street B36 | **Deferred Maintenance:** | $17,735 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 3,213 |
| **Building Code:** | H75HVH12419 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $105,040 |
| **Building Name:** | Bldg 32 - #3 Well | **Address:** | 1200 East 18th Street #3 Well | **Deferred Maintenance:** | $10,823 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 198 |
| **Building Code:** | H75HVH12619 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $32,311 |
| **Building Name:** | Building 28 -Tool Shed | **Address:** | 1200 East 18th Street B28 | **Deferred Maintenance:** | $18,214 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | Hastings | **Ext. Gross Area:** | 572 |
| **Building Code:** | H75HVH12719 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $907,371 |
| **Building Name:** | Building 34 | **Address:** | 1200 East 18th Street B34 | **Deferred Maintenance:** | $630,322 |
| **Facility Condition Index:** | 0.69 - Crisis | **City Code:** | Hastings | **Ext. Gross Area:** | 8,044 |
| **Building Code:** | H75HVH13019 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $3,937,430 |
| **Building Name:** | Building 1 - Detox | **Address:** | 1200 E. 18th St. B1 | **Deferred Maintenance:** | $1,268,686 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | Hastings | **Ext. Gross Area:** | 21,325 |
| **Building Code:** | H75HVH13119 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $3,376,351 |
| **Building Name:** | Building 2 - Detox | **Address:** | 1200 E. 18th St B2 | **Deferred Maintenance:** | $1,318,950 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | Hastings | **Ext. Gross Area:** | 19,067 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75HVH17A | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $1,036,903 |
| **Building Name:** | Tunnel A | **Address:** | 1200 E. 18th St.TA | **Deferred Maintenance:** | $59,546 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 3,600 |
| **Building Code:** | H75HVH17B | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $303,055 |
| **Building Name:** | Tunnel B | **Address:** | 1200 E. 18th St. TB | **Deferred Maintenance:** | $9,968 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Hastings | **Ext. Gross Area:** | 1,100 |
| **Building Code:** | H75HVH17C1 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $432,043 |
| **Building Name:** | Tunnel C1 | **Address:** | 1200 E. 18th St. TC1 | **Deferred Maintenance:** | $48,677 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | H75HVH17C2 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $449,999 |
| **Building Name:** | Tunnel C2 | **Address:** | 1200 E. 18th St. TC2 | **Deferred Maintenance:** | $29,605 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 1,400 |
| **Building Code:** | H75HVH17D | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $215,574 |
| **Building Name:** | Tunnel D | **Address:** | 1200 E. 18th St TD | **Deferred Maintenance:** | $12,851 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 710 |
| **Building Code:** | H75HVH17E | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $1,854,575 |
| **Building Name:** | Tunnel E | **Address:** | 1200 E. 18th St. TE | **Deferred Maintenance:** | $365,271 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Hastings | **Ext. Gross Area:** | 6,040 |
| **Building Code:** | H75HVH17F | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $516,162 |
| **Building Name:** | Tunnel F | **Address:** | 1200 E. 18th St, TF | **Deferred Maintenance:** | $30,770 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 1,700 |
| **Building Code:** | H75HVH17G | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $273,262 |
| **Building Name:** | Tunnel G | **Address:** | 1200 E. 18th St. TG | **Deferred Maintenance:** | $18,101 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 900 |
| **Building Code:** | H75HVH17H | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $97,160 |
| **Building Name:** | Tunnel H | **Address:** | 1200 E, 18th St. TH | **Deferred Maintenance:** | $5,792 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 320 |
| **Building Code:** | H75HVH17J | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $485,164 |
| **Building Name:** | Tunnel J | **Address:** | 1200 E. 18th St. TJ | **Deferred Maintenance:** | $15,958 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Hastings | **Ext. Gross Area:** | 1,761 |
| **Building Code:** | H75HVH17K | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $141,885 |
| **Building Name:** | Tunnel K | **Address:** | 1200 E. 18th St. TK | **Deferred Maintenance:** | $4,667 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Hastings | **Ext. Gross Area:** | 515 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75HVH17L | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $430,889 |
| **Building Name:** | Tunnel L | **Address:** | 1200 E. 18th St. TL | **Deferred Maintenance:** | $14,173 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Hastings | **Ext. Gross Area:** | 1,564 |
| **Building Code:** | H75HVH17N | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $131,081 |
| **Building Name:** | Tunnel N | **Address:** | 1200 E. 18th St. TN | **Deferred Maintenance:** | $7,950 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 443 |
| **Building Code:** | H75HVHHUD | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $687,575 |
| **Building Name:** | HUD House | **Address:** | | **Deferred Maintenance:** | $56,970 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 2,415 |

### *Site: H75LFC - Little Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75CEM00101 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $876,711 |
| **Building Name:** | Admin Building | **Address:** | 15550 Hwy 115 | **Deferred Maintenance:** | $123,863 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 4,123 |
| **Building Code:** | H75CEM00201 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,406,640 |
| **Building Name:** | Maintenance building | **Address:** | 15550 Hwy 115 | **Deferred Maintenance:** | $261,954 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 6,910 |

### *Site: H75LVH - Luverne*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75LVH10167 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $18,025,946 |
| **Building Name:** | Luverne Vets Home | **Address:** | 1300 N. Kniss | **Deferred Maintenance:** | $2,774,787 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Luverne | **Ext. Gross Area:** | 68,226 |

### *Site: H75MVH - Minneapolis*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75MVH00127 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $3,052,231 |
| **Building Name:** | MVH 001 Tunnels between 1,2,4,10, 1 | **Address:** | 5101 Minnehaha Ave S | **Deferred Maintenance:** | $575,794 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 10,000 |
| **Building Code:** | H75MVH00227 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $1,036,717 |
| **Building Name:** | MVH 002 Deep tunnel | **Address:** | 5101 Minnehaha Ave S. | **Deferred Maintenance:** | $218,658 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 4,000 |
| **Building Code:** | H75MVH10127 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $4,067,915 |
| **Building Name:** | Building 4 | **Address:** | 5101 Minnehaha Ave S B4 | **Deferred Maintenance:** | $279,074 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Minneapolis | **Ext. Gross Area:** | 16,384 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75MVH10327 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,643,739 |
| **Building Name:** | Building 18 - Warehouse | **Address:** | 5101 Minnehaha Ave S B18 | **Deferred Maintenance:** | $223,048 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Minneapolis | **Ext. Gross Area:** | 15,537 |
| **Building Code:** | H75MVH10527 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,329,233 |
| **Building Name:** | Building 14-A | **Address:** | 5101 Minnehaha Ave S B14-A | **Deferred Maintenance:** | $2,398,215 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 11,779 |
| **Building Code:** | H75MVH10627 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,603,054 |
| **Building Name:** | Building 2 | **Address:** | 5101 Minnehaha Ave S B2 | **Deferred Maintenance:** | $1,448,772 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Minneapolis | **Ext. Gross Area:** | 16,894 |
| **Building Code:** | H75MVH10727 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $17,412,736 |
| **Building Name:** | Building 6 | **Address:** | 5101 Minnehaha Ave S B6 | **Deferred Maintenance:** | $3,432,375 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 77,479 |
| **Building Code:** | H75MVH10827 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $8,708,164 |
| **Building Name:** | Building 16 | **Address:** | 5101 Minnehaha Ave S B16 | **Deferred Maintenance:** | $990,523 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Minneapolis | **Ext. Gross Area:** | 38,540 |
| **Building Code:** | H75MVH11027 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,185,269 |
| **Building Name:** | Building 15 | **Address:** | 5101 Minnehaha Ave S B15 | **Deferred Maintenance:** | $765,484 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 17,468 |
| **Building Code:** | H75MVH11127 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,220,078 |
| **Building Name:** | Building 12A | **Address:** | 5101 MInnehaha Ave S B12-A | **Deferred Maintenance:** | $373,471 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Minneapolis | **Ext. Gross Area:** | 5,400 |
| **Building Code:** | H75MVH11227 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,824,980 |
| **Building Name:** | Building 10 | **Address:** | 5101 Minnehaha Ave S B10 | **Deferred Maintenance:** | $1,807,689 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | Minneapolis | **Ext. Gross Area:** | 15,514 |
| **Building Code:** | H75MVH11527 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,263,007 |
| **Building Name:** | Building 13 | **Address:** | 5101 Minnehaha Ave S B13 | **Deferred Maintenance:** | $903,279 |
| **Facility Condition Index:** | 0.72 - Crisis | **City Code:** | Minneapolis | **Ext. Gross Area:** | 5,484 |
| **Building Code:** | H75MVH11827 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $3,662,122 |
| **Building Name:** | Building 1 | **Address:** | 5101 Minnehaha Ave S B1 | **Deferred Maintenance:** | $739,245 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 13,054 |
| **Building Code:** | H75MVH11927 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $5,003,360 |
| **Building Name:** | Building 14 - Powerhouse | **Address:** | 5101 Minnehaha Ave S B14 | **Deferred Maintenance:** | $225,072 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | Minneapolis | **Ext. Gross Area:** | 3,483 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75MVH12007 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $287,909 |
| **Building Name:** | Building 12 | **Address:** | 5101 Minnehaha Ave S B12 | **Deferred Maintenance:** | $136,566 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 1,788 |
| **Building Code:** | H75MVH19001 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $27,074,055 |
| **Building Name:** | Building 19 | **Address:** | 5101 Minnehaha Ave S B19 | **Deferred Maintenance:** | $1,351,655 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 118,972 |
| **Building Code:** | H75MVH20001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,378,727 |
| **Building Name:** | Building 20 | **Address:** | 5101 Minnehaha Ave S B20 | **Deferred Maintenance:** | $27,575 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | H75MVH21001 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $41,938,344 |
| **Building Name:** | Building 21 | **Address:** | 5101 MInnehaha Ave S | **Deferred Maintenance:** | $1,801,235 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 109,814 |
| **Building Code:** | H75MVH22001 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $25,250,236 |
| **Building Name:** | Building 22 | **Address:** | 5101 Minnehaha Ave South | **Deferred Maintenance:** | $505,005 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 175,366 |

### *Site: H75PRC - Preston*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75PRC00101 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $633,413 |
| **Building Name:** | Administration Bldg | **Address:** | 715 HWY 52 | **Deferred Maintenance:** | $30,699 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 2,293 |
| **Building Code:** | H75PRC00102 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $959,748 |
| **Building Name:** | Maintenance Bldg | **Address:** | 715 HWY 52 | **Deferred Maintenance:** | $19,195 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 4,025 |
| **Building Code:** | H75PRC00103 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $245,125 |
| **Building Name:** | Committal Shelter | **Address:** | 715 HWY 52 | **Deferred Maintenance:** | $4,903 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 1,003 |
| **Building Code:** | H75PRC00104 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,650 |
| **Building Name:** | Irrigation Pump House | **Address:** | 715 HWY 52 | **Deferred Maintenance:** | $993 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 120 |

### *Site: H75SVH - Silver Bay*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75SVH00001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $869,368 |
| **Building Name:** | Storage Shop | **Address:** | 45 Banks BLVD | **Deferred Maintenance:** | $17,641 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 4,800 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75SVH00002 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $6,691 |
| **Building Name:** | Gazebo | **Address:** | 45 Banks Blvd | **Deferred Maintenance:** | $134 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 600 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | H75SVH10139 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $19,645,432 |
| **Building Name:** | Silver Bay Vets Home | **Address:** | 45 Banks Blvd. | **Deferred Maintenance:** | $3,757,812 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Silver Bay | **Ext. Gross Area:** | 101,895 |

# Agency: P01 - Military Affairs

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $631,176,526 | **Ext. Gross Area:** | 2,660,359 |
| **Facility Condition Index:** | 0.22 | **Deferred Maintenance:** | $136,511,687 | **Building Count:** | 68 |

## *Site: P01146 - FARIBAULT AFRC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P0114620002 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $20,303,561 |
| **Building Name:** | Faribault TACC | **Address:** | 3000 West Airport Drive | **Deferred Maintenance:** | $1,612,686 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 64,482 |

## *Site: P01670 - AHATS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P0167001002 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $9,049,499 |
| **Building Name:** | AHATS Hamiline Ave RC | **Address:** | | **Deferred Maintenance:** | $938,988 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Arden Hills | **Ext. Gross Area:** | 60,413 |
| **Building Code:** | P0167001003 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $11,151,245 |
| **Building Name:** | Ben Franklin Readiness Center | **Address:** | | **Deferred Maintenance:** | $385,932 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 62,560 |

## *Site: P01774 - Stillwater RC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P0177411002 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $24,375,913 |
| **Building Name:** | Stillwater Readiness Center | **Address:** | | **Deferred Maintenance:** | $487,518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | STILLWATER | **Ext. Gross Area:** | 100,767 |

## *Site: P01818 - CAMBRIDGE RC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P0181816001 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $18,226,060 |
| **Building Name:** | Cambridge Armory | **Address:** | 505 SPIRIT RIVER DRVE | **Deferred Maintenance:** | $1,741,478 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 57,062 |

## *Site: P01A10 - ALBERT LEA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A1023001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $10,387,049 |
| **Building Name:** | Albert Lea TACC and MVSB | **Address:** | 410 Prospect Ave | **Deferred Maintenance:** | $2,573,396 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Albert Lea | **Ext. Gross Area:** | 28,791 |

## *Site: P01A15 - ALEXANDRIA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A1502001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,103,715 |
| **Building Name:** | Alexandria TACC | **Address:** | 310 Broadway | **Deferred Maintenance:** | $1,439,145 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Alexandria | **Ext. Gross Area:** | 28,151 |

### *Site: P01A20 - ANOKA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A2001001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,719,080 |
| **Building Name:** | Anoka TACC | **Address:** | 408 E Main St | **Deferred Maintenance:** | $1,707,417 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | Anoka | **Ext. Gross Area:** | 16,419 |

### *Site: P01A25 - APPLETON*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A2502001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $7,227,226 |
| **Building Name:** | Appleton NG TACC | **Address:** | 25 N Munsterman St | **Deferred Maintenance:** | $2,107,984 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Appleton | **Ext. Gross Area:** | 29,292 |

### *Site: P01A35 - AUSTIN*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A3525001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,059,613 |
| **Building Name:** | Austin Armory | **Address:** | 800 21st St NE | **Deferred Maintenance:** | $1,096,363 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Austin | **Ext. Gross Area:** | 21,878 |

### *Site: P01A40 - BEMIDJI*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A4003001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,483,280 |
| **Building Name:** | Bemidji TACC | **Address:** | 1430 23rd St NW | **Deferred Maintenance:** | $764,804 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Bemidji | **Ext. Gross Area:** | 21,006 |

### *Site: P01A47 - BLOOMINGTON*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A4707001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $9,927,767 |
| **Building Name:** | Bloomington TACC | **Address:** | 330 W 98th Street | **Deferred Maintenance:** | $2,981,103 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Bloomington | **Ext. Gross Area:** | 41,731 |

### *Site: P01A50 - BRAINERD*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A5001001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $8,438,303 |
| **Building Name:** | Brainerd TACC | **Address:** | 1115 Wright Street | **Deferred Maintenance:** | $3,260,800 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | Brainerd | **Ext. Gross Area:** | 38,569 |

### *Site: P01A53 - BROOKLYN PARK*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A5302001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $9,929,522 |
| **Building Name:** | Brooklyn Park TACC | **Address:** | 5500 85th Ave N | **Deferred Maintenance:** | $1,334,231 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Brooklyn Park | **Ext. Gross Area:** | 29,499 |

### *Site: P01A55 - CHISHOLM*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A5504001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,589,967 |
| **Building Name:** | Chisholm TACC | **Address:** | 900 W Lake St | **Deferred Maintenance:** | $1,162,275 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Chisholm | **Ext. Gross Area:** | 18,166 |

### *Site: P01A60 - CLOQUET*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A6011001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,218,519 |
| **Building Name:** | Cloquet TACC | **Address:** | 801 Hwy 33 South | **Deferred Maintenance:** | $1,603,391 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Cloquet TACC | **Ext. Gross Area:** | 27,244 |

### *Site: P01A63 - COTTAGE GROVE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A6309001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $10,333,882 |
| **Building Name:** | Cottage Grove TACC | **Address:** | 8180 Belden Blvd S | **Deferred Maintenance:** | $4,369,144 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | Cottage Grove | **Ext. Gross Area:** | 54,428 |

### *Site: P01A65 - CROOKSTON*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A6502001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $7,132,407 |
| **Building Name:** | Crookston | **Address:** | 1801 University Av N | **Deferred Maintenance:** | $1,557,338 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Crookston | **Ext. Gross Area:** | 21,484 |

### *Site: P01A75 - DETROIT LAKES*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A7507001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,711,997 |
| **Building Name:** | Detroit Lakes TACC | **Address:** | 1220 Rossman Ave | **Deferred Maintenance:** | $1,655,632 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Detroit Lakes | **Ext. Gross Area:** | 16,201 |

### *Site: P01A85 - DULUTH*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A8510001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $13,962,373 |
| **Building Name:** | Duluth TACC | **Address:** | 4015 Airpark Blvd | **Deferred Maintenance:** | $1,942,921 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Duluth | **Ext. Gross Area:** | 42,470 |

### *Site: P01A95 - FAIRMONT*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01A9522001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,561,786 |
| **Building Name:** | Fairmont TACC | **Address:** | 700 Fairlakes Ave | **Deferred Maintenance:** | $936,811 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Fairmont | **Ext. Gross Area:** | 18,948 |

### *Site: P01B00 - FARIBAULT*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B0020001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,629,462 |
| **Building Name:** | TACC (OLD) | **Address:** | | **Deferred Maintenance:** | $1,409,156 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 16,006 |

### *Site: P01B05 - FERGUS FALLS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B0508001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,990,734 |
| **Building Name:** | Fergus Falls TACC | **Address:** | 321 E Cecil Street | **Deferred Maintenance:** | $2,749,200 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | Fergus Falls | **Ext. Gross Area:** | 19,925 |

### *Site: P01B10 - GRAND RAPIDS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B1013001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,245,738 |
| **Building Name:** | Grand Rapids TACC | **Address:** | 930 NE 1st Ave | **Deferred Maintenance:** | $2,267,717 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | Grand Rapids | **Ext. Gross Area:** | 20,730 |

### *Site: P01B15 - HASTINGS ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B1510001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,613,381 |
| **Building Name:** | Hastings TACC | **Address:** | 3050 Hwy 316 S | **Deferred Maintenance:** | $396,526 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Hastings | **Ext. Gross Area:** | 18,451 |

### *Site: P01B20 - HIBBING ARMORY AND FMS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B2005001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,740,210 |
| **Building Name:** | Hibbing TACC | **Address:** | 2310 Brooklyn Drive | **Deferred Maintenance:** | $2,376,557 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Hibbing | **Ext. Gross Area:** | 29,352 |

### *Site: P01B25 - HUTCHINSON ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B2510001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,313,160 |
| **Building Name:** | Hutchinson TACC | **Address:** | 1200 Hwy 22 S | **Deferred Maintenance:** | $832,946 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Hutchinson | **Ext. Gross Area:** | 17,823 |

### *Site: P01B27 - INVER GOVE HEIGHT ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B2714001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $11,507,938 |
| **Building Name:** | Inver Grove Hts TACC | **Address:** | 8076 Babcock Trail | **Deferred Maintenance:** | $2,983,278 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Inver Grove Heig | **Ext. Gross Area:** | 42,392 |

### *Site: P01B30 - JACKSON ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B3014001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,554,708 |
| **Building Name:** | Jackson TACC | **Address:** | 108 Cty Road 51 | **Deferred Maintenance:** | $909,064 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Jackson | **Ext. Gross Area:** | 18,893 |

### *Site: P01B35 - LITCHFIELD ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B3509001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,389,875 |
| **Building Name:** | Litchfield TACC | **Address:** | 525 Gillman Ave N | **Deferred Maintenance:** | $582,628 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Litchfield | **Ext. Gross Area:** | 14,891 |

### *Site: P01B40 - CAMP RIPLEY TRAINING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B4002002 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $403,317 |
| **Building Name:** | Old School House | **Address:** | 15000 Hwy 115 | **Deferred Maintenance:** | $140,321 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Little Falls | **Ext. Gross Area:** | 2,256 |
| **Building Code:** | P01B4006078 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $3,991,492 |
| **Building Name:** | EMTC | **Address:** | 15000 Hwy 115 | **Deferred Maintenance:** | $309,967 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Little Falls | **Ext. Gross Area:** | 22,306 |
| **Building Code:** | P01B4011001 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $15,533,928 |
| **Building Name:** | Camp Ripley Armory | **Address:** | 15000 Hwy 115 | **Deferred Maintenance:** | $3,869,456 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Little Falls | **Ext. Gross Area:** | 98,722 |

### *Site: P01B50 - LUVERNE ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B5013001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,279,274 |
| **Building Name:** | Luverne TACC | **Address:** | 309 S Freeman Ave | **Deferred Maintenance:** | $2,176,852 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Luverne | **Ext. Gross Area:** | 29,172 |

### *Site: P01B55 - MADISON ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B5503001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $7,637,468 |
| **Building Name:** | Madison TACC | **Address:** | 504 3rd Street | **Deferred Maintenance:** | $2,220,928 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Madison | **Ext. Gross Area:** | 37,384 |

### *Site: P01B60 - MANKATO ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B6021002 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $16,882,762 |
| **Building Name:** | Mankato Armory | **Address:** | 100 Martin Luther King Jr Dr. | **Deferred Maintenance:** | $2,816,522 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Mankato | **Ext. Gross Area:** | 46,449 |

### *Site: P01B65 - MARSHAL ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B6508001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,273,397 |
| **Building Name:** | Marshall TACC | **Address:** | 500 Artillery Drive | **Deferred Maintenance:** | $1,635,415 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Marshall | **Ext. Gross Area:** | 16,833 |

### *Site: P01B75 - MINNEAPOLIS ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B7503001 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $5,632,671 |
| **Building Name:** | Minneapolis TACC | **Address:** | 1025 Broadway St NE | **Deferred Maintenance:** | $1,156,216 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Minneapolis | **Ext. Gross Area:** | 36,074 |

### *Site: P01B80 - MONTEVIDEO ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B8004001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $11,662,232 |
| **Building Name:** | Montevideo TACC | **Address:** | 711 S 17th Street | **Deferred Maintenance:** | $2,678,237 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Montevideo | **Ext. Gross Area:** | 38,667 |

### *Site: P01B82 - MONTICELLO*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B8207001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,202,863 |
| **Building Name:** | Monticello TACC | **Address:** | 505 Walnut St | **Deferred Maintenance:** | $183,361 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Monticello | **Ext. Gross Area:** | 31,085 |

### *Site: P01B85 - MOORHEAD ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B8506001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $8,844,339 |
| **Building Name:** | Moorhead TACC | **Address:** | 1002 15th Ave N | **Deferred Maintenance:** | $2,792,323 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | Moorhead | **Ext. Gross Area:** | 52,763 |

### *Site: P01B90 - MORRIS ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01B9005001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,470,854 |
| **Building Name:** | Morris TACC | **Address:** | 810 Iowa Ave | **Deferred Maintenance:** | $1,759,356 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Morris | **Ext. Gross Area:** | 28,265 |

### Site: P01C00 - NEW ULM ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C0016001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $8,138,105 |
| **Building Name:** | New Ulm TACC | **Address:** | 205 N Broadway | **Deferred Maintenance:** | $3,064,032 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | New Ulm | **Ext. Gross Area:** | 32,514 |

### Site: P01C15 - OLIVIA ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C1505001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $5,758,582 |
| **Building Name:** | Olivia TACC | **Address:** | 910 W Lincoln | **Deferred Maintenance:** | $1,891,575 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Olivia | **Ext. Gross Area:** | 29,630 |

### Site: P01C25 - ORTONVILLE ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C2501001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $8,836,431 |
| **Building Name:** | Ortonville TACC | **Address:** | 309 Madison Ave | **Deferred Maintenance:** | $2,121,861 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Ortonville | **Ext. Gross Area:** | 28,837 |

### Site: P01C30 - OWATONNA ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C3024001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,529,391 |
| **Building Name:** | Owatonna TACC | **Address:** | 2323 Bridge Street W | **Deferred Maintenance:** | $1,006,277 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Owatonna | **Ext. Gross Area:** | 18,939 |

### Site: P01C40 - PINE CITY ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C4012001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,764,706 |
| **Building Name:** | Pine City TACC | **Address:** | 1305 Main Street S | **Deferred Maintenance:** | $497,826 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Pine City | **Ext. Gross Area:** | 15,488 |

### Site: P01C45 - PIPESTONE ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C4512001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,131,192 |
| **Building Name:** | Pipestone TACC | **Address:** | 421 2nd Ave SW | **Deferred Maintenance:** | $990,822 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Pipestone | **Ext. Gross Area:** | 15,091 |

### Site: P01C55 - RED WING ARMORY

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C5519001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,923,323 |
| **Building Name:** | Red Wing TACC | **Address:** | 855 E 7th Street | **Deferred Maintenance:** | $626,669 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 18,527 |

### *Site: P01C60 - REDWOOD FALLS ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C6011001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,402,353 |
| **Building Name:** | Redwood Falls TACC | **Address:** | 530 Hwy 101 N | **Deferred Maintenance:** | $555,577 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Redwood Falls | **Ext. Gross Area:** | 18,730 |

### *Site: P01C65 - ROCHESTER RC and FMS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C6526001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $10,345,933 |
| **Building Name:** | Rochester TACC | **Address:** | 1715 Marion Road | **Deferred Maintenance:** | $1,328,851 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 34,180 |
| **Building Code:** | P01C6526155 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $786,920 |
| **Building Name:** | OMS #2 | **Address:** | 1715 Marion Road | **Deferred Maintenance:** | $109,620 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 3,283 |

### *Site: P01C67 - ROSEMOUNT ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C6708001 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $42,312,731 |
| **Building Name:** | Rosemount TACC | **Address:** | 13865 S Robert Trail | **Deferred Maintenance:** | $15,444,732 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | Rosemount | **Ext. Gross Area:** | 171,262 |

### *Site: P01C70 - ROSEVILLE ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C7006001 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $22,653,020 |
| **Building Name:** | Roseville TACC | **Address:** | 211 N McCarrons Blvd | **Deferred Maintenance:** | $9,308,434 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | Roseville | **Ext. Gross Area:** | 53,966 |

### *Site: P01C74 - St Cloud AASF*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C7406155 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $35,995,147 |
| **Building Name:** | St Cloud AASF | **Address:** | | **Deferred Maintenance:** | $995,093 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 246,492 |

### *Site: P01C75 - ST CLOUD RC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C7506001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $9,051,588 |
| **Building Name:** | St Cloud TACC | **Address:** | | **Deferred Maintenance:** | $4,145,623 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 54,257 |

### *Site: P01C80 - ST JAMES ARMORY AND MVSB*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C8015001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,019,858 |
| **Building Name:** | St James TACC | **Address:** | | **Deferred Maintenance:** | $624,343 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. JAMES | **Ext. Gross Area:** | 16,176 |

### *Site: P01C90 - ST PAUL CEDAR ST ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C9004002 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $34,606,811 |
| **Building Name:** | Cedar Street TACC | **Address:** | | **Deferred Maintenance:** | $1,999,034 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 124,567 |

### *Site: P01C95 - ST PAUL AASF*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01C9504003 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $23,014,302 |
| **Building Name:** | AASF And TACC | **Address:** | | **Deferred Maintenance:** | $6,910,133 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 143,250 |

### *Site: P01D00 - ST PAUL EAST ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D0004001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,625,323 |
| **Building Name:** | East St Paul TACC | **Address:** | | **Deferred Maintenance:** | $935,874 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 19,936 |

### *Site: P01D05 - WEST ST PAUL ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D0505001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,036,294 |
| **Building Name:** | W. St Paul TACC | **Address:** | | **Deferred Maintenance:** | $2,238,893 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 18,148 |

### *Site: P01D10 - ST PETER ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D1017001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,822,039 |
| **Building Name:** | St Peter TACC | **Address:** | | **Deferred Maintenance:** | $1,556,974 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | ST. PETER | **Ext. Gross Area:** | 16,891 |

### *Site: P01D15 - SAUK CENTRE ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D1504001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,476,452 |
| **Building Name:** | Sauk Centre TACC | **Address:** | 628 3rd Street | **Deferred Maintenance:** | $1,143,708 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Sauk Centre | **Ext. Gross Area:** | 27,221 |

### *Site: P01D20 - STILLWATER ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D2011001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $8,166,458 |
| **Building Name:** | Stillwater TACC | **Address:** | 107 E Chestnut St | **Deferred Maintenance:** | $3,152,048 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | Stillwater | **Ext. Gross Area:** | 37,260 |

### *Site: P01D25 - THIEF RIVER FALLS ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D2501001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,292,697 |
| **Building Name:** | Thief River Falls TACC | **Address:** | 250 West Emil St. | **Deferred Maintenance:** | $780,721 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Thief River Fall | **Ext. Gross Area:** | 15,117 |

### *Site: P01D45 - WADENA ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D4509001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,869,931 |
| **Building Name:** | Wadena TACC | **Address:** | 517 N Jefferson | **Deferred Maintenance:** | $1,950,701 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Wadena | **Ext. Gross Area:** | 19,808 |

### *Site: P01D60 - WILLMAR ARMORY AND FMS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D6007001 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $3,006,695 |
| **Building Name:** | Willmar TACC | **Address:** | 614 Hwy 71 N | **Deferred Maintenance:** | $305,569 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Willmar | **Ext. Gross Area:** | 24,902 |

### *Site: P01D70 - WINONA ARMORY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P01D7027001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,917,676 |
| **Building Name:** | Winona TACC | **Address:** | 1303 Homer Road | **Deferred Maintenance:** | $921,312 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Winona | **Ext. Gross Area:** | 17,889 |

# Agency: P07 - Public Safety

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $4,611,357 | **Ext. Gross Area:** | 20,360 |
| **Facility Condition Index:** | 0.20 | **Deferred Maintenance:** | $940,821 | **Building Count:** | 6 |

## *Site: P07100 - Arden Hills Driver Exam Site*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P0710000001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $1,603,336 |
| **Building Name:** | ARDEN HILLS - DRIVERS LICENSE | **Address:** | 5400 Old Hwy 8 | **Deferred Maintenance:** | $256,692 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Arden Hills | **Ext. Gross Area:** | 7,785 |
| **Building Code:** | P0710000002 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $60,632 |
| **Building Name:** | ARDEN HILLS - MISC STORAGE | **Address:** | 5400 Old Hwy 8 | **Deferred Maintenance:** | $6,195 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Arden Hills | **Ext. Gross Area:** | 639 |
| **Building Code:** | P0710000003 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,527 |
| **Building Name:** | ARDEN HILL - MISC STORAGE #2 | **Address:** | 5400 Old Hwy 8 | **Deferred Maintenance:** | $1,747 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Arden Hills | **Ext. Gross Area:** | 150 |

## *Site: P07200 - Eagan Driver Exam Site*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P0720000001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $2,857,562 |
| **Building Name:** | EAGAN - DRIVERS LICENSE | **Address:** | 2070 Cliff Road | **Deferred Maintenance:** | $666,426 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Eagan | **Ext. Gross Area:** | 10,998 |
| **Building Code:** | P0720000002 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $58,683 |
| **Building Name:** | EAGAN - MISC STORAGE | **Address:** | 2070 Cliff Road | **Deferred Maintenance:** | $6,318 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Eagan | **Ext. Gross Area:** | 638 |
| **Building Code:** | P0720000003 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,617 |
| **Building Name:** | EAGAN - MISC STORAGE #2 | **Address:** | 2070 Cliff Road | **Deferred Maintenance:** | $3,443 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Eagan | **Ext. Gross Area:** | 150 |

# Agency: P78 - Department of Corrections

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $2,625,984,833 | **Ext. Gross Area:** | 7,481,526 |
| **Facility Condition Index:** | 0.23 | **Deferred Maintenance:** | $592,726,311 | **Building Count:** | 329 |

## *Site: P78103 - Moose Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7810300001 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $10,723,912 |
| **Building Name:** | Unit 1 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $3,008,099 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 28,892 |
| **Building Code:** | P7810300002 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $8,993,164 |
| **Building Name:** | Unit 2 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,409,388 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 28,847 |
| **Building Code:** | P7810300003 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $10,841,156 |
| **Building Name:** | Unit 3 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $3,008,689 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 28,847 |
| **Building Code:** | P7810300004 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,535,541 |
| **Building Name:** | Unit 4 Segregation/OSI | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,904,420 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 28,895 |
| **Building Code:** | P7810300005 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $86,612 |
| **Building Name:** | Storage Building D | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $60,763 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | Moose Lake | **Ext. Gross Area:** | 1,006 |
| **Building Code:** | P7810300006 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $84,139 |
| **Building Name:** | Pump House #1 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $10,100 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 302 |
| **Building Code:** | P7810300007 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $146,298 |
| **Building Name:** | Storage Building A | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $105,632 |
| **Facility Condition Index:** | 0.72 - Crisis | **City Code:** | Moose Lake | **Ext. Gross Area:** | 1,708 |
| **Building Code:** | P7810300008 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,809,819 |
| **Building Name:** | Unit 8 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $3,949,673 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 34,704 |
| **Building Code:** | P7810300009 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $22,015 |
| **Building Name:** | Storage Building B | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $5,916 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 288 |
| **Building Code:** | P781030000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,769,642 |
| **Building Name:** | Perimeter Fence | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $4,543,982 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 131,160 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7810300010 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,838,336 |
| **Building Name:** | Unit 10 - ANNEX | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $3,325,513 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 34,714 |
| **Building Code:** | P7810300011 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,215 |
| **Building Name:** | Pump House #2 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $878 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 48 |
| **Building Code:** | P7810300012 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $180,202 |
| **Building Name:** | Storage Building E | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $144,050 |
| **Facility Condition Index:** | 0.80 - Crisis | **City Code:** | Moose Lake | **Ext. Gross Area:** | 1,564 |
| **Building Code:** | P7810300015 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,528 |
| **Building Name:** | Storage Building C | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $8,782 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Moose Lake | **Ext. Gross Area:** | 384 |
| **Building Code:** | P7810300035 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $6,601,562 |
| **Building Name:** | Unit 35 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $1,621,665 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 18,492 |
| **Building Code:** | P7810300050 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $10,169,948 |
| **Building Name:** | Bldg 50 Area H | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,018,005 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 33,494 |
| **Building Code:** | P7810300051 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $12,670,374 |
| **Building Name:** | Bldg 50 L Wing W Visit | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,924,918 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 37,822 |
| **Building Code:** | P7810300052 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $12,192,758 |
| **Building Name:** | Bldg 50 K Wing E HS | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,832,601 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 37,576 |
| **Building Code:** | P7810300053 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $15,507,317 |
| **Building Name:** | Bldg 50 J "S" Wing | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $4,144,967 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 41,449 |
| **Building Code:** | P7810300054 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $14,129,551 |
| **Building Name:** | Area M - Building 54, 56 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $3,786,736 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 29,674 |
| **Building Code:** | P7810300060 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $5,128,717 |
| **Building Name:** | Bldg 60 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $1,385,815 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 13,677 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7810300064 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $13,542,273 |
| **Building Name:** | Bldg 64 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,767,304 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 20,742 |
| **Building Code:** | P7810300065 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $6,543,595 |
| **Building Name:** | Bldg 65 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $1,645,087 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 18,715 |
| **Building Code:** | P7810300070 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,613,439 |
| **Building Name:** | Power Plant | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $1,430,606 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Moose Lake | **Ext. Gross Area:** | 27,581 |
| **Building Code:** | P7810300074 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,759,715 |
| **Building Name:** | Maintenance | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $196,819 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 7,922 |
| **Building Code:** | P7810300080 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $21,231,765 |
| **Building Name:** | Industry | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $2,743,772 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 72,955 |
| **Building Code:** | P7810300082 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $92,424 |
| **Building Name:** | Truck Gate | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $13,646 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 430 |
| **Building Code:** | P7810300083 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $5,410,474 |
| **Building Name:** | Gymnasium | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $456,106 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 16,218 |
| **Building Code:** | P7810300084 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $841,147 |
| **Building Name:** | Bldg 84 | **Address:** | 1000 Lake Shore Drive | **Deferred Maintenance:** | $45,799 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | Moose Lake | **Ext. Gross Area:** | 3,600 |
| **Building Code:** | P7810300085 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $521,202 |
| **Building Name:** | Silo | **Address:** | 100 Lake Shore Drive | **Deferred Maintenance:** | $171,997 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Moose Lake | **Ext. Gross Area:** | 3,696 |

### *Site: P78114 - Rush City*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7811400001 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $14,071,566 |
| **Building Name:** | Admin | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $3,130,444 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Rush City | **Ext. Gross Area:** | 54,710 |
| **Building Code:** | P7811400002 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $96,962,776 |
| **Building Name:** | Support | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $10,874,436 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 192,755 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7811400003 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $16,564,558 |
| **Building Name:** | Complex 1 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $2,082,087 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 47,497 |
| **Building Code:** | P7811400004 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $16,309,827 |
| **Building Name:** | Complex 3 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $1,371,244 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 46,734 |
| **Building Code:** | P7811400007 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $16,780,813 |
| **Building Name:** | Complex 4 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $1,445,873 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 46,733 |
| **Building Code:** | P7811400008 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $16,539,066 |
| **Building Name:** | Complex 2 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $1,513,935 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 47,497 |
| **Building Code:** | P7811400009 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,539,550 |
| **Building Name:** | Generator Bldg | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $223,397 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 2,360 |
| **Building Code:** | P781140000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $10,841,807 |
| **Building Name:** | Perimeter Fence | **Address:** | 7600 - 525th Street | **Deferred Maintenance:** | $1,084,181 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RUSH CITY | **Ext. Gross Area:** | 119,052 |
| **Building Code:** | P7811400010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $70,107 |
| **Building Name:** | Greenhouse 1 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $22,965 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | RUSH CITY | **Ext. Gross Area:** | 1,040 |
| **Building Code:** | P7811400011 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $65,654 |
| **Building Name:** | Greenhouse 2 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $24,538 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | RUSH CITY | **Ext. Gross Area:** | 1,040 |
| **Building Code:** | P7811400020 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $411,994 |
| **Building Name:** | Program Building | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $70,762 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Rush City | **Ext. Gross Area:** | 2,532 |
| **Building Code:** | P7811400028 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $63,653 |
| **Building Name:** | Garage | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $9,410 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Rush City | **Ext. Gross Area:** | 720 |
| **Building Code:** | P7811400030 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $431,869 |
| **Building Name:** | Outside Construction #45 | **Address:** | 7600 525th Street | **Deferred Maintenance:** | $14,287 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Rush City | **Ext. Gross Area:** | 2,881 |

***Site: P78550 - Lino Lakes***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P785500000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,245,656 |
| **Building Name:** | Perimter Fence | **Address:** | 7525 4th | **Deferred Maintenance:** | $9,934,242 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LINO LAKES | **Ext. Gross Area:** | 146,356 |
| **Building Code:** | P7855000102 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $3,788,315 |
| **Building Name:** | J-1 Kellogg | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $690,212 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 18,757 |
| **Building Code:** | P7855000202 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $13,053,088 |
| **Building Name:** | A Power House | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $2,451,640 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 11,137 |
| **Building Code:** | P7855000302 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,498 |
| **Building Name:** | M Pump House | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $7,119 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 180 |
| **Building Code:** | P7855000402 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $4,837,119 |
| **Building Name:** | L-2 Sibley | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,234,800 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 12,032 |
| **Building Code:** | P7855000502 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $600,243 |
| **Building Name:** | S Maintenance Garage | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $84,609 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 3,836 |
| **Building Code:** | P7855000602 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,498 |
| **Building Name:** | N Valve House | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $10,888 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 180 |
| **Building Code:** | P7855000902 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $5,396,985 |
| **Building Name:** | J-2 Andrews | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,160,470 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 18,757 |
| **Building Code:** | P7855001002 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $17,020,248 |
| **Building Name:** | H Food Service | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $5,653,067 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 27,100 |
| **Building Code:** | P7855001102 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $967,480 |
| **Building Name:** | T Building | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $465,652 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 6,078 |
| **Building Code:** | P7855001202 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $33,827,840 |
| **Building Name:** | B Building | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $7,726,784 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 89,076 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7855001302 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $667,498 |
| **Building Name:** | A Control Center | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $127,847 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 2,245 |
| **Building Code:** | P7855001402 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,302,123 |
| **Building Name:** | F-2 Administration | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $465,057 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 10,178 |
| **Building Code:** | P7855001602 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,682,066 |
| **Building Name:** | J-3 Carver | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $780,526 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 18,757 |
| **Building Code:** | P7855001702 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,467,362 |
| **Building Name:** | E Building | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,553,685 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 10,397 |
| **Building Code:** | P7855001802 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $12,749 |
| **Building Name:** | Truck Gate | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,541 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 99 |
| **Building Code:** | P7855002002 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $4,659,280 |
| **Building Name:** | L-1 Mayo | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,216,493 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 12,560 |
| **Building Code:** | P7855002102 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,313,932 |
| **Building Name:** | F-1 LRC | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $313,506 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 9,019 |
| **Building Code:** | P7855002202 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $7,136,668 |
| **Building Name:** | G Operations | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,713,776 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 28,668 |
| **Building Code:** | P7855002302 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $9,075,068 |
| **Building Name:** | K-4 | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,594,883 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 24,175 |
| **Building Code:** | P7855002401 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $9,023,811 |
| **Building Name:** | K-3 | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $1,685,470 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 24,176 |
| **Building Code:** | P7855002402 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $8,394,001 |
| **Building Name:** | C Activities | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $2,580,411 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 35,094 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7855002802 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,280,279 |
| **Building Name:** | U Building | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $252,793 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 8,875 |
| **Building Code:** | P7855002901 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $43,633 |
| **Building Name:** | Outside Maintenance Storage Garage | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $7,401 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 624 |
| **Building Code:** | P7855003102 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $292,925 |
| **Building Name:** | Engineer Pole Barn | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $47,192 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 2,911 |
| **Building Code:** | P7855003202 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $24,865,581 |
| **Building Name:** | Triad | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $3,532,345 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 59,908 |
| **Building Code:** | P7855003302 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $3,533,525 |
| **Building Name:** | Education | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $323,715 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 11,138 |
| **Building Code:** | P7855003402 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $23,806 |
| **Building Name:** | MCO | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $5,141 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 123 |
| **Building Code:** | P7855003502 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $10,771,086 |
| **Building Name:** | Q Building | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $2,838,829 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 31,091 |
| **Building Code:** | P7855003702 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $36,476,822 |
| **Building Name:** | South Housing | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $2,891,943 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 93,397 |
| **Building Code:** | P7855003902 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $94,010 |
| **Building Name:** | U Building Annex | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $28,795 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 696 |
| **Building Code:** | P7855004102 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $211,363 |
| **Building Name:** | Trades Pole Barn | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $46,433 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | P7855004202 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $118,279 |
| **Building Name:** | Green House | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $46,651 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 1,256 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7855004302 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,053 |
| **Building Name:** | Religious Storage | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $6,074 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 120 |
| **Building Code:** | P7855004304 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $4,226,438 |
| **Building Name:** | East Tunnels | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $920,751 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 15,064 |
| **Building Code:** | P7855004403 | **Cost Model Name:** | Tunnel | **Current Replacement Value:** | $4,113,775 |
| **Building Name:** | West Tunnel | **Address:** | 7525 4th Avenue | **Deferred Maintenance:** | $675,448 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Lino Lakes | **Ext. Gross Area:** | 18,149 |

### *Site: P78620 - Stillwater*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P786200000A | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $3,950,073 |
| **Building Name:** | #27 Perimeter Wall | **Address:** | 970 Picket Street | **Deferred Maintenance:** | $571,767 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BAYPORT | **Ext. Gross Area:** | 105,521 |
| **Building Code:** | P786200000B | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $1,536,443 |
| **Building Name:** | Perimeter Fence | **Address:** | | **Deferred Maintenance:** | $153,644 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BAYPORT | **Ext. Gross Area:** | 105,521 |
| **Building Code:** | P7862000282 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $72,960,652 |
| **Building Name:** | Power House - #19 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $17,598,705 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 28,655 |
| **Building Code:** | P7862000582 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $5,930,017 |
| **Building Name:** | Health Services #10 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $502,688 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 20,933 |
| **Building Code:** | P7862000882 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $15,336,261 |
| **Building Name:** | Security Center/C-Annex #9 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $3,133,820 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 29,171 |
| **Building Code:** | P7862001282 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $60,032,732 |
| **Building Name:** | Industry Bldg #18 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $23,953,588 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 124,776 |
| **Building Code:** | P7862001382 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $4,786,877 |
| **Building Name:** | Industry #26 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $974,762 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 18,400 |
| **Building Code:** | P7862001482 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $312,061 |
| **Building Name:** | Utility #22 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $92,714 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 1,038 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7862001582 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,214,908 |
| **Building Name:** | Vehicle Maint Garage #42 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $205,497 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 4,602 |
| **Building Code:** | P7862001782 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $8,300,785 |
| **Building Name:** | MN Security Unit #35 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $2,185,734 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 20,638 |
| **Building Code:** | P7862001882 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,004,696 |
| **Building Name:** | Building Maintenance #24 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $299,099 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 10,378 |
| **Building Code:** | P7862001982 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $18,811,174 |
| **Building Name:** | Kitchen #15 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $2,895,811 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 39,035 |
| **Building Code:** | P7862002082 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $63,561,077 |
| **Building Name:** | Industry Bldg #20 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $20,662,155 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 125,768 |
| **Building Code:** | P7862002182 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $34,664,091 |
| **Building Name:** | Cell Hall D #12 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $9,089,411 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 62,862 |
| **Building Code:** | P7862002482 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,463,858 |
| **Building Name:** | Main Corridor #6 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $746,709 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 23,935 |
| **Building Code:** | P7862002782 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $20,383,441 |
| **Building Name:** | Industry /Plt Op #25 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $4,837,788 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 63,288 |
| **Building Code:** | P7862002882 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,810,091 |
| **Building Name:** | Computer for Schools #49 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $865,682 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 10,430 |
| **Building Code:** | P7862003082 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $19,943,997 |
| **Building Name:** | Education #13 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $8,061,054 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 46,987 |
| **Building Code:** | P7862003182 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,186,343 |
| **Building Name:** | Chapel #7 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $216,317 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 3,929 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7862003482 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $11,493,198 |
| **Building Name:** | Dining Room #14 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $3,619,151 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 16,008 |
| **Building Code:** | P7862003582 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $21,793,087 |
| **Building Name:** | Administration #1 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $4,503,635 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 55,006 |
| **Building Code:** | P7862003782 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $86,408,009 |
| **Building Name:** | Cell Hall A #5 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $26,318,103 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 154,500 |
| **Building Code:** | P7862004082 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,109,151 |
| **Building Name:** | Grainery Storage #50 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $173,797 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 5,046 |
| **Building Code:** | P7862004182 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $7,158,399 |
| **Building Name:** | Recreation #11 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $1,614,313 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 26,178 |
| **Building Code:** | P7862004482 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,065,602 |
| **Building Name:** | Outside Construction #45 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $310,645 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 9,094 |
| **Building Code:** | P7862004582 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $61,319,404 |
| **Building Name:** | Cell Hall B #3 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $13,098,798 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 154,684 |
| **Building Code:** | P7862004782 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,828,603 |
| **Building Name:** | Admin West Annex #4 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $1,054,402 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 18,265 |
| **Building Code:** | P7862005282 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $4,407,209 |
| **Building Name:** | Young Conference Center #28 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $618,370 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 10,225 |
| **Building Code:** | P7862005482 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,860 |
| **Building Name:** | Scale House #48 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $2,427 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 65 |
| **Building Code:** | P7862005582 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $9,947,076 |
| **Building Name:** | Generator #1 Bldg #38 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $1,036,272 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 1,617 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7862005682 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $50,422,870 |
| **Building Name:** | Industry Bldg #21 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $9,490,518 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 87,762 |
| **Building Code:** | P7862005782 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $232,504 |
| **Building Name:** | Canteen/Property #16 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $76,699 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 16,227 |
| **Building Code:** | P7862005882 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $3,474,091 |
| **Building Name:** | Control Unit #2 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $778,193 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 10,767 |
| **Building Code:** | P7862005982 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $259,058 |
| **Building Name:** | Greenhouse Office #30 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $31,684 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 999 |
| **Building Code:** | P7862006282 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,624,992 |
| **Building Name:** | Discipline #8 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $198,575 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 3,835 |
| **Building Code:** | P7862006382 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,344,998 |
| **Building Name:** | Flammable Storage #41 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $222,127 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 4,976 |
| **Building Code:** | P7862006482 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $9,831,872 |
| **Building Name:** | West Warehouse # 37 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $4,706,578 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 58,545 |
| **Building Code:** | P7862006582 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $9,690,591 |
| **Building Name:** | East Warehouse #36 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $4,311,268 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 66,706 |
| **Building Code:** | P7862006682 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $3,343,705 |
| **Building Name:** | Root Cellar #40 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $569,233 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 5,492 |
| **Building Code:** | P7862006882 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $285,165 |
| **Building Name:** | Residence Garage #29 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $91,126 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 1,056 |
| **Building Code:** | P7862006982 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $349,891 |
| **Building Name:** | Storage Shed #60 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $104,936 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 2,704 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7862007182 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $437,679 |
| **Building Name:** | Butler Building #57 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $243,258 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | Bayport | **Ext. Gross Area:** | 3,405 |
| **Building Code:** | P7862007282 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $770,396 |
| **Building Name:** | Pole Barn Storage #58 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $114,284 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 6,050 |
| **Building Code:** | P7862007682 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $534,001 |
| **Building Name:** | Ice House Storage #54 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $53,400 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 1,061 |
| **Building Code:** | P7862007782 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $513,822 |
| **Building Name:** | Machine Storage #44 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $131,212 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 4,038 |
| **Building Code:** | P7862008081 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $137,371 |
| **Building Name:** | Green House #79 | **Address:** | 970 Pickett Street N | **Deferred Maintenance:** | $45,332 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 2,195 |
| **Building Code:** | P7862008082 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $348,978 |
| **Building Name:** | C/O Transporation Garage #43 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $84,535 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 3,072 |
| **Building Code:** | P7862008084 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $75,407 |
| **Building Name:** | Sally Port #73 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $17,042 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 163 |
| **Building Code:** | P7862008085 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $202,711 |
| **Building Name:** | Green House #74 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $70,171 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | Bayport | **Ext. Gross Area:** | 1,771 |
| **Building Code:** | P7862008086 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $284,958 |
| **Building Name:** | Green House #75 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $75,918 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 2,195 |
| **Building Code:** | P7862008087 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,102 |
| **Building Name:** | 71 -Storage | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $110 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 93 |
| **Building Code:** | P7862008088 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $105,388 |
| **Building Name:** | Guard Tower #1 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $9,193 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 395 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7862008089 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $101,705 |
| **Building Name:** | Guard Tower #2 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $10,171 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 389 |
| **Building Code:** | P7862008090 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $136,807 |
| **Building Name:** | Guard Tower #3 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $13,681 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 489 |
| **Building Code:** | P7862008091 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $114,651 |
| **Building Name:** | Guard Tower #4 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $11,465 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 394 |
| **Building Code:** | P7862008092 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $106,209 |
| **Building Name:** | Guard Tower #5 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $10,621 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 396 |
| **Building Code:** | P7862008093 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $120,330 |
| **Building Name:** | Guard Tower #6 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $12,033 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 459 |
| **Building Code:** | P7862008094 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $109,509 |
| **Building Name:** | Guard Tower #7 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $10,951 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 395 |
| **Building Code:** | P7862008095 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $693 |
| **Building Name:** | 72 -Storage | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $69 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 92 |
| **Building Code:** | P7862008096 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $232,868 |
| **Building Name:** | Industry Pass Bldg #76 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $37,048 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Bayport | **Ext. Gross Area:** | 768 |
| **Building Code:** | P7862008097 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $212,351 |
| **Building Name:** | South Gate Officers Station #77 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $6,365 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Bayport | **Ext. Gross Area:** | 480 |
| **Building Code:** | P7862008100 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $20,661,212 |
| **Building Name:** | Segregation Bldg #17 | **Address:** | 970 Pickett Street No | **Deferred Maintenance:** | $1,104,030 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 60,977 |
| **Building Code:** | P7862008101 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $645,149 |
| **Building Name:** | Water Treatment #78 | **Address:** | | **Deferred Maintenance:** | $46,862 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Bayport | **Ext. Gross Area:** | 3,487 |

***Site: P78630 - Oak Park Heights***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P786300000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $15,412,973 |
| **Building Name:** | Perimeter Fences | **Address:** | 5329 Osgood Avenue N | **Deferred Maintenance:** | $1,541,297 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | OAK PARK HEIGHTS | **Ext. Gross Area:** | 149,854 |
| **Building Code:** | P7863000100 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $12,616,426 |
| **Building Name:** | Complex 1 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $2,177,646 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Stillwater | **Ext. Gross Area:** | 30,842 |
| **Building Code:** | P7863000200 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $10,119,224 |
| **Building Name:** | Complex 2 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,720,211 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Stillwater | **Ext. Gross Area:** | 34,810 |
| **Building Code:** | P7863000300 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $12,069,288 |
| **Building Name:** | Complex 3 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,491,122 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 31,629 |
| **Building Code:** | P7863000400 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $12,436,389 |
| **Building Name:** | Complex 4 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,577,087 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 30,841 |
| **Building Code:** | P7863000500 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $11,804,068 |
| **Building Name:** | Complex 5 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,467,669 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 30,079 |
| **Building Code:** | P7863000600 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $13,481,310 |
| **Building Name:** | Complex 6 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,656,637 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 34,199 |
| **Building Code:** | P7863000700 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $9,204,029 |
| **Building Name:** | Complex 7 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,319,435 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 20,086 |
| **Building Code:** | P7863000800 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $14,673,566 |
| **Building Name:** | Complex 8 | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,900,782 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 42,209 |
| **Building Code:** | P7863000900 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $8,875,813 |
| **Building Name:** | Gym/Chapel | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,069,610 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 26,849 |
| **Building Code:** | P7863001000 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $32,317,345 |
| **Building Name:** | Core Building | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $6,926,895 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Stillwater | **Ext. Gross Area:** | 61,932 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7863001100 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $8,582,999 |
| **Building Name:** | Warehouse/Garage/Range | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $1,198,651 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 27,862 |
| **Building Code:** | P7863001200 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $26,308 |
| **Building Name:** | Communications Bldg | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $2,577 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 180 |
| **Building Code:** | P7863001300 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $185,560 |
| **Building Name:** | Polebarn/Storage | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $35,256 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Stillwater | **Ext. Gross Area:** | 2,880 |
| **Building Code:** | P7863001400 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $1,648,738 |
| **Building Name:** | Bridge | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $167,941 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | P7863001500 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $668,687 |
| **Building Name:** | Boiler Building | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $63,899 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 799 |
| **Building Code:** | P7863001600 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $18,518,808 |
| **Building Name:** | ACU | **Address:** | 5329 Osgood Avenue North | **Deferred Maintenance:** | $2,709,009 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Stillwater | **Ext. Gross Area:** | 46,711 |

### *Site: P78640 - Shakopee*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7864000001 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $115,450,090 |
| **Building Name:** | Core | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $27,877,134 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 72,934 |
| **Building Code:** | P7864000002 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $5,507,834 |
| **Building Name:** | Bldg D Roosevelt | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $1,415,273 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 11,786 |
| **Building Code:** | P7864000003 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $3,416,290 |
| **Building Name:** | Bldg G Novello | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $711,738 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 8,695 |
| **Building Code:** | P7864000004 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $8,491,938 |
| **Building Name:** | Bldg H Power Plant | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $2,512,191 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 4,144 |
| **Building Code:** | P7864000005 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $4,159,022 |
| **Building Name:** | Bldg J Anthony | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $1,012,412 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 11,786 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7864000006 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $6,493,333 |
| **Building Name:** | Bldg K Broker | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $990,800 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 18,674 |
| **Building Code:** | P7864000007 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $6,493,450 |
| **Building Name:** | Bldg L Bethune | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $1,185,678 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 18,676 |
| **Building Code:** | P7864000008 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $3,508,581 |
| **Building Name:** | Bldg M Mead | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $626,159 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 5,142 |
| **Building Code:** | P7864000009 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $15,686,251 |
| **Building Name:** | Bldg N Parks | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $1,996,385 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Shakopee | **Ext. Gross Area:** | 32,470 |
| **Building Code:** | P786400000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $10,108,721 |
| **Building Name:** | Perimeter Fences | **Address:** | 1010 West Sixth Avenue | **Deferred Maintenance:** | $202,174 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SHAKOPEE | **Ext. Gross Area:** | 58,500 |
| **Building Code:** | P7864000010 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $2,293,292 |
| **Building Name:** | Bldg F Higbee | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $363,996 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 10,450 |
| **Building Code:** | P7864000012 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $14,813,431 |
| **Building Name:** | Bldg P Monahan | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $812,890 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | Shakopee | **Ext. Gross Area:** | 41,220 |
| **Building Code:** | P7864000013 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $425,905 |
| **Building Name:** | Greenhouse | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $54,748 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Shakopee | **Ext. Gross Area:** | 6,331 |
| **Building Code:** | P7864000014 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $4,008,325 |
| **Building Name:** | Bldg E Tubman | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $950,975 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Shakopee | **Ext. Gross Area:** | 11,790 |
| **Building Code:** | P7864000015 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $528,748 |
| **Building Name:** | Garage | **Address:** | 1010 West 6th Avenue | **Deferred Maintenance:** | $59,201 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Shakopee | **Ext. Gross Area:** | 1,781 |

### *Site: P78760 - Red Wing*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P787600000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $6,908,095 |
| **Building Name:** | Perimeter Fences | **Address:** | 1079 Hwy 292 | **Deferred Maintenance:** | $138,162 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | RED WING | **Ext. Gross Area:** | 97,572 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7876000010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $538,658 |
| **Building Name:** | Barn #1 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $244,636 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 4,630 |
| **Building Code:** | P7876000030 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $9,863,947 |
| **Building Name:** | Dayton #30 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $951,275 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 20,209 |
| **Building Code:** | P7876000031 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $83,092 |
| **Building Name:** | Garage #31 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $3,258 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | Red Wing | **Ext. Gross Area:** | 611 |
| **Building Code:** | P7876000032 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $696,154 |
| **Building Name:** | Garage #32 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $76,782 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 4,201 |
| **Building Code:** | P7876000033 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $21,397 |
| **Building Name:** | Gas Metering House | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $3,081 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 142 |
| **Building Code:** | P7876000125 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $24,627,823 |
| **Building Name:** | Industrial Building #10 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $7,170,671 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 46,895 |
| **Building Code:** | P7876000160 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $161,292 |
| **Building Name:** | Garden Storage #16 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $78,646 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 848 |
| **Building Code:** | P7876000180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $218,453 |
| **Building Name:** | Storage Building #18 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $21,671 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 1,950 |
| **Building Code:** | P7876000325 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $559,795 |
| **Building Name:** | Auto Shop #14 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $89,477 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 2,547 |
| **Building Code:** | P7876000800 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $48,270 |
| **Building Name:** | Flammable Storage #8 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $6,149 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 192 |
| **Building Code:** | P7876000900 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $46,082 |
| **Building Name:** | Deep Well Pump House #9 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $19,166 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 220 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7876000925 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,409,613 |
| **Building Name:** | Maintenance Office #6 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $429,695 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 3,655 |
| **Building Code:** | P7876001125 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $902,627 |
| **Building Name:** | Green House #11 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $335,520 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 3,540 |
| **Building Code:** | P7876001321 | **Cost Model Name:** | Parking Structure | **Current Replacement Value:** | $651,225 |
| **Building Name:** | Root Cellar #15 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $49,295 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 3,663 |
| **Building Code:** | P7876001425 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $2,796,285 |
| **Building Name:** | Duke #5 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $541,452 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 9,880 |
| **Building Code:** | P7876001525 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,548,030 |
| **Building Name:** | Cabinet Shop #12 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $208,069 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 3,959 |
| **Building Code:** | P7876001625 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $770,120 |
| **Building Name:** | Welding Shop #7 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $115,868 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 1,528 |
| **Building Code:** | P7876001925 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,697,953 |
| **Building Name:** | Food Prep #19 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $295,956 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 8,846 |
| **Building Code:** | P7876002325 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $11,043,268 |
| **Building Name:** | School #25 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $1,343,171 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 34,908 |
| **Building Code:** | P7876002400 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $15,080,283 |
| **Building Name:** | Vocational Building | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $355,422 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | Red Wing | **Ext. Gross Area:** | 25,628 |
| **Building Code:** | P7876002425 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $6,133,527 |
| **Building Name:** | LaSalle/Chapel #21 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $1,223,393 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 13,739 |
| **Building Code:** | P7876002525 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $3,070,484 |
| **Building Name:** | Wardens House #28 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $159,581 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 6,660 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7876002725 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $24,478,013 |
| **Building Name:** | Admin/Centennial Hall | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $9,624,718 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 70,748 |
| **Building Code:** | P7876002825 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $2,416,177 |
| **Building Name:** | Yale #27 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $483,625 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 7,487 |
| **Building Code:** | P7876002925 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $3,324,661 |
| **Building Name:** | Brown #29 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $304,748 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 7,441 |
| **Building Code:** | P7876003425 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $4,349,259 |
| **Building Name:** | Grinnell #4 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $1,306,599 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Red Wing | **Ext. Gross Area:** | 13,368 |
| **Building Code:** | P7876003525 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $3,142,346 |
| **Building Name:** | Knox #20 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $796,711 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 9,830 |
| **Building Code:** | P7876003625 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $2,120,336 |
| **Building Name:** | Stanford #2 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $376,367 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 7,462 |
| **Building Code:** | P7876003825 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $2,625,453 |
| **Building Name:** | Princeton #26 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $373,616 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | Red Wing | **Ext. Gross Area:** | 7,935 |
| **Building Code:** | P7876004125 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $2,518,696 |
| **Building Name:** | Harvard #3 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $468,916 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 7,534 |
| **Building Code:** | P7876006254 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $489,227 |
| **Building Name:** | Laundry #24 | **Address:** | 1079 Highway 292 | **Deferred Maintenance:** | $103,760 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Red Wing | **Ext. Gross Area:** | 1,977 |

### *Site: P78780 - TOGO*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7878010001 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $531,727 |
| **Building Name:** | Barracks #2 | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $86,509 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 3,484 |
| **Building Code:** | P7878010002 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $347,865 |
| **Building Name:** | Green Storage Building | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $53,446 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 2,020 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7878010003 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $788,054 |
| **Building Name:** | Challenge | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $184,416 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 3,599 |
| **Building Code:** | P7878010004 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $1,166,156 |
| **Building Name:** | Barracks #1 | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $300,654 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 8,085 |
| **Building Code:** | P7878010005 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $2,380,195 |
| **Building Name:** | CD Services/Health Services | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $371,380 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 10,825 |
| **Building Code:** | P7878010006 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $19,204 |
| **Building Name:** | Pump House | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $2,421 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Togo | **Ext. Gross Area:** | 187 |
| **Building Code:** | P7878010007 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $308,264 |
| **Building Name:** | Education | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $37,539 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Togo | **Ext. Gross Area:** | 2,223 |
| **Building Code:** | P7878010008 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $127,285 |
| **Building Name:** | Industry | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $33,882 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 1,629 |
| **Building Code:** | P7878010009 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $1,198,550 |
| **Building Name:** | Gym | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $212,299 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 5,852 |
| **Building Code:** | P7878010010 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $254,105 |
| **Building Name:** | Chapel | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $33,407 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | Togo | **Ext. Gross Area:** | 1,244 |
| **Building Code:** | P7878010011 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $29,746 |
| **Building Name:** | Ski Chalet | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $24,357 |
| **Facility Condition Index:** | 0.82 - Crisis | **City Code:** | Togo | **Ext. Gross Area:** | 406 |
| **Building Code:** | P7878010012 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,344 |
| **Building Name:** | Gym - Water Pump 3 | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $2,112 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Togo | **Ext. Gross Area:** | 217 |
| **Building Code:** | P7878010013 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,153,717 |
| **Building Name:** | Maintenance/Receiving | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $141,686 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Togo | **Ext. Gross Area:** | 4,171 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7878010014 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $919,967 |
| **Building Name:** | Food Service | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $183,210 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 3,270 |
| **Building Code:** | P7878010015 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $561,912 |
| **Building Name:** | SQ | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $106,563 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 3,617 |
| **Building Code:** | P7878010016 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $715,693 |
| **Building Name:** | Administration | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $117,925 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 2,860 |
| **Building Code:** | P7878010017 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $184,396 |
| **Building Name:** | Wash Bay | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $17,022 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Togo | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | P7878010018 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,158 |
| **Building Name:** | Lumber Storage | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $10,010 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | Togo | **Ext. Gross Area:** | 296 |
| **Building Code:** | P7878010019 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $938,852 |
| **Building Name:** | Lakeside | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $193,976 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 5,581 |
| **Building Code:** | P7878010020 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $950,326 |
| **Building Name:** | CIP Offices | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $203,022 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 6,277 |
| **Building Code:** | P7878010021 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $578,256 |
| **Building Name:** | CIP Property | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $133,771 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 3,046 |
| **Building Code:** | P7878010023 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,512 |
| **Building Name:** | B2 Storage Shed | **Address:** | 62741 County Road 551 | **Deferred Maintenance:** | $3,423 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Togo | **Ext. Gross Area:** | 98 |

### *Site: P78830 - St Cloud*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7883000001 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,183,836 |
| **Building Name:** | HR/Finance | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $209,775 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 3,692 |
| **Building Code:** | P788300000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $27,404,071 |
| **Building Name:** | Perimeter Wall & Fences | **Address:** | 2305 Minnesota Blvd SE | **Deferred Maintenance:** | $14,526,539 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 135,320 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7883000071 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $176,463 |
| **Building Name:** | Truck Gate | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $80,110 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 704 |
| **Building Code:** | P7883001071 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $94,801 |
| **Building Name:** | Guard Tower | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $21,674 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 129 |
| **Building Code:** | P7883001171 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $16,692,808 |
| **Building Name:** | Education | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $4,759,276 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 57,813 |
| **Building Code:** | P7883001270 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $24,389,865 |
| **Building Name:** | Gymnasium | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $11,125,150 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 45,449 |
| **Building Code:** | P7883001271 | **Cost Model Name:** | Multi-story Educational Facility | **Current Replacement Value:** | $14,768,742 |
| **Building Name:** | Industries Building | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $3,665,605 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 49,506 |
| **Building Code:** | P7883001771 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,422,418 |
| **Building Name:** | Sticker Shop | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $312,623 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 8,586 |
| **Building Code:** | P7883002571 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $39,173,955 |
| **Building Name:** | B House | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $11,826,861 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 36,159 |
| **Building Code:** | P7883003671 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,325,532 |
| **Building Name:** | Food Service Laundry | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $6,885,908 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 36,107 |
| **Building Code:** | P7883004671 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $5,134,764 |
| **Building Name:** | Health Services | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $1,347,867 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 6,945 |
| **Building Code:** | P7883004771 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,409,238 |
| **Building Name:** | GPPI | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $544,664 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 8,883 |
| **Building Code:** | P7883004871 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $11,519,171 |
| **Building Name:** | Reshape/B-Annex/Canteen | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $3,536,673 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 20,073 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7883005171 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $7,961,878 |
| **Building Name:** | Auto Body/Maint Shop | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $2,122,588 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 14,448 |
| **Building Code:** | P7883005271 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $637,127 |
| **Building Name:** | OK 1901 House | **Address:** | 1901 Minnesota Blvd SE | **Deferred Maintenance:** | $452,233 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 2,908 |
| **Building Code:** | P7883005371 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $642,601 |
| **Building Name:** | OK 1905 House | **Address:** | 1905 Minnesota Blvd SE | **Deferred Maintenance:** | $482,282 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 2,678 |
| **Building Code:** | P7883005471 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $18,223 |
| **Building Name:** | 2305 Garage | **Address:** | 2305 Minnesota Blvd SE | **Deferred Maintenance:** | $14,496 |
| **Facility Condition Index:** | 0.80 - Crisis | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 322 |
| **Building Code:** | P7883005871 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,103,242 |
| **Building Name:** | License Plant | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $1,066,335 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 9,556 |
| **Building Code:** | P7883006171 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,727,591 |
| **Building Name:** | Mason Shop | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $507,949 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 8,815 |
| **Building Code:** | P7883006571 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $30,095,522 |
| **Building Name:** | C House | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $11,324,237 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 36,793 |
| **Building Code:** | P7883006670 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $38,232,163 |
| **Building Name:** | E House | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $13,633,043 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 46,134 |
| **Building Code:** | P7883006671 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,580,904 |
| **Building Name:** | Upper/Lower E Complex | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $875,095 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 13,413 |
| **Building Code:** | P7883007170 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $21,609,425 |
| **Building Name:** | D House | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $6,120,511 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 24,693 |
| **Building Code:** | P7883007171 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $27,693,163 |
| **Building Name:** | Segregation | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $8,496,731 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 34,282 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7883007271 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,926,356 |
| **Building Name:** | Main Corridors | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $545,577 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 6,571 |
| **Building Code:** | P7883007370 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $30,555,544 |
| **Building Name:** | A House | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $10,542,797 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 36,681 |
| **Building Code:** | P7883007371 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $949,833 |
| **Building Name:** | Orientation Complex | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $123,634 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | St. Cloud | **Ext. Gross Area:** | 3,516 |
| **Building Code:** | P7883007471 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,512,282 |
| **Building Name:** | Power Plant | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $3,369,943 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | St. Cloud | **Ext. Gross Area:** | 12,453 |
| **Building Code:** | P7883007571 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,355,892 |
| **Building Name:** | Plant Operations Office | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $1,735,646 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 13,726 |
| **Building Code:** | P7883007671 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $154,324 |
| **Building Name:** | Pump Station | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $91,343 |
| **Facility Condition Index:** | 0.59 - Crisis | **City Code:** | St. Cloud | **Ext. Gross Area:** | 720 |
| **Building Code:** | P7883007771 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $17,460,358 |
| **Building Name:** | Administration | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $4,575,497 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 55,138 |
| **Building Code:** | P7883007871 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,669,038 |
| **Building Name:** | Training Barn | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $477,756 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 8,155 |
| **Building Code:** | P7883007971 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $399,358 |
| **Building Name:** | Payloader/Snow Plow Bldg | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $88,448 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 4,323 |
| **Building Code:** | P7883008171 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $452,642 |
| **Building Name:** | Steamfitter/Plumbers | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $132,557 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 2,259 |
| **Building Code:** | P7883008271 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $574,517 |
| **Building Name:** | Paint Shop | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $126,574 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 2,528 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7883008371 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $13,890,306 |
| **Building Name:** | Dining Rm/Warehouse | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $3,391,673 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 37,647 |
| **Building Code:** | P7883008571 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $385,814 |
| **Building Name:** | Cardboard Storage | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $84,264 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 4,000 |
| **Building Code:** | P7883008771 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $470,082 |
| **Building Name:** | Clinton Building | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $155,127 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 3,772 |
| **Building Code:** | P7883008871 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $455,345 |
| **Building Name:** | South Quonset | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $90,918 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 4,214 |
| **Building Code:** | P7883008971 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $93,164 |
| **Building Name:** | Storage Building | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $51,281 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | St. Cloud | **Ext. Gross Area:** | 1,222 |
| **Building Code:** | P7883009071 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $214,615 |
| **Building Name:** | Outside Grounds | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $61,573 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 1,327 |
| **Building Code:** | P7883009171 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $140,199 |
| **Building Name:** | Slaughter House | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $112,426 |
| **Facility Condition Index:** | 0.80 - Crisis | **City Code:** | St. Cloud | **Ext. Gross Area:** | 873 |
| **Building Code:** | P7883009271 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $320,552 |
| **Building Name:** | Staff Trip Car Shed | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $44,631 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | St. Cloud | **Ext. Gross Area:** | 2,640 |
| **Building Code:** | P7883009371 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $446,632 |
| **Building Name:** | Inside Grounds | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $157,544 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 2,551 |
| **Building Code:** | P7883009471 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,688,673 |
| **Building Name:** | Industries Warehouse | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $429,666 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 9,793 |
| **Building Code:** | P7883009571 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,942 |
| **Building Name:** | Shooting Range Building | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $6,233 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | St. Cloud | **Ext. Gross Area:** | 248 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7883009671 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $159,893 |
| **Building Name:** | Recreation Building | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $72,412 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 576 |
| **Building Code:** | P7883009771 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $728,747 |
| **Building Name:** | Old Mason Shop | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $300,050 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 2,562 |
| **Building Code:** | P7883009871 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $161,668 |
| **Building Name:** | Car Wash | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $19,365 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | St. Cloud | **Ext. Gross Area:** | 1,213 |
| **Building Code:** | P7883009971 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,546,606 |
| **Building Name:** | Root Cellar | **Address:** | 2305 Minnesota Boulevard S.E. | **Deferred Maintenance:** | $730,079 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | St. Cloud | **Ext. Gross Area:** | 7,452 |

### *Site: P78890 - Willow River*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7889000001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $351,546 |
| **Building Name:** | Pole Building | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $66,034 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | Willow River | **Ext. Gross Area:** | 3,341 |
| **Building Code:** | P7889000002 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $64,752 |
| **Building Name:** | Storage Shed | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $11,665 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Willow River | **Ext. Gross Area:** | 246 |
| **Building Code:** | P7889000003 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $169,254 |
| **Building Name:** | Classroom 7 | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $19,988 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 862 |
| **Building Code:** | P7889000004 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $973,727 |
| **Building Name:** | Property Building | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $143,549 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 4,524 |
| **Building Code:** | P7889000006 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $56,623 |
| **Building Name:** | Storage Garage | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $5,392 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 503 |
| **Building Code:** | P7889000007 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $386,551 |
| **Building Name:** | Education Building | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $61,252 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Willow River | **Ext. Gross Area:** | 3,362 |
| **Building Code:** | P7889000258 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $1,176,980 |
| **Building Name:** | CD Program Building | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $119,128 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 7,624 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7889000358 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,777,567 |
| **Building Name:** | Kitchen | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $416,525 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 5,086 |
| **Building Code:** | P7889001258 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,022,548 |
| **Building Name:** | Maintenance Building | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $211,426 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Willow River | **Ext. Gross Area:** | 4,592 |
| **Building Code:** | P7889001458 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,690,589 |
| **Building Name:** | Administration | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $190,663 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 4,946 |
| **Building Code:** | P7889001558 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $9,248,500 |
| **Building Name:** | Barracks Building | **Address:** | 86032 County Highway 61 | **Deferred Maintenance:** | $619,757 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Willow River | **Ext. Gross Area:** | 23,564 |

### *Site: P78900 - Faribault*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7890000002 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $6,042,193 |
| **Building Name:** | Pine | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $1,249,518 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 25,282 |
| **Building Code:** | P7890000003 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $30,654,232 |
| **Building Name:** | Industry / MINNCOR | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $4,903,440 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 156,152 |
| **Building Code:** | P7890000004 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $540,889 |
| **Building Name:** | Master Control | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $47,886 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 2,254 |
| **Building Code:** | P7890000005 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $151,456 |
| **Building Name:** | Grounds Building | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $36,928 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 1,258 |
| **Building Code:** | P7890000007 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,168,761 |
| **Building Name:** | Walnut | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $199,052 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 6,480 |
| **Building Code:** | P789000000A | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $22,376,456 |
| **Building Name:** | Perimeter Fences | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,237,646 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 306,000 |
| **Building Code:** | P7890000010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $175,253 |
| **Building Name:** | Upholstery Shop | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $65,470 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 1,485 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7890000011 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $25,179,774 |
| **Building Name:** | Main Warehouse | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $6,780,783 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 56,657 |
| **Building Code:** | P7890000013 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $532,988 |
| **Building Name:** | Paint Shop | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $95,439 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 3,008 |
| **Building Code:** | P7890000014 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,579,279 |
| **Building Name:** | Sycamore | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $680,095 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 18,887 |
| **Building Code:** | P7890000015 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $21,715,899 |
| **Building Name:** | Power Plant | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $3,472,318 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 41,468 |
| **Building Code:** | P7890000021 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $436,403 |
| **Building Name:** | Mason Shed | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $303,636 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | Faribault | **Ext. Gross Area:** | 4,180 |
| **Building Code:** | P7890000023 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $8,798,229 |
| **Building Name:** | Dakota | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,210,031 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 40,717 |
| **Building Code:** | P7890000026 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $29,799 |
| **Building Name:** | Pump House #2 | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $8,690 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 249 |
| **Building Code:** | P7890000027 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,156 |
| **Building Name:** | Pump House #1 | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $12,619 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 264 |
| **Building Code:** | P7890000030 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $11,819,222 |
| **Building Name:** | Aspen | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,160,517 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 34,558 |
| **Building Code:** | P7890000038 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $10,246,147 |
| **Building Name:** | Fern | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $3,987,972 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 46,564 |
| **Building Code:** | P7890000043 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $5,537,367 |
| **Building Name:** | Sierra/Holly | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $1,262,921 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 20,122 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7890000044 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $7,196,576 |
| **Building Name:** | Willow | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $1,148,734 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 36,686 |
| **Building Code:** | P7890000045 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $8,951,555 |
| **Building Name:** | Birch | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $1,972,678 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 34,558 |
| **Building Code:** | P7890000049 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,296,978 |
| **Building Name:** | Laundry | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $1,245,083 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 37,050 |
| **Building Code:** | P7890000081 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,807,852 |
| **Building Name:** | Bus Barn/Equip Storage | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $938,991 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | Faribault | **Ext. Gross Area:** | 11,328 |
| **Building Code:** | P7890000082 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $304,429 |
| **Building Name:** | General Storage | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $304,429 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | Faribault | **Ext. Gross Area:** | 4,549 |
| **Building Code:** | P7890000083 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $370,113 |
| **Building Name:** | Calf Barn | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $85,658 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 4,112 |
| **Building Code:** | P7890000084 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,077,407 |
| **Building Name:** | Mechanics Shop | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $396,035 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 6,782 |
| **Building Code:** | P7890000086 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $35,812 |
| **Building Name:** | Truck Gate-FRB | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $5,978 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 200 |
| **Building Code:** | P7890000093 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $4,688,170 |
| **Building Name:** | Segregation | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $551,565 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 14,301 |
| **Building Code:** | P7890000096 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $83,831 |
| **Building Name:** | Refrigerator Building | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $42,696 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | Faribault | **Ext. Gross Area:** | 760 |
| **Building Code:** | P7890000097 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,525,638 |
| **Building Name:** | Root Cellar | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $550,757 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 5,177 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | P7890000098 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $7,302,876 |
| **Building Name:** | Tunnel - Inside | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,291,814 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 24,650 |
| **Building Code:** | P7890000099 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $6,610,687 |
| **Building Name:** | Tunnel - Outside | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $4,230,511 |
| **Facility Condition Index:** | 0.64 - Crisis | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 22,680 |
| **Building Code:** | P7890000111 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,990,866 |
| **Building Name:** | Food Service Bldg | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $1,155,875 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 37,285 |
| **Building Code:** | P7890000166 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $9,166,326 |
| **Building Name:** | Maple | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,771,676 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | Faribault | **Ext. Gross Area:** | 24,066 |
| **Building Code:** | P7890000266 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $17,840,670 |
| **Building Name:** | Linden | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $3,839,489 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 50,344 |
| **Building Code:** | P7890000666 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $10,372,679 |
| **Building Name:** | Roger's Memorial Act | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,424,707 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | Faribault | **Ext. Gross Area:** | 62,034 |
| **Building Code:** | P7890000901 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $22,992,968 |
| **Building Name:** | K1 | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,147,124 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 85,945 |
| **Building Code:** | P7890000902 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $24,372,115 |
| **Building Name:** | K2 | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,045,592 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 85,945 |
| **Building Code:** | P7890000903 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $22,392,894 |
| **Building Name:** | K3 | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,185,375 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 89,390 |
| **Building Code:** | P7890000904 | **Cost Model Name:** | Correctional Facility Housing Unit | **Current Replacement Value:** | $30,643,268 |
| **Building Name:** | K4 | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $2,236,405 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | Faribault | **Ext. Gross Area:** | 85,945 |
| **Building Code:** | P7890001000 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $14,972,043 |
| **Building Name:** | Intake and Receiving Building | **Address:** | 1101 Linden Lane | **Deferred Maintenance:** | $468,563 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | Faribault | **Ext. Gross Area:** | 41,538 |

# Agency: R29 - Department of Natural Resources

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Fair | **Current Replacement Value:** | $622,232,471 | **Ext. Gross Area:** | 3,328,712 |
| **Facility Condition Index:** | 0.24 | **Deferred Maintenance:** | $146,365,460 | **Building Count:** | 2,856 |

## *Site: R290001 - Afton State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600090 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $56,275 |
| **Building Name:** | Afton SP Picnic Shelter 1 | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $14,738 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 637 |
| **Building Code:** | R2900600100 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $102,463 |
| **Building Name:** | Afton SP Sanitation | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $24,806 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 418 |
| **Building Code:** | R2900601150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $300,895 |
| **Building Name:** | Afton SP Shop | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $91,901 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 1,929 |
| **Building Code:** | R2900601160 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,163 |
| **Building Name:** | Afton SP Oil House | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,859 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900601170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $381,054 |
| **Building Name:** | Afton SP Contact Station | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $46,446 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900601180 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $895,828 |
| **Building Name:** | Afton SP Trails Ctr | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $381,648 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 3,125 |
| **Building Code:** | R2900601710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,910 |
| **Building Name:** | Afton SP Vault Toilet | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,020 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 27 |
| **Building Code:** | R2900601720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,910 |
| **Building Name:** | Afton SP Vault Toilet | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,020 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 27 |
| **Building Code:** | R2900601730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,910 |
| **Building Name:** | Afton SP Backpack CG Vault Toilet | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $2,227 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900601830 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $94,251 |
| **Building Name:** | Afton SP Picnic Shelter 1 | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $28,098 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 1,080 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900602120 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $318,988 |
| **Building Name:** | Afton SP Cold Storage | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $47,337 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 2,991 |
| **Building Code:** | R2900602250 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $51,363 |
| **Building Name:** | Afton SP Vault Toilet Concrete | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $5,136 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900602260 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,610 |
| **Building Name:** | Afton SP Group CG 1 Adirondack | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $2,841 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 79 |
| **Building Code:** | R2900602270 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $9,381 |
| **Building Name:** | Afton SP Backpack CG Adirondack | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,576 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 146 |
| **Building Code:** | R2900602280 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,610 |
| **Building Name:** | Afton SP Backpack CG Adirondack | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,078 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 87 |
| **Building Code:** | R2900602320 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $5,236 |
| **Building Name:** | Afton SP Backpack CG Adirondack | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,927 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | HASTINGS | **Ext. Gross Area:** | 55 |
| **Building Code:** | R2900602330 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $5,318 |
| **Building Name:** | Afton SP Cold Storage | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $2,130 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | HASTINGS | **Ext. Gross Area:** | 135 |
| **Building Code:** | R2900602340 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $57,129 |
| **Building Name:** | Afton Grp CG 1 Big Blue Stem Cabin | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,234 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900602350 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $59,111 |
| **Building Name:** | Afton Grp CG 1 ADA Blue Bird Cabin | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $3,124 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900602360 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $59,461 |
| **Building Name:** | Afton Grp CG 1 ADA White Pine Cabin | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $4,248 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900602370 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $57,129 |
| **Building Name:** | Afton SP Group CG 1 Bur Oak Cabin | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $6,424 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 296 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900602430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,143 |
| **Building Name:** | Afton SP Backpack CG Vault Concrete | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $403 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HASTINGS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900602440 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $6,551 |
| **Building Name:** | Afton SP Grp CG 1 Picnic Shelter 1 | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $522 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900602450 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $63,133 |
| **Building Name:** | Afton SP Group CG 1 East Yurt | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $5,875 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 365 |
| **Building Code:** | R2900602460 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $63,133 |
| **Building Name:** | Afton SP Group CG 1 West Yurt | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $5,875 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 365 |
| **Building Code:** | R2900602470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,143 |
| **Building Name:** | Afton SP Group CG 1 Vault Concrete | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $403 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HASTINGS | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900602480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,682 |
| **Building Name:** | Afton SP Backpack CG Vault Concrete | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $514 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HASTINGS | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900602490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,682 |
| **Building Name:** | Afton SP Group CG 1 Vault Concrete | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $514 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HASTINGS | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900602500 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,682 |
| **Building Name:** | Afton SP Group CG 2 Vault Concrete | **Address:** | 6959 PELLER AVE S | **Deferred Maintenance:** | $514 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HASTINGS | **Ext. Gross Area:** | 51 |

### *Site: R290002 - Aitkin*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306230 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,716,840 |
| **Building Name:** | Aitkin Office | **Address:** | 1200 MINNESOTA AVE S | **Deferred Maintenance:** | $456,485 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | AITKIN | **Ext. Gross Area:** | 17,304 |
| **Building Code:** | R2900306550 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $285,247 |
| **Building Name:** | Aitkin Boat Storage | **Address:** | 1200 MINNESOTA AVE S | **Deferred Maintenance:** | $61,825 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | AITKIN | **Ext. Gross Area:** | 3,129 |
| **Building Code:** | R2900307130 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,743 |
| **Building Name:** | Aitkin Cold Storage | **Address:** | 1200 MINNESOTA AVE S | **Deferred Maintenance:** | $6,712 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | AITKIN | **Ext. Gross Area:** | 229 |

### *Site: R290003 - Appleton*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900403960 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,282 |
| **Building Name:** | Appleton Pump House | **Address:** | 25 N MUNSTERMAN ST | **Deferred Maintenance:** | $346 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | APPLETON | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900404970 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $175,063 |
| **Building Name:** | Appleton Shop | **Address:** | 25 N MUNSTERMAN ST | **Deferred Maintenance:** | $69,024 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | APPLETON | **Ext. Gross Area:** | 1,440 |

### *Site: R290004 - Banning State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300830 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $250,375 |
| **Building Name:** | Banning SP Shop | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $94,552 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 1,531 |
| **Building Code:** | R2900300840 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $240,203 |
| **Building Name:** | Banning SP CG Sanitation | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $80,672 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 694 |
| **Building Code:** | R2900300850 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $118,140 |
| **Building Name:** | Banning SP Sanitation | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $68,895 |
| **Facility Condition Index:** | 0.58 - Crisis | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 348 |
| **Building Code:** | R2900303690 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $245,401 |
| **Building Name:** | Banning SP Office | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $78,426 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 979 |
| **Building Code:** | R2900303780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,380 |
| **Building Name:** | Banning SP Oil House | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $5,336 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 104 |
| **Building Code:** | R2900303830 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $419,441 |
| **Building Name:** | Banning SP Residence | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $129,936 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 3,189 |
| **Building Code:** | R2900304940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,047 |
| **Building Name:** | Banning SP Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $2,249 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900304950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,965 |
| **Building Name:** | Banning SP Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $2,477 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 25 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900304960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,393 |
| **Building Name:** | Banning SP Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $3,124 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 25 |
| **Building Code:** | R2900304970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,557 |
| **Building Name:** | Banning SP Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $2,186 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 25 |
| **Building Code:** | R2900305130 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $135,853 |
| **Building Name:** | Banning SP Shop Area Cold Storage | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $51,056 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 1,259 |
| **Building Code:** | R2900306580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,797 |
| **Building Name:** | Banning SP CG Site 32 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $3,791 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900306990 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $37,272 |
| **Building Name:** | Banning SP CG Cabin | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $3,531 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 196 |
| **Building Code:** | R2900307290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,861 |
| **Building Name:** | Banning CG Sites 12/13 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $989 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900307300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,861 |
| **Building Name:** | Banning SP CG Site 9 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $989 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900308420 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,439 |
| **Building Name:** | Banning SP CG Recycling Center | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $1,428 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 49 |

### *Site: R290005 - Bear Head Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201460 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $275,622 |
| **Building Name:** | Bear Head Lake SP Shop | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $58,209 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 1,441 |
| **Building Code:** | R2900201480 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $25,323 |
| **Building Name:** | Bear Head Lake SP Cold Storage | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,856 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 520 |
| **Building Code:** | R2900201520 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $59,789 |
| **Building Name:** | Bear Head Lk CG Fish Cleaning House | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $6,567 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 195 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201530 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $116,230 |
| **Building Name:** | Bear Head Lake SP Sanitation | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $21,212 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 483 |
| **Building Code:** | R2900201540 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $140,902 |
| **Building Name:** | Bear Head Lake CG C-Loop Sanitation | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $30,903 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 506 |
| **Building Code:** | R2900203830 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,872 |
| **Building Name:** | Bear Head Lake SP Oil House | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $2,291 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900204330 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $539,168 |
| **Building Name:** | Bear Head Lake SP Lodging House | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $52,612 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 2,656 |
| **Building Code:** | R2900205290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,839 |
| **Building Name:** | Bear Head Lk Grp CG Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $4,243 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ELY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900205300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,839 |
| **Building Name:** | Bear Head Lk Grp CG Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $4,243 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ELY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900205310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,839 |
| **Building Name:** | Bear Head Lk CG A-Loop Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $2,936 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900205320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,839 |
| **Building Name:** | Bear Head Lk CG A-Loop Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $2,936 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900205330 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,839 |
| **Building Name:** | Bear Head Lk CG C-Loop Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $2,936 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900205340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,106 |
| **Building Name:** | Bear Head N Bay Boat Lnd Vault Toil | **Address:** | 9301 Bear Head State Park Rd | **Deferred Maintenance:** | $1,943 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Ely | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206650 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $35,700 |
| **Building Name:** | Bear Head Lake SP Garage | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $5,529 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 436 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207420 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $43,649 |
| **Building Name:** | Bear Head Lake SP Picnic Shelter 2 | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,391 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 832 |
| **Building Code:** | R2900207430 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,923 |
| **Building Name:** | Bear Head Lake SP Spring House | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $2,951 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900207630 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $387,828 |
| **Building Name:** | Bear Head Lake SP Contact Sta | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $71,729 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 1,214 |
| **Building Code:** | R2900207690 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $43,320 |
| **Building Name:** | Bear Head Lk CG Camper Cabin | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $3,420 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900207880 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $312,508 |
| **Building Name:** | Bear Head Lake SP Sanitation | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $24,398 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 1,147 |
| **Building Code:** | R2900208620 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,425 |
| **Building Name:** | Bear Head Lake SP Cold Storage | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $537 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900208780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,313 |
| **Building Name:** | Bear Head Lk CG B-Loop Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,092 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,313 |
| **Building Name:** | Bear Head Lk CG B-Loop Vault Toilet | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,426 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208980 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $43,747 |
| **Building Name:** | Bear Head Lk CG White Cedar Cabin | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,104 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900208990 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $42,569 |
| **Building Name:** | Bear Head Lk CG Camper Cabin | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,081 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900209000 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $43,213 |
| **Building Name:** | Bear Head Lk CG Red Pine Cabin | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,412 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 288 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209010 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $43,747 |
| **Building Name:** | Bear Head Lk CG Quaking Aspen Cabin | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,423 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900209270 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $444,003 |
| **Building Name:** | Bear Head Lake SP Trails Center | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $10,179 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 1,685 |
| **Building Code:** | R2900210510 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $55,437 |
| **Building Name:** | Bear Head Lk CG Cabin Loop Vault | **Address:** | 9301 BEAR HEAD STATE PARK R | **Deferred Maintenance:** | $1,109 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 48 |

### *Site: R290006 - Beaver Creek Valley State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500720 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $41,769 |
| **Building Name:** | BCV SP Picnic Area Sanitation | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $10,446 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 317 |
| **Building Code:** | R2900500730 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $210,498 |
| **Building Name:** | BCV SP Picnic Area Recreation Hall | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $23,829 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 1,639 |
| **Building Code:** | R2900500740 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $149,597 |
| **Building Name:** | BCV SP Drive-In CG Sanitation | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $50,021 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 554 |
| **Building Code:** | R2900500750 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $523,229 |
| **Building Name:** | Beaver Creek Valley SP Contact Sta | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $102,759 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 2,468 |
| **Building Code:** | R2900500760 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $219,796 |
| **Building Name:** | Beaver Creek Valley SP Shop | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $16,530 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 1,529 |
| **Building Code:** | R2900502590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,960 |
| **Building Name:** | Beaver Creek Valley SP Vault Toilet | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $4,966 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,960 |
| **Building Name:** | Beaver Creek Valley SP Vault Toilet | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $3,782 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503060 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,960 |
| **Building Name:** | Beaver Creek Valley SP Vault Toilet | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $8,189 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504780 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,379 |
| **Building Name:** | Beaver Creek Valley SP Cabin | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $4,057 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900505030 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,327 |
| **Building Name:** | Beaver Creek Valley SP Shed | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $3,703 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900505040 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,960 |
| **Building Name:** | Beaver Creek Valley SP Vault Toilet | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $1,432 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 64 |

### *Site: R290007 - Big Bog SRA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100510 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,348 |
| **Building Name:** | Big Bog SRA South Unit Pump House | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,351 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | WASKISH | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900103810 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $353,070 |
| **Building Name:** | Big Bog SRA South Unit Office | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $60,582 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WASKISH | **Ext. Gross Area:** | 1,866 |
| **Building Code:** | R2900106600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,657 |
| **Building Name:** | Big Bog SRA South Old Lakesde Vault | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $2,399 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WASKISH | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900106610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,895 |
| **Building Name:** | Big Bog SRA South Changing House | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,162 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | WASKISH | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900107690 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $301,728 |
| **Building Name:** | Big Bog SRA South Unit Sanitation | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $29,506 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 902 |
| **Building Code:** | R2900107700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,409 |
| **Building Name:** | Big Bog SRA South Fish Cleaning Hse | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $2,641 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 345 |
| **Building Code:** | R2900107710 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $71,288 |
| **Building Name:** | Big Bog SRA South Picnic Shelter 2 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $7,129 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 825 |
| **Building Code:** | R2900107740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,594 |
| **Building Name:** | Big Bog SRA South Campground Vault | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,559 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,594 |
| **Building Name:** | Big Bog SRA South New Lakesde Vault | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,559 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900107790 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $40,507 |
| **Building Name:** | Big Bog SRA South Unit Pump House | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $4,051 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 128 |
| **Building Code:** | R2900108020 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,701 |
| **Building Name:** | Big Bog SRA South Cabin 2 Vault | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,570 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108030 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,322 |
| **Building Name:** | Big Bog SRA North Unit Vault Toilet | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $3,332 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900108040 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $60,988 |
| **Building Name:** | Big Bog SRA South Camper Cabin 1 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $6,099 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900108050 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $70,885 |
| **Building Name:** | Big Bog SRA South Camper Cabin 2 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $7,089 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900108060 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $70,885 |
| **Building Name:** | Big Bog SRA South Camper Cabin 3 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $7,089 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900108070 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $57,390 |
| **Building Name:** | Big Bog SRA South Camper Cabin 4 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $5,739 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900108080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $70,885 |
| **Building Name:** | Big Bog SRA South Camper Cabin 5 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $7,089 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900108090 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $66,363 |
| **Building Name:** | Big Bog SRA North Picnic Shelter 2 | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $6,636 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900108290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,701 |
| **Building Name:** | Big Bog SRA South Cabin Vault | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,570 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108650 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $888,261 |
| **Building Name:** | Big Bog SRA South Contact Station | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $88,826 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 3,037 |
| **Building Code:** | R2900108770 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $1,003 |
| **Building Name:** | Big Bog SRA North Interp Unoccupied | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $100 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 25 |
| **Building Code:** | R2900108790 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $17,641 |
| **Building Name:** | Big Bog SRA South Unit Fire Tower | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $1,764 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900207790 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $45,239 |
| **Building Name:** | Big Bog SRA South Unit Cabin | **Address:** | 55716 HWY 72 NE | **Deferred Maintenance:** | $4,524 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WASKISH | **Ext. Gross Area:** | 336 |

### *Site: R290008 - Big Stone Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401680 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,731,901 |
| **Building Name:** | Big Stone Lake SP Bonanza Ed Ctr | **Address:** | 31167 Big Stone Lake Park Road | **Deferred Maintenance:** | $454,247 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | CLINTON | **Ext. Gross Area:** | 4,971 |
| **Building Code:** | R2900401700 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $373,011 |
| **Building Name:** | Big Stone Lake SP Contact Sta | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $75,568 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 1,588 |
| **Building Code:** | R2900401710 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $83,560 |
| **Building Name:** | Big Stone Lake SP Shop | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $18,914 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900401720 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $73,751 |
| **Building Name:** | Big Stone Lake SP Cold Storage | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $14,568 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 900 |
| **Building Code:** | R2900403260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,507 |
| **Building Name:** | BSL SP Meadowbrook Upr Vault Toilet | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $2,732 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900403270 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,581 |
| **Building Name:** | BSL SP Meadowbrook Low Vault Toilet | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $2,640 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900404070 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $357,462 |
| **Building Name:** | BSL SP Meadowbrook Sanitation | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $95,457 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 933 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404770 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,557 |
| **Building Name:** | Big Stone Lake SP Bonanza Vault | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $1,268 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900404780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,412 |
| **Building Name:** | Big Stone Lake SP Bonanza Vault | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $2,020 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900404840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,991 |
| **Building Name:** | BSL SP Meadowbrook Pump House | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $4,993 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900404850 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $25,132 |
| **Building Name:** | Big Stone Lake SP Shed | **Address:** | 35889 MEADOWBROOK STATE P/ | **Deferred Maintenance:** | $5,145 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 123 |
| **Building Code:** | R2900405800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $544 |
| **Building Name:** | BSL SP Meadowbrook Concrete Vault | **Address:** | 35889 Meadowbrook State Park | **Deferred Maintenance:** | $11 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 47 |

### *Site: R290009 - Blue Mounds State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400680 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $415,382 |
| **Building Name:** | Blue Mounds SP HQ Contact Station | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $46,968 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LUVERNE | **Ext. Gross Area:** | 1,216 |
| **Building Code:** | R2900400690 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $74,248 |
| **Building Name:** | Blue Mounds SP HQ Residence Garage | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $24,502 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900400700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $99,690 |
| **Building Name:** | Blue Mounds SP HQ Open Shed | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $32,898 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 2,808 |
| **Building Code:** | R2900400710 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $744,646 |
| **Building Name:** | Blue Mounds SP Interp Center | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $317,650 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 3,916 |
| **Building Code:** | R2900400730 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $96,149 |
| **Building Name:** | Blue Mounds SP Picnic Shelter 2 | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $31,729 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900400740 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $90,232 |
| **Building Name:** | Blue Mounds SP HQ Cold Storage | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $33,610 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 1,160 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400750 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $573,634 |
| **Building Name:** | Blue Mounds SP Residence | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $222,286 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 2,959 |
| **Building Code:** | R2900400770 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $196,833 |
| **Building Name:** | Blue Mounds SP Sanitation | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $64,955 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 596 |
| **Building Code:** | R2900400780 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $291,282 |
| **Building Name:** | Blue Mounds SP HQ Shop | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $84,464 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900402690 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $188,647 |
| **Building Name:** | Blue Mounds SP CG Sanitation | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $56,198 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 658 |
| **Building Code:** | R2900403340 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,485 |
| **Building Name:** | Blue Mounds SP HQ Oil House | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $2,140 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 68 |
| **Building Code:** | R2900403830 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,562 |
| **Building Name:** | Blue Mounds SP HQ Granary Storage | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $1,709 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 67 |
| **Building Code:** | R2900404180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,189 |
| **Building Name:** | Blue Mounds Group CG Vault Toilet | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $2,047 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900404190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,189 |
| **Building Name:** | Blue Mounds Group CG Vault Toilet | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $2,047 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900404200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,189 |
| **Building Name:** | Blue Mounds SP CG Vault Toilet | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $2,047 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900404290 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,224 |
| **Building Name:** | Blue Mounds SP Pump House | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $9,742 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900404400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,941 |
| **Building Name:** | Blue Mounds SP CG Vault Toilet | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $3,966 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 38 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404720 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $417,240 |
| **Building Name:** | Blue Mounds SP CG Sanitation | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $10,119 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUVERNE | **Ext. Gross Area:** | 1,113 |
| **Building Code:** | R2900405020 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,211 |
| **Building Name:** | Blue Mounds SP HQ Firewood Shed | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $521 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LUVERNE | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900405070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,189 |
| **Building Name:** | Blue Mounds SP Vault Toilet | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $1,912 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900405440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,631 |
| **Building Name:** | Blue Mounds Beach Vault Concrete | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $253 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUVERNE | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900405450 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $19,740 |
| **Building Name:** | Blue Mounds SP CG Tipi | **Address:** | 1410 161ST ST | **Deferred Maintenance:** | $1,572 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LUVERNE | **Ext. Gross Area:** | 174 |

### *Site: R290010 - Buffalo River State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103150 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $240,259 |
| **Building Name:** | Buffalo River SP Trails Center | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $73,633 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | GLYNDON | **Ext. Gross Area:** | 795 |
| **Building Code:** | R2900103160 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $608,575 |
| **Building Name:** | Buffalo River SP Priarie Vw CG San | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $311,811 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | GLYNDON | **Ext. Gross Area:** | 1,283 |
| **Building Code:** | R2900103170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $126,466 |
| **Building Name:** | Buffalo River PraV CG Hist San Bldg | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $28,614 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900103180 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $561,556 |
| **Building Name:** | Buffalo River SP Beach Area San | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $184,743 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | GLYNDON | **Ext. Gross Area:** | 1,165 |
| **Building Code:** | R2900103190 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $47,066 |
| **Building Name:** | Buffalo Riv Prairie Vw CG Pumphouse | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $6,609 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 141 |
| **Building Code:** | R2900103200 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $209,887 |
| **Building Name:** | Buffalo River SP Shop | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $38,067 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 1,531 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103210 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $83,599 |
| **Building Name:** | Buffalo River SP Residence Garage | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $11,125 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900103220 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $438,553 |
| **Building Name:** | Buffalo River SP Residence | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $89,601 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 1,962 |
| **Building Code:** | R2900105370 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $139,277 |
| **Building Name:** | Buffalo Riv Beach Ar Picnic Shel 2 | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $20,341 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 617 |
| **Building Code:** | R2900105870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,686 |
| **Building Name:** | Buffalo River Picnic Ar Mens Vault | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $1,542 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900105880 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,686 |
| **Building Name:** | Buffalo River Picnic Ar Wmns Vault | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $1,542 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900106380 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $235,821 |
| **Building Name:** | Buffalo River SP Contact Sta | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $17,358 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 1,043 |
| **Building Code:** | R2900106700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,152 |
| **Building Name:** | Buffalo River Prairie Vw CG Vault | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $1,638 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 43 |
| **Building Code:** | R2900106710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,185 |
| **Building Name:** | Buffalo River SP Pioneer Camp Vault | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $1,642 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107870 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $148,903 |
| **Building Name:** | Buffalo River SP Pool Water Trtmnt | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $31,470 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900107890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,352 |
| **Building Name:** | Buffalo River SP Group Camp Vault | **Address:** | 565 155TH ST S, HWY 10 | **Deferred Maintenance:** | $1,103 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GLYNDON | **Ext. Gross Area:** | 48 |

### *Site: R290011 - Camden State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401470 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $160,797 |
| **Building Name:** | Camden SP Picnic Shelter 2 | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $52,097 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 1,440 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401510 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $869,808 |
| **Building Name:** | Camden SP Bath House | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $287,037 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 2,068 |
| **Building Code:** | R2900401530 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $206,376 |
| **Building Name:** | Camden Lower Picnic Area Sanitation | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $67,777 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 435 |
| **Building Code:** | R2900401540 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $168,883 |
| **Building Name:** | Camden SP Group CG Picnic Shelter 2 | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $51,740 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 1,032 |
| **Building Code:** | R2900401570 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $195,594 |
| **Building Name:** | Camden Lower Residence Cold Storage | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $23,485 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LYND | **Ext. Gross Area:** | 880 |
| **Building Code:** | R2900401590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $352,070 |
| **Building Name:** | Camden SP Old Residence Garage | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $126,058 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 1,526 |
| **Building Code:** | R2900401600 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $560,942 |
| **Building Name:** | Camden SP Lower CG Old Residence | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $277,143 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 1,636 |
| **Building Code:** | R2900402610 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $554,684 |
| **Building Name:** | Camden SP Upper CG Residence | **Address:** | 1895 CAMDEN PARK RD | **Deferred Maintenance:** | $164,615 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 1,632 |
| **Building Code:** | R2900402620 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $335,411 |
| **Building Name:** | Camden SP Shop | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $80,225 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900402630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $237,081 |
| **Building Name:** | Camden SP Cold Storage | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $47,608 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 1,920 |
| **Building Code:** | R2900402640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $85,155 |
| **Building Name:** | Camden SP Upper Residence Garage | **Address:** | 1895 CAMDEN PARK RD | **Deferred Maintenance:** | $25,940 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900402650 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $449,776 |
| **Building Name:** | Camden SP Contact Station | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $29,275 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LYND | **Ext. Gross Area:** | 1,308 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402660 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,378 |
| **Building Name:** | Camden SP Oil House | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $5,991 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900402890 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $117,409 |
| **Building Name:** | Camden SP Group CG Sanitation | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $43,849 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 432 |
| **Building Code:** | R2900403030 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $400,957 |
| **Building Name:** | Camden SP Upper CG Sanitation | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $105,580 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900403300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,606 |
| **Building Name:** | Camden SP Upper CG W Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $1,919 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,904 |
| **Building Name:** | Camden SP Upper CG M Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $2,017 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,567 |
| **Building Name:** | Camden SP Horse CG W Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $2,551 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,627 |
| **Building Name:** | Camden SP Horse CG M Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $2,571 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,858 |
| **Building Name:** | Camden SP Picnic Area Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $2,647 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,858 |
| **Building Name:** | Camden SP Picnic Area Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $2,647 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900404080 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $304,295 |
| **Building Name:** | Camden SP Lower CG Sanitation | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $61,872 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 916 |
| **Building Code:** | R2900404510 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,487 |
| **Building Name:** | Camden SP Brawner Lake Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $5,184 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Camden SP Lower CG Vault Toilet | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $3,476 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LYND | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405290 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $42,497 |
| **Building Name:** | Camden SP Wood Shed | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $4,250 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LYND | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900405300 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,713 |
| **Building Name:** | Camden SP Pump House | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $1,832 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | LYND | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900405490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $529,082 |
| **Building Name:** | Camden SP Upper CG Vault Concrete | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $52,908 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LYND | **Ext. Gross Area:** | 81 |
| **Building Code:** | R2900405500 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,790 |
| **Building Name:** | Camden SP Upper CG Vault Concrete | **Address:** | 1897 CAMDEN PARK RD | **Deferred Maintenance:** | $1,740 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LYND | **Ext. Gross Area:** | 81 |

### *Site: R290012 - Cascade River State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201250 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $376,462 |
| **Building Name:** | Cascade River SP Shop | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $70,416 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LUTSEN | **Ext. Gross Area:** | 1,523 |
| **Building Code:** | R2900201260 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,880 |
| **Building Name:** | Cascade SP Shop Area Cold Storage | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $4,527 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | LUTSEN | **Ext. Gross Area:** | 103 |
| **Building Code:** | R2900201290 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,337 |
| **Building Name:** | Cascade Shop Area Firewood Storage | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $7,422 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 538 |
| **Building Code:** | R2900201310 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $188,305 |
| **Building Name:** | Cascade Riv SP CG Picnic Shelter 2 | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $19,882 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 780 |
| **Building Code:** | R2900201340 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $66,843 |
| **Building Name:** | Cascade River SP CG Spring House | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $17,518 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LUTSEN | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900204250 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,781 |
| **Building Name:** | Cascade SP Shop Area Oil House | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $1,378 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 102 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204380 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $207,338 |
| **Building Name:** | Cascade River SP Office | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $21,793 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 960 |
| **Building Code:** | R2900205380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,160 |
| **Building Name:** | Cascade Riv SP Grp CG Vault Toilet | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $2,219 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LUTSEN | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900205390 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,068 |
| **Building Name:** | Cascade River SP CG Vault Toilet | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $2,067 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LUTSEN | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900205400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,068 |
| **Building Name:** | Cascade River SP CG Vault Toilet | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $2,067 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LUTSEN | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900207460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,314 |
| **Building Name:** | Cascade SP Picnic Area Vault Toilet | **Address:** | 3550 W HWY 61 | **Deferred Maintenance:** | $3,321 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LUTSEN | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900208660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,161 |
| **Building Name:** | Cascade Riv SP HQ Area Vault Toilet | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $1,224 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,161 |
| **Building Name:** | Cascade Riv SP CG B/C Vault Toilet | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $1,224 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 50 |
| **Building Code:** | R2900208680 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,161 |
| **Building Name:** | Cascade River SP CG Vault Toilet | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $1,224 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900208830 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $98,737 |
| **Building Name:** | Cascade River SP Cold Storage | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $11,207 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 1,020 |
| **Building Code:** | R2900208840 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $330,533 |
| **Building Name:** | Cascade River SP Dormitory | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $36,900 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 1,740 |
| **Building Code:** | R2900210020 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,608 |
| **Building Name:** | Cascade River SP BP01 Adirondack | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $319 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 65 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210030 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $1,711 |
| **Building Name:** | Cascade River SP BP01 Pit Toilet | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $34 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900210040 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,921 |
| **Building Name:** | Cascade River SP BP02 Adirondack | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $722 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900210050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $1,711 |
| **Building Name:** | Cascade River SP BP02 Pit Toilet | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $34 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900210060 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,921 |
| **Building Name:** | Cascade River SP BP03 Adirondack | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $688 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900210070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $1,711 |
| **Building Name:** | Cascade River SP BP03 Pit Toilet | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $34 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900210080 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,606 |
| **Building Name:** | Cascade River SP BP04 Adirondack | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $665 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 90 |
| **Building Code:** | R2900210090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $1,711 |
| **Building Name:** | Cascade River SP BP04 Pit Toilet | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $34 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900210100 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $6,376 |
| **Building Name:** | Cascade River SP BP05 Adirondack | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $424 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LUTSEN | **Ext. Gross Area:** | 110 |
| **Building Code:** | R2900210110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $1,711 |
| **Building Name:** | Cascade River SP BP05 Pit Toilet | **Address:** | 3997 W HWY 61 | **Deferred Maintenance:** | $34 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900210470 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $370,802 |
| **Building Name:** | Cascade River SP CG Sanitation | **Address:** | 3481 W HWY 61 | **Deferred Maintenance:** | $17,569 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | LUTSEN | **Ext. Gross Area:** | 1,200 |

### *Site: R290013 - Charles A Lindbergh State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301020 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $156,680 |
| **Building Name:** | CA Lindbergh SP Contact Sta | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $20,441 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 793 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301030 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $119,812 |
| **Building Name:** | CA Lindbergh SP Tenant Farmhouse | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $119,812 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 1,036 |
| **Building Code:** | R2900301040 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $48,917 |
| **Building Name:** | CA Lindbergh SP Garage | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $19,645 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 660 |
| **Building Code:** | R2900301050 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $272,705 |
| **Building Name:** | CA Lindbergh Picnic Area Shelter 2 | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $56,424 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 1,278 |
| **Building Code:** | R2900301060 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $209,700 |
| **Building Name:** | CA Lindbergh Picnic Area Pump House | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $73,836 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 448 |
| **Building Code:** | R2900301070 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $144,121 |
| **Building Name:** | CA Lindbergh SP CG Sanitation | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $22,092 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 678 |
| **Building Code:** | R2900301080 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $136,413 |
| **Building Name:** | CA Lindbergh Picnic Area Sanitation | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $32,969 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 336 |
| **Building Code:** | R2900303770 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $44,705 |
| **Building Name:** | CA Lindbergh SP Cold Storage | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $18,367 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 248 |
| **Building Code:** | R2900304120 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $285,500 |
| **Building Name:** | CA Lindbergh SP Shop | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $71,245 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900304220 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,897 |
| **Building Name:** | CA Lindbergh SP Oil House | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $990 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 104 |
| **Building Code:** | R2900304750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,523 |
| **Building Name:** | CA Lindbergh Picnic Area Vault Toil | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $2,265 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 34 |
| **Building Code:** | R2900304760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,570 |
| **Building Name:** | CA Lindbergh SP CG Vault Toilet | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $2,375 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 34 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,797 |
| **Building Name:** | CA Lindbergh Group CG Vault Toilet | **Address:** | 1615 LINDBERGH DR S | **Deferred Maintenance:** | $1,807 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 41 |
| **Building Code:** | R2900306980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $52,318 |
| **Building Name:** | CA Lindbergh SP Cold Storage | **Address:** | 17912 GROUSE RD | **Deferred Maintenance:** | $7,750 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 960 |

### *Site: R290014 - Crow Wing State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300860 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $37,045 |
| **Building Name:** | Crow Wing SP Grp CG Picnic Sheltr 2 | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $3,255 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900300870 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $462,483 |
| **Building Name:** | Crow Wing SP S Picnic Area San Bldg | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $90,404 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,488 |
| **Building Code:** | R2900300880 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $236,332 |
| **Building Name:** | Crow Wing SP CG Sanitation | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $58,949 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 640 |
| **Building Code:** | R2900300890 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $443,983 |
| **Building Name:** | Crow Wing SP Residence | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $125,640 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 2,546 |
| **Building Code:** | R2900300900 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $103,196 |
| **Building Name:** | Crow Wing SP HQ Area Cold Storage | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $47,430 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | BRAINERD | **Ext. Gross Area:** | 968 |
| **Building Code:** | R2900300910 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $322,201 |
| **Building Name:** | Crow Wing SP Shop | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $68,934 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,920 |
| **Building Code:** | R2900300920 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $95,275 |
| **Building Name:** | Crow Wing SP HQ Area Office | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $19,363 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 526 |
| **Building Code:** | R2900300930 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $186,005 |
| **Building Name:** | Crow Wing SP HQ Area Cold Storage | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $89,653 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,070 |
| **Building Code:** | R2900303590 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,449 |
| **Building Name:** | Crow Wing SP Shop Area Oil House | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $830 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 96 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900304590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,109 |
| **Building Name:** | Crow Wing SP CG Mens A Vault Toilet | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $3,006 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BRAINERD | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900304600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,109 |
| **Building Name:** | Crow Wing SP CG Women A Vault Toil | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $3,561 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | BRAINERD | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900305140 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,134 |
| **Building Name:** | Crow Wing SP Group CG Vault Toilet | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $1,859 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900305170 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $196,808 |
| **Building Name:** | Crow Wing SP Interp Center | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $42,523 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900306800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,270 |
| **Building Name:** | Crow Wing SP CG C Vault Toilet | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $1,899 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,270 |
| **Building Name:** | Crow Wing SP N Picnic Ar Vault Toil | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $1,608 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306820 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $42,630 |
| **Building Name:** | Crow Wing SP CG Cabin | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $8,090 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900307110 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $105,170 |
| **Building Name:** | Crow Wing SP Cold Storage | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $9,611 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,154 |
| **Building Code:** | R2900307270 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,257 |
| **Building Name:** | Crow Wing SP S Picnic Ar Vault Toil | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $1,017 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,583 |
| **Building Name:** | Crow Wing SP CG Spring House | **Address:** | 3124 STATE PARK RD | **Deferred Maintenance:** | $288 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 36 |

### *Site: R290015 - Cuyuna Country SRA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209040 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $245,218 |
| **Building Name:** | Cuyuna Portsmouth CG Sanitation | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $148,199 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | IRONTON | **Ext. Gross Area:** | 864 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $26,079 |
| **Building Name:** | Cuyuna Portsmouth M Vault Concrete | **Address:** | 17951 COUNTY RD 30 | **Deferred Maintenance:** | $522 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CROSBY | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900209350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $26,079 |
| **Building Name:** | Cuyuna Pennington M Vault Concrete | **Address:** | 19406 NORTH RD | **Deferred Maintenance:** | $522 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900209360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $26,079 |
| **Building Name:** | Cuyuna Sagamore Mine Vault Concrete | **Address:** | 20141 SAGAMORE RD | **Deferred Maintenance:** | $522 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900209370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,828 |
| **Building Name:** | Cuyuna Croft Mine Site Cold Storage | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $8,828 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | IRONTON | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900209380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,157 |
| **Building Name:** | Cuyuna Croft Mine Vault Concrete | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $1,043 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900209950 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $61,385 |
| **Building Name:** | Cuyuna Yawkey Mine Lake Yurt 1 | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $1,228 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900209960 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $18,105 |
| **Building Name:** | Cuyuna Yawkey Mine Lake Picnic 1 | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $362 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900209970 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $61,385 |
| **Building Name:** | Cuyuna Yawkey Mine Lake Yurt 2 | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $1,228 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900209980 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $18,105 |
| **Building Name:** | Cuyuna Yawkey Mine Lake Picnic 2 | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $362 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900209990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $101,499 |
| **Building Name:** | Cuyuna Yawkey Mine Vault Concrete | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $2,030 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900210000 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $61,385 |
| **Building Name:** | Cuyuna Yawkey Mine Lake Yurt 3 | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $1,228 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 314 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210010 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $18,105 |
| **Building Name:** | Cuyuna Yawkey Mine Lake Picnic 3 | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $362 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900210290 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,785 |
| **Building Name:** | Cuyuna Huntington Water Treatment | **Address:** | | **Deferred Maintenance:** | $1,027 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900210300 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $67,962 |
| **Building Name:** | Cuyuna Huntington Picnic Shelter 1 | **Address:** | | **Deferred Maintenance:** | $4,693 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | IRONTON | **Ext. Gross Area:** | 600 |
| **Building Code:** | R2900210310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,709 |
| **Building Name:** | Cuyuna Huntington Vault Concrete | **Address:** | | **Deferred Maintenance:** | $554 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900210320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,709 |
| **Building Name:** | Cuyuna Country SRA Vault Concrete | **Address:** | | **Deferred Maintenance:** | $554 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900306060 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $259,085 |
| **Building Name:** | Cuyuna Country SRA Office | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $50,256 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 1,568 |
| **Building Code:** | R2900306430 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $191,367 |
| **Building Name:** | Cuyuna Croft Mine Site Sanitation | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $12,935 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | IRONTON | **Ext. Gross Area:** | 624 |
| **Building Code:** | R2900306440 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $7,029 |
| **Building Name:** | Cuyuna Croft Mine Site Concession | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $1,072 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 101 |
| **Building Code:** | R2900306450 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $51,978 |
| **Building Name:** | Cuyuna Croft M Cuyler Adam's Office | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $11,600 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 508 |
| **Building Code:** | R2900306460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $29,121 |
| **Building Name:** | Cuyuna Croft Mine Site Vault Toilet | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $7,209 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900306470 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $62,757 |
| **Building Name:** | Cuyuna Croft Mine Site Crosby House | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $26,153 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | IRONTON | **Ext. Gross Area:** | 576 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306480 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $12,079 |
| **Building Name:** | Cuyuna Croft M Martinetto Residence | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $8,277 |
| **Facility Condition Index:** | 0.69 - Crisis | **City Code:** | IRONTON | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900306490 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $31,688 |
| **Building Name:** | Cuyuna Croft Mine SIte Office | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $2,713 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | IRONTON | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900306500 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $87,039 |
| **Building Name:** | Cuyuna Croft Mine Interp Occupied | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $2,300 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 713 |
| **Building Code:** | R2900306510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $571,514 |
| **Building Name:** | Cuyuna Croft Mine Interp Occupied | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $25,518 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | IRONTON | **Ext. Gross Area:** | 3,780 |
| **Building Code:** | R2900306520 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $28,868 |
| **Building Name:** | Cuyuna Croft Mine Engineer's Office | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $4,540 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 256 |
| **Building Code:** | R2900306530 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $614,691 |
| **Building Name:** | Cuyuna Croft Mine Interp Occupied | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $128,779 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 3,116 |
| **Building Code:** | R2900307280 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,257 |
| **Building Name:** | Cuyuna Portsmouth CG Vault Toilet | **Address:** | 307 3RD ST | **Deferred Maintenance:** | $1,017 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | IRONTON | **Ext. Gross Area:** | 47 |

### *Site: R290016 - Father Hennepin State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300940 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $311,704 |
| **Building Name:** | Father Hennepin SP Shop | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $133,036 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | ISLE | **Ext. Gross Area:** | 1,523 |
| **Building Code:** | R2900300960 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $373,147 |
| **Building Name:** | Father Hennepin SP Residence | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $99,172 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 1,751 |
| **Building Code:** | R2900300970 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $175,656 |
| **Building Name:** | Father Hennepin SP Picnic Shelter 2 | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $22,888 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 1,620 |
| **Building Code:** | R2900300980 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $152,314 |
| **Building Name:** | Father Hennepin SP Picnic Shelter 1 | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $39,852 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 1,512 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301000 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $44,500 |
| **Building Name:** | FH SP Lakeview CG Fish Cleaning Hse | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $11,411 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900301010 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $131,672 |
| **Building Name:** | Father Hennepin SP Beach Sanitation | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $57,553 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ISLE | **Ext. Gross Area:** | 432 |
| **Building Code:** | R2900303050 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $82,636 |
| **Building Name:** | Father Hennepin SP HQ Cold Storage | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $40,359 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | ISLE | **Ext. Gross Area:** | 816 |
| **Building Code:** | R2900303400 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $347,113 |
| **Building Name:** | FH SP Maple Grove CG Sanitation | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $90,509 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 1,120 |
| **Building Code:** | R2900303420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $120,889 |
| **Building Name:** | Father Hennepin SP Boat House | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $36,903 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ISLE | **Ext. Gross Area:** | 972 |
| **Building Code:** | R2900304170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,346 |
| **Building Name:** | Father Hennepin SP HQ Oil House | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $1,366 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900304260 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $236,822 |
| **Building Name:** | Father Hennepin SP Office | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $52,557 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 897 |
| **Building Code:** | R2900304480 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $376,777 |
| **Building Name:** | FH SP Lakeview CG Sanitation | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $89,051 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 1,092 |
| **Building Code:** | R2900306790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,816 |
| **Building Name:** | Father Henn SP Picnic Vault Toilet | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $877 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900307160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,083 |
| **Building Name:** | FH SP Lakeview CG Rght Vault Toilet | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $854 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,083 |
| **Building Name:** | FH SP Lakeview CG Left Vault Toilet | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $559 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ISLE | **Ext. Gross Area:** | 47 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,083 |
| **Building Name:** | FH SP Maple Grove CG R Vault Toilet | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $559 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ISLE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,083 |
| **Building Name:** | FH SP Maple Grove CG L Vault Toilet | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $720 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | ISLE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900307770 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,807 |
| **Building Name:** | Father Henn SP Wood Cold Storage | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $536 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ISLE | **Ext. Gross Area:** | 387 |
| **Building Code:** | R2900307780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,051 |
| **Building Name:** | Father Henn SP Boat Vault Toilet | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $1,012 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900308280 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,903 |
| **Building Name:** | FH SP Group CG Vault Concrete | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $1,058 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ISLE | **Ext. Gross Area:** | 102 |

### *Site: R290017 - Flandrau State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400320 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,065,078 |
| **Building Name:** | Flandrau SP Res Garage/Cold Storage | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $193,818 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 2,350 |
| **Building Code:** | R2900400330 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,308,180 |
| **Building Name:** | Flandrau SP Residence | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $280,776 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 2,560 |
| **Building Code:** | R2900400350 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $117,580 |
| **Building Name:** | Flandrau SP Group CG Cabin 1 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $35,688 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400360 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $147,382 |
| **Building Name:** | Flandrau SP Group CG Cabin 2 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $45,522 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400370 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $140,407 |
| **Building Name:** | Flandrau SP Group CG Cabin 3 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $43,221 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400380 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $140,407 |
| **Building Name:** | Flandrau SP Group CG Cabin 4 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $46,302 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400390 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $96,438 |
| **Building Name:** | Flandrau SP Group CG Cabin 5 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $29,633 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400400 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $117,006 |
| **Building Name:** | Flandrau SP Group CG Cabin 6 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $36,017 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400410 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $93,182 |
| **Building Name:** | Flandrau SP Group CG Cabin 7 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $29,303 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400420 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $140,407 |
| **Building Name:** | Flandrau SP Group CG Cabin 8 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $51,346 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900400430 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $205,546 |
| **Building Name:** | Flandrau SP Group CG Mens San Bldg | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $36,314 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 522 |
| **Building Code:** | R2900400440 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $205,191 |
| **Building Name:** | Flandrau SP Group CG Women San Bldg | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $36,197 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 522 |
| **Building Code:** | R2900400450 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $695,395 |
| **Building Name:** | Flandrau SP Group CG Dining Hall | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $156,930 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 2,701 |
| **Building Code:** | R2900400460 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,371,931 |
| **Building Name:** | Flandrau SP Bath House | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $270,657 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 4,250 |
| **Building Code:** | R2900400470 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $431,054 |
| **Building Name:** | Flandrau SP Semi-Modern Stone Cabin | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $8,621 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW ULM | **Ext. Gross Area:** | 700 |
| **Building Code:** | R2900400510 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,171,107 |
| **Building Name:** | Flandrau SP Shop | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $317,235 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 3,800 |
| **Building Code:** | R2900400530 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $338,756 |
| **Building Name:** | Flandrau SP Group CG Cabin | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $130,356 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 1,908 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900403100 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $50,894 |
| **Building Name:** | Flandrau SP Pump House | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $7,403 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | NEW ULM | **Ext. Gross Area:** | 675 |
| **Building Code:** | R2900403120 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,505 |
| **Building Name:** | Flandrau SP Picnic Ar Vault Toilet | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $4,930 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900403170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,606 |
| **Building Name:** | Flandrau SP Rustic CG Vault Toilet | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $4,871 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900403180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,606 |
| **Building Name:** | Flandrau SP Rustic CG Vault Toilet | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $4,871 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900404020 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $379,770 |
| **Building Name:** | Flandrau SP Contact Station | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $87,950 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 1,311 |
| **Building Code:** | R2900404140 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,908 |
| **Building Name:** | Flandrau SP Oil House | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $3,634 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900404550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,606 |
| **Building Name:** | Flandrau SP Beach Hse Vault Toilet | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $2,958 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900404560 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $49,851 |
| **Building Name:** | Flandrau SP Wood Cold Storage | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $16,451 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 600 |
| **Building Code:** | R2900404650 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $313,503 |
| **Building Name:** | Flandrau SP Semi-Modern Sanitation | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $17,649 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | NEW ULM | **Ext. Gross Area:** | 1,000 |
| **Building Code:** | R2900404860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,606 |
| **Building Name:** | Flandrau SP Group CG Vault Toilet | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $1,704 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | NEW ULM | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900405220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,837 |
| **Building Name:** | Flandrau SP Vault Concrete | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $517 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW ULM | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900405230 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $53,582 |
| **Building Name:** | Flandrau SP Camper Cabin 1 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $2,379 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | NEW ULM | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405240 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $53,582 |
| **Building Name:** | Flandrau SP Camper Cabin 2 | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $2,379 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | NEW ULM | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405430 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $664,903 |
| **Building Name:** | Flandrau SP Wood Shed | **Address:** | 1300 SUMMIT AVE | **Deferred Maintenance:** | $13,898 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW ULM | **Ext. Gross Area:** | 280 |

### *Site: R290018 - Forestville-Mystery Cave State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501410 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $703,362 |
| **Building Name:** | F-MC SP Main CG Sanitation | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $63,804 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 1,702 |
| **Building Code:** | R2900501470 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,995 |
| **Building Name:** | F-MC SP Main CG Pump House | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $4,046 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 121 |
| **Building Code:** | R2900501480 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $206,241 |
| **Building Name:** | F-MC SP Group CG Cold Storage | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $52,245 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 1,952 |
| **Building Code:** | R2900501860 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $997,904 |
| **Building Name:** | F-MC SP Picnic Area Sanitation | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $164,358 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 2,800 |
| **Building Code:** | R2900501880 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $248,846 |
| **Building Name:** | F-MC SP Forestville Shop | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $37,586 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 1,460 |
| **Building Code:** | R2900501890 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,177 |
| **Building Name:** | F-MC SP Oil House | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,210 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 103 |
| **Building Code:** | R2900501950 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $264,773 |
| **Building Name:** | F-MC SP Forestville Contact Station | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $34,653 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 901 |
| **Building Code:** | R2900502080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $289,872 |
| **Building Name:** | F-MC SP Residence | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $83,701 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 3,539 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $106,667 |
| **Building Name:** | F-MC SP Mystery Cave Shop | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $10,820 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900502150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,466 |
| **Building Name:** | F-MC SP Cave Entrance Bldg | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $4,956 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 306 |
| **Building Code:** | R2900502870 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,778 |
| **Building Name:** | F-MC SP Mystery Cave Wood Shed | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $13,426 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | PRESTON | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900502890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Main CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,111 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Main CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,759 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Main CG B Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,759 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Main CG B Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,759 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Group CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,759 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Group CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $3,942 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,687 |
| **Building Name:** | F-MC SP Group CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $3,819 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Group CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,759 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Main CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,757 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900504200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Main CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,405 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900504210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Horse CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,405 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900504220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,061 |
| **Building Name:** | F-MC SP Horse CG Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $2,405 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900505020 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,787,296 |
| **Building Name:** | F-MC SP Mystery Cave Contact Sta | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $114,396 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 5,307 |
| **Building Code:** | R2900505180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | F-MC SP Horse CG S Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,080 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | F-MC SP Horse CG E Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,080 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | F-MC SP Parking Area Vault Toilet | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,080 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505250 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $36,256 |
| **Building Name:** | F-MC SP Amphitheatre | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,221 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 410 |
| **Building Code:** | R2900505510 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,535 |
| **Building Name:** | F-MC SP Horse CG Vault Concrete | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $511 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $56,504 |
| **Building Name:** | F-MC SP Vault Concrete | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,130 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 104 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505860 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $80,413 |
| **Building Name:** | F-MC SP Pine Camper Cabin | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,608 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 390 |
| **Building Code:** | R2900505870 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $80,413 |
| **Building Name:** | F-MC SP Owl Camper Cabin | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,608 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 390 |
| **Building Code:** | R2900505880 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $94,159 |
| **Building Name:** | F-MC SP Lily Camper Cabin | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,883 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 390 |
| **Building Code:** | R2900505890 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $94,159 |
| **Building Name:** | F-MC SP Mink Camper Cabin | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,883 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 390 |
| **Building Code:** | R2900505900 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $70,349 |
| **Building Name:** | F-MC SP Trout Camper Cabin | **Address:** | 21071 CTY 118 | **Deferred Maintenance:** | $1,407 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PRESTON | **Ext. Gross Area:** | 390 |

### *Site: R290019 - Fort Ridgely State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400790 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $46,627 |
| **Building Name:** | Fort Ridgely SP Cold Storage | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $14,917 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 200 |
| **Building Code:** | R2900400800 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $540,212 |
| **Building Name:** | Fort Ridgely SP Trails Center | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $165,198 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | R2900400810 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $851,221 |
| **Building Name:** | Fort Ridgely SP Picnic Shelter 2 | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $277,357 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,560 |
| **Building Code:** | R2900400820 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $223,232 |
| **Building Name:** | Fort Ridgely SP Shop | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $78,903 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,155 |
| **Building Code:** | R2900400830 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $695,188 |
| **Building Name:** | Ft Ridgely SP Rustic CG Pic Shel 2 | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $442,276 |
| **Facility Condition Index:** | 0.64 - Crisis | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,304 |
| **Building Code:** | R2900400840 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,441,757 |
| **Building Name:** | Fort Ridgely SP Residence Garage | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $471,553 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,938 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400860 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $238,749 |
| **Building Name:** | Fort Ridgely SP Creekside CG San | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $71,502 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 522 |
| **Building Code:** | R2900400880 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $170,839 |
| **Building Name:** | Fort Ridgely SP Picnic Area San | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $56,377 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 405 |
| **Building Code:** | R2900400900 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $799,355 |
| **Building Name:** | Fort Ridgely SP Residence | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $386,752 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 2,210 |
| **Building Code:** | R2900402910 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $205,642 |
| **Building Name:** | Fort Ridgely SP Cold Storage | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $92,017 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,820 |
| **Building Code:** | R2900402920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $119,877 |
| **Building Name:** | Fort Ridgely SP Shop Cold Storage | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $39,560 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,404 |
| **Building Code:** | R2900403490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,551 |
| **Building Name:** | Fort Ridgely SP Picnic Vault Toilet | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $1,885 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403500 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,493 |
| **Building Name:** | Fort Ridgely SP Oil House | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $3,793 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900403820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,551 |
| **Building Name:** | Fort Ridgely SP Creekside CG Vault | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $1,885 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403930 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $207,604 |
| **Building Name:** | Fort Ridgely SP Contact Station | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $68,509 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 645 |
| **Building Code:** | R2900404050 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $813,491 |
| **Building Name:** | Fort Ridgely SP Interp Center | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $268,452 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 1,506 |
| **Building Code:** | R2900404420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,551 |
| **Building Name:** | Fort Ridgely SP Vault Toilet | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $1,885 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 24 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,696 |
| **Building Name:** | Fort Ridgely SP Picnic Vault Toilet | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $2,350 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900404470 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $107,831 |
| **Building Name:** | Fort Ridgely SP Horse CG Lodgng Hse | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $23,163 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 480 |
| **Building Code:** | R2900404480 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $54,009 |
| **Building Name:** | Fort Ridgely SP Horse CG Shed | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $8,120 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 750 |
| **Building Code:** | R2900404490 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,474 |
| **Building Name:** | Fort Ridgely SP Horse CG Cold Stor | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $3,127 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 176 |
| **Building Code:** | R2900404500 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $203,834 |
| **Building Name:** | Fort Ridgely SP Horse CG Sanitation | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $46,908 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 884 |
| **Building Code:** | R2900404750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,103 |
| **Building Name:** | Fort Ridgely SP Grp CG Vault Toilet | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $1,117 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900404760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,836 |
| **Building Name:** | Fort Ridgely SP Vault Toilet | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $1,099 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405190 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,710 |
| **Building Name:** | Fort Ridgely SP Golf Crse Pumphouse | **Address:** | 72158 CO RD 30 | **Deferred Maintenance:** | $334 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | FAIRFAX | **Ext. Gross Area:** | 64 |

### *Site: R290020 - Fort Snelling State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600110 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $516,476 |
| **Building Name:** | Fort Snelling SP Contact Station | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $80,011 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,967 |
| **Building Code:** | R2900600180 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $190,311 |
| **Building Name:** | Fort Snelling SP Picnic San 1 | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $52,185 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 501 |
| **Building Code:** | R2900600190 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $191,534 |
| **Building Name:** | Fort Snelling SP Picnic San 2 | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $53,728 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 501 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600200 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $5,147,315 |
| **Building Name:** | Fort Snelling SP Chapel | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $2,032,927 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 13,968 |
| **Building Code:** | R2900600220 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $166,673 |
| **Building Name:** | Fort Snelling SP Beach Bath House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $37,079 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900600230 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $98,636 |
| **Building Name:** | Fort Snelling SP Beach Concession | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $24,183 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900600240 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $186,291 |
| **Building Name:** | Fort Snelling SP Beach Sanitation | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $27,781 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900601110 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $468,381 |
| **Building Name:** | Fort Snelling SP Shop | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $97,157 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 2,477 |
| **Building Code:** | R2900601120 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $196,038 |
| **Building Name:** | Fort Snelling SP Picnic San 3 | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $53,646 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 78 |
| **Building Code:** | R2900601130 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $219,163 |
| **Building Name:** | Fort Snelling SP Picnic Shelter 2 | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $27,394 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,887 |
| **Building Code:** | R2900601960 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $334,220 |
| **Building Name:** | Fort Snelling SP Shop Cold Storage | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $37,997 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,927 |
| **Building Code:** | R2900601970 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,949,779 |
| **Building Name:** | Fort Snelling SP Interp Center | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $227,768 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 7,022 |
| **Building Code:** | R2900602000 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $184,509 |
| **Building Name:** | Fort Snelling SP Picnic Shelter 1 | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $39,953 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 880 |
| **Building Code:** | R2900602300 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,017 |
| **Building Name:** | Fort Snelling SP Cold Storage Barn | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $384 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 65 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900602310 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,608 |
| **Building Name:** | Fort Snelling SP Chapel Cold Storag | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $1,336 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900690530 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $664,154 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $664,154 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 15,750 |
| **Building Code:** | R2900690540 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $746,382 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $746,382 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 17,700 |
| **Building Code:** | R2900690550 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $2,151,141 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $2,151,141 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 51,013 |
| **Building Code:** | R2900690560 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $80,660 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $80,660 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 2,700 |
| **Building Code:** | R2900690570 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $292,765 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $292,765 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 9,800 |
| **Building Code:** | R2900690620 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $95,597 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $95,597 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | R2900690630 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $506,022 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $506,022 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 12,000 |
| **Building Code:** | R2900690640 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $161,319 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $161,319 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 5,400 |
| **Building Code:** | R2900690650 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $716,864 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $716,864 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 17,000 |
| **Building Code:** | R2900690660 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $292,765 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $292,765 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 9,800 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900690670 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $796,984 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $796,984 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 18,900 |
| **Building Code:** | R2900690760 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $497,588 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $497,588 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 11,800 |
| **Building Code:** | R2900691010 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $1,846,979 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $1,846,979 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 43,800 |
| **Building Code:** | R2900691020 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $615,660 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $615,660 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 14,600 |
| **Building Code:** | R2900691030 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $615,660 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $615,660 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 14,600 |
| **Building Code:** | R2900691120 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $113,521 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $113,521 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,800 |
| **Building Code:** | R2900691510 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $860,237 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $860,237 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 20,400 |
| **Building Code:** | R2900691520 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $125,471 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $125,471 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,200 |
| **Building Code:** | R2900691530 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $125,471 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $125,471 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,200 |
| **Building Code:** | R2900691540 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $143,395 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $143,395 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,800 |
| **Building Code:** | R2900691550 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $129,055 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $129,055 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,320 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900691560 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $129,055 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $129,055 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,320 |
| **Building Code:** | R2900691570 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $423,793 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $423,793 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 10,050 |
| **Building Code:** | R2900691580 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $143,395 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $143,395 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,800 |
| **Building Code:** | R2900691590 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $125,471 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $125,471 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,200 |
| **Building Code:** | R2900691600 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $143,395 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $143,395 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,800 |
| **Building Code:** | R2900691610 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $177,108 |
| **Building Name:** | Lodging House | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $177,108 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,200 |
| **Building Code:** | R2900691750 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $130,146 |
| **Building Name:** | Fort Snelling SP Up Bluff Clubhouse | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $35,867 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 700 |
| **Building Code:** | R2900691780 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $122,126 |
| **Building Name:** | Fort Snelling Golf Course Cold Stor | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $53,274 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,000 |
| **Building Code:** | R2900691820 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $157,693 |
| **Building Name:** | Fort Snelling Golf Course Cold Stor | **Address:** | 101 SNELLING LAKE RD | **Deferred Maintenance:** | $66,456 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,000 |

### *Site: R290021 - Frontenac State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500430 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $11,164 |
| **Building Name:** | Frontenac SP Trails Center | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,978 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 152 |
| **Building Code:** | R2900500460 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,008 |
| **Building Name:** | Frontenac SP Wood Cold Storage | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,040 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 149 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500470 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $204,137 |
| **Building Name:** | Frontenac SP Picnic Area Sanitation | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $73,457 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 979 |
| **Building Code:** | R2900500480 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $190,209 |
| **Building Name:** | Frontenac SP CG Sanitation | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $88,678 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 668 |
| **Building Code:** | R2900500490 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $22,344 |
| **Building Name:** | Frontenac SP Grp CG Old Picnic Shel | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $16,758 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 209 |
| **Building Code:** | R2900502070 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $122,798 |
| **Building Name:** | Frontenac SP Shop | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $19,427 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 1,792 |
| **Building Code:** | R2900502630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,313 |
| **Building Name:** | Frontenac SP CG Site 1 Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $1,869 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,105 |
| **Building Name:** | Frontenac SP Walk-in CG Vault Toil | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,902 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,482 |
| **Building Name:** | Frontenac SP CG Ste 39 Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,250 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,554 |
| **Building Name:** | Frontenac SP Grp CG Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,743 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,921 |
| **Building Name:** | Frontenac SP Grp CG Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,451 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,080 |
| **Building Name:** | Frontenac SP CG ADA Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,303 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,354 |
| **Building Name:** | Frontenac SP Picnic Ar Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $1,934 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503750 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $260,490 |
| **Building Name:** | Frontenac SP Contact Station | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $35,145 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 1,389 |
| **Building Code:** | R2900504360 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $36,310 |
| **Building Name:** | Frontenac SP Grp CG New Picnic Shel | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $5,967 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 328 |
| **Building Code:** | R2900504370 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $493,986 |
| **Building Name:** | Frontenac SP Main Shop | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $41,272 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 4,515 |
| **Building Code:** | R2900504380 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,878 |
| **Building Name:** | Frontenac SP Picnic Area Shelter 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $1,314 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 150 |
| **Building Code:** | R2900504600 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $10,557 |
| **Building Name:** | Frontenac SP Sled Hill Adirondack | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $2,327 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900504620 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,664 |
| **Building Name:** | Frontenac SP Sand Pt Trl Adirondack | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $6,268 |
| **Facility Condition Index:** | 0.54 - Crisis | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900505390 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $12,472 |
| **Building Name:** | Frontenac SP Picnic Shelter 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $319 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 125 |

### *Site: R290022 - Glacial Lakes State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102210 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $142,796 |
| **Building Name:** | Glacial Lakes SP Grp CG Picnic Shel | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $14,280 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 1,152 |
| **Building Code:** | R2900102220 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $132,846 |
| **Building Name:** | Glacial Lakes SP Swimming Area San | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $59,411 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | STARBUCK | **Ext. Gross Area:** | 432 |
| **Building Code:** | R2900102230 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $159,284 |
| **Building Name:** | Glacial Lakes SP Lower CG San Bldg | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $44,205 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 640 |
| **Building Code:** | R2900102270 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,802 |
| **Building Name:** | Glacial Lakes SP Grp CG Pumphouse | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $4,659 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | STARBUCK | **Ext. Gross Area:** | 37 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102280 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $36,214 |
| **Building Name:** | Glacial Lakes SP Lower CG Pumphouse | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $9,201 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 121 |
| **Building Code:** | R2900102290 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $156,810 |
| **Building Name:** | Glacial Lakes SP Shop | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $42,189 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 1,538 |
| **Building Code:** | R2900105770 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,715 |
| **Building Name:** | Glacial Lakes SP Hill BP Mens Vault | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $972 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900105780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,715 |
| **Building Name:** | Glacial Lakes SP Hill BP Women Valt | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $972 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900105790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,834 |
| **Building Name:** | Glacial Lakes Grp CG SE Picnic Valt | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $1,940 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900105800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,834 |
| **Building Name:** | Glacial Lakes Grp CG SE Picnic Vlt2 | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $2,796 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900106660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,014 |
| **Building Name:** | Glacial Lakes SP Lowr CG Vault Toil | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $1,701 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,784 |
| **Building Name:** | Glacial Lakes SP Oakridge CG Vault | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $1,956 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106680 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,014 |
| **Building Name:** | Glacial Lakes SP Oakridge Vault 2 | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $2,032 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106690 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,014 |
| **Building Name:** | Glacial Lakes SP Beach Park Vault | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $2,032 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107260 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $442,771 |
| **Building Name:** | Glacial Lakes SP Residence | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $74,741 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | STARBUCK | **Ext. Gross Area:** | 2,880 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107820 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $274,881 |
| **Building Name:** | Glacial Lakes SP Contact Sta | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $14,294 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 923 |
| **Building Code:** | R2900107830 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $135,062 |
| **Building Name:** | Glacial Lakes SP Shop Pole Building | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $10,042 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 1,536 |
| **Building Code:** | R2900107990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,073 |
| **Building Name:** | Glacial Lakes Horse CG Vault Toilet | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $1,993 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108250 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $58,651 |
| **Building Name:** | Glacial Lakes SP Coneflower Cabin | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $3,639 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900108260 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,195 |
| **Building Name:** | Glacial Lakes SP Wood Shed | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $1,904 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 112 |
| **Building Code:** | R2900108460 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $47,369 |
| **Building Name:** | Glacial Lakes SP Kettle Cabin | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $4,737 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108470 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $69,320 |
| **Building Name:** | Glacial Lakes SP Kame Cabin | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $6,932 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108480 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $72,149 |
| **Building Name:** | Glacial Lakes SP Esker Cabin | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $7,215 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108490 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $72,149 |
| **Building Name:** | Glacial Lakes SP Glacial Erractic | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $7,215 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108540 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $21,732 |
| **Building Name:** | Glacial Lakes Upr CG Vault Concret | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $435 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | STARBUCK | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900108570 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,339 |
| **Building Name:** | Glacial Lakes SP Friends Cabin | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $9,235 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | STARBUCK | **Ext. Gross Area:** | 264 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900109220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,125 |
| **Building Name:** | Glacial Lakes SP Baby Lake Pit | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $701 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | STARBUCK | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900109230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,125 |
| **Building Name:** | Glacial Lakes SP Kettle Lake Pit | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $701 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | STARBUCK | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900109240 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,125 |
| **Building Name:** | Glacial Lakes SP Oak Backpack Pit | **Address:** | 25022 CO RD 41 | **Deferred Maintenance:** | $701 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | STARBUCK | **Ext. Gross Area:** | 16 |

### *Site: R290023 - Glendalough State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $110,075 |
| **Building Name:** | Glendalough Lakeside Carriage Hse | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $79,365 |
| **Facility Condition Index:** | 0.72 - Crisis | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 912 |
| **Building Code:** | R2900106060 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $583,177 |
| **Building Name:** | Glendalough Lakeside Trails Center | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $97,039 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 2,361 |
| **Building Code:** | R2900106080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $523,656 |
| **Building Name:** | Glendalough Lakeside Lodge | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $68,028 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 1,965 |
| **Building Code:** | R2900106090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $239,440 |
| **Building Name:** | Glendalough Game F Seed drying bldg | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $68,397 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 2,156 |
| **Building Code:** | R2900106100 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $92,508 |
| **Building Name:** | Glendalough Game Farm Metal Storage | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $20,779 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 1,456 |
| **Building Code:** | R2900106120 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $199,216 |
| **Building Name:** | Glendalough Game F Seed Proces Bldg | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $36,876 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | R2900106260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,622 |
| **Building Name:** | Glendalough Walk-in CG Vault Toilet | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $1,933 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106270 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $81,526 |
| **Building Name:** | Glendalough SP Walk-in CG Cabin 12 | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $8,153 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 299 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106280 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $81,526 |
| **Building Name:** | Glendalough SP Walk-in CG Cabin 6 | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $8,153 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 299 |
| **Building Code:** | R2900106290 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $81,526 |
| **Building Name:** | Glendalough SP Walk-in CG Cabin 10 | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $8,153 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 299 |
| **Building Code:** | R2900106300 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $130,375 |
| **Building Name:** | Glendalough SP Walk-in CG San Bldg | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $16,983 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900106310 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $81,526 |
| **Building Name:** | Glendalough SP Walk-in CG Cabin 3 | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $8,153 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 299 |
| **Building Code:** | R2900106320 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $16,417 |
| **Building Name:** | Glendalough Walk-in CG Cold Storage | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $1,642 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 106 |
| **Building Code:** | R2900106330 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $58,227 |
| **Building Name:** | Glendalough MStark Picnic Shelter 1 | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $5,823 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 928 |
| **Building Code:** | R2900106870 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $43,317 |
| **Building Name:** | Glendalough Lakeside Electric Shed | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $15,778 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900106880 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,315 |
| **Building Name:** | Glendalough SP Old Wood Storage | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $4,434 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900106890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,622 |
| **Building Name:** | Glendalough MStark Picnic Ar Vault | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $2,354 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900108000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,933 |
| **Building Name:** | Glendalough Canoe-in CG Vault Toil | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $1,073 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108390 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $126,169 |
| **Building Name:** | Glendalough Game F West Metal Bldg | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $67,424 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 2,040 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108620 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $446,188 |
| **Building Name:** | Glendalough SP Game Farm Office | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $45,018 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 1,850 |
| **Building Code:** | R2900108630 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $159,061 |
| **Building Name:** | Glendalough SP Info Center | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $15,906 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 1,024 |
| **Building Code:** | R2900109190 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $49,079 |
| **Building Name:** | Glendalough Canoe-in CG Yurt | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $4,908 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 256 |
| **Building Code:** | R2900109200 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $68,329 |
| **Building Name:** | Glendalough Canoe-in CG ADA Yurt | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $6,833 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 370 |
| **Building Code:** | R2900109260 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $10,472 |
| **Building Name:** | Glendalough Walk-in CG Wood Storage | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $1,065 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 290 |
| **Building Code:** | R2900109470 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,720 |
| **Building Name:** | Glendalough MStark Picnic Pumphouse | **Address:** | 24869 WHITETAIL LN | **Deferred Maintenance:** | $372 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 48 |

### *Site: R290024 - Gooseberry Falls State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202050 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $1,332,520 |
| **Building Name:** | Gooseberry Falls SP Sanitation | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $137,260 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 3,082 |
| **Building Code:** | R2900202060 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $65,182 |
| **Building Name:** | Gooseberry Falls SP Icehouse | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $6,599 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 328 |
| **Building Code:** | R2900202080 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $142,631 |
| **Building Name:** | Gooseberry F CG Cold H20 Sanitation | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $77,878 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 394 |
| **Building Code:** | R2900202090 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $980,898 |
| **Building Name:** | Gooseberry Falls SP Recreation Hall | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $102,791 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 1,679 |
| **Building Code:** | R2900202100 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $1,071,799 |
| **Building Name:** | Gooseberry Falls Lakeview Shelter | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $84,171 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 1,740 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202110 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $115,381 |
| **Building Name:** | Gooseberry Falls SP Pump House | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $11,538 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900202130 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $263,136 |
| **Building Name:** | Gooseberry Falls SP Trickle Filter | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $28,730 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 915 |
| **Building Code:** | R2900202140 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $173,782 |
| **Building Name:** | Gooseberry Falls Concourse San Bldg | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $7,523 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 600 |
| **Building Code:** | R2900202160 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $134,861 |
| **Building Name:** | Gooseberry Falls SP Well House | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $25,127 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 221 |
| **Building Code:** | R2900202170 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $723,955 |
| **Building Name:** | Gooseberry Falls SP Residence | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $93,161 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 2,236 |
| **Building Code:** | R2900202180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $717,046 |
| **Building Name:** | Gooseberry Falls SP Office Shp | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $89,684 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 4,947 |
| **Building Code:** | R2900202200 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,547,802 |
| **Building Name:** | Gooseberry Falls SP Old Visitor Ctr | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $260,737 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 4,298 |
| **Building Code:** | R2900202230 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $117,482 |
| **Building Name:** | Gooseberry Falls SP Caretaker Cabin | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $50,730 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 311 |
| **Building Code:** | R2900202250 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $71,201 |
| **Building Name:** | Gooseberry Falls GG Stone Shelter | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $20,842 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 228 |
| **Building Code:** | R2900202260 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $26,272 |
| **Building Name:** | Gooseberry Falls 5th Falls Shelter | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $13,596 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 152 |
| **Building Code:** | R2900202270 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $26,272 |
| **Building Name:** | Gooseberry Falls SP GG Log Shelter | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $13,596 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 152 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202290 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $94,487 |
| **Building Name:** | Gooseberry Falls SP Water Tower | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $40,224 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 259 |
| **Building Code:** | R2900203950 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $22,531 |
| **Building Name:** | Gooseberry Falls SP Incinerator | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $15,764 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900203990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $63,687 |
| **Building Name:** | Gooseberry Falls Residence Garage | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $12,395 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 586 |
| **Building Code:** | R2900204340 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $520,105 |
| **Building Name:** | Gooseberry Falls SP Sanitation | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $48,257 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 1,202 |
| **Building Code:** | R2900204530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $702,632 |
| **Building Name:** | Gooseberry Falls SP Cold Storage | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $82,860 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 4,284 |
| **Building Code:** | R2900205450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Gooseberry Falls SP Vault Toilet | **Address:** | 3206 Hwy 61 | **Deferred Maintenance:** | $1,964 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | Two Harbors | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Gooseberry Falls SP Vault Toilet | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $2,714 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,997 |
| **Building Name:** | Gooseberry Falls Low CG Vault Toil | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $625 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900205490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,997 |
| **Building Name:** | Gooseberry Falls Up CG Vault Toilet | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $625 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900205550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Gooseberry Falls SP Vault Toilet | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $1,964 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900207540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $21,668 |
| **Building Name:** | Gooseberry Falls SP Wood Storage | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $803 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 259 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207580 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $3,947,911 |
| **Building Name:** | Gooseberry Falls SP Visitor Cr | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $611,290 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 11,779 |
| **Building Code:** | R2900207620 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $101,878 |
| **Building Name:** | Gooseberry Falls SP Contct Sta | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $4,229 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 447 |
| **Building Code:** | R2900207900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,997 |
| **Building Name:** | Gooseberry Falls Grp CG Vault Toil | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $1,671 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900207910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,997 |
| **Building Name:** | Gooseberry Falls Grp CG Vault Toil | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $1,671 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900207920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,997 |
| **Building Name:** | Gooseberry Falls Grp CG Vault Toil | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $1,144 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900210340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $26,411 |
| **Building Name:** | Gooseberry Falls CG Vault Concrete | **Address:** | 3206 HWY 61 | **Deferred Maintenance:** | $528 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 42 |

### *Site: R290025 - Grand Portage State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208150 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | Grand Portage SP Vault Toilet | **Address:** | 9393 E HWY 61 | **Deferred Maintenance:** | $3,047 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | GRAND PORTAGE | **Ext. Gross Area:** | 41 |
| **Building Code:** | R2900209020 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,200,437 |
| **Building Name:** | Grand Portage SP Interp Ctr | **Address:** | 9393 E HWY 61 | **Deferred Maintenance:** | $44,009 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND PORTAGE | **Ext. Gross Area:** | 6,057 |
| **Building Code:** | R2900210200 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $20,313 |
| **Building Name:** | Grand Portage SP Recycle Center | **Address:** | 9393 E HWY 61 | **Deferred Maintenance:** | $537 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | GRAND PORTAGE | **Ext. Gross Area:** | 253 |
| **Building Code:** | R2900210210 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $45,020 |
| **Building Name:** | Grand Portage SP Picnic Shelter 1 | **Address:** | 9393 E HWY 61 | **Deferred Maintenance:** | $900 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND PORTAGE | **Ext. Gross Area:** | 415 |
| **Building Code:** | R2900210490 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $103,933 |
| **Building Name:** | Grand Portage SP Garage | **Address:** | 9393 E HWY 61 | **Deferred Maintenance:** | $2,079 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND PORTAGE | **Ext. Gross Area:** | 576 |

### *Site: R290026 - Great River Bluffs State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500880 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,388 |
| **Building Name:** | Great River Bluffs SP Pump House | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $4,747 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | WINONA | **Ext. Gross Area:** | 67 |
| **Building Code:** | R2900500920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $109,966 |
| **Building Name:** | Great River Bluffs SP Shop | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $65,790 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | WINONA | **Ext. Gross Area:** | 1,166 |
| **Building Code:** | R2900502640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,588 |
| **Building Name:** | Great River Bluffs CG Vault Toilet | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $2,281 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WINONA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,588 |
| **Building Name:** | Great River Bluffs CG Vault Toilet | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $2,281 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WINONA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900502660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,588 |
| **Building Name:** | Great River Bluffs CG Vault Toilet | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $2,165 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WINONA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900503760 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $232,735 |
| **Building Name:** | Great River Bluffs SP CG Sanitation | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $37,768 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WINONA | **Ext. Gross Area:** | 749 |
| **Building Code:** | R2900505050 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,103 |
| **Building Name:** | Great River Bluffs SP Adirondack | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $2,674 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WINONA | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900505070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,128 |
| **Building Name:** | Great River Bluffs SP Vault Concret | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $3,413 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WINONA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900505280 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $219,459 |
| **Building Name:** | Great River Bluffs SP Cold Storage | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $24,290 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WINONA | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | R2900505410 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $50,967 |
| **Building Name:** | Great River Bluffs SP Info Center | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $1,523 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | WINONA | **Ext. Gross Area:** | 654 |
| **Building Code:** | R2900505420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,061 |
| **Building Name:** | Great River Bluffs SP Vault Concret | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $661 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WINONA | **Ext. Gross Area:** | 62 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,061 |
| **Building Name:** | Great River Bluffs SP Vault Concret | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $661 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WINONA | **Ext. Gross Area:** | 62 |
| **Building Code:** | R2900505440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,061 |
| **Building Name:** | Great River Bluffs SP Vault Concret | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $661 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WINONA | **Ext. Gross Area:** | 62 |
| **Building Code:** | R2900505470 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $720,245 |
| **Building Name:** | Great River Bluffs SP Office | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $16,941 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WINONA | **Ext. Gross Area:** | 2,326 |
| **Building Code:** | R2900505580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,664 |
| **Building Name:** | Great River Bluffs SP Vault Concret | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $373 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WINONA | **Ext. Gross Area:** | 35 |

### *Site: R290027 - Hayes Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102160 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $392,693 |
| **Building Name:** | Hayes Lake SP Residence | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $53,831 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 2,288 |
| **Building Code:** | R2900102170 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $88,802 |
| **Building Name:** | Hayes Lake SP HQ Cold Storage | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $35,212 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 494 |
| **Building Code:** | R2900102180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $104,753 |
| **Building Name:** | Hayes Lake SP HQ Cold Storage | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $15,460 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900102190 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $201,963 |
| **Building Name:** | Hayes Lake SP HQ Area Shop | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $44,139 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900104330 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $471,874 |
| **Building Name:** | Hayes Lake SP CG Sanitation | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $95,184 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 1,280 |
| **Building Code:** | R2900104340 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,064 |
| **Building Name:** | Hayes Lake SP Pump House | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $2,035 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900104730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,152 |
| **Building Name:** | Hayes Lake Picnic Area Vault Toilet | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $2,037 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 24 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,383 |
| **Building Name:** | Hayes Lake Picnic Area Vault Toilet | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $1,310 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900104750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,383 |
| **Building Name:** | Hayes Lake SP Mens Vault Toilet | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $2,255 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900104760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,152 |
| **Building Name:** | Hayes Lake SP CG Vault Toilet | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $2,037 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900105290 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $58,259 |
| **Building Name:** | Hayes Lake SP Fish Cleaning House | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $24,245 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900105530 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,426 |
| **Building Name:** | Hayes Lake SP Fire Tower | **Address:** | RIVER | **Deferred Maintenance:** | $10,820 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | WANNASKA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900105940 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $51,127 |
| **Building Name:** | Hayes Lake SP CG Timber Edge Cabin | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $5,113 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900105950 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $47,052 |
| **Building Name:** | Hayes Lake SP Lakeside Cabin | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $5,101 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900106200 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $72,935 |
| **Building Name:** | Hayes Lake Picnic Area Shelter 2 | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $7,294 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900106440 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $48,129 |
| **Building Name:** | Hayes Lake SP Residence Garage | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $6,034 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900106550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,050 |
| **Building Name:** | Hayes Lake SP CG Vault Toilet | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $1,605 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900107810 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $213,495 |
| **Building Name:** | Hayes Lake SP Contact Station | **Address:** | 48990 CTY RD 4 | **Deferred Maintenance:** | $21,350 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 796 |

***Site: R290028 - Hill Annex Mine State Park***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204750 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,461 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $5,056 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900204760 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $1,518,694 |
| **Building Name:** | Hill Annex Mine SP Clubhouse | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $341,740 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 7,535 |
| **Building Code:** | R2900204770 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,336 |
| **Building Name:** | Hill Annex Mine SP Old Contact Sta | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $6,203 |
| **Facility Condition Index:** | 0.98 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900204780 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $939,826 |
| **Building Name:** | Hill Annex Mine SP Office | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $432,186 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 3,140 |
| **Building Code:** | R2900204790 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $825,429 |
| **Building Name:** | Hill Annex Mine SP Electric Shop | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $423,319 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 4,059 |
| **Building Code:** | R2900204800 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,214 |
| **Building Name:** | Hill Annex Mine SP Pay Master Shed | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $2,955 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 85 |
| **Building Code:** | R2900204810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,857 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $2,593 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900204820 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $17,139 |
| **Building Name:** | Hill Annex Mine SP Water Tower | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $12,854 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 92 |
| **Building Code:** | R2900204830 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,118 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $4,659 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 115 |
| **Building Code:** | R2900204840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,911 |
| **Building Name:** | Hill Annex Mine SP Blasting Shed | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $1,621 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900204850 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,767 |
| **Building Name:** | Hill Annex Mine SP Shed | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $6,708 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 66 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204860 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $222,751 |
| **Building Name:** | Hill Annex Mine SP Garage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $89,841 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 1,722 |
| **Building Code:** | R2900204870 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,907 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $4,259 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 91 |
| **Building Code:** | R2900204880 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,894,396 |
| **Building Name:** | Hill Annex Mine SP 7-Stall Garage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $1,226,362 |
| **Facility Condition Index:** | 0.65 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 14,405 |
| **Building Code:** | R2900204890 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,312,391 |
| **Building Name:** | Hill Annex Mine SP Repair Shop | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $2,169,035 |
| **Facility Condition Index:** | 0.65 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 13,787 |
| **Building Code:** | R2900204900 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $307,921 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $78,652 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 2,556 |
| **Building Code:** | R2900204910 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,160,041 |
| **Building Name:** | Hill Annex Mine SP Ore Crush Bldg | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $646,734 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 10,276 |
| **Building Code:** | R2900204920 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,734 |
| **Building Name:** | Hill Annex Mine SP Shed | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $27,579 |
| **Facility Condition Index:** | 0.82 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900204930 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,360 |
| **Building Name:** | Hill Annex Mine SP Shed | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $25,094 |
| **Facility Condition Index:** | 0.83 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900204940 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $257,321 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $97,007 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 2,112 |
| **Building Code:** | R2900204950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,818 |
| **Building Name:** | Hill Annex Mine SP Garage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $20,850 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 490 |
| **Building Code:** | R2900204960 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,488 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $24,602 |
| **Facility Condition Index:** | 0.81 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 290 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204970 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $20,248 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $6,682 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 280 |
| **Building Code:** | R2900204980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,822 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $16,841 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 462 |
| **Building Code:** | R2900204990 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $48,518 |
| **Building Name:** | Hill Annex Mine SP Old Office | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $47,499 |
| **Facility Condition Index:** | 0.98 - Crisis | **City Code:** | CALUMET | **Ext. Gross Area:** | 173 |
| **Building Code:** | R2900205000 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,643 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $6,482 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900205010 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,732 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $4,862 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900205020 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,420 |
| **Building Name:** | Hill Annex Mine SP Shed | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $1,458 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900205030 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $1,964 |
| **Building Name:** | Hill Annex Mine SP HazMat Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $648 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 16 |
| **Building Code:** | R2900205040 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $10,317 |
| **Building Name:** | Hill Annex Mine SP Office | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $3,405 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900205050 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205060 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205070 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900205080 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205090 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205100 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205110 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,945 |
| **Building Name:** | Hill Annex Mine SP Pump House | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $8,892 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205120 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,976 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $3,292 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900205130 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,976 |
| **Building Name:** | Hill Annex Mine SP Cold Storage | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $3,292 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALUMET | **Ext. Gross Area:** | 120 |

### *Site: R290029 - Interstate State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301260 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $163,214 |
| **Building Name:** | Interstate SP Office | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $21,049 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 804 |
| **Building Code:** | R2900301270 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $43,276 |
| **Building Name:** | Interstate SP Pump House | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $11,925 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900301280 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $145,413 |
| **Building Name:** | Interstate SP Pothole Cold Storage | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $27,216 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 352 |
| **Building Code:** | R2900301340 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $233,746 |
| **Building Name:** | Interstate SP Pothole Concession | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $64,540 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,637 |
| **Building Code:** | R2900301350 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $427,069 |
| **Building Name:** | Interstate SP Pothole Interp Center | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $76,938 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,600 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301440 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $357,091 |
| **Building Name:** | Interstate SP Picnic Shelter 2 | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $49,838 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,750 |
| **Building Code:** | R2900301450 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $682,559 |
| **Building Name:** | Interstate SP Campground Sanitation | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $240,672 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,770 |
| **Building Code:** | R2900303250 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $359,117 |
| **Building Name:** | Interstate SP Shop | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $114,108 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,807 |
| **Building Code:** | R2900303460 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $424,812 |
| **Building Name:** | Interstate SP Sanitation | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $76,586 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,100 |
| **Building Code:** | R2900303800 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $215,286 |
| **Building Name:** | Interstate SP Picnic Shelter 2 | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $27,857 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,007 |
| **Building Code:** | R2900304100 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,033 |
| **Building Name:** | Interstate SP Oil House | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $2,573 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900306280 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $39,904 |
| **Building Name:** | Interstate SP Cold Storage | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $4,893 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900306920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $143,898 |
| **Building Name:** | Interstate SP Cold Storage | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $20,464 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900307380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $51,825 |
| **Building Name:** | Interstate SP Vault Toilet Concrete | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $5,183 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900307420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,004 |
| **Building Name:** | Interstate SP Vault Toilet | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $572 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,004 |
| **Building Name:** | Interstate SP Vault Toilet | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $572 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 47 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308240 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,913 |
| **Building Name:** | Interstate Group CG Vault Concrete | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 51 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308250 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,913 |
| **Building Name:** | Interstate Group CG Vault Concrete | **Address:** | 307 MILLTOWN RD | **Deferred Maintenance:** | $518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 51 |

### *Site: R290030 - Itasca State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100150 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Itasca Pine Rdg CG Pine E Uni Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Itasca Pine Rdg CG Poplar E Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Itasca Pine Rdg CG Poplar W Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Itasca Pine Rdg CG Pine W Uni Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Itasca Bear Paw CG Ice House Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Itasca Bear Paw CG Walk-in Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $3,128 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100250 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $125,554 |
| **Building Name:** | Itasca SP Boat Shop Log Picnic Shel | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $14,761 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 867 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100270 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,057 |
| **Building Name:** | Itasca SP Tower Area Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $3,649 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100290 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,526 |
| **Building Name:** | Itasca SP Red Pine/Ozawi Adirondack | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,494 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 111 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100300 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $5,803 |
| **Building Name:** | Itasca SP Desoto/Eagle Adirondack | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,423 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 111 |
| **Building Code:** | R2900100310 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,526 |
| **Building Name:** | Itasca SP Deer Prk/Alton Adirondack | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,046 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 111 |
| **Building Code:** | R2900100940 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,023 |
| **Building Name:** | Itasca SP McKay Lake Adirondack | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $3,017 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 111 |
| **Building Code:** | R2900100970 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $15,366 |
| **Building Name:** | Itasca SP Aiton Heights Fire Tower | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,537 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900101370 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $420,978 |
| **Building Name:** | Itasca SP Old HQ Office | **Address:** | 27841 FOREST LN | **Deferred Maintenance:** | $77,527 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,926 |
| **Building Code:** | R2900101380 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $82,876 |
| **Building Name:** | Itasca SP Old HQ Residence Garage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $11,768 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 565 |
| **Building Code:** | R2900101390 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $2,098,903 |
| **Building Name:** | Itasca SP Residence | **Address:** | 27859 FOREST LN | **Deferred Maintenance:** | $284,754 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,118 |
| **Building Code:** | R2900101400 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $225,313 |
| **Building Name:** | Itasca SP Picnic Sanitation | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $38,249 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 481 |
| **Building Code:** | R2900101410 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $496,397 |
| **Building Name:** | Itasca SP Museum | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $71,094 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,887 |
| **Building Code:** | R2900101430 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $968,629 |
| **Building Name:** | Itasca SP Beach Bath House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $120,011 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,516 |
| **Building Code:** | R2900101450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $100,678 |
| **Building Name:** | Itasca SP Boat House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $22,829 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,019 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101460 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $156,426 |
| **Building Name:** | Itasca SP Ozawindib Lake Cabin | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $28,528 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 697 |
| **Building Code:** | R2900101470 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $621,134 |
| **Building Name:** | Itasca SP Ozawindib Dining Hall | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $81,775 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,218 |
| **Building Code:** | R2900101490 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $293,155 |
| **Building Name:** | Itasca SP Ozawindib Rental Cabin | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $73,362 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 870 |
| **Building Code:** | R2900101500 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,137 |
| **Building Name:** | Itasca SP Douglas Clubhouse Storage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $718 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 19 |
| **Building Code:** | R2900101510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $30,989 |
| **Building Name:** | Itasca SP North Contact Station | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $6,628 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 123 |
| **Building Code:** | R2900101550 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $1,155,212 |
| **Building Name:** | Itasca SP Youth Hostel | **Address:** | 27910 FOREST LN | **Deferred Maintenance:** | $371,107 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 7,173 |
| **Building Code:** | R2900101560 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $312,968 |
| **Building Name:** | Itasca Cardboard Recycling Storage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $62,365 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,616 |
| **Building Code:** | R2900101570 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $109,446 |
| **Building Name:** | Itasca SP Boat Shop 3-Stall Garage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $25,809 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 945 |
| **Building Code:** | R2900101580 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $78,227 |
| **Building Name:** | Itasca SP Boat Shop Lumber Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $21,119 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,240 |
| **Building Code:** | R2900101590 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,744 |
| **Building Name:** | Itasca SP Bike Rental Pump Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $3,102 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 37 |
| **Building Code:** | R2900101600 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,553,435 |
| **Building Name:** | Itasca SP Shop | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $359,352 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 8,958 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $41,933 |
| **Building Name:** | Itasca SP Boat Shop Oil House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $14,725 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900101620 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $206,487 |
| **Building Name:** | Itasca SP Boat Shop Plumbers Shop | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $50,491 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,036 |
| **Building Code:** | R2900101630 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $159,168 |
| **Building Name:** | Itasca SP CCC Water Tower Shop Yard | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $26,226 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 331 |
| **Building Code:** | R2900101640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $178,024 |
| **Building Name:** | Itasca SP Boat Shop 5-Stall Garage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $21,746 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,519 |
| **Building Code:** | R2900101650 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $347,657 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 16 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $65,111 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 880 |
| **Building Code:** | R2900101660 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $120,068 |
| **Building Name:** | Itasca Pine Ridge CG Contact Sta | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $23,607 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 342 |
| **Building Code:** | R2900101670 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $920,850 |
| **Building Name:** | Itasca Bear Paw CG Old Store | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $61,006 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,921 |
| **Building Code:** | R2900101680 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $340,891 |
| **Building Name:** | Itasca Bear Paw CG South Sanitation | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $99,108 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 443 |
| **Building Code:** | R2900101690 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $928,335 |
| **Building Name:** | Itasca Bear Paw CG Shower/Toilet | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $121,115 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,606 |
| **Building Code:** | R2900101700 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $175,190 |
| **Building Name:** | Itasca Bear Paw CG North Sanitation | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $42,893 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 280 |
| **Building Code:** | R2900101710 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $63,674 |
| **Building Name:** | Itasca Bear Paw CG Old Log Pumphse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $17,964 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 159 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101720 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $122,638 |
| **Building Name:** | Itasca Bear Paw CG Ice House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $30,046 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 830 |
| **Building Code:** | R2900101730 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,487 |
| **Building Name:** | Itasca Bear Paw CG Fish Cleang Hse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $15,210 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 187 |
| **Building Code:** | R2900101740 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $132,759 |
| **Building Name:** | Itasca SP Bear Paw Cabin 1 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $30,337 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 362 |
| **Building Code:** | R2900101750 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $144,612 |
| **Building Name:** | Itasca SP Bear Paw Cabin 2 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $30,218 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 363 |
| **Building Code:** | R2900101760 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $120,228 |
| **Building Name:** | Itasca SP Bear Paw Cabin 3 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $24,890 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 363 |
| **Building Code:** | R2900101770 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $144,558 |
| **Building Name:** | Itasca SP Bear Paw Cabin 4 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $31,886 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 363 |
| **Building Code:** | R2900101780 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $144,558 |
| **Building Name:** | Itasca SP Bear Paw Cabin 5 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $30,955 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 363 |
| **Building Code:** | R2900101790 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $144,558 |
| **Building Name:** | Itasca SP Bear Paw Cabin 6 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $32,242 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 363 |
| **Building Code:** | R2900101800 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $173,591 |
| **Building Name:** | Itasca Pine Ridge CG Pump House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $18,644 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 414 |
| **Building Code:** | R2900101810 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $245,690 |
| **Building Name:** | Itasca Pine Rdg CG Oak Loop San Bld | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $68,620 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 670 |
| **Building Code:** | R2900101830 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $247,731 |
| **Building Name:** | Itasca Pine Rdg CG Maple Loop San | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $56,501 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 670 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101850 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,344 |
| **Building Name:** | Itasca SP Old HQ 2-Stall Garage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $10,548 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 634 |
| **Building Code:** | R2900101910 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,542,044 |
| **Building Name:** | Itasca SP Douglas Lodge Forest Inn | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $308,815 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 6,721 |
| **Building Code:** | R2900101920 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $290,779 |
| **Building Name:** | Itasca SP Forest Inn Stone Toilet | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $53,252 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 422 |
| **Building Code:** | R2900101930 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $1,902,397 |
| **Building Name:** | Itasca SP Douglas Lodge Dormitory | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $304,984 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 5,655 |
| **Building Code:** | R2900101940 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $5,007,749 |
| **Building Name:** | Itasca SP Douglas Lodge | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $807,253 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 14,548 |
| **Building Code:** | R2900101950 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $1,331,358 |
| **Building Name:** | Itasca SP Douglas Nicollet Court | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $760,302 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 8,280 |
| **Building Code:** | R2900101960 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $678,878 |
| **Building Name:** | Itasca SP Douglas Lodge Fourplex | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $90,246 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,100 |
| **Building Code:** | R2900101970 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $1,272,985 |
| **Building Name:** | Itasca SP Douglas Lodge Clubhouse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $154,891 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,715 |
| **Building Code:** | R2900101980 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $309,766 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 11 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $53,962 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 769 |
| **Building Code:** | R2900101990 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $110,740 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 1 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $25,390 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 512 |
| **Building Code:** | R2900102000 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $166,288 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 4 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $40,072 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 768 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102010 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $282,859 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 5 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $56,894 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 851 |
| **Building Code:** | R2900102020 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $413,249 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 6 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $70,540 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,280 |
| **Building Code:** | R2900102030 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $364,943 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 7 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $84,882 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,128 |
| **Building Code:** | R2900102040 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $271,541 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 8 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $54,647 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 810 |
| **Building Code:** | R2900102050 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $336,307 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 9 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $57,254 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,035 |
| **Building Code:** | R2900102060 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $379,098 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 10 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $64,933 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,184 |
| **Building Code:** | R2900102070 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $381,340 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 12 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $67,703 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,178 |
| **Building Code:** | R2900102080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $316,345 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 14 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $91,439 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 512 |
| **Building Code:** | R2900102090 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $110,672 |
| **Building Name:** | Itasca SP Douglas Lodge Cabin 15 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $27,574 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 512 |
| **Building Code:** | R2900102100 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $18,504 |
| **Building Name:** | Itasca SP Boat Shop Area Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $6,106 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 366 |
| **Building Code:** | R2900102110 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $156,907 |
| **Building Name:** | Itasca SP Douglas Lodge Pump House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $36,322 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 178 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102120 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $103,101 |
| **Building Name:** | Itasca SP Douglas Old Timers Cabin | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $11,473 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 455 |
| **Building Code:** | R2900102140 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,387 |
| **Building Name:** | Itasca Boat Landing Fish Cleang Hse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $7,017 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 167 |
| **Building Code:** | R2900102150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,452 |
| **Building Name:** | Itasca Pine Rdg CG Reg Wood Storage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $10,202 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 336 |
| **Building Code:** | R2900103380 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $606,781 |
| **Building Name:** | Itasca SP FOR Site Residence | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $76,893 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,424 |
| **Building Code:** | R2900103390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $411,759 |
| **Building Name:** | Itasca SP FOR 3-Stall Warehouse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $79,238 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,519 |
| **Building Code:** | R2900103420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $30,573 |
| **Building Name:** | Itasca SP FOR 1-Stall Garage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $10,089 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 267 |
| **Building Code:** | R2900103440 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $37,499 |
| **Building Name:** | Itasca SP FOR Pump House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $12,375 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 186 |
| **Building Code:** | R2900103450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $171,727 |
| **Building Name:** | Itasca SP FOR 4-Stall Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $37,592 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,561 |
| **Building Code:** | R2900104390 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $183,059 |
| **Building Name:** | Itasca Bear Paw Pumphouse by Cabins | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $22,572 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 292 |
| **Building Code:** | R2900104400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,681 |
| **Building Name:** | Itasca SP CG Registration Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,617 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 73 |
| **Building Code:** | R2900104410 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $109,927 |
| **Building Name:** | Itasca SP Boat Shop Wegmans Store | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $30,289 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 509 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104420 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,063 |
| **Building Name:** | Itasca SP Boat Shop Well Pump House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $7,764 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 205 |
| **Building Code:** | R2900104430 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $139,643 |
| **Building Name:** | Itasca SP Elk Lake CG Cabin | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $127,947 |
| **Facility Condition Index:** | 0.92 - Crisis | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 481 |
| **Building Code:** | R2900104440 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $44,879 |
| **Building Name:** | Itasca SP Elk Lake CG Dining Hall | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $14,810 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 533 |
| **Building Code:** | R2900104450 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $32,956 |
| **Building Name:** | Itasca SP Pumphouse on Lake Trail | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $18,346 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 221 |
| **Building Code:** | R2900104770 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,618 |
| **Building Name:** | Itasca SP Douglas Fish Cleaning Hse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $4,824 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900104780 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $14,109 |
| **Building Name:** | Itasca SP Water Tower Near Hostel | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $6,117 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 289 |
| **Building Code:** | R2900104820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,554 |
| **Building Name:** | Itasca SP Douglas Boat Tour U Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,493 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900104830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,169 |
| **Building Name:** | Itasca SP Boat Landing Unisex Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $3,026 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900104840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,624 |
| **Building Name:** | Itasca SP HW Mens Vault Near Picnic | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,516 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900104850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,624 |
| **Building Name:** | Itasca SP HW Wmn Vault Near Picnic | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,516 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900104860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,624 |
| **Building Name:** | Itasca SP Elk Lake CG Mens Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,516 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 24 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,624 |
| **Building Name:** | Itasca SP Elk Lake CG Womens Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,516 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900104880 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,072 |
| **Building Name:** | Itasca SP North Contact Sta Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,664 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900106140 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $75,361 |
| **Building Name:** | Itasca SP Nicolette Cabin | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $14,651 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 572 |
| **Building Code:** | R2900106220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $346,467 |
| **Building Name:** | Itasca SP Gift Warehouse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $48,531 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,943 |
| **Building Code:** | R2900106340 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $142,912 |
| **Building Name:** | Itasca SP Boat Shop Quonset Storage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $43,621 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 974 |
| **Building Code:** | R2900106530 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,255 |
| **Building Name:** | Itasca Pine Rdg CG Registra Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,694 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106540 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,255 |
| **Building Name:** | Itasca Pine Rdg CG Maple Loop Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,694 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106620 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,271 |
| **Building Name:** | Itasca SP Aiton Hts Fire Tower Cab | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $527 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900106630 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,462 |
| **Building Name:** | Itasca SP Lake Oza Cabin Wood Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $427 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900106640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,255 |
| **Building Name:** | Itasca SP Bison Kill Vault Toilet | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,069 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106650 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,417 |
| **Building Name:** | Itasca SP Ozawindib Well House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $915 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 16 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,255 |
| **Building Name:** | Itasca Pine Rdg CG Spruce E Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,069 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,255 |
| **Building Name:** | Itasca Pine Rdg CG Oak Loop Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,662 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106830 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $35,009 |
| **Building Name:** | Itasca SP Douglas Lodge Kiosk | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $3,501 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 360 |
| **Building Code:** | R2900107150 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $41,882 |
| **Building Name:** | Itasca SP Ozawindib Pumphouse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $4,429 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 200 |
| **Building Code:** | R2900107160 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $384,189 |
| **Building Name:** | Itasca Pine Rdg CG Spruce Loop San | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $43,224 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,154 |
| **Building Code:** | R2900107170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $797,784 |
| **Building Name:** | Itasca SP Douglas Admin Office | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $123,547 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,947 |
| **Building Code:** | R2900107180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,991 |
| **Building Name:** | Itasca SP Douglas Admin Pumphouse | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $11,702 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 563 |
| **Building Code:** | R2900107190 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,460,268 |
| **Building Name:** | Itasca SP Douglas Jacob Brower Ctr | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $387,826 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 13,489 |
| **Building Code:** | R2900107270 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $86,229 |
| **Building Name:** | Itasca SP Douglas East Contact Sta | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $10,029 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 265 |
| **Building Code:** | R2900107280 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $384,189 |
| **Building Name:** | Itasca Pine Rdg CG Pine Loop San | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $38,419 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,154 |
| **Building Code:** | R2900107590 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $791,187 |
| **Building Name:** | Itasca SP Douglas Lodge Suites 1 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $86,593 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 4,253 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107600 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $791,187 |
| **Building Name:** | Itasca SP Douglas Lodge Suites 2 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $86,593 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 4,253 |
| **Building Code:** | R2900107800 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $368,563 |
| **Building Name:** | Itasca SP Ozawindib Sanitation | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $36,856 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,121 |
| **Building Code:** | R2900107840 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $3,215,219 |
| **Building Name:** | Itasca SP HW Mary Gibbs Center | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $191,921 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 6,178 |
| **Building Code:** | R2900107900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,352 |
| **Building Name:** | Itasca SP ADA Vault Toilet | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,535 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900107910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,352 |
| **Building Name:** | Itasca SP ADA Vault Toilet | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,935 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,061 |
| **Building Name:** | Itasca SP HW Gibbs Well House | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,606 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900108280 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $25,194 |
| **Building Name:** | Itasca SP Doug Cabin 16 Screen Shel | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,519 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 166 |
| **Building Code:** | R2900108420 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $43,936 |
| **Building Name:** | Itasca SP Doug Refrigerated Storage | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $43,936 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 180 |

### *Site: R290031 - Jay Cooke State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200510 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,527 |
| **Building Name:** | Jay Cooke SP Shop/Recycling/Wood | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $7,567 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900200520 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $377,648 |
| **Building Name:** | Jay Cooke SP CG Sanitation Combo | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $121,101 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | CARLTON | **Ext. Gross Area:** | 1,229 |
| **Building Code:** | R2900200570 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,361,101 |
| **Building Name:** | Jay Cooke SP River Inn Interp Ctr | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $281,804 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 4,464 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200580 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $267,560 |
| **Building Name:** | Jay Cooke SP Oldenburg Sanitation | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $127,763 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | CARLTON | **Ext. Gross Area:** | 756 |
| **Building Code:** | R2900200590 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $451,279 |
| **Building Name:** | Jay Cooke Oldenburg Picnic Shelter | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $120,455 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 1,300 |
| **Building Code:** | R2900200600 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $86,995 |
| **Building Name:** | Jay Cooke SP Spring House | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $28,708 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CARLTON | **Ext. Gross Area:** | 195 |
| **Building Code:** | R2900200630 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $335,461 |
| **Building Name:** | Jay Cooke SP Historic Residence | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $190,303 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | CARLTON | **Ext. Gross Area:** | 1,258 |
| **Building Code:** | R2900203710 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $389,734 |
| **Building Name:** | Jay Cooke SP Shop | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $108,719 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 2,061 |
| **Building Code:** | R2900206740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,271 |
| **Building Name:** | Jay Cooke SP Grp CG Men Vault Toil | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,059 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CARLTON | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,271 |
| **Building Name:** | Jay Cooke SP Grp CG Wom Vault Toil | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,059 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CARLTON | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206770 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,271 |
| **Building Name:** | Jay Cooke SP Contact Sta Vault Toil | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,016 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CARLTON | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900207930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,150 |
| **Building Name:** | Jay Cooke SP CG Site 32 Vault Toil | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $944 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 41 |
| **Building Code:** | R2900207940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,150 |
| **Building Name:** | Jay Cooke SP CG Site 76 Vault Toil | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $944 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 41 |
| **Building Code:** | R2900207950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,150 |
| **Building Name:** | Jay Cooke SP CG Site 78 Vault Toil | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $944 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 41 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | Jay Cooke SP CG Vault Toilet | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $1,080 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900208640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,257 |
| **Building Name:** | Jay Cooke SP CG Vault Toilet | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $1,426 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900208800 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $809,718 |
| **Building Name:** | Jay Cooke SP Contact Station | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $80,103 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 2,173 |
| **Building Code:** | R2900208810 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $35,865 |
| **Building Name:** | Jay Cooke SP HQ Wood Shed | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $2,004 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900208940 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $76,858 |
| **Building Name:** | Jay Cooke SP CG Slate Cabin | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,113 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 335 |
| **Building Code:** | R2900208950 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $76,858 |
| **Building Name:** | Jay Cooke SP CG Agate Cabin | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,113 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 335 |
| **Building Code:** | R2900208960 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $76,858 |
| **Building Name:** | Jay Cooke SP CG Gabbro Cabin | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,113 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 335 |
| **Building Code:** | R2900208970 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $101,396 |
| **Building Name:** | Jay Cooke SP CG Shale Cabin | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $4,652 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 335 |
| **Building Code:** | R2900209050 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $84,497 |
| **Building Name:** | Jay Cooke SP CG Basalt Cabin | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,877 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900209420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,157 |
| **Building Name:** | Jay Cooke SP CG Vault Concrete | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $5,232 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900210480 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $104,197 |
| **Building Name:** | Jay Cooke SP Solar Garage | **Address:** | 780 HWY 210 | **Deferred Maintenance:** | $3,904 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 642 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,656 |
| **Building Name:** | Jay Cooke Oldenburg Vault Concrete | **Address:** | 780 Hwy 210 | **Deferred Maintenance:** | $513 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 51 |

### *Site: R290032 - Judge CR Magney State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200820 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $309,636 |
| **Building Name:** | Judge CR Magney SP Office | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $81,301 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 1,110 |
| **Building Code:** | R2900200830 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $152,405 |
| **Building Name:** | Judge CR Magney SP Shop | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $35,382 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900200850 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $41,332 |
| **Building Name:** | Judge CR Magney SP Contct Station | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $4,133 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 260 |
| **Building Code:** | R2900200870 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,098 |
| **Building Name:** | Judge CR Magney SP Spring House | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $4,548 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900200880 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,149 |
| **Building Name:** | Judge CR Magney SP Cold Storage | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $11,073 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 480 |
| **Building Code:** | R2900204190 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,678 |
| **Building Name:** | Judge CR Magney SP Cold Storage | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $8,170 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 128 |
| **Building Code:** | R2900204310 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $55,077 |
| **Building Name:** | Judge CR Magney SP Garage | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $4,245 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900205910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,954 |
| **Building Name:** | Judge CR Magney SP Vault Toilet | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $1,334 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900207410 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $280,871 |
| **Building Name:** | Judge CR Magney SP CG Sanitation | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $28,087 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 850 |
| **Building Code:** | R2900207600 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $153,010 |
| **Building Name:** | Judge CR Magney SP Water Tower | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $15,031 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 308 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | Judge CR Magney SP CG Vault Toilet | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $1,940 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900208170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | Judge CR Magney SP CG Vault Toilet | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $2,452 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900208180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | Judge CR Magney SP CG Vault Toilet | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $1,558 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900209510 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,234 |
| **Building Name:** | Judge CR Magney SP Shed | **Address:** | 4051 E HWY 61 | **Deferred Maintenance:** | $125 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 65 |

### *Site: R290033 - Kilen Woods State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401210 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $99,143 |
| **Building Name:** | Kilen Woods SP Cold Storage | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $33,073 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 880 |
| **Building Code:** | R2900401250 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $356,547 |
| **Building Name:** | Kilen Woods SP Trails Center | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $137,480 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 1,643 |
| **Building Code:** | R2900404350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,349 |
| **Building Name:** | Kilen Woods SP Vault Toilet | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $1,597 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900404680 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $315,099 |
| **Building Name:** | Kilen Woods SP Contact Station | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $16,206 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 900 |
| **Building Code:** | R2900404690 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $401,884 |
| **Building Name:** | Kilen Woods SP Sanitation | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $8,787 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 1,070 |
| **Building Code:** | R2900404700 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $318,968 |
| **Building Name:** | Kilen Woods SP Shop | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $6,379 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 2,020 |
| **Building Code:** | R2900405200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,349 |
| **Building Name:** | Kilen Woods SP Grp CG Vault Toilet | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $1,628 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 24 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900405210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,349 |
| **Building Name:** | Kilen Woods SP Vault Toilet | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $1,628 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900405420 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $2,242 |
| **Building Name:** | Kilen Woods SP Firewood Shed | **Address:** | 50200 860TH ST | **Deferred Maintenance:** | $224 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LAKEFIELD | **Ext. Gross Area:** | 24 |

### *Site: R290034 - Lac Qui Parle State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400910 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $147,878 |
| **Building Name:** | Lac Qui Parle SP Lower CG Sanitatio | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $71,848 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 331 |
| **Building Code:** | R2900400920 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $482,859 |
| **Building Name:** | Lac Qui Parle SP Office | **Address:** | 3749 STATE PARK RD | **Deferred Maintenance:** | $172,206 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | MONTEVIDEO | **Ext. Gross Area:** | 2,554 |
| **Building Code:** | R2900400930 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $87,168 |
| **Building Name:** | LQParle SP Horse Camp Picnic Shel 1 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $28,765 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 960 |
| **Building Code:** | R2900400940 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $296,764 |
| **Building Name:** | Lac Qui Parle SP Lower CG Map Shel | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $97,932 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 1,936 |
| **Building Code:** | R2900400950 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $212,368 |
| **Building Name:** | Lac Qui Parle SP Low CG Pic Shel 2 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $70,081 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 1,299 |
| **Building Code:** | R2900400960 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $132,831 |
| **Building Name:** | Lac Qui Parle SP Lower CG Bathhouse | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $43,834 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 430 |
| **Building Code:** | R2900400970 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $247,339 |
| **Building Name:** | Lac Qui Parle SP Shop | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $73,927 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900400980 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,441 |
| **Building Name:** | Lac Qui Parle SP Shop Ar Oil House | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $4,755 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900400990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $109,131 |
| **Building Name:** | Lac Qui Parle SP Shop Cold Storage | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $45,432 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 837 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402880 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $24,561 |
| **Building Name:** | Lac Qui Parle SP Contact Station | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $8,105 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 189 |
| **Building Code:** | R2900403540 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,116 |
| **Building Name:** | Lac Qui Parle SP Lower CG Vault | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $2,026 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,116 |
| **Building Name:** | Lac Qui Parle SP Lower CG Vault | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $2,026 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403640 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,685 |
| **Building Name:** | Lac Qui Parle SP Shop Wood Storage | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $2,866 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900403990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,970 |
| **Building Name:** | Lac Qui Parle SP Vault Toilet | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $1,983 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900404000 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,779 |
| **Building Name:** | Lac Qui Parle SP Lower CG Pumphouse | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $5,867 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 78 |
| **Building Code:** | R2900404410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,759 |
| **Building Name:** | LQParle SP Horse Camp Vault Toilet | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $3,913 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900404670 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $366,652 |
| **Building Name:** | Lac Qui Parle SP Upper CG Sanitatio | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $41,611 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WATSON | **Ext. Gross Area:** | 882 |
| **Building Code:** | R2900404980 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,418 |
| **Building Name:** | Lac Qui Parle SP Upper CG Vault | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $5,000 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,418 |
| **Building Name:** | Lac Qui Parle SP Upper CG Vault | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $3,308 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,418 |
| **Building Name:** | Lac Qui Parle SP Upper CG Vault | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $3,139 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 47 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900405010 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,418 |
| **Building Name:** | Lac Qui Parle SP Upper CG Vault | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $3,308 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405140 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $58,279 |
| **Building Name:** | Lac Qui Parle SP Upper CG Cabin 1 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $5,828 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATSON | **Ext. Gross Area:** | 310 |
| **Building Code:** | R2900405150 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $58,279 |
| **Building Name:** | Lac Qui Parle SP Upper CG Cabin 2 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $5,828 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATSON | **Ext. Gross Area:** | 310 |
| **Building Code:** | R2900405160 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $58,279 |
| **Building Name:** | Lac Qui Parle SP Upper CG Cabin 3 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $5,828 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATSON | **Ext. Gross Area:** | 310 |
| **Building Code:** | R2900405260 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,793 |
| **Building Name:** | Lac Qui Parle SP Lower CG Wood Stor | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $176 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WATSON | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900405370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $29,504 |
| **Building Name:** | Lac Qui Parle SP Low CG Vault Concr | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $590 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WATSON | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900405380 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,685 |
| **Building Name:** | Lac Qui Parle SP Upper CG Shed | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $1,329 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 18 |

### *Site: R290035 - Lake Bemidji State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102330 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $287,025 |
| **Building Name:** | Lake Bemidji SP Beach San/Cabanas | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $88,537 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 748 |
| **Building Code:** | R2900102340 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $261,979 |
| **Building Name:** | Lake Bemidji SP CG Oak Lane San | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $93,190 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 840 |
| **Building Code:** | R2900102360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $351,316 |
| **Building Name:** | Lake Bemidji SP Shop | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $82,562 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,743 |
| **Building Code:** | R2900102370 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $62,275 |
| **Building Name:** | Lake Bemidji SP Residence Garage | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $14,813 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 720 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102380 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,214 |
| **Building Name:** | Lake Bemidji SP Oil House | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,359 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 72 |
| **Building Code:** | R2900102390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $111,361 |
| **Building Name:** | Lake Bemidji SP Trails Storage | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $14,297 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 820 |
| **Building Code:** | R2900102400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,066 |
| **Building Name:** | Lake Bemidji SP Pump House | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $4,964 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 72 |
| **Building Code:** | R2900102410 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $525,147 |
| **Building Name:** | Lake Bemidji SP Grp CG Dining Hall | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $108,954 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | R2900102420 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $428,431 |
| **Building Name:** | Lake Bemidji SP Office | **Address:** | 3296 STATE PARK RD NE | **Deferred Maintenance:** | $58,851 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,879 |
| **Building Code:** | R2900102460 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $136,726 |
| **Building Name:** | Lake Bemidji SP Historic Log San | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $69,694 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 506 |
| **Building Code:** | R2900102480 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $443,754 |
| **Building Name:** | Lake Bemidji SP Beach Picnic Shel | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $70,780 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,830 |
| **Building Code:** | R2900104210 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $907,285 |
| **Building Name:** | Lake Bemidji SP Contact Station | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $163,005 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 5,457 |
| **Building Code:** | R2900104220 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $422,523 |
| **Building Name:** | Lake Bemidji SP CG Aspen Lane San | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $105,747 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,120 |
| **Building Code:** | R2900105230 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,926 |
| **Building Name:** | Lake Bemidji SP Oil House | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,685 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900105700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,797 |
| **Building Name:** | Lake Bemidji SP Bass Crk Mens Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,573 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 24 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,177 |
| **Building Name:** | Lake Bemidji SP Bass Crk Wmns Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,368 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900105720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,772 |
| **Building Name:** | Lake Bemidji SP Boat Launch Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $3,186 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900105750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,797 |
| **Building Name:** | Lake Bemidji SP Picnic Mens Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,573 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900105760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,780 |
| **Building Name:** | Lake Bemidji SP Picnic Wmns Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,567 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900106780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,765 |
| **Building Name:** | Lake Bemidji SP Picnic Amphitheater | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $4,637 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 165 |
| **Building Code:** | R2900107030 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $115,851 |
| **Building Name:** | Lake Bemidji SP Metal Storage Shop | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $11,585 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,120 |
| **Building Code:** | R2900107210 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $401,653 |
| **Building Name:** | Lake Bemidji SP CG Pine Lane San | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $45,266 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,140 |
| **Building Code:** | R2900107220 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $24,839 |
| **Building Name:** | Lake Bemidji SP Bass Crk Adirondack | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $8,197 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900107230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,485 |
| **Building Name:** | Lake Bemidji SP Main Parking Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,752 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107880 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,701 |
| **Building Name:** | Lake Bemidji SP CG Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,570 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,701 |
| **Building Name:** | Lake Bemidji SP Bog Walk Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,570 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108580 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $24,577 |
| **Building Name:** | Lake Bemidji SP Fish Cleaning House | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,458 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 325 |
| **Building Code:** | R2900109050 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $51,450 |
| **Building Name:** | Lake Bemidji SP Tamarack Cabin | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $5,145 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900109060 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $51,450 |
| **Building Name:** | Lake Bemidji SP Spruce Cabin | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $5,145 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900109070 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $51,450 |
| **Building Name:** | Lake Bemidji SP Balsam Cabin | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,853 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900109080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $51,450 |
| **Building Name:** | Lake Bemidji SP Maple Cabin | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $4,362 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900109090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $28,863 |
| **Building Name:** | Lake Bemidji Tmrck Cab Concr Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,886 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900109100 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $28,863 |
| **Building Name:** | Lake Bemidji SP Maple Cabin Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,886 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900109110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,808 |
| **Building Name:** | Lake Bemidji Aspen Ln Concr Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $396 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900109360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $28,863 |
| **Building Name:** | Lake Bemidji Lavinia Grp CG W Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $2,886 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900109370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,808 |
| **Building Name:** | Lake Bemidji Lavinia Grp CG E Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $396 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900109380 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,618 |
| **Building Name:** | Lake Bemidji Lavinia Grp CG Pumphse | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $562 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 20 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900109390 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $54,022 |
| **Building Name:** | Lake Bemidji Lavinia Picnic Shel 2 | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $5,402 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 675 |

### *Site: R290036 - Lake Bronson State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100060 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,872 |
| **Building Name:** | Lake Bronson Lakeside CG Vault Toil | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $3,042 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900102600 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $341,147 |
| **Building Name:** | Lake Bronson SP Two Rivers S San | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $137,231 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 936 |
| **Building Code:** | R2900102610 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $349,060 |
| **Building Name:** | Lake Bronson SP Lakeside CG San | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $110,322 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 119 |
| **Building Code:** | R2900102630 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $267,713 |
| **Building Name:** | Lake Bronson SP Contact Sta | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $77,047 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 1,192 |
| **Building Code:** | R2900102640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $260,232 |
| **Building Name:** | Lake Bronson SP Shop | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $54,408 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 1,840 |
| **Building Code:** | R2900102650 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $428,954 |
| **Building Name:** | Lake Bronson SP Residence | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $63,182 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 2,604 |
| **Building Code:** | R2900102660 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $310,656 |
| **Building Name:** | Lake Bronson SP Dining Hall | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $67,638 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 1,640 |
| **Building Code:** | R2900102670 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $494,712 |
| **Building Name:** | Lake Bronson SP Picnic Shelter 2 | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $116,896 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 1,840 |
| **Building Code:** | R2900102680 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $298,036 |
| **Building Name:** | Lake Bronson Picnic Tip Trough San | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $113,889 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 696 |
| **Building Code:** | R2900102690 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $314,531 |
| **Building Name:** | Lake Bronson SP Two Rivers San | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $107,701 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 858 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $37,188 |
| **Building Name:** | Lake Bronson SP Wood Storage | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $6,216 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 520 |
| **Building Code:** | R2900102710 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $227,447 |
| **Building Name:** | Lake Bronson Old Residence Storage | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $55,829 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 1,116 |
| **Building Code:** | R2900102720 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $464,737 |
| **Building Name:** | Lake Bronson SP Water Tower | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $114,289 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 744 |
| **Building Code:** | R2900102730 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $534,268 |
| **Building Name:** | Lake Bronson SP Bath House | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $56,064 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 1,012 |
| **Building Code:** | R2900104310 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $98,124 |
| **Building Name:** | Lake Bronson SP Residence Garage | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $20,417 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900105050 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,626 |
| **Building Name:** | Lake Bronson SP Contact Sta Shed | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $471 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900105280 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $62,964 |
| **Building Name:** | Lake Bronson SP Fish Cleaning House | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $16,117 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900106230 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,469,675 |
| **Building Name:** | Lake Bronson SP Visitor Center | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $166,894 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 5,130 |
| **Building Code:** | R2900106930 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,330 |
| **Building Name:** | Lake Bronson SP Pump House | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $2,115 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900106940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,784 |
| **Building Name:** | Lake Bronson SP Vault Toilet | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $987 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,591 |
| **Building Name:** | Lake Bronson SP Two Rvrs Vault Toil | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $1,108 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,050 |
| **Building Name:** | Lake Bronson SP Vault Toilet | **Address:** | 3793 230TH ST | **Deferred Maintenance:** | $1,153 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LAKE BRONSON | **Ext. Gross Area:** | 48 |

### *Site: R290037 - Lake Carlos State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102890 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $141,866 |
| **Building Name:** | Lake Carlos SP Hid Lk GC Bunkhse 1 | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $37,858 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 792 |
| **Building Code:** | R2900102900 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $145,634 |
| **Building Name:** | Lake Carlos SP Hid Lk GC Bunkhse 2 | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $39,102 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 792 |
| **Building Code:** | R2900102910 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $337,594 |
| **Building Name:** | Lake Carlos SP Hid Lk GC Craft Bldg | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $68,479 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,152 |
| **Building Code:** | R2900102920 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $394,101 |
| **Building Name:** | Lake Carlos SP Hid Lk GC Staff Resd | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $69,518 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,824 |
| **Building Code:** | R2900102930 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $667,372 |
| **Building Name:** | Lake Carlos SP Hid Lk GC Dininghall | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $76,193 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,792 |
| **Building Code:** | R2900102940 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $251,362 |
| **Building Name:** | Lake Carlos SP Lkvw Picnic Area San | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $62,671 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 549 |
| **Building Code:** | R2900102950 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $71,941 |
| **Building Name:** | Lake Carlos SP Lkvw Picnic Shel 2 | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $7,991 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,025 |
| **Building Code:** | R2900102960 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $188,878 |
| **Building Name:** | Lake Carlos SP Lkvw Pic Water Tower | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $22,852 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 345 |
| **Building Code:** | R2900102970 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $445,512 |
| **Building Name:** | Lake Carlos SP Beach Bath House | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $119,366 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,193 |
| **Building Code:** | R2900102990 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,399 |
| **Building Name:** | Lake Carlos SP Pump House | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $2,680 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 36 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103010 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $134,710 |
| **Building Name:** | Lake Carlos SP Upper CG South San | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $47,544 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | CARLOS | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900103030 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,855 |
| **Building Name:** | Lake Carlos SP Horse Camp Pumphouse | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $4,106 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | CARLOS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900103050 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $307,955 |
| **Building Name:** | Lake Carlos SP Lower CG East San | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $49,062 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,015 |
| **Building Code:** | R2900103060 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,513 |
| **Building Name:** | Lake Carlos SP LowCG Fish Clean Hse | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $14,742 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900103100 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $134,235 |
| **Building Name:** | Lake Carlos SP Shop | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $16,477 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,516 |
| **Building Code:** | R2900103110 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $55,282 |
| **Building Name:** | Lake Carlos SP Shop Area Garage | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $11,205 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900104480 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $320,289 |
| **Building Name:** | Lake Carlos SP Residence | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $27,822 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,836 |
| **Building Code:** | R2900104580 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $388,862 |
| **Building Name:** | Lake Carlos SP Upper CG North San | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $41,574 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,330 |
| **Building Code:** | R2900104590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $49,866 |
| **Building Name:** | Lake Carlos SP Residence Garage | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $6,208 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900104600 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $126,955 |
| **Building Name:** | Lake Carlos SP Metal Cold Storage | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $13,466 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,764 |
| **Building Code:** | R2900106170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $497,147 |
| **Building Name:** | Lake Carlos SP Interpretive Ctr | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $60,550 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,702 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,247 |
| **Building Name:** | Lake Carlos SP Lower CG Vault | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $2,671 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900106420 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $254,194 |
| **Building Name:** | Lake Carlos SP Contact Station | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $37,305 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,226 |
| **Building Code:** | R2900106430 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $407,830 |
| **Building Name:** | Lake Carlos SP Lower CG West San | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $45,307 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,147 |
| **Building Code:** | R2900106520 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,933 |
| **Building Name:** | Lake Carlos SP Lakeview Pic Vault | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $2,107 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900106970 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $2,100 |
| **Building Name:** | Lake Carlos SP Contact Sta Kiosk | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $210 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900106980 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Lake Carlos SP Contact Sta Vault | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $1,772 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Lake Carlos SP Horse Camp Vault | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $3,184 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CARLOS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107010 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Lake Carlos Inspir Pk Vault Toilet | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $3,953 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | CARLOS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107410 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $1,895 |
| **Building Name:** | Lake Carlos SP Trail Kiosk | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $270 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900107850 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $337,040 |
| **Building Name:** | Lake Carlos SP Hid Lk GC Sanitation | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $45,904 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 1,126 |
| **Building Code:** | R2900107860 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $54,169 |
| **Building Name:** | Lake Carlos SP Pioneer Picnic Shel | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $5,417 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 943 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,430 |
| **Building Name:** | Lake Carlos SP Pioneer Grp CG Vault | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $1,443 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900107930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,933 |
| **Building Name:** | Lake Carlos SP Pioneer Grp Vault 2 | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $1,493 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108270 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,933 |
| **Building Name:** | Lake Carlos SP Lakeview Pic Vault | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $1,493 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108500 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,423 |
| **Building Name:** | Lake Carlos SP Upp CG Raccoon Cabin | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $8,005 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108510 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $71,481 |
| **Building Name:** | Lake Carlos SP Upper CG Frog Cabin | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $8,311 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108520 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $71,481 |
| **Building Name:** | Lake Carlos SP Upper CG Eagle Cabin | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $8,311 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108530 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $71,481 |
| **Building Name:** | Lake Carlos SP Upper CG Loon Cabin | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $8,311 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900108550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $54,904 |
| **Building Name:** | Lake Carlos SP Upper CG Vault Concr | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $5,490 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900108640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $36,560 |
| **Building Name:** | Lake Carlos SP Wood Storage | **Address:** | 2601 CTY RD 38 NE | **Deferred Maintenance:** | $3,656 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CARLOS | **Ext. Gross Area:** | 400 |

### *Site: R290038 - Lake Louise State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500350 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $128,005 |
| **Building Name:** | Lake Louise SP Picnic Ar Sanitation | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $9,521 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 391 |
| **Building Code:** | R2900500360 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,995 |
| **Building Name:** | Lake Louise SP Well House | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $2,568 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 121 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502040 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $91,081 |
| **Building Name:** | Lake Louise SP Picnic Area Shel 1 | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $7,019 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 858 |
| **Building Code:** | R2900503670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Lake Louise SP Vault Toilet | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | LEROY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900503870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Lake Louise SP Horse CG Vault Toil | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $2,895 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | LEROY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900504170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $247,165 |
| **Building Name:** | Lake Louise SP Contact Station | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $24,001 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 760 |
| **Building Code:** | R2900504180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $293,908 |
| **Building Name:** | Lake Louise SP Shop | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $37,044 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 2,037 |
| **Building Code:** | R2900504930 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,472 |
| **Building Name:** | Lake Louise SP Wood Storage Shed | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $2,958 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 200 |
| **Building Code:** | R2900505100 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $371,912 |
| **Building Name:** | Lake Louise SP CG Sanitation | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $25,881 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 960 |
| **Building Code:** | R2900505170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | Lake Louise SP Grp CG Vault Toilet | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $1,950 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | Lake Louise SP CG Vault Toilet | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $1,555 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | Lake Louise SP Vault Toilet | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $1,950 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | Lake Louise SP Picnic Ar Vault Toil | **Address:** | 12385 766TH AVE | **Deferred Maintenance:** | $1,080 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LEROY | **Ext. Gross Area:** | 47 |

***Site: R290039 - Lake Maria State Park***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $160,250 |
| **Building Name:** | Lake Maria SP Office | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $97,233 |
| **Facility Condition Index:** | 0.61 - Crisis | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 968 |
| **Building Code:** | R2900301100 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $265,929 |
| **Building Name:** | Lake Maria SP Shop | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $58,825 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 1,523 |
| **Building Code:** | R2900301110 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $34,185 |
| **Building Name:** | Lake Maria SP Pump House | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $6,880 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 121 |
| **Building Code:** | R2900301120 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $392,957 |
| **Building Name:** | Lake Maria SP Trails Center | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $94,785 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | R2900303210 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $118,466 |
| **Building Name:** | Lake Maria SP Contact Station | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $36,734 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 472 |
| **Building Code:** | R2900303680 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,587 |
| **Building Name:** | Lake Maria SP Oil House | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,663 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900305180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $21,462 |
| **Building Name:** | Lake Maria SP Shop Ar Cold Storage | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $5,052 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 360 |
| **Building Code:** | R2900305250 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,212 |
| **Building Name:** | Lake Maria SP Horse CG Vault Toilet | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $4,574 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900305280 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,212 |
| **Building Name:** | Lake Maria SP Group CG Vault Toilet | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,228 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900305290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,212 |
| **Building Name:** | Lake Maria SP Group CG Vault Toilet | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,891 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900307000 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $61,578 |
| **Building Name:** | Lake Maria SP Camper Cabin C1 | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $17,586 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 264 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307010 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $64,942 |
| **Building Name:** | Lake Maria SP Camper Cabin C2 | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $12,227 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900307020 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $63,873 |
| **Building Name:** | Lake Maria SP Camper Cabin C3 | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $13,487 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900307250 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,004 |
| **Building Name:** | Lake Maria SP Vault Toilet | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,040 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900308140 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,881 |
| **Building Name:** | Lake Maria SP Shop Cold Storage | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $7,418 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 495 |
| **Building Code:** | R2900308710 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,020 |
| **Building Name:** | Lake Maria SP Wood Shed | **Address:** | 11411 CLEMENTA AVE | **Deferred Maintenance:** | $240 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 100 |

### *Site: R290040 - Lake Shetek State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401280 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $311,113 |
| **Building Name:** | Lake Shetek SP Recreation Hall | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $93,334 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,176 |
| **Building Code:** | R2900401290 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $121,623 |
| **Building Name:** | Lake Shetek SP Cabin 1 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $35,731 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900401300 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $116,089 |
| **Building Name:** | Lake Shetek SP Cabin 2 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $36,425 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900401310 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $121,623 |
| **Building Name:** | Lake Shetek SP Cabin 3 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $36,979 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900401320 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $231,479 |
| **Building Name:** | Lake Shetek SP Zuya GC Sanitation | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $71,211 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900401330 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $939,607 |
| **Building Name:** | Lake Shetek SP Zuya GC Dining Hall | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $190,322 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,725 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401340 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $73,910 |
| **Building Name:** | Lake Shetek SP Picnic Ar Sanitation | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $24,083 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 459 |
| **Building Code:** | R2900401350 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $551,883 |
| **Building Name:** | Lake Shetek SP Beach Bath House | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $274,307 |
| **Facility Condition Index:** | 0.50 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,626 |
| **Building Code:** | R2900401360 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $271,055 |
| **Building Name:** | Lake Shetek SP Picnic Ar Shelter 2 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $89,448 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 494 |
| **Building Code:** | R2900401370 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $287,226 |
| **Building Name:** | Lake Shetek SP Shop | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $95,401 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,349 |
| **Building Code:** | R2900401380 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $94,469 |
| **Building Name:** | Lake Shetek SP Wood Storage | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $37,915 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900401390 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $693,807 |
| **Building Name:** | Lake Shetek SP Residence | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $208,111 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 2,599 |
| **Building Code:** | R2900401410 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $266,988 |
| **Building Name:** | Lake Shetek SP Oak Woods CG San 1 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $79,830 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 682 |
| **Building Code:** | R2900401420 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $163,080 |
| **Building Name:** | Lake Shetek SP Interp Center | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $52,289 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 960 |
| **Building Code:** | R2900401440 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $228,845 |
| **Building Name:** | Lake Shetek SP Cold Storage Barn | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $105,556 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | R2900401830 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,344 |
| **Building Name:** | Lake Shetek SP Cold Storage | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $4,304 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | CURRIE | **Ext. Gross Area:** | 72 |
| **Building Code:** | R2900401840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,815 |
| **Building Name:** | Lake Shetek SP Pump House | **Address:** | 175 CTY RD 26 | **Deferred Maintenance:** | $3,205 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WINDOM | **Ext. Gross Area:** | 49 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402940 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $383,467 |
| **Building Name:** | Lake Shetek SP Oak Woods CG San 2 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $103,978 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,248 |
| **Building Code:** | R2900402950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,342 |
| **Building Name:** | Lake Shetek SP Cold Storage | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $11,845 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 352 |
| **Building Code:** | R2900403190 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $134,006 |
| **Building Name:** | Lake Shetek SP Picnic Ar Shelter 1 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $18,909 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,360 |
| **Building Code:** | R2900403200 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,440 |
| **Building Name:** | Lake Shetek SP Cold Storage | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $13,440 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | CURRIE | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900403210 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,096 |
| **Building Name:** | Lake Shetek SP Cold Storage | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $10,626 |
| **Facility Condition Index:** | 0.88 - Crisis | **City Code:** | CURRIE | **Ext. Gross Area:** | 108 |
| **Building Code:** | R2900403220 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,840 |
| **Building Name:** | Lake Shetek SP Oil House | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $6,887 |
| **Facility Condition Index:** | 0.88 - Crisis | **City Code:** | CURRIE | **Ext. Gross Area:** | 70 |
| **Building Code:** | R2900403230 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,699 |
| **Building Name:** | Lake Shetek SP Fish Cleaning House | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $9,746 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900403240 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,316 |
| **Building Name:** | Lake Shetek SP Pump House | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $4,820 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | CURRIE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900403760 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $282,177 |
| **Building Name:** | Lake Shetek SP Contact Station | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $37,103 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,329 |
| **Building Code:** | R2900404030 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $38,211 |
| **Building Name:** | Lake Shetek SP Historic Cabin | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $12,722 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CURRIE | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900404640 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $55,182 |
| **Building Name:** | Lake Shetek SP Oak Woods CG Cabin 1 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $5,518 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 280 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404880 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Picnic Area Vault | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Prairie CG Vault | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Wilderness GC Vault | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Oak Woods CG Vault | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Vault Toilet | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Oak Woods CG Vault | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,529 |
| **Building Name:** | Lake Shetek SP Zuya GC Vault Toilet | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405310 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $56,759 |
| **Building Name:** | Lake Shetek SP Oak Woods CG Cabin 4 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $5,676 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405320 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $56,759 |
| **Building Name:** | Lake Shetek SP Oak Woods CG Cabin 2 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $5,676 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405330 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $33,533 |
| **Building Name:** | Lake Shetek SP Oak Woods CG Cabin 3 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $3,456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CURRIE | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $60,850 |
| **Building Name:** | Lake Shetek SP Sunrise Vault Concr | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $1,217 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CURRIE | **Ext. Gross Area:** | 108 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900405350 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $180,248 |
| **Building Name:** | Lake Shetek SP Sunrise E Pic Shel 1 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $3,605 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,312 |
| **Building Code:** | R2900405360 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $180,248 |
| **Building Name:** | Lake Shetek SP Sunrise W Pic Shel 1 | **Address:** | 163 STATE PARK RD | **Deferred Maintenance:** | $3,605 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CURRIE | **Ext. Gross Area:** | 1,312 |

### *Site: R290041 - Maplewood State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102240 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $98,966 |
| **Building Name:** | Maplewood SP Trails Center | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $17,677 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900102560 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $255,165 |
| **Building Name:** | Maplewood SP Grass Lk CG Sanitation | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $65,532 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 837 |
| **Building Code:** | R2900102570 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $195,757 |
| **Building Name:** | Maplewood SP Shop | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $25,150 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 1,495 |
| **Building Code:** | R2900102590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $98,172 |
| **Building Name:** | Maplewood SP Shop Area Cold Storage | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $22,472 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 968 |
| **Building Code:** | R2900104280 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $284,718 |
| **Building Name:** | Maplewood SP Lk Lida Day Beach San | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $69,607 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 840 |
| **Building Code:** | R2900104620 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $281,953 |
| **Building Name:** | Maplewood SP Contact Station | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $64,019 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 925 |
| **Building Code:** | R2900105100 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,424 |
| **Building Name:** | Maplewood SP Grass Lk CG Lift Sta | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,707 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900105110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,425 |
| **Building Name:** | Maplewood SP Hollow CG Mens Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $4,760 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900105120 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,425 |
| **Building Name:** | Maplewood SP Hollow CG Wmns Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $4,760 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105130 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,425 |
| **Building Name:** | Maplewood SP Knoll CG Mens Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $7,028 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900105140 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,425 |
| **Building Name:** | Maplewood SP Knoll CG Wmns Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $6,368 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900105150 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,425 |
| **Building Name:** | Maplewood SP Horse Camp Wmns Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $6,942 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900105160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,696 |
| **Building Name:** | Maplewood SP Horse Camp Mens Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $7,127 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900105170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Maplewood SP Lake Lida CG N Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $4,232 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900105430 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,355 |
| **Building Name:** | Maplewood Grass Lk Fish Cleang Hse | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $9,232 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900106490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Maplewood SP Lake Lida CG Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $3,184 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Maplewood Grass Lk Baker Cabn Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $3,184 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,825 |
| **Building Name:** | Maplewood SP Lake Lida CG S Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,993 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106920 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $99,372 |
| **Building Name:** | Maplewood SP Grass Lk CG Knoll Cab | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $9,937 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 299 |
| **Building Code:** | R2900107200 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $240,196 |
| **Building Name:** | Maplewood SP Steel Pole Building | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $4,804 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 2,268 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,933 |
| **Building Name:** | Maplewood Beers Lk Boat Acs Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,073 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900107980 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,933 |
| **Building Name:** | Maplewood SP Group Camp Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,073 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900108380 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $75,072 |
| **Building Name:** | Maplewood SP Grass Lk CG Baker Cab | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $15,123 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900108560 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $209,702 |
| **Building Name:** | Maplewood Lk Lida JHanson Pic Shel | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $5,374 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 1,518 |
| **Building Code:** | R2900108660 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,402 |
| **Building Name:** | Maplewood Horse CG Ste 5 Adirondack | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $2,507 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 117 |
| **Building Code:** | R2900108670 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $3,612 |
| **Building Name:** | Maplewood Horse CG Ste 9 Adirondack | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $361 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900108680 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,064 |
| **Building Name:** | Maplewood Horse CG Ste18 Adirondack | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,341 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 108 |
| **Building Code:** | R2900108690 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,287 |
| **Building Name:** | Maplewood Horse CG Ste22 Adirondack | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,789 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900108700 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $3,612 |
| **Building Name:** | Maplewood SP Grass Lk CG Adirondack | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,192 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900108720 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $3,913 |
| **Building Name:** | Maplewood Lil Grass Bkpk Adirondack | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $2,228 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 104 |
| **Building Code:** | R2900108730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $54,904 |
| **Building Name:** | Maplewood Grass Lk Dbl Concr Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $5,490 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 102 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $54,904 |
| **Building Name:** | Maplewood Beers Lk CG Cab Concr Vau | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $5,490 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900108780 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $1,286 |
| **Building Name:** | Maplewood SP Office Kiosk | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $81 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 22 |
| **Building Code:** | R2900108800 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $99,400 |
| **Building Name:** | Maplewood SP Beers Lk Muskie Cabin | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $13,076 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900108810 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $94,810 |
| **Building Name:** | Maplewood SP Beers Lk Crappie Cabin | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $12,617 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900108820 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $77,619 |
| **Building Name:** | Maplewood SP Beers Lk Pike Cabin | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $12,640 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900109030 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $57,137 |
| **Building Name:** | Maplewood SP Trails Ctr Sugar House | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $1,143 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 196 |
| **Building Code:** | R2900109120 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $29,067 |
| **Building Name:** | Maplewood SP Horse Camp Concr Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $2,907 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900109130 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $29,067 |
| **Building Name:** | Maplewood SP Trails Ctr Concr Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $2,907 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900109140 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $29,067 |
| **Building Name:** | Maplewood Lk Lida Day Concr Vault | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $2,907 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900109330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $38,762 |
| **Building Name:** | Maplewood SP Friends Storage | **Address:** | 39721 PARK ENTRANCE RD | **Deferred Maintenance:** | $775 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 192 |

### *Site: R290042 - McCarthy Beach State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200670 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $15,024 |
| **Building Name:** | McCarthy Beach SP Cold Stor Garage | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $4,182 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 320 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200750 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $70,378 |
| **Building Name:** | McCarthy Bch Side Lk Fish Clean Hse | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $12,276 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 195 |
| **Building Code:** | R2900200760 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $47,449 |
| **Building Name:** | McCarthy Beach SP Spring House | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $5,048 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 143 |
| **Building Code:** | R2900200790 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $210,423 |
| **Building Name:** | McCarthy Beach SP Picnic Shelter 2 | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $21,695 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 1,620 |
| **Building Code:** | R2900200800 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $29,756 |
| **Building Name:** | McCarthy Beach SP Cold Storage | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $14,400 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 2,950 |
| **Building Code:** | R2900203840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,044 |
| **Building Name:** | McCarthy Beach SP Oil House | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $4,454 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900204490 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $746,930 |
| **Building Name:** | McCarthy Beach SP Shop | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $174,711 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 4,046 |
| **Building Code:** | R2900205570 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,899 |
| **Building Name:** | McCarthy Beach Side Lk CG Mns Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $2,705 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900205580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,899 |
| **Building Name:** | McCarthy Beach Side Lk CG Wmn Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $2,705 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900205590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,173 |
| **Building Name:** | McCarthy Bch Side Lk CG F Mns Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,729 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900205600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,173 |
| **Building Name:** | McCarthy Bch Side Lk CG F Wmn Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,729 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900205630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,432 |
| **Building Name:** | McCarthy Bch Beatrice Lk Mns Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $3,244 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 41 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900205640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,432 |
| **Building Name:** | McCarthy Bch Beatrice Lk Wmn Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $3,244 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 41 |
| **Building Code:** | R2900205650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,573 |
| **Building Name:** | McCarthy Bch Beatrice Lk Mns Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $2,558 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900205660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,573 |
| **Building Name:** | McCarthy Bch Beatrice Lk Wmn Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $2,558 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900207640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | McCarthy Beach SP Boat Land Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,185 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900207650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | McCarthy Beach SP Boat Land Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,185 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900207960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,862 |
| **Building Name:** | McCarthy Beach SP Beach Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $926 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900207970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | McCarthy Beach SP Trail Head Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,604 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900207980 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | McCarthy Beach SP Picnic Area Vault | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,642 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900208420 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $311,141 |
| **Building Name:** | McCarthy Beach SP Contact Station | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $44,640 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 1,251 |
| **Building Code:** | R2900208440 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,362 |
| **Building Name:** | McCarthy Beach SP Cold Storage | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,827 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900208850 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $337,270 |
| **Building Name:** | McCarthy Beach SP Beach Bath House | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $72,247 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 1,350 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209880 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $561,474 |
| **Building Name:** | McCarthy Beach Side Lk CG San Bldg | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $11,229 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 1,294 |
| **Building Code:** | R2900209890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $85,782 |
| **Building Name:** | McCarthy Bch Side Lk CG Vault Concr | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $1,716 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 102 |

### *Site: R290043 - Mille Lacs Kathio State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $333,081 |
| **Building Name:** | Mille Lacs Kathio SP HQ Shop | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $121,511 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ONAMIA | **Ext. Gross Area:** | 1,494 |
| **Building Code:** | R2900301140 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $166,093 |
| **Building Name:** | Mille Lacs Kathio SP HQ Cold Stor | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $42,549 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 1,008 |
| **Building Code:** | R2900301190 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $189,795 |
| **Building Name:** | Mille Lacs Kathio SP Sanitation | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $43,023 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 728 |
| **Building Code:** | R2900301200 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $578,205 |
| **Building Name:** | Mille Lacs Kathio SP Trail Center | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $150,548 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 2,610 |
| **Building Code:** | R2900301220 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $818,292 |
| **Building Name:** | Mille Lacs Kathio SP Interp Center | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $140,728 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 4,909 |
| **Building Code:** | R2900301240 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $162,107 |
| **Building Name:** | Mille Lacs Kathio SP HQ Cold Stor | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $39,947 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900301250 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $65,331 |
| **Building Name:** | MLKathio SP Petaga CG Fish Clean Hs | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $19,908 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | ONAMIA | **Ext. Gross Area:** | 176 |
| **Building Code:** | R2900303750 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $313,239 |
| **Building Name:** | Mille Lacs Kathio SP HQ Contact Sta | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $66,628 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 1,306 |
| **Building Code:** | R2900304200 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,902 |
| **Building Name:** | Mille Lacs Kathio SP HQ Oil House | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,849 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 96 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900304780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,369 |
| **Building Name:** | MLKathio SP Ogechie CG Ste 23 Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,084 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900304790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,173 |
| **Building Name:** | MLKathio SP Rum River CG Wmns Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,280 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900304800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,173 |
| **Building Name:** | MLKathio SP Rum River CG Mens Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,280 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900304810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,369 |
| **Building Name:** | MLKathio SP Ogechie CG Ste7/23 Vaul | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $1,971 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900305730 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $9,659 |
| **Building Name:** | MLKathio SP Isle Harbor Fire Tower | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $6,854 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | ONAMIA | **Ext. Gross Area:** | 60 |
| **Building Code:** | R2900306370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,672 |
| **Building Name:** | Mille Lacs Kathio SP HQ Vault Toil | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $1,444 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ONAMIA | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,505 |
| **Building Name:** | MLKathio SP Petaga CG Cabins Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $3,174 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306390 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,055 |
| **Building Name:** | MLKathio SP Petaga CG C-d-S Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $3,070 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,636 |
| **Building Name:** | MLKathio SP Petaga CG Site 37 Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,966 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,830 |
| **Building Name:** | MLKathio SP Petaga CG Site 62 Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $3,591 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306680 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $52,294 |
| **Building Name:** | MLKathio SP Petaga CG Cabin 1 | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $6,219 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ONAMIA | **Ext. Gross Area:** | 264 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306690 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $53,325 |
| **Building Name:** | MLKathio SP Petaga CG Cabin 2 | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $10,003 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900306700 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $59,636 |
| **Building Name:** | MLKathio SP Petaga CG Cabin3 | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $9,781 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900306710 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $62,229 |
| **Building Name:** | MLKathio SP Petaga CG ADA Cabin 4 | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $6,591 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ONAMIA | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900306720 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $58,001 |
| **Building Name:** | MLKathio SP Petaga CG Cabin 5 | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $14,657 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900306830 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $316,545 |
| **Building Name:** | MLKathio SP Petaga CG Sanitation | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $58,782 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 1,177 |
| **Building Code:** | R2900306890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,239 |
| **Building Name:** | Mille Lacs Kathio SP Vault Toilet | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,084 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900306900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,742 |
| **Building Name:** | Mille Lacs Kathio SP Picnic Vault | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $3,242 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900306910 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,114 |
| **Building Name:** | Mille Lacs Kathio SP Cold Storage | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $5,921 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | ONAMIA | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900307240 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,295 |
| **Building Name:** | Mille Lacs Kathio SP Vault Toilet | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,319 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900308190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $24,377 |
| **Building Name:** | Mille Lacs Kathio SP Vault Concrete | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $488 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ONAMIA | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900308310 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,213 |
| **Building Name:** | Mille Lacs Kathio SP HQ Wood Shed | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $926 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ONAMIA | **Ext. Gross Area:** | 135 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308320 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $9,871 |
| **Building Name:** | Mille Lacs Kathio SP HQ Salt Shed | **Address:** | 15066 KATHIO STATE PARK RD | **Deferred Maintenance:** | $2,737 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 96 |

### *Site: R290044 - Minneopa State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400540 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $311,475 |
| **Building Name:** | Minneopa SP Granary Storage | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $50,430 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 736 |
| **Building Code:** | R2900400550 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,227,382 |
| **Building Name:** | Minneopa Seppmann Windmill Pumphse | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $898,142 |
| **Facility Condition Index:** | 0.73 - Crisis | **City Code:** | MANKATO | **Ext. Gross Area:** | 2,121 |
| **Building Code:** | R2900400560 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $235,804 |
| **Building Name:** | Minneopa SP CG Sanitation | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $58,506 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 912 |
| **Building Code:** | R2900400570 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $255,673 |
| **Building Name:** | Minneopa SP Picnic Shelter 1 | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $79,779 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 2,784 |
| **Building Code:** | R2900400580 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $45,479 |
| **Building Name:** | Minneopa SP Pump House | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $14,847 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 81 |
| **Building Code:** | R2900400590 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $143,534 |
| **Building Name:** | Minneopa SP Interp Center | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $46,290 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 708 |
| **Building Code:** | R2900400600 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $293,738 |
| **Building Name:** | Minneopa SP Sanitation | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $87,010 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 840 |
| **Building Code:** | R2900400620 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $268,800 |
| **Building Name:** | Minneopa SP Office | **Address:** | 21009 547TH AVE | **Deferred Maintenance:** | $72,394 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 1,660 |
| **Building Code:** | R2900400630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $8,854 |
| **Building Name:** | Minneopa SP Shop Area Shed | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $6,640 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MANKATO | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900400640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $328,853 |
| **Building Name:** | Minneopa SP Shop | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $98,687 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 1,596 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400660 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $100,672 |
| **Building Name:** | Minneopa SP Shop Area Cold Storage | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $29,882 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 828 |
| **Building Code:** | R2900402740 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,747 |
| **Building Name:** | Minneopa SP Oil House | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $2,068 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900403350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,422 |
| **Building Name:** | Minneopa SP Picnic Ar Vault Toilet | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $2,351 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900403360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,422 |
| **Building Name:** | Minneopa Seppmann Windmill Vault | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $2,351 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900403370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,422 |
| **Building Name:** | Minneopa SP Picnic Ar Vault Toilet | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $3,356 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900403380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,185 |
| **Building Name:** | Minneopa SP Picnic Ar Vault Toilet | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $3,286 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | MANKATO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900404310 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $63,181 |
| **Building Name:** | Minneopa SP CG Site 16 Cabin | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $7,371 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MANKATO | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900404320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,422 |
| **Building Name:** | Minneopa SP CG Site 16 Vault Toilet | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $2,351 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900404380 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $258,620 |
| **Building Name:** | Minneopa SP Contact Station | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $24,392 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MANKATO | **Ext. Gross Area:** | 1,156 |
| **Building Code:** | R2900405390 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $336,142 |
| **Building Name:** | Minneopa SP Quonset | **Address:** | 54497 GADWALL RD | **Deferred Maintenance:** | $63,357 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MANKATO | **Ext. Gross Area:** | 5,000 |

### *Site: R290045 - Minnesota Valley SRA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600320 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $464,538 |
| **Building Name:** | MN Valley SRA Lawrence Strait House | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $149,336 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | JORDAN | **Ext. Gross Area:** | 1,587 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601250 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $138,788 |
| **Building Name:** | Minnesota Valley SRA Trails Center | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $28,998 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900601350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,580 |
| **Building Name:** | MN Valley SRA Walk-in Vault Toilet | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $5,726 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | JORDAN | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900601360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,231 |
| **Building Name:** | MN Valley SRA Walk-in Vault Toilet | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $2,252 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900601370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,334 |
| **Building Name:** | MN Valley SRA CG Site11 Wmn L Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $4,061 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900601380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,334 |
| **Building Name:** | MN Valley SRA CG Site11 Men R Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $4,791 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900601390 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,158 |
| **Building Name:** | MN Valley SRA CG Site24 Men L Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $2,811 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900601400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,334 |
| **Building Name:** | MN Valley SRA CG Site24 Wmn R Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $3,529 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900601410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,231 |
| **Building Name:** | MN Valley SRA Trail Ctr Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $2,049 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900601420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,231 |
| **Building Name:** | MN Valley SRA Trail Ctr Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $2,049 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900601430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,231 |
| **Building Name:** | MN Valley SRA Grp CG Picnic Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $2,535 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | JORDAN | **Ext. Gross Area:** | 28 |
| **Building Code:** | R2900601440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,927 |
| **Building Name:** | MN Valley SRA Grp CG Picnic Vault | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $2,169 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 48 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601850 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $378,704 |
| **Building Name:** | Minnesota Valley SRA Shop | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $68,105 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | JORDAN | **Ext. Gross Area:** | 3,024 |
| **Building Code:** | R2900601930 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,962 |
| **Building Name:** | Minnesota Valley SRA Wood Storage | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $6,272 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | JORDAN | **Ext. Gross Area:** | 81 |
| **Building Code:** | R2900602070 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $55,385 |
| **Building Name:** | MN Valley SRA Carver Rap Pic Shel 2 | **Address:** | 19825 PARK BLVD | **Deferred Maintenance:** | $18,233 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JORDAN | **Ext. Gross Area:** | 680 |

### *Site: R290046 - Monson Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401000 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $233,982 |
| **Building Name:** | Monson Lake SP CG Sanitation | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $76,035 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | SUNBURG | **Ext. Gross Area:** | 405 |
| **Building Code:** | R2900401010 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $177,457 |
| **Building Name:** | Monson Lake SP Contact Station | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $25,380 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | SUNBURG | **Ext. Gross Area:** | 1,056 |
| **Building Code:** | R2900401020 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $689,433 |
| **Building Name:** | Monson Lake SP Picnic Shelter 2 | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $109,060 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | SUNBURG | **Ext. Gross Area:** | 1,104 |
| **Building Code:** | R2900404360 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,619 |
| **Building Name:** | Monson Lake SP Cold Storage | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $13,908 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | SUNBURG | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900404370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Monson Lake SP Boat Landg Vault | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $3,574 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | SUNBURG | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900404870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,945 |
| **Building Name:** | Monson Lake SP Picnic Area Vault | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $1,149 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SUNBURG | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $25,780 |
| **Building Name:** | Monson Lake SP Shed | **Address:** | 1690 15TH ST NE | **Deferred Maintenance:** | $516 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SUNBURG | **Ext. Gross Area:** | 140 |

### *Site: R290047 - Moose Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203690 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $369,036 |
| **Building Name:** | Moose Lake SP Cold Storage | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $204,209 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 2,484 |
| **Building Code:** | R2900204320 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,006 |
| **Building Name:** | Moose Lake SP Grp CG Spring House | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $5,703 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900204360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $61,104 |
| **Building Name:** | Moose Lake SP Shop | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $11,479 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900205830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,856 |
| **Building Name:** | Moose Lake SP CG C-Lane E Vault | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $1,923 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,856 |
| **Building Name:** | Moose Lake SP CG C-Lane W Vault | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $2,011 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,617 |
| **Building Name:** | Moose Lake SP Beach Picnic E Vault | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $1,441 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,617 |
| **Building Name:** | Moose Lake SP Beach Picnic W Vault | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $1,441 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,617 |
| **Building Name:** | Moose Lake SP Boat Landing Vault | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $2,089 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,656 |
| **Building Name:** | Moose Lake SP Grp CG Vault Toilet | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $1,785 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900205940 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,259 |
| **Building Name:** | Moose Lake SP CG Spring House | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $5,971 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900207400 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $211,948 |
| **Building Name:** | Moose Lake SP CG Sanitation | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $40,551 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 850 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207470 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $362,407 |
| **Building Name:** | Moose Lake SP Heat/Cold Storage | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $52,165 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | R2900208030 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $2,550 |
| **Building Name:** | Moose Lake SP Cold Storage | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $1,912 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900208490 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,649 |
| **Building Name:** | Moose Lake SP Cold Storage | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $2,900 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900208600 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,005,232 |
| **Building Name:** | Moose Lake SP Interpretive Ctr | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $80,664 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 4,474 |
| **Building Code:** | R2900208650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,257 |
| **Building Name:** | Moose Lake SP CG Sites 10/11 Vault | **Address:** | 4252 CTY RD 137 | **Deferred Maintenance:** | $1,017 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 47 |

### *Site: R290048 - Myre-Big Island State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500590 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $344,538 |
| **Building Name:** | Myre-Big Isl SP NY Pt Grp Rec Hall | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $35,367 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,100 |
| **Building Code:** | R2900500600 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $512,313 |
| **Building Name:** | Myre-Big Island SP Interp Unocc | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $181,504 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,844 |
| **Building Code:** | R2900500610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,698 |
| **Building Name:** | Myre-Big Isl SP White Fox Pumphouse | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $2,559 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 108 |
| **Building Code:** | R2900500640 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $183,350 |
| **Building Name:** | Myre-Big Island SP Picnic Ar Shel 2 | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $67,390 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 1,682 |
| **Building Code:** | R2900500650 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $246,642 |
| **Building Name:** | Myre-Big Isl SP Big Isl CG San Bldg | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $80,909 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 725 |
| **Building Code:** | R2900500660 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $238,880 |
| **Building Name:** | Myre-Big Island SP Picnic Area San | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $84,505 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 720 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $275,224 |
| **Building Name:** | Myre-Big Island SP Wood Storage | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $49,464 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,074 |
| **Building Code:** | R2900500710 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $395,199 |
| **Building Name:** | Myre-Big Isl SP NY Pt Grp Dine Hall | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $37,626 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,472 |
| **Building Code:** | R2900501960 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $517,834 |
| **Building Name:** | Myre-Big Island SP Contact Station | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $41,665 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,261 |
| **Building Code:** | R2900502480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Isl SP NY Pt Grp Ctr Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $4,916 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,086 |
| **Building Name:** | Myre-Big Isl SP NY Pt Grp Ctr Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $5,590 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502500 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,785 |
| **Building Name:** | Myre-Big Island SP Cold Storage | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $8,839 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900502520 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $6,097 |
| **Building Name:** | Myre-Big Island SP Shop Area Shed | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $3,175 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900503780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,494 |
| **Building Name:** | Myre-Big Island SP Shop Cold Stor | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $2,843 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 81 |
| **Building Code:** | R2900503790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Isl SP White Fox CG Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $6,098 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Isl SP Big Isl CG Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $8,262 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Isl SP Big Isl CG Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $4,269 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Isl SP White Fox CG Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $4,916 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Island SP Picnic Ar Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $3,773 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504510 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,790 |
| **Building Name:** | Myre-Big Isl SP Little Isl Grp Vaul | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $1,904 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504520 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,616 |
| **Building Name:** | Myre-Big Island SP Bkpk Camp Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $5,711 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504530 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,616 |
| **Building Name:** | Myre-Big Island SP Bkpk Camp Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $8,099 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504540 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,787 |
| **Building Name:** | Myre-Big Island SP Bkpk Camp Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $7,382 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504550 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $89,597 |
| **Building Name:** | Myre-Big Isl SP Big Isl CG Cabin | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $8,076 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 260 |
| **Building Code:** | R2900504720 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,073 |
| **Building Name:** | Myre-Big Island SP Wood Storage | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $2,809 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900505090 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $473,164 |
| **Building Name:** | Myre-Big Isl SP White Fox San Bldg | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $28,988 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 1,144 |
| **Building Code:** | R2900505240 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,975 |
| **Building Name:** | Myre-Big Isl SP White Fox CG Vault | **Address:** | 19499 780TH AVE | **Deferred Maintenance:** | $1,080 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 47 |

### *Site: R290049 - Nerstrand Big Woods State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500520 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,235 |
| **Building Name:** | Nerstrand Big Woods SP Garage | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $4,753 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 528 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $210,430 |
| **Building Name:** | Nerstrand Big Woods SP Shop | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $42,160 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 1,095 |
| **Building Code:** | R2900500570 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,506 |
| **Building Name:** | Nerstrand Big Woods SP Cold Storage | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $9,344 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900500580 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $317,659 |
| **Building Name:** | Nerstrand Big Woods SP Sanitation | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $146,210 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900502280 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $14,269 |
| **Building Name:** | Nerstrand Big Woods SP Wood Shed | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $3,896 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 262 |
| **Building Code:** | R2900503860 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $14,735 |
| **Building Name:** | Nerstrand Big Woods SP Recycle Shed | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $3,805 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 341 |
| **Building Code:** | R2900504140 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $673,826 |
| **Building Name:** | Nerstrand Big Woods SP Contact Sta | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $89,763 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 2,760 |
| **Building Code:** | R2900505110 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $376,455 |
| **Building Name:** | Nerstrand Big Woods SP CG San Bldg | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $8,270 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 1,144 |
| **Building Code:** | R2900505120 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,364 |
| **Building Name:** | Nerstrand Big Woods SP Grp CG Vault | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $1,036 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505560 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $2,748 |
| **Building Name:** | Nerstrand Big Woods SP Wood Shed | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $55 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900505800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,181 |
| **Building Name:** | Nerstrand Big Wds SP CG Vault Concr | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $1,231 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 81 |
| **Building Code:** | R2900505810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,606 |
| **Building Name:** | Nerst-Big Wds SP Grp CG Vault Concr | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $968 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 81 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,606 |
| **Building Name:** | Nerst-Big Wds SP Picnic Vault Concr | **Address:** | 9700 170TH ST E | **Deferred Maintenance:** | $1,347 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | NERSTRAND | **Ext. Gross Area:** | 81 |

### *Site: R290050 - Old Mill State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102760 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $83,947 |
| **Building Name:** | Old Mill SP Residence Garage | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $13,649 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ARGYLE | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900102770 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $256,814 |
| **Building Name:** | Old Mill SP Residence | **Address:** | 33569 240TH AVE NW | **Deferred Maintenance:** | $30,276 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ARGYLE | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | R2900102780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $56,314 |
| **Building Name:** | Old Mill SP Pump House | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $5,968 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ARGYLE | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900102790 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $132,266 |
| **Building Name:** | Old Mill SP Historic Cabin | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $42,179 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | ARGYLE | **Ext. Gross Area:** | 672 |
| **Building Code:** | R2900102800 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $74,752 |
| **Building Name:** | Old Mill SP Historic Flour Mill | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $19,167 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ARGYLE | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900102810 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $250,817 |
| **Building Name:** | Old Mill SP CG Sanitation | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $89,731 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ARGYLE | **Ext. Gross Area:** | 825 |
| **Building Code:** | R2900102820 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $174,515 |
| **Building Name:** | Old Mill SP Picnic Area Sanitation | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $36,457 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ARGYLE | **Ext. Gross Area:** | 408 |
| **Building Code:** | R2900102830 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $485,722 |
| **Building Name:** | Old Mill SP Beach Bath House | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $64,300 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ARGYLE | **Ext. Gross Area:** | 1,320 |
| **Building Code:** | R2900102840 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $313,557 |
| **Building Name:** | Old Mill SP Water Tower | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $34,044 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ARGYLE | **Ext. Gross Area:** | 632 |
| **Building Code:** | R2900102850 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $175,736 |
| **Building Name:** | Old Mill SP Shop | **Address:** | 33489 240TH AVE NW | **Deferred Maintenance:** | $20,199 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ARGYLE | **Ext. Gross Area:** | 1,494 |

**Building Code:** R2900104300
**Building Name:** Old Mill SP Picnic Area Shelter 2
**Facility Condition Index:** 0.17 - Fair

**Cost Model Name:** Open Air Shelter
**Address:** 33489 240TH AVE NW
**City Code:** ARGYLE

**Current Replacement Value:** $583,852
**Deferred Maintenance:** $98,883
**Ext. Gross Area:** 1,312

**Building Code:** R2900105380
**Building Name:** Old Mill SP Scout Camp Vault
**Facility Condition Index:** 0.27 - Fair

**Cost Model Name:** Vault Toilet
**Address:** 33489 240TH AVE NW
**City Code:** ARGYLE

**Current Replacement Value:** $9,981
**Deferred Maintenance:** $2,652
**Ext. Gross Area:** 30

**Building Code:** R2900106450
**Building Name:** Old Mill SP Contact Station
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Single-story Office/Public Access Facility
**Address:** 33489 240TH AVE NW
**City Code:** ARGYLE

**Current Replacement Value:** $175,171
**Deferred Maintenance:** $19,525
**Ext. Gross Area:** 711

**Building Code:** R2900106960
**Building Name:** Old Mill SP CG Vault
**Facility Condition Index:** 0.16 - Fair

**Cost Model Name:** Vault Toilet
**Address:** 33489 240TH AVE NW
**City Code:** ARGYLE

**Current Replacement Value:** $13,966
**Deferred Maintenance:** $2,196
**Ext. Gross Area:** 42

**Building Code:** R2900108010
**Building Name:** Old Mill SP Picnic Area Vault
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Vault Toilet
**Address:** 33489 240TH AVE NW
**City Code:** ARGYLE

**Current Replacement Value:** $16,050
**Deferred Maintenance:** $1,605
**Ext. Gross Area:** 48

**Building Code:** R2900108240
**Building Name:** Old Mill SP Wood Shed
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Utility Shed
**Address:** 33489 240TH AVE NW
**City Code:** ARGYLE

**Current Replacement Value:** $7,914
**Deferred Maintenance:** $791
**Ext. Gross Area:** 72

### *Site: R290051 - Red River SRA*

**Building Code:** R2900107760
**Building Name:** Red River SRA Contact Station
**Facility Condition Index:** 0.11 - Good

**Cost Model Name:** Single-story Office/Public Access Facility
**Address:** 515 2ND ST NW
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** $125,228
**Deferred Maintenance:** $13,892
**Ext. Gross Area:** 413

**Building Code:** R2900108100
**Building Name:** Red River SRA Sherlock Pk South San
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Restroom Facility
**Address:** 515 2ND ST NW
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** $177,175
**Deferred Maintenance:** $17,717
**Ext. Gross Area:** 500

**Building Code:** R2900108110
**Building Name:** Red River SRA Sherlock Pk North San
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Single-story Restroom Facility
**Address:** 515 2ND ST NW
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** $177,175
**Deferred Maintenance:** $17,717
**Ext. Gross Area:** 500

**Building Code:** R2900108120
**Building Name:** Red River SRA Sherlock Park Vault
**Facility Condition Index:** 0.16 - Fair

**Cost Model Name:** Vault Toilet
**Address:** 515 2ND ST NW
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** $15,150
**Deferred Maintenance:** $2,423
**Ext. Gross Area:** 48

**Building Code:** R2900108130
**Building Name:** Red River SRA Sherlock Park Vault
**Facility Condition Index:** 0.10 - Good

**Cost Model Name:** Vault Toilet
**Address:** 515 2ND ST NW
**City Code:** EAST GRAND FORKS

**Current Replacement Value:** $15,150
**Deferred Maintenance:** $1,515
**Ext. Gross Area:** 48

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108320 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $177,175 |
| **Building Name:** | Red River SRA Sherlock Pk Bathhouse | **Address:** | 515 2ND ST NW | **Deferred Maintenance:** | $17,717 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 500 |
| **Building Code:** | R2900108330 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $80,922 |
| **Building Name:** | Red River SRA River Hgts Pic Shel 2 | **Address:** | 515 2ND ST NW | **Deferred Maintenance:** | $8,092 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 680 |
| **Building Code:** | R2900108340 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $178,505 |
| **Building Name:** | Red River SRA River Hgts Pic Shel 2 | **Address:** | 515 2ND ST NW | **Deferred Maintenance:** | $44,528 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900108350 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $170,192 |
| **Building Name:** | Red River SRA River Hgts Pic Shel 2 | **Address:** | 515 2ND ST NW | **Deferred Maintenance:** | $50,007 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900108360 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $255,132 |
| **Building Name:** | Red River SRA River Hgts Sanitation | **Address:** | 515 2ND ST NW | **Deferred Maintenance:** | $25,513 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900108370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,434 |
| **Building Name:** | Red River SRA HQ Cold Storage | **Address:** | 515 2ND ST NW | **Deferred Maintenance:** | $2,108 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 80 |

### *Site: R290052 - Rice Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $38,403 |
| **Building Name:** | Rice Lake SP Picnic Area Pumphouse | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $4,600 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 114 |
| **Building Code:** | R2900500790 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $232,931 |
| **Building Name:** | Rice Lake SP CG Sanitation | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $75,212 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 689 |
| **Building Code:** | R2900500800 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $146,856 |
| **Building Name:** | Rice Lake SP Picnic Area Sanitation | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $56,343 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 307 |
| **Building Code:** | R2900500810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,825 |
| **Building Name:** | Rice Lake SP Cold Storage | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $7,681 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 182 |
| **Building Code:** | R2900500820 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $791,589 |
| **Building Name:** | Rice Lake SP Contact Station | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $258,253 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 2,329 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502030 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $87,455 |
| **Building Name:** | Rice Lake SP Picnic Area Shelter 1 | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $10,654 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 845 |
| **Building Code:** | R2900503140 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,937 |
| **Building Name:** | Rice Lake SP Grp CG Vault Toilet | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $3,129 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900503150 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,621 |
| **Building Name:** | Rice Lake SP Grp CG Vault Toilet | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $3,327 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900504390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $433,080 |
| **Building Name:** | Rice Lake SP Shop | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $56,702 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 3,024 |
| **Building Code:** | R2900504400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,621 |
| **Building Name:** | Rice Lake SP Boat Land Vault Toilet | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $2,084 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900504410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,621 |
| **Building Name:** | Rice Lake SP Grp CG Vault Toilet | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $2,649 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900504420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,621 |
| **Building Name:** | Rice Lake SP CG B-Loop Vault Toilet | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $3,785 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900504430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,838 |
| **Building Name:** | Rice Lake SP Canoe CG Vault Toilet | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $4,672 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900505270 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,780 |
| **Building Name:** | Rice Lake SP Picnic Shelter 1 | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $587 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,255 |
| **Building Name:** | Rice Lake SP Wood Shed | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $6,188 |
| **Facility Condition Index:** | 0.67 - Crisis | **City Code:** | OWATONNA | **Ext. Gross Area:** | 103 |
| **Building Code:** | R2900505540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $255,317 |
| **Building Name:** | Rice Lake SP 3-Stall Cold Storage | **Address:** | 8485 ROSE ST | **Deferred Maintenance:** | $7,385 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | OWATONNA | **Ext. Gross Area:** | 3,024 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $61,557 |
| **Building Name:** | Rice Lake SP CG Vault Concrete | **Address:** | 8465 ROSE ST | **Deferred Maintenance:** | $1,231 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | OWATONNA | **Ext. Gross Area:** | 118 |

### *Site: R290053 - Sakatah Lake State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500950 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $315,243 |
| **Building Name:** | Sakatah Lake SP Contact Station | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $36,749 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 1,320 |
| **Building Code:** | R2900500970 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $137,917 |
| **Building Name:** | Sakatah Lake SP Picnic Area San Bld | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $42,320 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 414 |
| **Building Code:** | R2900501000 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $145,559 |
| **Building Name:** | Sakatah Lake SP Wood Shop | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $23,182 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 2,009 |
| **Building Code:** | R2900501010 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $232,425 |
| **Building Name:** | Sakatah Lake SP Office | **Address:** | 50507 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $6,292 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 1,064 |
| **Building Code:** | R2900501020 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $36,559 |
| **Building Name:** | Sakatah Lake SP CG Fish Cleang Hse | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $1,522 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900502400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,437 |
| **Building Name:** | Sakatah Lake SP CG Site 42 Vault | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $3,647 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504020 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,437 |
| **Building Name:** | Sakatah Lake SP Upper CG Vault | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $3,647 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504030 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,437 |
| **Building Name:** | Sakatah Lake SP Picnic Area Vault | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $4,821 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $353,918 |
| **Building Name:** | Sakatah Lake SP Shop | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $38,873 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | R2900504270 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $378,207 |
| **Building Name:** | Sakatah Lake SP CG Sanitation | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $32,144 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 1,133 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504280 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $45,020 |
| **Building Name:** | Sakatah Lake SP CG Cabin | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $2,877 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 282 |
| **Building Code:** | R2900504290 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,435 |
| **Building Name:** | Sakatah Lake SP Shed | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $5,443 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 832 |
| **Building Code:** | R2900504300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,437 |
| **Building Name:** | Sakatah Lake SP Lower CG Vault | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $4,180 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,437 |
| **Building Name:** | Sakatah Lake SP CG Site 10 Vault | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $4,821 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,437 |
| **Building Name:** | Sakatah Lake SP CG Vault Toilet | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $4,180 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,124 |
| **Building Name:** | Sakatah Lake SP Wood Shed | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $3,564 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 246 |
| **Building Code:** | R2900504690 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,632 |
| **Building Name:** | Sakatah Lake SP Pump House | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $1,205 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900504800 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $51 |
| **Building Name:** | Sakatah Lake SP Adirondack | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $8 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900505130 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,360 |
| **Building Name:** | Sakatah Lake SP Upper CG Vault | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $887 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900505140 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,836 |
| **Building Name:** | Sakatah Lake SP CG Vault Toilet | **Address:** | 50499 SAKATAH LAKE SP RD | **Deferred Maintenance:** | $1,070 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 47 |

### *Site: R290054 - Savanna Portage State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305320 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $293,034 |
| **Building Name:** | Savanna Portage SP Office | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $67,171 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 1,395 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305330 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $714,850 |
| **Building Name:** | Savanna Portage SP HQ Cold Storage | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $315,196 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 3,382 |
| **Building Code:** | R2900305340 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $594,198 |
| **Building Name:** | Savanna Portage SP Residence | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $125,889 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 2,310 |
| **Building Code:** | R2900305350 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $660,404 |
| **Building Name:** | Savanna Portage SP Shop | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $208,855 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 3,695 |
| **Building Code:** | R2900305360 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,739 |
| **Building Name:** | Savanna Portage SP HQ Pump House | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $3,214 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 72 |
| **Building Code:** | R2900305370 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $267,477 |
| **Building Name:** | Savanna Portage SP Loon Lk San Bldg | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $38,374 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 1,425 |
| **Building Code:** | R2900305390 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $173,083 |
| **Building Name:** | Savanna Portage SP CG B-Loop San | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $57,117 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900305400 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $88,239 |
| **Building Name:** | Savanna Portage SP HQ Shed | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $25,575 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 1,020 |
| **Building Code:** | R2900305410 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,537 |
| **Building Name:** | Savanna Portage SP HQ Shed | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $8,845 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 520 |
| **Building Code:** | R2900305420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna Portage SP Grp CG Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,697 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna Portage SP Grp CG Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,752 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,988 |
| **Building Name:** | Savanna Portage SP Loon Lk Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $2,968 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 40 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,988 |
| **Building Name:** | Savanna Portage SP Savanna Lk Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $2,968 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900305460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna PortSP Shumway CG Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,752 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna PortageSP CG Ste41 Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,752 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305770 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $132,937 |
| **Building Name:** | Savanna Portage SP Lodging House | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $36,615 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 704 |
| **Building Code:** | R2900305780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,965 |
| **Building Name:** | Savanna Portage SP Shed | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $4,875 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900305790 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $92,004 |
| **Building Name:** | Savanna Portage SP Garage | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $21,628 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900305830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,988 |
| **Building Name:** | Savanna Portage SP Portage Trl Vaul | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,836 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900305840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna PortSP WolfLk Boat Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $696 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305850 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $2,927 |
| **Building Name:** | Savanna Portage SP SiteK Cold Stor | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $966 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna Portage SP E Sav R Bkp Vaul | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna PortSP WolfLk Bkpk Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305880 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,988 |
| **Building Name:** | Savanna PortSP ContTrlDivBkpk Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $872 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900305890 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna PortSP Pines Bkpk Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna Portage SP D Bkpk Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900305910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,442 |
| **Building Name:** | Savanna PortSP Sav Lk Bkpk Pit Toil | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900306100 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $46,327 |
| **Building Name:** | Savanna Portage SP CG Cabin | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $7,900 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 252 |
| **Building Code:** | R2900306960 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $252,227 |
| **Building Name:** | Savanna Portage SP CG A-Loop San | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $6,350 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 880 |
| **Building Code:** | R2900306970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,453 |
| **Building Name:** | Savanna Portage SP CG A-Loop Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,178 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900307260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,085 |
| **Building Name:** | Savanna Portage SP CG Site 43 Vault | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,005 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900308430 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,144 |
| **Building Name:** | Savanna Portage SP GrpCG Adirondack | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $3,678 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900308440 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,248 |
| **Building Name:** | Savanna Portage SP HQ Cold Storage | **Address:** | 55626 LAKE PLACE | **Deferred Maintenance:** | $1,072 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 34 |

### *Site: R290055 - Scenic State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201060 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $280,313 |
| **Building Name:** | Scenic SP Sanitation | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $92,613 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 800 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201070 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $51,158 |
| **Building Name:** | Scenic SP Fish Cleaning House | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $9,839 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900201080 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $374,604 |
| **Building Name:** | Scenic SP Contact Station | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $34,665 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 1,411 |
| **Building Code:** | R2900201090 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $60,565 |
| **Building Name:** | Scenic SP Fish Cleaning House | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $20,966 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900201100 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $170,009 |
| **Building Name:** | Scenic SP Log Cabin | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $22,045 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 513 |
| **Building Code:** | R2900201110 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $263,854 |
| **Building Name:** | Scenic SP Log Sanitation | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $26,500 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 544 |
| **Building Code:** | R2900201120 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $192,446 |
| **Building Name:** | Scenic SP Water Tower | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $27,872 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900201130 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $568,026 |
| **Building Name:** | Scenic SP Chase Point Lodge | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $107,438 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 1,900 |
| **Building Code:** | R2900201140 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $354,106 |
| **Building Name:** | Scenic SP Log Sanitation | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $13,942 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | BIGFORK | **Ext. Gross Area:** | 925 |
| **Building Code:** | R2900201150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $74,606 |
| **Building Name:** | Scenic SP Log Cold Storage | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $10,387 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 432 |
| **Building Code:** | R2900201160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $65,204 |
| **Building Name:** | Scenic SP Large Wood Shed | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $9,624 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 520 |
| **Building Code:** | R2900201190 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $232,614 |
| **Building Name:** | Scenic SP 3- Stall Log Garage | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $43,111 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 1,152 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201200 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $311,006 |
| **Building Name:** | Scenic SP Cold Shop | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $79,202 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 2,304 |
| **Building Code:** | R2900201210 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $391,351 |
| **Building Name:** | Scenic SP Heated Shop | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $57,017 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 2,140 |
| **Building Code:** | R2900201220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $101,720 |
| **Building Name:** | Scenic SP Log Cold Storage Garage | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $16,694 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 589 |
| **Building Code:** | R2900201230 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $579,915 |
| **Building Name:** | Scenic SP Log Office | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $52,211 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 1,824 |
| **Building Code:** | R2900203650 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $43,897 |
| **Building Name:** | Scenic SP Spring House | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $9,905 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 111 |
| **Building Code:** | R2900204240 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,673 |
| **Building Name:** | Scenic SP Oil House | **Address:** | 56956 Scenic Hwy 7 | **Deferred Maintenance:** | $8,071 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | BIGFORK | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900205730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $6,179 |
| **Building Name:** | Scenic SP Lake of the Isle Vault | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $959 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 20 |
| **Building Code:** | R2900205740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $6,179 |
| **Building Name:** | Scenic SP Lake of the Isle Vault | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $959 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 20 |
| **Building Code:** | R2900205750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $6,179 |
| **Building Name:** | Scenic SP Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,884 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 20 |
| **Building Code:** | R2900205760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $6,179 |
| **Building Name:** | Scenic SP Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,884 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 20 |
| **Building Code:** | R2900205790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,269 |
| **Building Name:** | Scenic SP Womens Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $2,295 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900205800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,269 |
| **Building Name:** | Scenic SP Mens Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $2,295 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900205810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,651 |
| **Building Name:** | Scenic SP Wood Shed | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,980 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900205820 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $2,918 |
| **Building Name:** | Scenic SP Oar Shed | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $145 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | BIGFORK | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900207350 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $38,597 |
| **Building Name:** | Scenic SP Fire Tower | **Address:** | 56956 Scenic Hwy 7 | **Deferred Maintenance:** | $7,668 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,988 |
| **Building Name:** | Scenic SP Chase Point Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,126 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900207850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,988 |
| **Building Name:** | Scenic SP Chase Point CG Uni Vault | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $786 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900207860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,988 |
| **Building Name:** | Scenic SP Chase Pt CG Boat Ld Vault | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $937 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900207870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,988 |
| **Building Name:** | Scenic SP Lodge Boat Landing Vault | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $937 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900208550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,248 |
| **Building Name:** | Scenic SP Unisex Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,300 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900208730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,248 |
| **Building Name:** | Scenic SP Lodge CG Uni Vault Toilet | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,094 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900210220 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $12,852 |
| **Building Name:** | Scenic SP Adirondack 1 | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $6,021 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 56 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210230 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,344 |
| **Building Name:** | Scenic SP Adirondack 2 | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $2,294 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900210240 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $12,852 |
| **Building Name:** | Scenic SP Adirondack 3 | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $6,095 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | BIGFORK | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900210250 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,399 |
| **Building Name:** | Scenic SP Adirondack 4 | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $7,466 |
| **Facility Condition Index:** | 0.65 - Crisis | **City Code:** | BIGFORK | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900210260 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,955 |
| **Building Name:** | Scenic SP Adirondack 5 | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $7,074 |
| **Facility Condition Index:** | 0.59 - Crisis | **City Code:** | BIGFORK | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900210280 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $10,026 |
| **Building Name:** | Scenic SP Adirondack 6 | **Address:** | 56956 SCENIC HWY 7 | **Deferred Maintenance:** | $1,149 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BIGFORK | **Ext. Gross Area:** | 42 |

### *Site: R290056 - Schoolcraft State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $101,657 |
| **Building Name:** | Schoolcraft SP Shop | **Address:** | 9042 SCHOOLCRAFT LN NE | **Deferred Maintenance:** | $41,173 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900207030 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,661 |
| **Building Name:** | Schoolcraft SP Oil House | **Address:** | 9042 SCHOOLCRAFT LN NE | **Deferred Maintenance:** | $2,293 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900208000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,866 |
| **Building Name:** | Schoolcraft SP Vault Toilet | **Address:** | 9042 SCHOOLCRAFT LN NE | **Deferred Maintenance:** | $2,489 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 50 |
| **Building Code:** | R2900208010 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,866 |
| **Building Name:** | Schoolcraft SP Day Use Area Vault | **Address:** | 9042 SCHOOLCRAFT LN NE | **Deferred Maintenance:** | $3,004 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 50 |
| **Building Code:** | R2900208020 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | Schoolcraft SP Vault Toilet | **Address:** | 9042 SCHOOLCRAFT LN NE | **Deferred Maintenance:** | $1,481 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 30 |

### *Site: R290057 - Sibley State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400020 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $13,978 |
| **Building Name:** | Sibley SP Shop Area Cold Storage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $7,788 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900400030 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $16,472 |
| **Building Name:** | Sibley SP Shop Area Cold Storage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $9,658 |
| **Facility Condition Index:** | 0.59 - Crisis | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900400050 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $471,403 |
| **Building Name:** | Sibley SP Lakeview CG W Sanitation | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $56,701 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 896 |
| **Building Code:** | R2900400060 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $957,124 |
| **Building Name:** | Sibley SP Lakeview CG E Sanitation | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $120,473 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,687 |
| **Building Code:** | R2900400070 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $438,421 |
| **Building Name:** | Sibley SP Lakeview CG Picnic Shel 2 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $83,036 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,464 |
| **Building Code:** | R2900400080 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $119,118 |
| **Building Name:** | Sibley SP Lakeview CG Cold Storage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $36,128 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900400090 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $76,353 |
| **Building Name:** | Sibley SP Lkvw CG Fish Cleaning Hse | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $8,457 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 169 |
| **Building Code:** | R2900400100 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $670,181 |
| **Building Name:** | Sibley SP Beach Bath House | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $129,181 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 989 |
| **Building Code:** | R2900400110 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $244,747 |
| **Building Name:** | Sibley SP Cedar Hill Sanitation | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $42,853 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 522 |
| **Building Code:** | R2900400120 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $240,950 |
| **Building Name:** | Sibley SP Cedar Hill Pump House | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $62,541 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 470 |
| **Building Code:** | R2900400130 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $759,839 |
| **Building Name:** | Sibley SP Cedar Hill Picnic Shel 2 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $187,102 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,836 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400140 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $749,198 |
| **Building Name:** | Sibley SP Group Center Dining Hall | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $162,260 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 3,552 |
| **Building Code:** | R2900400160 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 8 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $27,953 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400170 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 7 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $26,681 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400180 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 6 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $26,681 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400190 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 5 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $26,681 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400200 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 4 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $31,672 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400210 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 3 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $26,681 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400220 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $167,163 |
| **Building Name:** | Sibley SP Group Center Cabin 2 | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $23,313 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 648 |
| **Building Code:** | R2900400230 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $259,540 |
| **Building Name:** | Sibley SP Group Center Rec Hall | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $101,457 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900400240 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $413,245 |
| **Building Name:** | Sibley SP Group Center Lodging Hse | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $96,723 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,824 |
| **Building Code:** | R2900400250 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $650,650 |
| **Building Name:** | Sibley SP Residence | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $166,663 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 2,568 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400260 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $756,279 |
| **Building Name:** | Sibley SP Office | **Address:** | 398 SIBLEY PARK RD NE | **Deferred Maintenance:** | $364,557 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 2,187 |
| **Building Code:** | R2900400270 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $222,318 |
| **Building Name:** | Sibley SP Shop Area Cold Storage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $85,569 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,608 |
| **Building Code:** | R2900400280 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $449,065 |
| **Building Name:** | Sibley SP Main Shop | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $151,475 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 2,100 |
| **Building Code:** | R2900400290 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $322,322 |
| **Building Name:** | Sibley SP Contact Station | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $111,420 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,284 |
| **Building Code:** | R2900402700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $76,183 |
| **Building Name:** | Sibley SP Residence Garage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $20,878 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 832 |
| **Building Code:** | R2900402710 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $1,152,260 |
| **Building Name:** | Sibley SP Interpretive Ctr | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $243,016 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 4,723 |
| **Building Code:** | R2900402900 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,663 |
| **Building Name:** | Sibley SP Shop Area HazMat Storage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $7,777 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 104 |
| **Building Code:** | R2900402960 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $398,936 |
| **Building Name:** | Sibley SP Oak Ridge CG Sanitation | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $40,641 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,120 |
| **Building Code:** | R2900403000 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $476,009 |
| **Building Name:** | Sibley SP Group Center Sanitation | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $130,678 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,350 |
| **Building Code:** | R2900403060 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,686 |
| **Building Name:** | Sibley SP Wood Storage | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $9,150 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900403400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Horse CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,765 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900403410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Horse CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,765 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900403420 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $100,913 |
| **Building Name:** | Sibley SP Mt Tom Observation Tower | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $25,612 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 440 |
| **Building Code:** | R2900403650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $4,822 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900403660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $6,190 |
| **Facility Condition Index:** | 0.50 - Crisis | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900403670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $4,074 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900403680 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $4,074 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900403690 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,901 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900403700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,901 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900404230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,963 |
| **Building Name:** | Sibley SP Lakeview CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $2,096 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900404240 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,020 |
| **Building Name:** | Sibley SP Boat Landing Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $2,685 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900404250 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Mt Tom Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,235 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,347 |
| **Building Name:** | Sibley SP Group CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,235 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900404950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,945 |
| **Building Name:** | Sibley SP Picnic Area Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $651 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900405030 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $70,867 |
| **Building Name:** | Sibley SP Wastewater Cntrl Sys Bldg | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,417 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 200 |
| **Building Code:** | R2900405100 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $78,610 |
| **Building Name:** | Sibley SP Oak Rdg Lady Slipper Cab | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,572 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405110 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $78,610 |
| **Building Name:** | Sibley SP Oak Ridge CG Loon Cabin | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,572 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405120 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $78,610 |
| **Building Name:** | Sibley SP Oak Ridge CG Monarch Cab | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,572 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405130 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $78,610 |
| **Building Name:** | Sibley SP Oak Ridge CG Walleye Cab | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,572 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900405170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,601 |
| **Building Name:** | Sibley SP Group CG Vault Toilet | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $2,407 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900405180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $69,422 |
| **Building Name:** | Sibley SP Oak Ridge CG Vault Concr | **Address:** | 800 SIBLEY PARK RD NE | **Deferred Maintenance:** | $1,388 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 102 |

### *Site: R290058 - Lake Vermilion-Soudan Underground Mine State P*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202310 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,900,866 |
| **Building Name:** | Lake Ver-Soudan SP Pump House | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $1,030,860 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 10,072 |
| **Building Code:** | R2900202320 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,694,375 |
| **Building Name:** | Lake Ver-Sdn SP Mine Ar Dry House | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $781,684 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 4,428 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,917 |
| **Building Name:** | Lake Ver-Soudan SP Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $3,331 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 108 |
| **Building Code:** | R2900202340 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,727 |
| **Building Name:** | Lake Ver-Soudan SP Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $15,799 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 364 |
| **Building Code:** | R2900202350 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $821,034 |
| **Building Name:** | Lake Ver-Sdn SP Mine Ore Crush Bldg | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $454,602 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 6,376 |
| **Building Code:** | R2900202360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $263,076 |
| **Building Name:** | Lake Ver-Sdn SP Mine Ar Cold Stor | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $162,166 |
| **Facility Condition Index:** | 0.62 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,560 |
| **Building Code:** | R2900202370 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $17,462 |
| **Building Name:** | Lake Ver-Sdn Mine Ore Crsh Twr Bldg | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $5,763 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,190 |
| **Building Code:** | R2900202380 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,125 |
| **Building Name:** | Lake Ver-Soudan SP Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $4,732 |
| **Facility Condition Index:** | 0.58 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900202390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $56,413 |
| **Building Name:** | Lake Ver-Sdn SP Mine Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $47,609 |
| **Facility Condition Index:** | 0.84 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 408 |
| **Building Code:** | R2900202400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,204 |
| **Building Name:** | Lake Ver-Soudan SP Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $5,944 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 130 |
| **Building Code:** | R2900202410 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,904 |
| **Building Name:** | Lake Ver-Soudan SP Contact Station | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $9,868 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900202420 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $447,417 |
| **Building Name:** | Lake Ver-Soudan SP Residence | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $52,012 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,937 |
| **Building Code:** | R2900202430 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $315,187 |
| **Building Name:** | Lake Ver-Soudan SP Pay Office | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $93,495 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,140 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202440 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,599,733 |
| **Building Name:** | Lake Ver-Soudan SP Old Machine Shop | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $991,815 |
| **Facility Condition Index:** | 0.62 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 9,740 |
| **Building Code:** | R2900202450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $91,369 |
| **Building Name:** | Lake Ver-Soudan SP Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $73,660 |
| **Facility Condition Index:** | 0.81 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,040 |
| **Building Code:** | R2900202460 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $185,569 |
| **Building Name:** | Lake Ver-Soudan SP Cold Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $64,110 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,383 |
| **Building Code:** | R2900202470 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $211,431 |
| **Building Name:** | Lake Ver-Soudan SP 4-Stall Garage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $125,106 |
| **Facility Condition Index:** | 0.59 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,260 |
| **Building Code:** | R2900202480 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,353 |
| **Building Name:** | Lake Ver-Soudan SP Hose Storage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $13,363 |
| **Facility Condition Index:** | 0.82 - Crisis | **City Code:** | SOUDAN | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900202500 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $135,468 |
| **Building Name:** | Lake Ver-Soudan SP Pump House | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $64,278 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 936 |
| **Building Code:** | R2900204000 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,554 |
| **Building Name:** | Lake Ver-Soudan SP Residence Garage | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $9,570 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | SOUDAN | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900207380 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $733,039 |
| **Building Name:** | Lake Ver-Soudan SP Shop | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $111,991 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | SOUDAN | **Ext. Gross Area:** | 4,536 |
| **Building Code:** | R2900209260 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $862,996 |
| **Building Name:** | Lake Ver-Soudan Mine Water Trtmnt | **Address:** | 4793 ARMSTRONG BAY RD W | **Deferred Maintenance:** | $86,300 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOUDAN | **Ext. Gross Area:** | 3,975 |
| **Building Code:** | R2900209520 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $51,352 |
| **Building Name:** | Lake Ver-Sdn SP Armstr Bay Up Vault | **Address:** | 4761 ARMSTRONG BAY RD W | **Deferred Maintenance:** | $1,027 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900209530 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $86,384 |
| **Building Name:** | Lake Ver-Sdn SP Armstr Up Pic Shel | **Address:** | 4761 ARMSTRONG BAY RD W | **Deferred Maintenance:** | $1,728 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 444 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209540 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $86,384 |
| **Building Name:** | Lake Ver-Sdn SP Arms S Low Pic Shel | **Address:** | 4761 ARMSTRONG BAY RD W | **Deferred Maintenance:** | $1,728 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 444 |
| **Building Code:** | R2900209550 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $86,384 |
| **Building Name:** | Lake Ver-Sdn SP Arms N Low Pic Shel | **Address:** | 4761 ARMSTRONG BAY RD W | **Deferred Maintenance:** | $1,728 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 444 |
| **Building Code:** | R2900209560 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $51,352 |
| **Building Name:** | Lake Ver-Sdn SP Armst Bay Low Vault | **Address:** | 4761 ARMSTRONG BAY RD W | **Deferred Maintenance:** | $1,027 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900209570 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $183,628 |
| **Building Name:** | Lk Ver-Sdn SP W Big Sky Pic Shel | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $3,673 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 702 |
| **Building Code:** | R2900209580 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $477,812 |
| **Building Name:** | Lk Ver-Sdn SP Verm Ridge CG San | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $9,556 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,077 |
| **Building Code:** | R2900209590 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $183,628 |
| **Building Name:** | Lk Ver-Sdn SP E Big Sky Pic Shel | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $3,673 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 702 |
| **Building Code:** | R2900209600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $56,021 |
| **Building Name:** | Lk Ver-Sdn SP Big Sky Vault | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $1,120 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900209620 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $56,021 |
| **Building Name:** | Lk Ver-Sdn Vrm Rdg 100 Series Vault | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $1,120 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900209630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $56,021 |
| **Building Name:** | Lk Ver-Sdn Vrm Rdg 300 Series Vault | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $1,120 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900209640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $56,021 |
| **Building Name:** | Lk Ver-Sdn Vrm Rdg 400 Series Vault | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $1,120 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900209650 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $393,255 |
| **Building Name:** | Lk Ver-Sdn SP Verm Ridge CG San 2 | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $7,865 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 879 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209660 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $175,814 |
| **Building Name:** | Lk Ver-Sdn SP Cedar Valley Pic Shel | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $3,516 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 702 |
| **Building Code:** | R2900209670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $98,036 |
| **Building Name:** | Lk Ver-Sdn SP Cedar Valley Vault | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $1,961 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900209840 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $20,000 |
| **Building Name:** | Lake Ver-Sdn SP Blue Heron Bunkhse | **Address:** | Blue Heron Island | **Deferred Maintenance:** | $7,137 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | SOUDAN | **Ext. Gross Area:** | 131 |
| **Building Code:** | R2900209940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $56,021 |
| **Building Name:** | Lk Ver-Sdn SP Cable Bay WAS Vault | **Address:** | 4909 VERMILION RIDGE RD | **Deferred Maintenance:** | $1,120 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900210270 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $319,824 |
| **Building Name:** | Lake Ver-Sdn SP Blue Heron Cabin | **Address:** | Blue Heron Island | **Deferred Maintenance:** | $34,658 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SOUDAN | **Ext. Gross Area:** | 1,012 |
| **Building Code:** | R2900210350 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $136,217 |
| **Building Name:** | Lk Ver-Sdn SP Vrm Rdg H2O Stor Gar | **Address:** | 4805 VERMILION RIDGE RD | **Deferred Maintenance:** | $2,724 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 624 |
| **Building Code:** | R2900210400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $22,000 |
| **Building Name:** | Lake Ver-Sdn SP Blue Heron Vault | **Address:** | Blue Heron Island | **Deferred Maintenance:** | $440 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900210410 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $89,514 |
| **Building Name:** | Lake Ver-Sdn Lake Lodg Water Trtmnt | **Address:** | 4793 Armstrong Bay Rd W | **Deferred Maintenance:** | $1,790 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 609 |
| **Building Code:** | R2900210520 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $30,453 |
| **Building Name:** | Lake Ver-Sdn SP Blue Heron Shed | **Address:** | Blue Heron Island | **Deferred Maintenance:** | $3,045 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOUDAN | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900210530 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,841 |
| **Building Name:** | Lake Ver-Sdn SP Blue Heron Vault | **Address:** | Blue Heron Island | **Deferred Maintenance:** | $1,094 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | SOUDAN | **Ext. Gross Area:** | 20 |
| **Building Code:** | R2900210560 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $43,043 |
| **Building Name:** | Lk Ver-Sdn SP Entrance Reg Kiosk | **Address:** | 4887 VERMILION RIDGE RD | **Deferred Maintenance:** | $861 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 439 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210570 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $37,709 |
| **Building Name:** | Lk Ver-Sdn SP Vault Toilet Utility | **Address:** | 4887 VERMILION RIDGE RD | **Deferred Maintenance:** | $754 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SOUDAN | **Ext. Gross Area:** | 112 |

### *Site: R290059 - Split Rock Creek State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401030 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $409,193 |
| **Building Name:** | Split Rock Creek SP Bath House | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $135,034 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JASPER | **Ext. Gross Area:** | 1,099 |
| **Building Code:** | R2900401050 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $164,371 |
| **Building Name:** | Split Rock Creek SP Picnic Shel 2 | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $88,688 |
| **Facility Condition Index:** | 0.54 - Crisis | **City Code:** | JASPER | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900401060 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $343,619 |
| **Building Name:** | Split Rock Creek SP Interp Ctr | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $68,687 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | JASPER | **Ext. Gross Area:** | 675 |
| **Building Code:** | R2900401070 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $167,808 |
| **Building Name:** | Split Rock Creek SP Office | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $55,974 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JASPER | **Ext. Gross Area:** | 1,077 |
| **Building Code:** | R2900401080 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $154,366 |
| **Building Name:** | Split Rock Creek SP CG Sanitation | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $36,494 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | JASPER | **Ext. Gross Area:** | 572 |
| **Building Code:** | R2900403250 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,527 |
| **Building Name:** | Split Rock Creek SP Oil House | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $2,484 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JASPER | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900403770 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $22,684 |
| **Building Name:** | Split Rock Creek SP Fish Cleang Hse | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $4,216 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | JASPER | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900403900 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,104 |
| **Building Name:** | Split Rock Creek SP Picnic Vault | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $3,754 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | JASPER | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900403910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,104 |
| **Building Name:** | Split Rock Creek SP CG Vault Toilet | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $3,754 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | JASPER | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900403920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,104 |
| **Building Name:** | Split Rock Creek SP Beach ADA Vault | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $3,754 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | JASPER | **Ext. Gross Area:** | 47 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404660 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,051 |
| **Building Name:** | Split Rock Creek SP Cold Storage | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $9,257 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JASPER | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900404710 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $252,769 |
| **Building Name:** | Split Rock Creek SP Contact Station | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $20,719 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | JASPER | **Ext. Gross Area:** | 903 |
| **Building Code:** | R2900405270 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,748 |
| **Building Name:** | Split Rock Creek SP Wood Storage | **Address:** | 336 50TH AVE | **Deferred Maintenance:** | $1,567 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JASPER | **Ext. Gross Area:** | 48 |

### *Site: R290060 - Split Rock Lighthouse State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204350 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $123,069 |
| **Building Name:** | Split Rock Lighthouse SP Shop | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $12,307 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 1,083 |
| **Building Code:** | R2900204370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,755 |
| **Building Name:** | Split Rock Lighthouse SP Cold Stor | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $5,982 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900204450 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $674,712 |
| **Building Name:** | Split Rock Lighthouse SP Trails Ctr | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $65,804 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 2,700 |
| **Building Code:** | R2900204460 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $296,345 |
| **Building Name:** | Split Rock Lighthouse SP Sanitation | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $41,156 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 900 |
| **Building Code:** | R2900204470 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $51,826 |
| **Building Name:** | Split Rock Lighthouse Picnic Shel 2 | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $1,037 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900205410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,730 |
| **Building Name:** | Split Rock Lighthouse Vault Toilet | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $3,541 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900205440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,730 |
| **Building Name:** | Split Rock Lighthouse Site15 Vault | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $3,541 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206620 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $338,067 |
| **Building Name:** | Split Rock Lighthouse SP Contact St | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $31,232 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 1,077 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206630 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,415 |
| **Building Name:** | Split Rock Lighthouse SP Cold Stor | **Address:** | 3755 Split Rock Lighthouse Rd | **Deferred Maintenance:** | $2,788 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900207710 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $343,212 |
| **Building Name:** | Split Rock Lighthouse SP Shop | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $36,329 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 2,268 |
| **Building Code:** | R2900208750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,501 |
| **Building Name:** | Split Rock Lighthouse Diver's Vault | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $1,177 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900209910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $32,070 |
| **Building Name:** | SplitRock Lighthse PebBe Vault Conc | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $641 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900209920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $32,070 |
| **Building Name:** | SplitRock Lighthouse CG Vault Conc | **Address:** | 3755 SPLIT ROCK LIGHTHOUSE F | **Deferred Maintenance:** | $641 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 51 |

### *Site: R290061 - St Croix State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301500 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $758,995 |
| **Building Name:** | St Croix SP Head Rapids Dining Hall | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $233,728 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 3,015 |
| **Building Code:** | R2900301510 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $96,845 |
| **Building Name:** | St Croix SP Head of Rapids Garage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $38,199 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 816 |
| **Building Code:** | R2900301520 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $192,845 |
| **Building Name:** | St Croix SP Head of Rapids San A | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $71,520 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 508 |
| **Building Code:** | R2900301530 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $122,788 |
| **Building Name:** | St Croix SP Head Rapids Dormitory | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $39,291 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301540 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $122,788 |
| **Building Name:** | St Croix SP Head Rapids Dormitory | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $39,291 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301550 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $122,788 |
| **Building Name:** | St Croix SP Head Rapids Dormitory | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $39,291 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301560 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $119,561 |
| **Building Name:** | St Croix SP Head Rapids Dorm B1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $36,075 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301570 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $119,561 |
| **Building Name:** | St Croix SP Head Rapids Dorm B2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $38,226 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301580 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $119,561 |
| **Building Name:** | St Croix SP Head Rapids Dorm B3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $36,075 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301590 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $33,645 |
| **Building Name:** | St Croix SP Head Rapids San B | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $15,958 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 360 |
| **Building Code:** | R2900301600 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $119,561 |
| **Building Name:** | St Croix SP Head Rapids Dorm C1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $36,075 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301610 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $119,561 |
| **Building Name:** | St Croix SP Head Rapids Dorm C2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $38,226 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301620 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $99,634 |
| **Building Name:** | St Croix SP Head Rapids Dorm C3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $29,439 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900301630 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $149,451 |
| **Building Name:** | St Croix SP Head Rapids Dorm C4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $45,094 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900301640 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $131,413 |
| **Building Name:** | St Croix SP Head Rapids San C | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $40,823 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 448 |
| **Building Code:** | R2900301650 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $76,928 |
| **Building Name:** | St Croix SP Head Rapids Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $16,351 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 256 |
| **Building Code:** | R2900301660 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $74,106 |
| **Building Name:** | St Croix SP Head Rapids Rec Hall | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $21,553 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 540 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301670 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $137,168 |
| **Building Name:** | St Croix SP Head Rapids Lodging Hse | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $35,072 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 580 |
| **Building Code:** | R2900301680 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $91,283 |
| **Building Name:** | St Croix SP Head Rapids Office Dorm | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $28,893 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 510 |
| **Building Code:** | R2900301690 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $122,402 |
| **Building Name:** | St Croix SP Head Rapids Infirmary | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $37,189 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 594 |
| **Building Code:** | R2900301700 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $50,352 |
| **Building Name:** | St Croix SP Head Rapids Cooks Shack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $15,812 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301710 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $205,183 |
| **Building Name:** | St Croix SP Clayton Lk Beach San | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $23,948 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 624 |
| **Building Code:** | R2900301730 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $639,040 |
| **Building Name:** | St Croix SP St Johns Ln Dining Hall | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $194,741 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,899 |
| **Building Code:** | R2900301750 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $108,937 |
| **Building Name:** | St Croix SP St Johns Lodging House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $32,899 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 324 |
| **Building Code:** | R2900301760 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $78,763 |
| **Building Name:** | St Croix SP St Johns Lnd Cook Shack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $22,941 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 324 |
| **Building Code:** | R2900301770 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $176,241 |
| **Building Name:** | St Croix SP St Johns Lnd Infirmary | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $51,925 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 924 |
| **Building Code:** | R2900301780 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $143,849 |
| **Building Name:** | St Croix SP St Johns Lnd Office | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $45,042 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 432 |
| **Building Code:** | R2900301790 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $295,507 |
| **Building Name:** | St Croix SP St Johns Lnd Sanitation | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $35,910 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 928 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301800 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $72,339 |
| **Building Name:** | St Croix SP St Johns Lnd Rec Hall | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $18,112 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 540 |
| **Building Code:** | R2900301810 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $43,346 |
| **Building Name:** | St Croix SP St Johns Lnd Sanitatn B | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,053 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 189 |
| **Building Code:** | R2900301820 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,268 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301830 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,506 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301840 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,642 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301850 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $11,409 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301860 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,756 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301870 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,756 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301880 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm B7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,268 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301890 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,480 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301900 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $7,169 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301910 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $7,373 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301920 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $6,858 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301930 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $8,179 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301940 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $7,169 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301950 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm C7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $8,179 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900301960 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $45,799 |
| **Building Name:** | St Croix SP St Johns Lnd Sanitatn C | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,368 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 189 |
| **Building Code:** | R2900301970 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $199,661 |
| **Building Name:** | St Croix SP St Johns Lnd Rec Hall C | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $32,351 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 704 |
| **Building Code:** | R2900301980 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $199,661 |
| **Building Name:** | St Croix SP St Johns Lnd Rec Hall D | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $18,721 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 704 |
| **Building Code:** | R2900301990 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $43,346 |
| **Building Name:** | St Croix SP St Johns Lnd Sanitatn D | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $20,848 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 189 |
| **Building Code:** | R2900302000 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,187 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302010 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $8,553 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302020 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $27,178 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $21,079 |
| **Facility Condition Index:** | 0.78 - Crisis | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302030 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $8,398 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302040 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,083 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302050 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,083 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302060 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm D7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,187 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302070 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $84,801 |
| **Building Name:** | St Croix SP St Johns Lnd Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $27,360 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 256 |
| **Building Code:** | R2900302080 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $199,661 |
| **Building Name:** | St Croix SP St Johns Lnd Rec Hall A | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $21,713 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 704 |
| **Building Code:** | R2900302090 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $45,799 |
| **Building Name:** | St Croix SP St Johns Lnd Sanitatn A | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $4,947 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 189 |
| **Building Code:** | R2900302100 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,414 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302110 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $11,793 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302120 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $33,832 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,147 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302130 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $41,311 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $11,638 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302140 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $41,311 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,224 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302150 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $41,311 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $11,485 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302160 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $41,311 |
| **Building Name:** | St Croix SP St Johns Lnd Dorm A7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,425 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $667,553 |
| **Building Name:** | St Croix SP Norway Pt Dining Hall | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $172,782 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,953 |
| **Building Code:** | R2900302180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $178,682 |
| **Building Name:** | St Croix SP Norway Pt Garage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $70,854 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,248 |
| **Building Code:** | R2900302190 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $291,953 |
| **Building Name:** | St Croix SP Norway Pt Infirmary | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $76,481 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,045 |
| **Building Code:** | R2900302200 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $437,563 |
| **Building Name:** | St Croix SP Norway Pt Lodging House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $110,560 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,395 |
| **Building Code:** | R2900302210 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $105,852 |
| **Building Name:** | St Croix SP Norway Pt Office | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $29,916 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 366 |
| **Building Code:** | R2900302220 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $42,610 |
| **Building Name:** | St Croix SP Norway Pt Sanitation A | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $13,167 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900302230 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $135,268 |
| **Building Name:** | St Croix SP Norway Pt Rec Hall A | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $30,707 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 636 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302240 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $137,042 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $43,138 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302250 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,842 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,686 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302260 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,842 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,798 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302270 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $47,320 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,196 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302280 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,842 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,072 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302290 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,842 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $13,371 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302300 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,842 |
| **Building Name:** | St Croix SP Norway Pt Dormitory A7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $13,371 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302310 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $57,525 |
| **Building Name:** | St Croix SP Norway Pt Sanitation B | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $13,631 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900302320 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $119,877 |
| **Building Name:** | St Croix SP Norway Pt Rec Hall B | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $31,279 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 636 |
| **Building Code:** | R2900302330 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302340 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302350 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302360 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302370 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $48,560 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $13,937 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302380 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302390 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory B7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302400 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $57,509 |
| **Building Name:** | St Croix SP Norway Pt Sanitation C | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $15,994 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900302410 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $119,877 |
| **Building Name:** | St Croix SP Norway Pt Rec Hall C | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $35,048 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 636 |
| **Building Code:** | R2900302420 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302430 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302440 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,761 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302450 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302460 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302470 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $43,659 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $13,355 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302480 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory C7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,647 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302490 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $57,509 |
| **Building Name:** | St Croix SP Norway Pt Sanitation D | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $15,080 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 216 |
| **Building Code:** | R2900302500 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $136,247 |
| **Building Name:** | St Croix SP Norway Pt Rec Hall D | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $35,727 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 636 |
| **Building Code:** | R2900302510 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302520 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302530 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D3 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302540 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D4 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302550 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D5 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302560 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,678 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D6 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,192 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302570 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $46,258 |
| **Building Name:** | St Croix SP Norway Pt Dormitory D7 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,019 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900302580 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $73,485 |
| **Building Name:** | St Croix SP Norway Pt Rec Hall | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $14,791 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 600 |
| **Building Code:** | R2900302590 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $325,262 |
| **Building Name:** | St Croix SP Norway Pt Central San | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $24,159 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 943 |
| **Building Code:** | R2900302600 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $89,004 |
| **Building Name:** | St Croix SP Norway Pt Lodging House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $25,752 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 390 |
| **Building Code:** | R2900302610 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $70,960 |
| **Building Name:** | St Croix SP Norway Pt Cooks Shack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $16,507 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 390 |
| **Building Code:** | R2900302620 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $91,503 |
| **Building Name:** | St Croix SP Ranger Contact Station | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $23,532 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 440 |
| **Building Code:** | R2900302640 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,215,563 |
| **Building Name:** | St Croix SP Lodge Interp Center | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $173,941 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 3,915 |
| **Building Code:** | R2900302650 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $52,042 |
| **Building Name:** | St Croix SP Hexigon Log Wood Shed | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $22,668 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 441 |
| **Building Code:** | R2900302660 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $869,571 |
| **Building Name:** | St Croix SP Riverview CG Sanitation | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $141,307 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,752 |
| **Building Code:** | R2900302670 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $196,611 |
| **Building Name:** | St Croix SP Riverview A&B Cabin | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $48,959 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 660 |
| **Building Code:** | R2900302680 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $304,350 |
| **Building Name:** | St Croix SP Riverview C, D&E Cabin | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $62,790 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,226 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302690 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $48,847 |
| **Building Name:** | St Croix SP Old Log Trl Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,818 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 152 |
| **Building Code:** | R2900302700 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $98,154 |
| **Building Name:** | St Croix SP Riverview Jack Pine Cab | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $20,633 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 322 |
| **Building Code:** | R2900302710 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $215,706 |
| **Building Name:** | St Croix SP Paint Rock Springs San | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $21,027 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 608 |
| **Building Code:** | R2900302730 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $134,450 |
| **Building Name:** | St Croix SP HQ Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $23,305 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900302740 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $677,548 |
| **Building Name:** | St Croix SP Residence 1 | **Address:** | 53927 YELLOW BANKS DR | **Deferred Maintenance:** | $178,589 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,654 |
| **Building Code:** | R2900302750 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $107,661 |
| **Building Name:** | St Croix SP Residence 1 Garage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $26,220 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 650 |
| **Building Code:** | R2900302760 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $378,041 |
| **Building Name:** | St Croix SP Residence 2 | **Address:** | 53848 YELLOW BANKS DRIVE | **Deferred Maintenance:** | $97,400 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,576 |
| **Building Code:** | R2900302770 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $378,041 |
| **Building Name:** | St Croix SP Residence 3 | **Address:** | 53760 YELLOW BANKS DR | **Deferred Maintenance:** | $111,734 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,576 |
| **Building Code:** | R2900302780 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $138,615 |
| **Building Name:** | St Croix SP Residences 2&3 Garage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $55,152 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,120 |
| **Building Code:** | R2900302790 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $266,545 |
| **Building Name:** | St Croix SP HQ Dormitory | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $76,842 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 920 |
| **Building Code:** | R2900302800 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,600 |
| **Building Name:** | St Croix SP HQ Dormitory Garage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,910 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 430 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900302810 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $975,435 |
| **Building Name:** | St Croix SP HQ Mechanic Shop | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $286,278 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,162 |
| **Building Code:** | R2900302820 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,065,916 |
| **Building Name:** | St Croix SP HQ Carpenter Shop | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $284,989 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,887 |
| **Building Code:** | R2900302830 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,299,765 |
| **Building Name:** | St Croix SP HQ Cold Storage H-13 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $183,992 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,618 |
| **Building Code:** | R2900302840 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $147,070 |
| **Building Name:** | St Croix SP HQ Oil House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $21,107 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 315 |
| **Building Code:** | R2900302880 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $518,879 |
| **Building Name:** | St Croix SP HQ Office | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $72,984 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,296 |
| **Building Code:** | R2900302930 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $468,925 |
| **Building Name:** | St Croix SP Trails Center | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $114,884 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,131 |
| **Building Code:** | R2900302940 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $199,661 |
| **Building Name:** | St Croix SP St Johns Lnd Rec Hall B | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $10,817 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 704 |
| **Building Code:** | R2900302950 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,161 |
| **Building Name:** | St Croix SP Trail Ctr Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $11,749 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 110 |
| **Building Code:** | R2900302960 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $51,939 |
| **Building Name:** | St Croix SP Riverview CG Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $11,173 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 131 |
| **Building Code:** | R2900302970 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $241,364 |
| **Building Name:** | St Croix SP HQ Lumber Shed | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $25,535 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 2,430 |
| **Building Code:** | R2900302990 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $90,420 |
| **Building Name:** | St Croix SP Riverview CG Tower | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $9,247 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 242 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303010 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $26,923 |
| **Building Name:** | St Croix SP Bear Creek W Adirondack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $7,128 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900303020 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $22,436 |
| **Building Name:** | St Croix SP Bear Creek W Adirondack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $5,759 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900303030 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $52,929 |
| **Building Name:** | StCroix SP Crooked Crk E Adirondack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $7,205 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900303040 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $52,929 |
| **Building Name:** | StCroix SP Crooked Crk E Adirondack | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $7,205 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900303230 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $403,123 |
| **Building Name:** | St Croix SP Norway Pt Guest House 2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $93,042 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,971 |
| **Building Code:** | R2900303240 | **Cost Model Name:** | Multi-story Dormitory | **Current Replacement Value:** | $518,502 |
| **Building Name:** | St Croix SP Norway Pt Guest House 1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $70,214 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,971 |
| **Building Code:** | R2900303500 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,306 |
| **Building Name:** | St Croix SP Head Rapids Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $3,702 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900303510 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,777 |
| **Building Name:** | St Croix SP Cold Storage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $678 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 52 |
| **Building Code:** | R2900303520 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,131 |
| **Building Name:** | St Croix SP Paint Rock Spr Pumphse | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $967 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900303530 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $74,737 |
| **Building Name:** | St Croix SP Norway Pt Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $19,994 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 196 |
| **Building Code:** | R2900303540 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $131,417 |
| **Building Name:** | StCroixSP Clayton Lk Bch Pic Shel 2 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $18,467 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,248 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303570 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $51,956 |
| **Building Name:** | St Croix SP St Johns Lodging House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $8,681 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900304280 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $948,880 |
| **Building Name:** | St Croix SP HQ Shop | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $138,148 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 7,013 |
| **Building Code:** | R2900304290 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $356,473 |
| **Building Name:** | St Croix SP HQ Concession | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $39,595 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,043 |
| **Building Code:** | R2900304560 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,266 |
| **Building Name:** | St Croix SP Sand Crk Canoe Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,350 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 26 |
| **Building Code:** | R2900304860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,488 |
| **Building Name:** | St Croix SP Clayton Lk Beach Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $2,604 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900304880 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $5,235 |
| **Building Name:** | St Croix SP East Area Vault Toilet | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $2,565 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 27 |
| **Building Code:** | R2900304910 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $17,610 |
| **Building Name:** | St Croix SP West Area Fire Tower | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $5,548 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900304980 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,131 |
| **Building Name:** | St Croix SP Riverview CG Pump House | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,728 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900304990 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $24,385 |
| **Building Name:** | St Croix SP Bike Picnic Shelter 1 | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,094 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 800 |
| **Building Code:** | R2900305000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,428 |
| **Building Name:** | St Croix SP Old Log Trl S195 Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,622 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 27 |
| **Building Code:** | R2900305010 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,428 |
| **Building Name:** | St Croix SP Old Log Trl S195 Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,356 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 27 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305920 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,936 |
| **Building Name:** | St Croix SP HQ Cold Storage | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $199 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 99 |
| **Building Code:** | R2900305930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,560 |
| **Building Name:** | St Croix SP Trail Ctr Vault Toilet | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $3,102 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900305960 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,001 |
| **Building Name:** | St Croix SP HQ Wood Shed | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $2,543 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 252 |
| **Building Code:** | R2900306840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,861 |
| **Building Name:** | St Croix SP Head Rapids Mess Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $2,969 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900306850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,162 |
| **Building Name:** | St Croix SP Old Log Trl S167 Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,914 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,668 |
| **Building Name:** | St Croix SP Paint Rock S125 Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,450 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900307310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,861 |
| **Building Name:** | St Croix SP Little Yellow Bnk Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $989 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,861 |
| **Building Name:** | St Croix SP Big Eddy Canoe Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $989 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307330 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,240 |
| **Building Name:** | St Croix SP Head Rapids Canoe Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,090 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900307340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,027 |
| **Building Name:** | St Croix SP Maple Isl Canoe Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,003 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,035 |
| **Building Name:** | St Croix SP Riverview CG Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,013 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 45 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,559 |
| **Building Name:** | St Croix SP Riverview CG S21 Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,050 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,721 |
| **Building Name:** | St Croix SP HQ Vault Toilet | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,059 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900307740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,502 |
| **Building Name:** | St Croix SP Norway Pt Vault Toilet | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $820 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900307750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,451 |
| **Building Name:** | St Croix SP Riverview CG Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,031 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900307760 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,040 |
| **Building Name:** | St Croix SP Riverview CG Recycle Sh | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $594 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900307830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,785 |
| **Building Name:** | St Croix SP St Johns Lnd Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $918 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900307840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,944 |
| **Building Name:** | St Croix SP Trail Ctr Vault Toilet | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,577 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900307850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,944 |
| **Building Name:** | St Croix SP Trail Ctr Vault Toilet | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,950 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900308110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,454 |
| **Building Name:** | St Croix SP Head Rapids Swim Vault | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $4,442 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900308120 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $3,636 |
| **Building Name:** | St Croix SP Head Rapids Cold Stor | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $1,280 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900308130 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $5,640 |
| **Building Name:** | St Croix SP St Johns Lnd Cold Stor | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $2,163 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308230 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $632,242 |
| **Building Name:** | St Croix SP Old Log Trl Sanitation | **Address:** | 30065 ST CROIX PARK RD | **Deferred Maintenance:** | $12,645 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,833 |

### *Site: R290062 - Temperance River State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200990 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,448 |
| **Building Name:** | Temperance River SP Oil House | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $4,256 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900201010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $255,164 |
| **Building Name:** | Temperance River SP Shop/Cold Stor | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $56,778 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900201020 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $302,743 |
| **Building Name:** | Temperance River SP Upper CG San | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $140,390 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 792 |
| **Building Code:** | R2900201040 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $47,136 |
| **Building Name:** | Temperance River SP Wood Shed | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $6,115 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900206780 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $349,445 |
| **Building Name:** | Temperance River SP Shop | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $61,563 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | R2900207520 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $347,032 |
| **Building Name:** | Temperance River SP Contact Station | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $27,817 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 1,245 |
| **Building Code:** | R2900208050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,934 |
| **Building Name:** | Temperance River SP Upper CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,070 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208060 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Upper CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,481 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Upper CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,481 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208080 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Upper CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,684 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Upper CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,968 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208100 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Lower CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,839 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Lower CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,481 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208120 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Lower CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,481 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208130 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,811 |
| **Building Name:** | Temperance River SP Lower CG Vault | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,777 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900208690 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,161 |
| **Building Name:** | Temperance River SP Vault Toilet | **Address:** | 7620 W HWY 61 | **Deferred Maintenance:** | $1,415 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 47 |

### *Site: R290063 - Tettegouche State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204010 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $370,136 |
| **Building Name:** | Tettegouche SP Trails Center | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $128,235 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 1,224 |
| **Building Code:** | R2900204020 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $155,336 |
| **Building Name:** | Tettegouche SP Camper Cabin C | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $51,187 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 812 |
| **Building Code:** | R2900204050 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $91,379 |
| **Building Name:** | Tettegouche SP Barn (collapsed) | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $91,379 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900204070 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,477 |
| **Building Name:** | Tettegouche SP Cold Storage | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $8,457 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900204080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $166,010 |
| **Building Name:** | Tettegouche SP Camper Cabin B | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $54,702 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 896 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204090 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $120,174 |
| **Building Name:** | Tettegouche SP Camper Cabin A | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $39,657 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 650 |
| **Building Code:** | R2900204100 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $74,466 |
| **Building Name:** | Tettegouche SP Camper Cabin D | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $12,967 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 306 |
| **Building Code:** | R2900204110 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $36,764 |
| **Building Name:** | Tettegouche SP Blacksmith (colapsd) | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $36,764 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 256 |
| **Building Code:** | R2900204120 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,907 |
| **Building Name:** | Tettegouche SP Bath House/Sauna | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $9,152 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900204130 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $25,858 |
| **Building Name:** | Tettegouche SP Boat House | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $10,090 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 242 |
| **Building Code:** | R2900204480 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $389,105 |
| **Building Name:** | Tettegouche SP Shop | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $82,615 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 2,555 |
| **Building Code:** | R2900204500 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $492,953 |
| **Building Name:** | Tettegouche SP Baptism Riv CG San | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $54,266 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 1,220 |
| **Building Code:** | R2900205500 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Tettegouche SP Cart-In CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $4,470 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205540 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Tettegouche SP Cart-In CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $3,100 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205560 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Tettegouche SP Cart-In CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $4,470 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900205960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Tettegouche SP Baptism Riv CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $1,803 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 35 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900205970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Tettegouche SP Baptism Riv CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $2,213 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900207390 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $252,249 |
| **Building Name:** | Tettegouche SP Camper Cabin Sanitat | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $26,422 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 676 |
| **Building Code:** | R2900207450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,486 |
| **Building Name:** | Tettegouche SP Vault Toilet | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $2,579 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900207660 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $346,278 |
| **Building Name:** | Tettegouche SP Illgen Falls Cabin | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $33,870 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 884 |
| **Building Code:** | R2900207670 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,631 |
| **Building Name:** | Tettegouche SP Illgen Falls Shed | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $663 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900208200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,752 |
| **Building Name:** | Tettegouche SP Vault Toilet | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $7,088 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900208210 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,369 |
| **Building Name:** | Tettegouche SP Life Jacket Storage | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $5,210 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 72 |
| **Building Code:** | R2900208220 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,167 |
| **Building Name:** | Tettegouche SP Shed | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $3,829 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900208760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,501 |
| **Building Name:** | Tettegouche SP Group CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $2,734 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208770 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,501 |
| **Building Name:** | Tettegouche SP Group CG Vault | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $2,184 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208870 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,188 |
| **Building Name:** | Tettegouche SP Blacksmith Bldg | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $1,067 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 211 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208920 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,847 |
| **Building Name:** | Tettegouche SP Wood and Ice Shed | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $277 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 126 |
| **Building Code:** | R2900209060 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,331,637 |
| **Building Name:** | Tettegouche SP Interpretive Cr | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $86,633 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 12,738 |
| **Building Code:** | R2900210550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $32,070 |
| **Building Name:** | Tettegouche SP Trailhd Vault Concr | **Address:** | 5702 HWY 61 E | **Deferred Maintenance:** | $641 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 51 |

### *Site: R290064 - Upper Sioux Agency State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $85,357 |
| **Building Name:** | Upper Sioux Agency SP Garage | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $31,024 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900401150 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $742,487 |
| **Building Name:** | Upper Sioux Agency SP Interp Ctr | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $320,765 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 2,996 |
| **Building Code:** | R2900401160 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,480 |
| **Building Name:** | Upper Sioux Agency SP Contact Sta | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $10,361 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 184 |
| **Building Code:** | R2900403510 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $123,379 |
| **Building Name:** | Upper Sioux Agency SP Picnic Shel 1 | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $12,338 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 1,250 |
| **Building Code:** | R2900403520 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,116 |
| **Building Name:** | Upper Sioux Agency SP Picnic Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $4,734 |
| **Facility Condition Index:** | 0.58 - Crisis | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403530 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,116 |
| **Building Name:** | Upper Sioux Agency SP Picnic Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $4,027 |
| **Facility Condition Index:** | 0.50 - Poor | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900403890 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,839 |
| **Building Name:** | Upper Sioux Agency SP Shed | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $1,597 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900404040 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $328,916 |
| **Building Name:** | Upper Sioux Agency SP Shop | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $97,381 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 2,008 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404160 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $368,673 |
| **Building Name:** | Upper Sioux Agency SP Yellw Med San | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $77,958 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 1,036 |
| **Building Code:** | R2900404390 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $83,009 |
| **Building Name:** | Upr Sioux Agency SP Horse PicShel 1 | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $7,782 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 841 |
| **Building Code:** | R2900404570 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,508 |
| **Building Name:** | Upper Sioux Agency SP Horse W Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $2,928 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $42,699 |
| **Building Name:** | Upper Sioux Agency SP Horse M Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $11,900 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,508 |
| **Building Name:** | Upper Sioux Agency SP Yel Med Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $3,854 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,508 |
| **Building Name:** | Upr Sioux Agency SP Wst Horse Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $3,854 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,508 |
| **Building Name:** | Upr Sioux Agency SP Est Horse Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $3,348 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900404820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $29,507 |
| **Building Name:** | Upper Sioux Agency SP Riversd Vault | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $2,159 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 90 |
| **Building Code:** | R2900404830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,936 |
| **Building Name:** | Upper Sioux Agency SP Vault Toilet | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $3,234 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 55 |
| **Building Code:** | R2900405250 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $23,023 |
| **Building Name:** | Upper Sioux Agency SP Wood Shed | **Address:** | 5908 HWY 67 | **Deferred Maintenance:** | $3,805 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 480 |

### *Site: R290065 - Whitewater State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308760 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $90,695 |
| **Building Name:** | Whitewater SP Spors Garage | **Address:** | 18793 Long Bow LN | **Deferred Maintenance:** | $32,109 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 832 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308770 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $980,501 |
| **Building Name:** | Whitewater SP Spors Residence | **Address:** | 18793 Long Bow Ln | **Deferred Maintenance:** | $269,891 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 5,215 |
| **Building Code:** | R2900501060 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $355,896 |
| **Building Name:** | WWSP North Picnic Shelter 2 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $83,542 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,288 |
| **Building Code:** | R2900501110 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $615,598 |
| **Building Name:** | WWSP Group Camp Dining Hall | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $97,755 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 3,024 |
| **Building Code:** | R2900501120 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $113,770 |
| **Building Name:** | WWSP Group Camp Infirmary | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $8,927 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501130 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $112,500 |
| **Building Name:** | WWSP Group Camp Cabin 7 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $13,254 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501140 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $107,838 |
| **Building Name:** | WWSP Group Camp Cabin 6 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $12,892 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501150 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $107,838 |
| **Building Name:** | WWSP Group Camp Cabin 5 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $11,979 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501160 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $103,051 |
| **Building Name:** | WWSP Group Camp Cabin 1 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $17,860 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501170 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $115,427 |
| **Building Name:** | WWSP Group Camp Cabin 2 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $12,525 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501180 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $104,188 |
| **Building Name:** | WWSP Group Camp Cabin 3 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $18,008 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501200 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $247,276 |
| **Building Name:** | WWSP North Picnic Area Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $31,278 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 552 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,061 |
| **Building Name:** | WWSP Shop Area Cold Storage | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $6,560 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 462 |
| **Building Code:** | R2900501240 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $539,426 |
| **Building Name:** | WWSP Group Camp Cold Storage | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $128,716 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,008 |
| **Building Code:** | R2900501250 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $876,308 |
| **Building Name:** | Whitewater SP Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $123,593 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,955 |
| **Building Code:** | R2900501260 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $354,509 |
| **Building Name:** | WWSP North Picnic Area Interp Unocc | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $76,946 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 765 |
| **Building Code:** | R2900501270 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $79,651 |
| **Building Name:** | Whitewater SP Pump House | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $16,802 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900501290 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $227,971 |
| **Building Name:** | WWSP Cedar Hill CG Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $48,091 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 625 |
| **Building Code:** | R2900501300 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $842,244 |
| **Building Name:** | WWSP Gooseberry Glen CG Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $162,009 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,652 |
| **Building Code:** | R2900501320 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $441,440 |
| **Building Name:** | Whitewater SP Cold Storage | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $115,519 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,914 |
| **Building Code:** | R2900501330 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $227,930 |
| **Building Name:** | Whitewater SP Nature Store | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $41,059 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,064 |
| **Building Code:** | R2900501340 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,565,388 |
| **Building Name:** | Whitewater SP Office | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $392,452 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 2,382 |
| **Building Code:** | R2900501350 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,255 |
| **Building Name:** | WWSP Cedar Hill CG Pump House | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $7,809 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 121 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501870 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $107,838 |
| **Building Name:** | WWSP Group Camp Cabin 4 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $13,765 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900501910 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $252,663 |
| **Building Name:** | WWSP Main Shop | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $17,200 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900501920 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,791 |
| **Building Name:** | WWSP Shop Area Oil House | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,255 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 98 |
| **Building Code:** | R2900501980 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $349,530 |
| **Building Name:** | WWSP Cedar Hill CG Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $54,059 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 961 |
| **Building Code:** | R2900501990 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $546,904 |
| **Building Name:** | WWSP Group Camp Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $38,861 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,560 |
| **Building Code:** | R2900502850 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,682,317 |
| **Building Name:** | Whitewater SP Contact Station | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $217,395 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 8,623 |
| **Building Code:** | R2900503580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,401 |
| **Building Name:** | WWSP North Picnic Area Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,230 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900503590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,856 |
| **Building Name:** | WWSP South Picnic Area Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $3,401 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900503600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,856 |
| **Building Name:** | WWSP South Picnic Area Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $3,401 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900503620 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,490 |
| **Building Name:** | WWSP Cedar Hill CG Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,603 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900503630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,856 |
| **Building Name:** | WWSP Cedar Hill CG Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,724 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 35 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504560 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,588 |
| **Building Name:** | WWSP Cedar Hill CG Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,645 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900504570 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $49,057 |
| **Building Name:** | WWSP Cedar Hill CG Cabin | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $6,702 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900504700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $21,719 |
| **Building Name:** | Whitewater SP Cold Storage | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $2,773 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 675 |
| **Building Code:** | R2900504970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,423 |
| **Building Name:** | WWSP Goosebery Glen CG Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,391 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900505150 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,951 |
| **Building Name:** | Whitewater SP Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $2,548 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,697 |
| **Building Name:** | Whitewater SP Vault Toilet | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,060 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900505450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $31,995 |
| **Building Name:** | WWSP Minneiska CG 2 Vault Concrete | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $640 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 62 |
| **Building Code:** | R2900505460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $31,995 |
| **Building Name:** | WWSP Minneiska 1&3 Vault Concrete | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $640 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 62 |
| **Building Code:** | R2900505620 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $56,697 |
| **Building Name:** | WWSP Minneiska CG Picnic Shelter 1 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,134 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 728 |
| **Building Code:** | R2900505630 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $59,091 |
| **Building Name:** | WWSP Minneiska CG Picnic Shelter 2 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,182 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 728 |
| **Building Code:** | R2900505640 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $59,091 |
| **Building Name:** | WWSP Minneiska CG Picnic Shelter 3 | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,182 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 728 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505650 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $93,044 |
| **Building Name:** | WWSP Minneiska CG Rnbow Trout Cabin | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,861 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 305 |
| **Building Code:** | R2900505660 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $88,571 |
| **Building Name:** | WWSP Minneiska CG Cabin | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,771 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 305 |
| **Building Code:** | R2900505670 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $88,665 |
| **Building Name:** | WWSP Minneiska CG Tiger Trout Cabin | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,773 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 305 |
| **Building Code:** | R2900505680 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $84,654 |
| **Building Name:** | WWSP Minneiska CG Brown Trout Cabin | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $1,693 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 305 |
| **Building Code:** | R2900505690 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $510,340 |
| **Building Name:** | WWSP Minneiska CG Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $10,207 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,239 |
| **Building Code:** | R2900505700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $44,792 |
| **Building Name:** | WWSP Minneiska Vault Concrete | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $896 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $44,792 |
| **Building Name:** | WWSP Minneiska Vault Concrete | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $896 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $44,792 |
| **Building Name:** | WWSP Minneiska Vault Concrete | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $896 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $31,995 |
| **Building Name:** | WWSP Minneiska Vault Concrete | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $640 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505740 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $517,897 |
| **Building Name:** | WWSP Minneiska CG Sanitation | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $10,358 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,034 |

### *Site: R290066 - Wild River State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301400 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $532,917 |
| **Building Name:** | Wild River SP Office | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $103,773 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 1,380 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301430 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $64,498 |
| **Building Name:** | Wild River SP Garage | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $11,838 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900303090 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,046 |
| **Building Name:** | Wild River SP Oil House | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $5,084 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900303100 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $350,339 |
| **Building Name:** | Wild River SP Shop | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $84,228 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 2,048 |
| **Building Code:** | R2900303110 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $185,056 |
| **Building Name:** | Wild River SP Cold Storage | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $27,219 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900303120 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $447,335 |
| **Building Name:** | Wild River SP Trails Center | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $119,074 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 2,000 |
| **Building Code:** | R2900303130 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $711,543 |
| **Building Name:** | Wild River SP Interp Center | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $226,924 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 2,880 |
| **Building Code:** | R2900303140 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $570,117 |
| **Building Name:** | Wild River SP Picnic Shelter 2 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $151,479 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 1,152 |
| **Building Code:** | R2900303150 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $261,264 |
| **Building Name:** | Wild River SP CG C & D Loop Sanita | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $55,722 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 780 |
| **Building Code:** | R2900303160 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $265,711 |
| **Building Name:** | Wild River SP CG A & B Loop Sanita | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $77,326 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 780 |
| **Building Code:** | R2900303170 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $441,871 |
| **Building Name:** | Wild River SP Residence | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $122,433 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 1,680 |
| **Building Code:** | R2900303700 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $210,041 |
| **Building Name:** | Wild River SP Cold Storage | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $145,398 |
| **Facility Condition Index:** | 0.69 - Crisis | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 3,060 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900304380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,908 |
| **Building Name:** | Wild River SP Grp CG 3 Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $2,606 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900304430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,082 |
| **Building Name:** | Wild River SP CG D Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $2,261 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 31 |
| **Building Code:** | R2900306110 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $259,337 |
| **Building Name:** | Wild River SP Guest House | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $66,364 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 1,536 |
| **Building Code:** | R2900306340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,646 |
| **Building Name:** | Wild River SP Grp CG 6 Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,565 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900306350 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $52,510 |
| **Building Name:** | Wild River SP Cabin #5 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $8,859 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900306360 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $52,510 |
| **Building Name:** | Wild River SP Cabin #6 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $8,719 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900306590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,667 |
| **Building Name:** | Wild River SP Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $2,168 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,635 |
| **Building Name:** | Wild River SP Horse CG Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,295 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900307200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,507 |
| **Building Name:** | Wild River SP Horse CG Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,044 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900307210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,004 |
| **Building Name:** | Wild River SP CG C Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,615 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,415 |
| **Building Name:** | Wild River SP Grp CG 2 Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,649 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 39 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,004 |
| **Building Name:** | Wild River Cabin Area Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $3,080 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900307390 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,945 |
| **Building Name:** | Wild River Sunrise Vault Concrete | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $2,794 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 55 |
| **Building Code:** | R2900307600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,841 |
| **Building Name:** | Wild River Cabin Ar Vault Concrete | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $17,438 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 104 |
| **Building Code:** | R2900307610 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,632 |
| **Building Name:** | Wild River SP Cabin #1 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,790 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900307620 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,632 |
| **Building Name:** | Wild River SP Cabin #2 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $6,401 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900307630 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,632 |
| **Building Name:** | Wild River SP Cabin #3 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $9,383 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900307640 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $68,632 |
| **Building Name:** | Wild River SP Cabin #4 | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $8,919 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900307860 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,623 |
| **Building Name:** | Wild River SP Concession | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,237 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900307870 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $9,108 |
| **Building Name:** | Wild River SP Adirondack | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $6,415 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 84 |
| **Building Code:** | R2900307880 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $6,315 |
| **Building Name:** | Wild River SP Adirondack | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $2,246 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 57 |
| **Building Code:** | R2900307890 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,039 |
| **Building Name:** | Wild River SP Adirondack | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $5,103 |
| **Facility Condition Index:** | 0.72 - Crisis | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307900 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,804 |
| **Building Name:** | Wild River SP Adirondack | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $6,250 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 77 |
| **Building Code:** | R2900308100 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,913 |
| **Building Name:** | Wild River SP Vault Concrete | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900308290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,913 |
| **Building Name:** | Wild River SP CG A Vault Concrete | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900308300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,437 |
| **Building Name:** | Wild River SP CG B Vault Concrete | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $549 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900308530 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,913 |
| **Building Name:** | Wild River SP CG E Vault Concrete | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 51 |

### *Site: R290067 - William O'Brien State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600370 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $136,294 |
| **Building Name:** | WOB SP Beach Area Sanitation | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $40,806 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 460 |
| **Building Code:** | R2900600380 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $157,134 |
| **Building Name:** | WOB SP Picnic Area Sanitation | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $32,699 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 483 |
| **Building Code:** | R2900600420 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $130,475 |
| **Building Name:** | WOB SP Picnic Area Picnic Shelter 1 | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $33,147 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,620 |
| **Building Code:** | R2900600460 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $354,842 |
| **Building Name:** | WOB SP Savanna CG Sanitation | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $81,430 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,208 |
| **Building Code:** | R2900601190 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $404,169 |
| **Building Name:** | William O'Brien SP Residence | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $98,820 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 2,434 |
| **Building Code:** | R2900601200 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,191,107 |
| **Building Name:** | William O'Brien SP Interp Ctr | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $313,963 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 4,819 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $64,251 |
| **Building Name:** | William O'Brien SP Garage | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $10,262 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 625 |
| **Building Code:** | R2900601230 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $157,119 |
| **Building Name:** | WOB SP Picnic Area Picnic Shelter 2 | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $18,723 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900601240 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $157,119 |
| **Building Name:** | WOB SP Beach Area Picnic Shelter 3 | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $29,634 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900601590 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,499 |
| **Building Name:** | WOB Riverside Group CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,118 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900601600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,499 |
| **Building Name:** | WOB Riverside Group CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,118 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900601610 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,529 |
| **Building Name:** | WOB SP Riverway CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,318 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900601620 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,529 |
| **Building Name:** | WOB SP Riverway CG S13 Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,730 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900601640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,499 |
| **Building Name:** | WOB SP Savanna CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,150 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900601650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,499 |
| **Building Name:** | WOB SP Savanna CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,150 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900601660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,504 |
| **Building Name:** | WOB SP Savanna CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,856 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900601670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,499 |
| **Building Name:** | WOB SP Savanna CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,853 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 40 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601790 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $303,177 |
| **Building Name:** | WOB SP Riverway CG Sanitation | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $76,399 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,170 |
| **Building Code:** | R2900601860 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,504 |
| **Building Name:** | WOB SP Picnic Area Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,544 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900601870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,504 |
| **Building Name:** | WOB SP Picnic Area Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,544 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900601940 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $990,504 |
| **Building Name:** | William O'Brien SP Shop | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $203,271 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 5,108 |
| **Building Code:** | R2900602020 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $52,042 |
| **Building Name:** | WOB SP Savanna CG Copas Cabin | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $12,017 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 264 |
| **Building Code:** | R2900602080 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,935 |
| **Building Name:** | WOB SP Savanna CG Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,336 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900602090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,000 |
| **Building Name:** | William O'Brien SP Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,522 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900602100 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,751 |
| **Building Name:** | William O'Brien SP Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $3,626 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 37 |
| **Building Code:** | R2900602110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,935 |
| **Building Name:** | William O'Brien SP Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $2,155 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900602140 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $9,708 |
| **Building Name:** | William O'Brien SP Adirondack | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $6,784 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 89 |
| **Building Code:** | R2900602150 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $13,744 |
| **Building Name:** | William O'Brien SP Adirondack | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $10,308 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 126 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900602160 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,945 |
| **Building Name:** | William O'Brien SP Adirondack | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $6,708 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 82 |
| **Building Code:** | R2900602170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $371,578 |
| **Building Name:** | William O'Brien SP Contact Sta | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $38,042 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,551 |
| **Building Code:** | R2900602190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,371 |
| **Building Name:** | WOB SP Savanna CG Vault Concrete | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $5,237 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 104 |
| **Building Code:** | R2900602200 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $49,583 |
| **Building Name:** | WOB SP Savanna CG Otisville Cabin | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $6,411 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900602210 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $49,583 |
| **Building Name:** | WOB SP Savanna CG Vasa Cabin | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $6,932 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 296 |
| **Building Code:** | R2900602230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,877 |
| **Building Name:** | William O'Brien SP Vault Toilet | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $1,566 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900602240 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $46,471 |
| **Building Name:** | Wm O'Brien SP Marine Mills Cabin | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $5,721 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900602290 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $41,042 |
| **Building Name:** | William O'Brien SP Cold Storage | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $16,920 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 203 |
| **Building Code:** | R2900602390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $49,803 |
| **Building Name:** | WOB SP Anson Cold Storage 1 | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $14,458 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 700 |
| **Building Code:** | R2900602400 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $101,883 |
| **Building Name:** | WOB SP Anson Cold Storage 2 | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $29,091 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 913 |
| **Building Code:** | R2900602410 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $312,736 |
| **Building Name:** | WOB SP Anson Heated Storage | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $54,257 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 2,114 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900602420 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $684,802 |
| **Building Name:** | WOB SP Anson Heated Storage | **Address:** | 16821 O'BRIEN TRAIL N | **Deferred Maintenance:** | $172,309 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MARINE ON ST CRO | **Ext. Gross Area:** | 1,547 |

### *Site: R290068 - Zippel Bay State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100700 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $125,614 |
| **Building Name:** | Zippel Bay SP Sanitation | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $21,133 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 360 |
| **Building Code:** | R2900100720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,818 |
| **Building Name:** | Zippel Bay SP Shower Bldg Vault 1 | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,583 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900100780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,351 |
| **Building Name:** | Zippel Bay SP Shower Bldg Vault 2 | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $3,561 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900100790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,035 |
| **Building Name:** | Zippel Bay SP Birch CG Unisex Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,144 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900100800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,035 |
| **Building Name:** | Zippel Bay SP Birch CG Mens Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $1,980 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900100850 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,989 |
| **Building Name:** | Zippel Bay SP Anglers CG Mens Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,186 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900100890 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $2,427 |
| **Building Name:** | Zippel Bay SP Pic/Beach Bathhouse | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $1,028 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 54 |
| **Building Code:** | R2900101190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,986 |
| **Building Name:** | Zippel Bay SP Harbor Vault Toilet | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,256 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900101360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,959 |
| **Building Name:** | Zippel Bay SP Anglers CG Uni Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $1,490 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900102510 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,481 |
| **Building Name:** | Zippel Bay SP Harbor Fish Clean Hse | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $7,485 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 180 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102520 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $106,777 |
| **Building Name:** | Zippel Bay SP Office | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $18,106 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900102530 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $108,392 |
| **Building Name:** | Zippel Bay SP Contact Station | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $17,950 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 383 |
| **Building Code:** | R2900102540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $260,369 |
| **Building Name:** | Zippel Bay SP Shop | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $31,270 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900102550 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $37,503 |
| **Building Name:** | Zippel Bay SP Beach Picnic Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $6,785 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 308 |
| **Building Code:** | R2900104720 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $36,336 |
| **Building Name:** | Zippel Bay SP Open Storage by Shop | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $727 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900105460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,959 |
| **Building Name:** | Zippel Bay SP Ridge CG Vault 1 | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $1,728 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900105470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,959 |
| **Building Name:** | Zippel Bay SP Ridge CG Vault 2 | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $1,854 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900106470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,351 |
| **Building Name:** | ZippelBay SP Swimming Beach Vault 1 | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,225 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,351 |
| **Building Name:** | ZippelBay SP Swimming Beach Vault 2 | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,225 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,351 |
| **Building Name:** | Zippel Bay SP Lady Slipper CG Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,225 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106590 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $25,638 |
| **Building Name:** | Zippel Bay SP Harbor Picnic Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $3,600 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 560 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,905 |
| **Building Name:** | Zippel Bay SP Harbor ADA Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $318 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |

### *Site: R290069 - Birch Lake State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $69,920 |
| **Building Name:** | Birch Lake CG Cold Storage Shop | **Address:** | | **Deferred Maintenance:** | $8,557 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900306670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,996 |
| **Building Name:** | Birch Lake CG Vault Toilet | **Address:** | | **Deferred Maintenance:** | $2,137 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900307670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,637 |
| **Building Name:** | Birch Lake CG Site 17 Vault Toilet | **Address:** | | **Deferred Maintenance:** | $1,579 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900307680 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,637 |
| **Building Name:** | Birch Lake CG Site 12 Vault Toilet | **Address:** | | **Deferred Maintenance:** | $1,504 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900307690 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,637 |
| **Building Name:** | Birch Lake CG Vault Toilet | **Address:** | | **Deferred Maintenance:** | $1,579 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900307700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,637 |
| **Building Name:** | Birch Lake CG Vault Toilet | **Address:** | | **Deferred Maintenance:** | $2,025 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900307710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,752 |
| **Building Name:** | Birch Lake Grp CG Vault Toilet | **Address:** | | **Deferred Maintenance:** | $1,219 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 29 |
| **Building Code:** | R2900307720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,014 |
| **Building Name:** | Birch Lake Grp CG 35 Vault Toilet | **Address:** | | **Deferred Maintenance:** | $2,775 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 30 |

### *Site: R290070 - Carley State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,255 |
| **Building Name:** | Carley SP Picnic Area Vault Toilet | **Address:** | WABASHA CTY RD 4 | **Deferred Maintenance:** | $8,060 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | PLAINVIEW | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503980 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,255 |
| **Building Name:** | Carley SP CG Right Vault Toilet | **Address:** | WABASHA CTY RD 4 | **Deferred Maintenance:** | $5,936 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | PLAINVIEW | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,255 |
| **Building Name:** | Carley SP CG Left Vault Toilet | **Address:** | WABASHA CTY RD 4 | **Deferred Maintenance:** | $5,936 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | PLAINVIEW | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,255 |
| **Building Name:** | Carley SP Grp CG Left Vault Toilet | **Address:** | WABASHA CTY RD 4 | **Deferred Maintenance:** | $8,060 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | PLAINVIEW | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504010 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,255 |
| **Building Name:** | Carley SP Grp CG Right Vault Toilet | **Address:** | WABASHA CTY RD 4 | **Deferred Maintenance:** | $8,060 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | PLAINVIEW | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504730 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $52,271 |
| **Building Name:** | Carley SP Picnic Area Shelter 1 | **Address:** | WABASHA CTY RD 4 | **Deferred Maintenance:** | $2,128 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | PLAINVIEW | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900505750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,195 |
| **Building Name:** | Carley SP Vault Concrete | **Address:** | 19040 HWY 74 | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,195 |
| **Building Name:** | Carley SP CG Vault Concrete | **Address:** | 19040 hwy 74 | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,195 |
| **Building Name:** | Carley SP Grp CG Vault Concrete | **Address:** | 19040 HWY 74 | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900505790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,195 |
| **Building Name:** | Carley SP Picnic Ar Vault Concrete | **Address:** | 19040 HWY 74 | **Deferred Maintenance:** | $544 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 51 |

### *Site: R290071 - George H Crosby-Manitou State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201370 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $64,176 |
| **Building Name:** | Tettegouche SP Shop | **Address:** | 7616 Co Rd 7 | **Deferred Maintenance:** | $35,779 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | FINLAND | **Ext. Gross Area:** | 625 |
| **Building Code:** | R2900205920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,533 |
| **Building Name:** | GHCrosby-Manitou SP Vault Toilet | **Address:** | 7616 Co Rd 7 | **Deferred Maintenance:** | $2,277 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,501 |
| **Building Name:** | GHCrosby-Manitou SP Vault Toilet | **Address:** | 7616 Co Rd 7 | **Deferred Maintenance:** | $6,828 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | FINLAND | **Ext. Gross Area:** | 47 |

### *Site: R290072 - John A Latsch State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504580 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $19,255 |
| **Building Name:** | John Latsch SP CG Vault Toilet | **Address:** | 43605 KIPP DR | **Deferred Maintenance:** | $4,776 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WINONA | **Ext. Gross Area:** | 64 |

### *Site: R290073 - Garden Island SRA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107040 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $16,517 |
| **Building Name:** | Garden Island SRA Lodging House | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $5,451 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 320 |

### *Site: R290074 - Cass Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103460 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,774 |
| **Building Name:** | Cass Lake Cold Storage | **Address:** | 706 ASH AVE | **Deferred Maintenance:** | $6,848 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CASS LAKE | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900103470 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $273,814 |
| **Building Name:** | Cass Lake Office | **Address:** | 706 ASH AVE | **Deferred Maintenance:** | $73,624 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | CASS LAKE | **Ext. Gross Area:** | 1,534 |

### *Site: R290075 - Backus*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303740 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,506 |
| **Building Name:** | Backus Oil House | **Address:** | 4391 ST 87 NW | **Deferred Maintenance:** | $2,351 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BACKUS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900304460 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $260,306 |
| **Building Name:** | Backus Shop | **Address:** | 4391 ST 87 NW | **Deferred Maintenance:** | $48,757 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BACKUS | **Ext. Gross Area:** | 2,710 |
| **Building Code:** | R2900306170 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $723,838 |
| **Building Name:** | Backus Office | **Address:** | 4391 ST 87 NW | **Deferred Maintenance:** | $76,925 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BACKUS | **Ext. Gross Area:** | 4,084 |

### *Site: R290076 - Baudette Forestry*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,170 |
| **Building Name:** | Baudette Forestry Oil House | **Address:** | 206 MAIN ST E | **Deferred Maintenance:** | $5,219 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 124 |
| **Building Code:** | R2900103870 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $492,326 |
| **Building Name:** | Baudette Forestry Shop | **Address:** | 206 MAIN ST E | **Deferred Maintenance:** | $82,935 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 2,268 |
| **Building Code:** | R2900103880 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $501,388 |
| **Building Name:** | Baudette Forestry Office | **Address:** | 206 MAIN ST E | **Deferred Maintenance:** | $91,698 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 3,367 |
| **Building Code:** | R2900109180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $244,904 |
| **Building Name:** | Baudette Forestry Fire Truck Storag | **Address:** | 206 MAIN ST E | **Deferred Maintenance:** | $4,898 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 2,720 |

### *Site: R290077 - Blackduck*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106250 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $591,998 |
| **Building Name:** | Blackduck HeatColdStorage | **Address:** | 417B FORESTRY DR | **Deferred Maintenance:** | $101,205 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BLACKDUCK | **Ext. Gross Area:** | 4,896 |

### *Site: R290078 - Mississippi Headwaters State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105520 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $7,762 |
| **Building Name:** | Mississip HW SF LaSalle Fire Tower | **Address:** | LASALLE | **Deferred Maintenance:** | $2,561 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BAGLEY | **Ext. Gross Area:** | 36 |

### *Site: R290079 - Fergus Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107290 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $7,244,430 |
| **Building Name:** | Fergus Falls Office | **Address:** | 1509 1ST AVE N | **Deferred Maintenance:** | $1,003,571 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 29,784 |
| **Building Code:** | R2900107720 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $315,433 |
| **Building Name:** | Fergus Falls Anderson East | **Address:** | 1509 1ST AVE N | **Deferred Maintenance:** | $105,291 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 2,856 |
| **Building Code:** | R2900107730 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $545,944 |
| **Building Name:** | Fergus Falls Anderson West | **Address:** | 1509 1ST AVE N | **Deferred Maintenance:** | $153,373 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 3,724 |

### *Site: R290080 - Glenwood*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $299,885 |
| **Building Name:** | Glenwood Wildlife Metal Cold Storag | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $29,988 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 3,280 |
| **Building Code:** | R2900101240 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $21,347 |
| **Building Name:** | Glenwood Oil House | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $10,290 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 143 |
| **Building Code:** | R2900101250 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $733,508 |
| **Building Name:** | Glenwood 6-Stall Storage Garage | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $182,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 5,000 |
| **Building Code:** | R2900101260 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $310,066 |
| **Building Name:** | Glenwood Fish Hatchery | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $73,753 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | R2900101270 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $64,777 |
| **Building Name:** | Glenwood South Garage | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $13,017 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 744 |
| **Building Code:** | R2900101290 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $36,603 |
| **Building Name:** | Glenwood North Garage | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $7,661 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 440 |
| **Building Code:** | R2900101310 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $736,741 |
| **Building Name:** | Glenwood Shop Office | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $131,804 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 3,931 |
| **Building Code:** | R2900109320 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,072,498 |
| **Building Name:** | Glenwood Office | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $41,450 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 10,798 |

### *Site: R290081 - Grygla*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103970 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,187 |
| **Building Name:** | Grygla Cold Storage | **Address:** | 239 E PARK DR | **Deferred Maintenance:** | $5,342 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | GRYGLA | **Ext. Gross Area:** | 148 |
| **Building Code:** | R2900103980 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $274,770 |
| **Building Name:** | Grygla Residence | **Address:** | 239 E PARK DR | **Deferred Maintenance:** | $28,484 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRYGLA | **Ext. Gross Area:** | 1,296 |
| **Building Code:** | R2900103990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $333,554 |
| **Building Name:** | Grygla Office | **Address:** | 239 E PARK DR | **Deferred Maintenance:** | $34,340 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRYGLA | **Ext. Gross Area:** | 2,316 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104000 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,205 |
| **Building Name:** | Grygla Residence Garage | **Address:** | 239 E PARK DR | **Deferred Maintenance:** | $5,020 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRYGLA | **Ext. Gross Area:** | 384 |

### *Site: R290082 - Kelliher*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103740 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $470,586 |
| **Building Name:** | Kelliher Office | **Address:** | 485 W MAIN ST | **Deferred Maintenance:** | $124,764 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | KELLIHER | **Ext. Gross Area:** | 2,685 |

### *Site: R290083 - Nimrod*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107770 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $229,176 |
| **Building Name:** | Nimrod Shop | **Address:** | 30066 HUNTERSVILLE RD | **Deferred Maintenance:** | $30,922 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | SEBEKA | **Ext. Gross Area:** | 3,056 |
| **Building Code:** | R2900109150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $92,107 |
| **Building Name:** | Nimrod Fire Truck Storage | **Address:** | 30066 HUNTERSVILLE RD | **Deferred Maintenance:** | $9,211 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SEBEKA | **Ext. Gross Area:** | 1,056 |
| **Building Code:** | R2900300560 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $304,173 |
| **Building Name:** | Nimrod Office | **Address:** | 30066 HUNTERSVILLE RD | **Deferred Maintenance:** | $65,578 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SEBEKA | **Ext. Gross Area:** | 2,268 |
| **Building Code:** | R2900303310 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,449 |
| **Building Name:** | Nimrod Oil House | **Address:** | 30066 HUNTERSVILLE RD | **Deferred Maintenance:** | $3,841 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | SEBEKA | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900305580 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $13,548 |
| **Building Name:** | Nimrod Fire Tower | **Address:** | NIMROD | **Deferred Maintenance:** | $4,471 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 36 |

### *Site: R290084 - Northome*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206930 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $435,713 |
| **Building Name:** | Northome Office | **Address:** | 12006 HWY 1 E | **Deferred Maintenance:** | $64,539 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | NORTHOME | **Ext. Gross Area:** | 2,084 |
| **Building Code:** | R2900206940 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $337,407 |
| **Building Name:** | Northome Heat/Cold Storage | **Address:** | 12006 HWY 1 E | **Deferred Maintenance:** | $94,564 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | NORTHOME | **Ext. Gross Area:** | 3,072 |

### *Site: R290085 - Spire Valley*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107680 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $416,442 |
| **Building Name:** | Spire Valley Residence | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $73,661 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | REMER | **Ext. Gross Area:** | 2,240 |
| **Building Code:** | R2900108400 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $50,518 |
| **Building Name:** | Spire Valley North Raceway Shelter | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $16,523 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | REMER | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900108410 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $91,212 |
| **Building Name:** | Spire Valley South Raceway Shelter | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $4,286 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | REMER | **Ext. Gross Area:** | 1,560 |
| **Building Code:** | R2900303360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $186,997 |
| **Building Name:** | Spire Valley Fish Hatchery Office | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $61,130 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | REMER | **Ext. Gross Area:** | 1,353 |
| **Building Code:** | R2900303370 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $14,281 |
| **Building Name:** | Spire Valley Shed | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $2,278 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | REMER | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900304180 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,481 |
| **Building Name:** | Spire Valley Oil House | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $1,772 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | REMER | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900304550 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,224 |
| **Building Name:** | Spire Valley Shed | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $5,785 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | REMER | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900305160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $24,618 |
| **Building Name:** | Spire Valley Fish Feed Cold Storage | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $7,728 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | REMER | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900306560 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $225,618 |
| **Building Name:** | Spire Valley Cold Storage | **Address:** | 1852 ST 6 NE | **Deferred Maintenance:** | $22,562 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | REMER | **Ext. Gross Area:** | 2,880 |

### *Site: R290086 - Thief River Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108150 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $660,396 |
| **Building Name:** | Thief River Falls Office | **Address:** | 246 125TH AVE NE | **Deferred Maintenance:** | $24,285 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 7,366 |
| **Building Code:** | R2900108430 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $601,013 |
| **Building Name:** | Thief River Falls Cold Storage | **Address:** | 246 125TH AVE NE | **Deferred Maintenance:** | $60,101 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 5,856 |

### *Site: R290087 - Wannaska*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104140 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $331,259 |
| **Building Name:** | Wannaska Main Office | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $48,571 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | WANNASKA | **Ext. Gross Area:** | 3,852 |
| **Building Code:** | R2900104150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $401,919 |
| **Building Name:** | Wannaska Shop Office | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $59,215 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | WANNASKA | **Ext. Gross Area:** | 2,402 |
| **Building Code:** | R2900104260 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $38,455 |
| **Building Name:** | Wannaska Garage | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $25,928 |
| **Facility Condition Index:** | 0.67 - Crisis | **City Code:** | WANNASKA | **Ext. Gross Area:** | 528 |
| **Building Code:** | R2900104890 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $23,312 |
| **Building Name:** | Wannaska Equipment Pole Shelter | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $2,331 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WANNASKA | **Ext. Gross Area:** | 308 |
| **Building Code:** | R2900106360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $56,655 |
| **Building Name:** | Wannaska Tree Storage | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $6,792 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WANNASKA | **Ext. Gross Area:** | 512 |
| **Building Code:** | R2900106390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $65,507 |
| **Building Name:** | Wannaska Metal Garage with Lean-To | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $16,199 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WANNASKA | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900106400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,324 |
| **Building Name:** | Wannaska Oil House | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $3,445 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WANNASKA | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900108440 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,575 |
| **Building Name:** | Wannaska Generator Shed | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $1,257 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WANNASKA | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900109160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $171,433 |
| **Building Name:** | Wannaska Fire Truck Storage | **Address:** | 16945 STATE HWY 89 | **Deferred Maintenance:** | $3,429 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WANNASKA | **Ext. Gross Area:** | 1,904 |

### *Site: R290088 - Warroad*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108140 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,478,029 |
| **Building Name:** | Warroad Office | **Address:** | 804 CHERNE DR NW | **Deferred Maintenance:** | $29,561 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WARROAD | **Ext. Gross Area:** | 7,759 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108180 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $450,535 |
| **Building Name:** | Warroad Cold Storage | **Address:** | 804 CHERNE DR NW | **Deferred Maintenance:** | $44,523 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WARROAD | **Ext. Gross Area:** | 4,500 |

### *Site: R290089 - Williams*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103900 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $320,868 |
| **Building Name:** | Williams Office | **Address:** | 277 Wilderness AVE NE | **Deferred Maintenance:** | $47,831 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,880 |
| **Building Code:** | R2900103910 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $296,146 |
| **Building Name:** | Williams Heated Storage | **Address:** | 277 Wilderness AVE NE | **Deferred Maintenance:** | $55,961 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,860 |
| **Building Code:** | R2900103920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $41,456 |
| **Building Name:** | Williams Garage | **Address:** | 277 Wilderness AVE NE | **Deferred Maintenance:** | $6,736 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 384 |

### *Site: R290090 - Hinckley*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $127,589 |
| **Building Name:** | Hinckley Garage | **Address:** | 306 POWER AVE N | **Deferred Maintenance:** | $42,079 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900304470 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $607,748 |
| **Building Name:** | Hinckley Hatchery | **Address:** | 306 POWER AVE N | **Deferred Maintenance:** | $169,912 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | R2900307920 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,279 |
| **Building Name:** | Hinckley Pump House | **Address:** | 306 POWER AVE N | **Deferred Maintenance:** | $5,835 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 68 |

### *Site: R290091 - Paul Bunyan State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,797 |
| **Building Name:** | Paul Bunyan SF Gulch Lake CG Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,940 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900105500 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $13,548 |
| **Building Name:** | PBunyan SF Schoolcraft Fire Tower | **Address:** | SCHOOLCRAFT | **Deferred Maintenance:** | $10,161 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | GUTHRIE | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107300 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,825 |
| **Building Name:** | Paul Bunyan SF Mantrap Lk CG Shed | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $540 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900107310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Paul Bunyan SF Mantrap Site15 Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900107320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Paul Bunyan SF Mantrap Site22 Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900107330 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Paul Bunyan SF Mantrap Site19 Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900107340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Paul Bunyan SF Mantrap Site27 Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900107350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,014 |
| **Building Name:** | Paul Bunyan SF Mantrap CG WAS Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $2,457 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107360 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $20,172 |
| **Building Name:** | Paul Bunyan SF Mantrap Pic Shel 1 | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $4,594 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 624 |
| **Building Code:** | R2900107370 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $2,465 |
| **Building Name:** | Paul Bunyan SF Mantrap Lk CG Kiosk | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $458 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900107610 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,520 |
| **Building Name:** | Paul Bunyan W Gulch Trl Adirondack | **Address:** | W. Gulch Trail | **Deferred Maintenance:** | $2,904 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900107620 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,815 |
| **Building Name:** | Paul Bunyan SF Gulch Lk CG Kiosk | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $894 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900107630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,698 |
| **Building Name:** | Paul Bunyan SF Gulch CG Site2 Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $1,370 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 42 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,698 |
| **Building Name:** | Paul Bunyan SF Nelson Access Vault | **Address:** | NELSON ACCESS | **Deferred Maintenance:** | $1,370 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,485 |
| **Building Name:** | Paul Bunyan SF Gulch Lake CG Vault | **Address:** | 3401 STATE PARK RD NE | **Deferred Maintenance:** | $3,348 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107660 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $14,923 |
| **Building Name:** | Paul Bunyan Lake 21 Day-Use Adiron | **Address:** | Lake 21 day use area | **Deferred Maintenance:** | $1,492 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900107940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,073 |
| **Building Name:** | Paul Bunyan SF Mantrap Lk CG Vault | **Address:** | 36750 MAIN PARK DR | **Deferred Maintenance:** | $1,507 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 48 |

### *Site: R290092 - Sand Dunes State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305550 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $7,885 |
| **Building Name:** | Sand Dunes SF Fire Tower | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,602 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 60 |
| **Building Code:** | R2900307400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,945 |
| **Building Name:** | Sand Dunes SF Horse CG Vault Concr | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,794 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 55 |
| **Building Code:** | R2900307410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,945 |
| **Building Name:** | Sand Dunes SF Horse CG Vault Concr | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,794 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 55 |
| **Building Code:** | R2900307930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,287 |
| **Building Name:** | Sand Dunes SF Horse CG Site13 Vault | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,171 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900307940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,333 |
| **Building Name:** | Sand Dunes SF Ann Lk Site 8 R Vault | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,768 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900307950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,333 |
| **Building Name:** | Sand Dunes SF Ann Lk Site 9 L Vault | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,322 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900307960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand Dunes SF Ann Lk CG Ste2/3 Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,898 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307970 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand Dunes SF Ann Lk CG Ste 8 Vault | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,898 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307980 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand Dunes SF Ann Lk CG Ste21 Vault | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,379 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand DunesSF AnnLk CG Ste31/33 Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,182 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900308000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand Dunes SF Ann Lk CG Lakevw Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,700 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900308010 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand DunesSF AnnLk CG Lakevw 6 Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,700 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900308020 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,766 |
| **Building Name:** | Sand Dunes SF Ann Lk Fish Pier Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,182 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900308030 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,507 |
| **Building Name:** | Sand DunesSF AnnLk CG Pinevw 1 Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $616 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900308040 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,507 |
| **Building Name:** | Sand DunesSF AnnLk CG Pinevw 2 Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,036 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900308050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,507 |
| **Building Name:** | Sand DunesSF AnnLk CG Pinevw 3 Vaul | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $1,238 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900308060 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,178 |
| **Building Name:** | Sand Dunes SF Ann Lk CG Wood Storag | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $2,915 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 71 |
| **Building Code:** | R2900308070 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $22,751 |
| **Building Name:** | Sand Dunes SF Ann Lk CG Wood Storag | **Address:** | 11411 CLEMENTA AVE NW | **Deferred Maintenance:** | $3,587 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 311 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308080 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,938 |
| **Building Name:** | Sand Dunes SF Vault Toilet | **Address:** | 940 INDUSTRIAL DR S #103 | **Deferred Maintenance:** | $1,525 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SAUK RAPIDS | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900308090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,938 |
| **Building Name:** | Sand Dunes SF Vault Toilet | **Address:** | 940 INDUSTRIAL DR S #103 | **Deferred Maintenance:** | $2,845 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | SAUK RAPIDS | **Ext. Gross Area:** | 49 |

### *Site: R290093 - George Washington State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206000 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,587 |
| **Building Name:** | GWash SF Bear Lk CG S2 Vault Toilet | **Address:** | 55334 W BEAR LAKE FOREST RD | **Deferred Maintenance:** | $3,824 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | NASHWAUK | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900206020 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,587 |
| **Building Name:** | GWash SF Bear Lk CG S21 Vault Toil | **Address:** | 55334 W BEAR LAKE FOREST RD | **Deferred Maintenance:** | $2,877 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NASHWAUK | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900206030 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,587 |
| **Building Name:** | GWash SF Thistledew CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $3,824 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900206050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,587 |
| **Building Name:** | GWash SF Thistledew CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $3,824 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900206060 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,587 |
| **Building Name:** | GWash SF Thistledew CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $3,824 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900206070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,587 |
| **Building Name:** | GWash SF Thistledew CG Vault Toilet | **Address:** | 7622 MCCARTHY BEACH RD | **Deferred Maintenance:** | $3,824 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900206270 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | GWash SF Owen Lake CG Vault Toilet | **Address:** | 55379 OWEN LAKE CAMPGROUN | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206280 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | GWash SF Owen Lake CG Vault Toilet | **Address:** | 55379 OWEN LAKE CAMPGROUN | **Deferred Maintenance:** | $1,790 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | GWash SF Owen Lake CG Vault Toilet | **Address:** | 55379 OWEN LAKE CAMPGROUN | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206330 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | GWash SF Larson Lk CG Vault Toilet | **Address:** | 61186 LARSON LAKE STATE FOR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | EFFIE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,478 |
| **Building Name:** | GWash SF Larson Lk CG Vault Toilet | **Address:** | 61186 LARSON LAKE STATE FOR | **Deferred Maintenance:** | $2,356 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | EFFIE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,994 |
| **Building Name:** | GWash SF Bear Lk CG Vault Toilet | **Address:** | 54669 E BEAR LAKE FOREST RD | **Deferred Maintenance:** | $2,484 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NASHWAUK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,994 |
| **Building Name:** | GWash SF Btn Bx CG S12 Vault Toilet | **Address:** | BUTTON BOX RD | **Deferred Maintenance:** | $2,484 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900207990 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,373 |
| **Building Name:** | GWash SF Lost Lake CG Vault Toilet | **Address:** | 55659 LOST LAKE CAMPGROUNI | **Deferred Maintenance:** | $2,827 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIGFORK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900208260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | GWash SF Thistledew CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $2,161 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900208270 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | GWash SF Togo Horse CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $2,161 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900208280 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,904 |
| **Building Name:** | GWash SF Togo Horse CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $2,161 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900208350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,147 |
| **Building Name:** | GWash SF Larson Lk CG Vault Toilet | **Address:** | 61186 LARSON LAKE STATE FOR | **Deferred Maintenance:** | $2,201 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | EFFIE | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900208360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,918 |
| **Building Name:** | GWash SF Larson Lk CG Vault Toilet | **Address:** | CO RD 551 | **Deferred Maintenance:** | $2,321 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 45 |
| **Building Code:** | R2900208370 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $16,804 |
| **Building Name:** | GWash SF Btn Bx CG S8 Vault Toilet | **Address:** | BUTTON BOX RD | **Deferred Maintenance:** | $1,661 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 50 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,994 |
| **Building Name:** | GWash SF Btn Bx CG Vault Toilet | **Address:** | BUTTON BOX RD | **Deferred Maintenance:** | $2,201 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900208480 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $48,876 |
| **Building Name:** | GWash SF Bear Lk CG Picnic Shelt 1 | **Address:** | 55334 W BEAR LAKE FOREST RD | **Deferred Maintenance:** | $3,221 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NASHWAUK | **Ext. Gross Area:** | 1,080 |
| **Building Code:** | R2900208700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,313 |
| **Building Name:** | GWash SF Stony Brk CG Vault Toilet | **Address:** | SNAKE TRAIL FOREST RD | **Deferred Maintenance:** | $1,092 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,313 |
| **Building Name:** | GWash SF Stony Brk CG Vault Toilet | **Address:** | SNAKE TRAIL FOREST RD | **Deferred Maintenance:** | $1,092 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 47 |
| **Building Code:** | R2900208720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,313 |
| **Building Name:** | GWash SF Stony Brk CG Vault Toilet | **Address:** | SNAKE TRAIL FOREST RD | **Deferred Maintenance:** | $1,092 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 47 |

### *Site: R290094 - Kabetogama State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203060 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $234,101 |
| **Building Name:** | Kabetogama Woodenfrog CG Refectory | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $55,871 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 1,447 |
| **Building Code:** | R2900203070 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $92,403 |
| **Building Name:** | Kabetogama Woodenfrog Cold Storage | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $23,774 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 252 |
| **Building Code:** | R2900203200 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $447,363 |
| **Building Name:** | Kabetogama SF Office | **Address:** | 8730 HWY 53 | **Deferred Maintenance:** | $58,712 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ORR | **Ext. Gross Area:** | 2,464 |
| **Building Code:** | R2900203210 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $44,685 |
| **Building Name:** | Kabetogama Woodenfrog Guard Shack | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $13,017 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 252 |
| **Building Code:** | R2900203220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,580 |
| **Building Name:** | Kabetogama SF Garage | **Address:** | 8730 HWY 53 | **Deferred Maintenance:** | $12,980 |
| **Facility Condition Index:** | 0.41 - Poor | **City Code:** | ORR | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900203610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,150 |
| **Building Name:** | Kabetogama Woodenfrog Spring House | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $5,473 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 144 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204400 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $70,964 |
| **Building Name:** | Kabetogama Woodenfrog CG Sanitation | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $7,923 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900206080 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,215 |
| **Building Name:** | Kabetogama Woodenfrog Vault Toilet | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $1,843 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,215 |
| **Building Name:** | Kabetogama Woodenfrog Vault Toilet | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $1,952 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206100 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,215 |
| **Building Name:** | Kabetogama Woodenfrog Vault Toilet | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $2,549 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206110 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,215 |
| **Building Name:** | Kabetogama Woodenfrog Vault Toilet | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $1,843 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206120 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,215 |
| **Building Name:** | Kabetogama Woodenfrog Vault Toilet | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $2,549 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206130 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,215 |
| **Building Name:** | Kabetogama Woodenfrog Vault Toilet | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $2,549 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,105 |
| **Building Name:** | Kabetogama Wakemup CG Vault Toilet | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $2,317 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206230 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,105 |
| **Building Name:** | Kabetogama Wakemup CG Vault Toilet | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $2,319 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206240 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,105 |
| **Building Name:** | Kabetogama Wakemup CG Vault Toilet | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $1,445 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | COOK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206250 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,105 |
| **Building Name:** | Kabetogama Wakemup CG Vault Toilet | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $1,722 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,105 |
| **Building Name:** | Kabetogama Wakemup CG Vault Toilet | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $1,722 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206390 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,288 |
| **Building Name:** | Kabetogama SF Ash R CG Vault Toilet | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $2,264 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SOUDAN | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,288 |
| **Building Name:** | Kabetogama SF Ash R CG Vault Toilet | **Address:** | 1379 STUNTZ BAY RD | **Deferred Maintenance:** | $2,400 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | SOUDAN | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900207140 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,552 |
| **Building Name:** | Kabetogama SF Fire Tower | **Address:** | CO RD 422 | **Deferred Maintenance:** | $4,802 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | COOK | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207160 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,552 |
| **Building Name:** | Kabetogama Subsite Fire Tower | **Address:** | 8730 HWY 53 | **Deferred Maintenance:** | $4,802 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ORR | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207170 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,552 |
| **Building Name:** | Kabetogama Gheen Hill Fire Tower | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $10,914 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ORR | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207260 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,552 |
| **Building Name:** | Kabetogama Elephant Lake Fire Tower | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $10,914 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ORR | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207440 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $36,790 |
| **Building Name:** | Kabetogama Wakemup CG Picnic Shel 1 | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $13,415 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | COOK | **Ext. Gross Area:** | 486 |
| **Building Code:** | R2900208390 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,888 |
| **Building Name:** | Kabetogama Wakemup CG Spring House | **Address:** | 8501 PETERSON RD | **Deferred Maintenance:** | $1,139 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | COOK | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900208610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,770 |
| **Building Name:** | Kabetogama Woodenfrog CG Shed | **Address:** | 10449 WALTZ RD | **Deferred Maintenance:** | $2,238 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | KABETOGAMA | **Ext. Gross Area:** | 120 |

### *Site: R290095 - Finland State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Eckbeck CG Vault Toilet | **Address:** | 6120 STATE HWY 1 | **Deferred Maintenance:** | $1,963 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206170 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Eckbeck CG Vault Toilet | **Address:** | 6120 STATE HWY 1 | **Deferred Maintenance:** | $2,606 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206180 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Eckbeck CG Vault Toilet | **Address:** | 6120 STATE HWY 1 | **Deferred Maintenance:** | $1,963 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Eckbeck CG Vault Toilet | **Address:** | 6120 STATE HWY 1 | **Deferred Maintenance:** | $2,606 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Finland CG Vault Toilet | **Address:** | 5244 COUNTY RD 6 | **Deferred Maintenance:** | $1,963 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Finland CG Vault Toilet | **Address:** | 5244 COUNTY RD 6 | **Deferred Maintenance:** | $2,606 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Finland CG Vault Toilet | **Address:** | 5244 COUNTY RD 6 | **Deferred Maintenance:** | $2,539 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,928 |
| **Building Name:** | Finland SF Sullivan Lk Vault Toilet | **Address:** | 6253 SULLIVAN LAKE RD | **Deferred Maintenance:** | $1,545 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900207230 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $19,601 |
| **Building Name:** | Finland SF Fire Tower | **Address:** | 6686 HWY 1 | **Deferred Maintenance:** | $6,468 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | FINLAND | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900208040 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,684 |
| **Building Name:** | Finland SF Finland CG Vault Toilet | **Address:** | 5244 COUNTY RD 6 | **Deferred Maintenance:** | $2,586 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900208290 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,684 |
| **Building Name:** | Finland SF Finland CG Vault Toilet | **Address:** | 5244 COUNTY RD 6 | **Deferred Maintenance:** | $911 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | FINLAND | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900210670 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $32,070 |
| **Building Name:** | Finland SF Sullivan Vault Concrete | **Address:** | 6253 Sullivan Lake Rd | **Deferred Maintenance:** | $641 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | Two Harbors | **Ext. Gross Area:** | 51 |

***Site: R290096 - Cloquet Valley State Forest***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206430 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,086 |
| **Building Name:** | Cloquet SF Indian Lk CG Vault Toil | **Address:** | 2147 INDIAN LAKE RD, BRIMSON | **Deferred Maintenance:** | $1,592 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,086 |
| **Building Name:** | Cloquet SF Indian Lk CG Vault Toil | **Address:** | 2147 INDIAN LAKE RD, BRIMSON | **Deferred Maintenance:** | $1,592 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900207770 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,220 |
| **Building Name:** | Cloquet SF Indian Lk CG Vault Toil | **Address:** | 2147 INDIAN LAKE RD, BRIMSON | **Deferred Maintenance:** | $1,093 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 42 |

### *Site: R290097 - St Croix Valley State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,797 |
| **Building Name:** | St Croix Valley SF Boulder CG Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $1,573 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,797 |
| **Building Name:** | St Croix Val SF Graces Lake Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $3,268 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,797 |
| **Building Name:** | St Croix Val SF Tamarack Upr Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $2,550 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900306660 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,797 |
| **Building Name:** | St Croix Val SF Tamarack Upr Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $2,550 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900307520 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,062 |
| **Building Name:** | St Croix Val SF Tamarack Low Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $3,611 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 27 |
| **Building Code:** | R2900307530 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,785 |
| **Building Name:** | St Croix Val SF Tamarack Low Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $1,279 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900307540 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $31,416 |
| **Building Name:** | St Croix Val SF Tamarack Pic Shel 1 | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $5,318 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900307790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,785 |
| **Building Name:** | St Croix Valley SF Boulder CG Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $2,447 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 42 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,785 |
| **Building Name:** | St Croix Valley SF Boulder CG Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $1,691 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900307810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,785 |
| **Building Name:** | St Croix Val SF Tamarack S34 Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $2,447 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900307820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,785 |
| **Building Name:** | St Croix Val SF Tamarack S27 Vault | **Address:** | TAMARACK FOREST RD | **Deferred Maintenance:** | $2,447 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | HINCKLEY | **Ext. Gross Area:** | 42 |

### *Site: R290098 - Chengwatana State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307550 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $8,830 |
| **Building Name:** | Chengwatana Snake R CG Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,659 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 27 |
| **Building Code:** | R2900307560 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,039 |
| **Building Name:** | Chengwatana Snake R CG Vault Toilet | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $1,009 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900308520 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,913 |
| **Building Name:** | Chengwatana Snake R CG Vault Concrt | **Address:** | 39797 PARK TRAIL | **Deferred Maintenance:** | $518 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CENTER CITY | **Ext. Gross Area:** | 51 |

### *Site: R290099 - Beltrami Island State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104010 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,682 |
| **Building Name:** | Beltrami Is Bemis Hill CG Wellhouse | **Address:** | 48990 CO RD 4 | **Deferred Maintenance:** | $1,768 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900104020 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,338,183 |
| **Building Name:** | Beltrami Is Bemis Hill CG Trls Ctr | **Address:** | 48990 CO RD 4 | **Deferred Maintenance:** | $464,969 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 960 |
| **Building Code:** | R2900105550 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $18,817 |
| **Building Name:** | Beltrami Is SF Faunce Fire Tower | **Address:** | FAUNCE | **Deferred Maintenance:** | $14,113 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 49 |
| **Building Code:** | R2900105640 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $18,033 |
| **Building Name:** | Beltrami Is SF Norris Fire Tower | **Address:** | NORRIS | **Deferred Maintenance:** | $5,951 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WARROAD | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106500 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,784 |
| **Building Name:** | Beltrami Is Bemis Hill CG Vault 1 | **Address:** | 48990 CO RD 4 | **Deferred Maintenance:** | $4,934 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900106510 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,784 |
| **Building Name:** | Beltrami Is Bemis Hill CG Vault 2 | **Address:** | 48990 CO RD 4 | **Deferred Maintenance:** | $3,422 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107440 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,384 |
| **Building Name:** | Beltrami Is Blueberry Hill CG Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $1,883 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,496 |
| **Building Name:** | Beltrami Is Faunce CG Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $3,345 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |

### *Site: R290100 - General Andrews State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300160 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $182,195 |
| **Building Name:** | GenAndr SF Nursery Tin Pole | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $108,183 |
| **Facility Condition Index:** | 0.59 - Crisis | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 3,258 |
| **Building Code:** | R2900300170 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $181,213 |
| **Building Name:** | GenAndr SF Nursery Fertilizer Bldg | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $123,395 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 2,040 |
| **Building Code:** | R2900300180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $292,391 |
| **Building Name:** | GenAndr SF Nursery Greenhouse | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $68,268 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 1,844 |
| **Building Code:** | R2900300190 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $4,860,047 |
| **Building Name:** | General Andrews SF Shop | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $1,886,444 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 29,331 |
| **Building Code:** | R2900300200 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,058,484 |
| **Building Name:** | GenAndr SF Cement Seedling Pack Hse | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $747,818 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 12,927 |
| **Building Code:** | R2900300220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $32,120 |
| **Building Name:** | GenAndr SF Nursry F Block Pumphouse | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $6,558 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 332 |
| **Building Code:** | R2900300230 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,440 |
| **Building Name:** | GenAndr SF Nursery 2 Stall Garage | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $17,018 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 480 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300240 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $621,782 |
| **Building Name:** | GenAndr SF Metal Seedling Pack Hse | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $96,529 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 4,466 |
| **Building Code:** | R2900300250 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $485,682 |
| **Building Name:** | General Andrews SF Nursery Office | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $138,687 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 4,417 |
| **Building Code:** | R2900303190 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $643,194 |
| **Building Name:** | GenAndr SF Nursery South Garage | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $244,559 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 4,228 |
| **Building Code:** | R2900303730 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $82,135 |
| **Building Name:** | GenAndr SF Nursery Shop Pumphouse | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $21,445 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 224 |
| **Building Code:** | R2900303810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,629 |
| **Building Name:** | GenAndr SF Nursery Oil House | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $1,808 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900303980 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $208,204 |
| **Building Name:** | GenAndr SF Nursery Machine Shed | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $65,619 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 3,303 |
| **Building Code:** | R2900304210 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $36,896 |
| **Building Name:** | GenAndr SF Nursery Lumber Shed | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $9,804 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 650 |
| **Building Code:** | R2900307030 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,732 |
| **Building Name:** | GenAndr Willow CG St 5 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $906 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307040 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,732 |
| **Building Name:** | GenAndr Willow CG St 5 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $694 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,027 |
| **Building Name:** | GenAndr Willow CG St20 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $715 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307060 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,027 |
| **Building Name:** | GenAndr Willow CG St20 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $2,195 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,027 |
| **Building Name:** | GenAndr Willow CG St37 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $2,668 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307080 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,027 |
| **Building Name:** | GenAndr Willow CG St37 Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $1,137 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307090 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,027 |
| **Building Name:** | GenAndr Willow Grp CG Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $715 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307100 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,027 |
| **Building Name:** | GenAndr Willow Grp CG Vault Toilet | **Address:** | 61101 BANNING PARK RD | **Deferred Maintenance:** | $715 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900307660 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $467,082 |
| **Building Name:** | GenAndr SF Nursery Walk-in-Freezer | **Address:** | 85894 CO HWY 61 | **Deferred Maintenance:** | $9,808 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 3,062 |

### *Site: R290101 - Bemidji Glidden*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $213,628 |
| **Building Name:** | Bemidji Glidden Shop | **Address:** | 7902 GLIDDEN RD NE | **Deferred Maintenance:** | $44,772 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 1,171 |
| **Building Code:** | R2900100960 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $359,439 |
| **Building Name:** | Bemidji Glidden Cold Storage | **Address:** | 7902 GLIDDEN RD NE | **Deferred Maintenance:** | $58,858 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 3,608 |
| **Building Code:** | R2900104670 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,956 |
| **Building Name:** | Bemidji Glidden Oil House | **Address:** | 7902 GLIDDEN RD NE | **Deferred Maintenance:** | $1,636 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 57 |

### *Site: R290102 - Bagley*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103340 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $107,014 |
| **Building Name:** | Bagley 4-Stall Storage | **Address:** | 36452 STATE 92 | **Deferred Maintenance:** | $20,599 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BAGLEY | **Ext. Gross Area:** | 1,300 |
| **Building Code:** | R2900103360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $359,445 |
| **Building Name:** | Bagley Shop Office | **Address:** | 36452 STATE 92 | **Deferred Maintenance:** | $79,598 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BAGLEY | **Ext. Gross Area:** | 2,432 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103480 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $307,817 |
| **Building Name:** | Bagley Office | **Address:** | 36452 STATE 92 | **Deferred Maintenance:** | $55,089 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BAGLEY | **Ext. Gross Area:** | 3,072 |
| **Building Code:** | R2900106720 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,380 |
| **Building Name:** | Bagley Pump House | **Address:** | 36452 STATE 92 | **Deferred Maintenance:** | $1,351 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BAGLEY | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900107780 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $64,795 |
| **Building Name:** | Bagley Cold Storage | **Address:** | 36452 STATE 92 | **Deferred Maintenance:** | $6,480 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BAGLEY | **Ext. Gross Area:** | 640 |

### *Site: R290103 - Pine Island State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103700 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $51,788 |
| **Building Name:** | Pine Island SF Lost River Cabin | **Address:** | 10.5 mi. E. of State 72 Lost River R( | **Deferred Maintenance:** | $17,090 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | KELLIHER | **Ext. Gross Area:** | 374 |

### *Site: R290104 - Land O'Lakes State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,118 |
| **Building Name:** | LO'Lakes SF Converse CG Ste 1 Vault | **Address:** | Washburn Lake solitude area | **Deferred Maintenance:** | $3,263 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 39 |
| **Building Code:** | R2900108200 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,082 |
| **Building Name:** | LO'Lakes SF Converse CG Ste 8 Vault | **Address:** | C/o CUYUNA COUNTRY SRA 307 | **Deferred Maintenance:** | $3,254 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900108210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,924 |
| **Building Name:** | LO'Lakes SF Converse CG Ste18 Vault | **Address:** | C/o CUYUNA COUNTRY SRA 307 | **Deferred Maintenance:** | $2,719 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900108220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,082 |
| **Building Name:** | LO'Lakes SF Converse CG Ste30 Vault | **Address:** | C/o CUYUNA COUNTRY SRA 307 | **Deferred Maintenance:** | $3,254 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900108230 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $10,129 |
| **Building Name:** | LO'Lakes SF Converse CG Adirondack | **Address:** | C/o CUYUNA COUNTRY SRA 307 | **Deferred Maintenance:** | $2,946 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | IRONTON | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900300610 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $444,216 |
| **Building Name:** | Land O'Lakes SF Washburn Lk Office | **Address:** | 1145 STATE 6 NE | **Deferred Maintenance:** | $140,095 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | OUTING | **Ext. Gross Area:** | 2,968 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303270 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,481 |
| **Building Name:** | Land O'Lakes SF Washburn Lk Oil Hse | **Address:** | 1145 STATE 6 NE | **Deferred Maintenance:** | $1,634 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | OUTING | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900305500 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $10,839 |
| **Building Name:** | LO'Lakes SF Ben Draper Fire Tower | **Address:** | BEN DRAPER | **Deferred Maintenance:** | $8,129 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | BRAINERD | **Ext. Gross Area:** | 2,750 |
| **Building Code:** | R2900306600 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $13,082 |
| **Building Name:** | LO'Lakes SF Baker Lake CG Vault | **Address:** | Draper Rd ATV Trail | **Deferred Maintenance:** | $3,031 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 39 |

### *Site: R290105 - Lac Qui Parle WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $699,296 |
| **Building Name:** | Lac Qui Parle WMA Shop | **Address:** | 14040 20TH ST NW | **Deferred Maintenance:** | $316,135 |
| **Facility Condition Index:** | 0.45 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 2,424 |
| **Building Code:** | R2900402080 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $145,433 |
| **Building Name:** | Lac Qui Parle WMA Cold Storage | **Address:** | 14040 20TH ST NW | **Deferred Maintenance:** | $48,631 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 1,536 |
| **Building Code:** | R2900402090 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,463,191 |
| **Building Name:** | Lac Qui Parle WMA Residence | **Address:** | 14042 20TH ST NW | **Deferred Maintenance:** | $590,472 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 3,224 |
| **Building Code:** | R2900402670 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $376,678 |
| **Building Name:** | Lac Qui Parle WMA Cold Storage | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $124,304 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 7,040 |
| **Building Code:** | R2900403790 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $21,496 |
| **Building Name:** | Lac Qui Parle WMA Cold Storage | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $7,094 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 352 |
| **Building Code:** | R2900404110 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,235,726 |
| **Building Name:** | Lac Qui Parle WMA Main Office | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $205,124 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 3,670 |
| **Building Code:** | R2900404120 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $114,314 |
| **Building Name:** | LQParle WMA Watson Picnic Shelter 2 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $40,444 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 612 |
| **Building Code:** | R2900404130 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $44,680 |
| **Building Name:** | Lac Qui Parle WMA Watson Sanitation | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $14,744 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WATSON | **Ext. Gross Area:** | 270 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404600 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $267,919 |
| **Building Name:** | Lac Qui Parle WMA Cold Storage | **Address:** | 14006 20TH ST NW | **Deferred Maintenance:** | $26,792 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATSON | **Ext. Gross Area:** | 2,880 |
| **Building Code:** | R2900404620 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $22,553 |
| **Building Name:** | LQParle WMA Watson Picnic Shelter 1 | **Address:** | 14047 20TH ST NW | **Deferred Maintenance:** | $15,883 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | WATSON | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900405080 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,097 |
| **Building Name:** | Lac Qui Parle WMA Residence Garage | **Address:** | 14042 20TH ST NW | **Deferred Maintenance:** | $5,475 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WATSON | **Ext. Gross Area:** | 592 |
| **Building Code:** | R2900405710 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $356,103 |
| **Building Name:** | LQParle WMA Larson Cold Storage | **Address:** | 14005 20TH ST NW | **Deferred Maintenance:** | $74,240 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | WATSON | **Ext. Gross Area:** | 3,283 |

### *Site: R290106 - Red Lake WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100230 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $340,318 |
| **Building Name:** | Red Lake WMA Norris Remote Residnce | **Address:** | 2879 N ROOSEVELT RD | **Deferred Maintenance:** | $47,992 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,928 |
| **Building Code:** | R2900100240 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $390,219 |
| **Building Name:** | Red Lake WMA Norris Onsite Residnce | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $60,566 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 3,072 |
| **Building Code:** | R2900100280 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $224,949 |
| **Building Name:** | Red Lake WMA Norris Shop | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $76,591 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,048 |
| **Building Code:** | R2900100320 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $135,845 |
| **Building Name:** | Red Lake WMA Norris Sanitation | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $57,296 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,240 |
| **Building Code:** | R2900100330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,936 |
| **Building Name:** | Red Lake WMA Norris Garbage Shed | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $7,162 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900100340 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $553,807 |
| **Building Name:** | Red Lake WMA Norris Office | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $108,361 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 3,091 |
| **Building Code:** | R2900100350 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $311,337 |
| **Building Name:** | Red Lake WMA Norris Dining Hall | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $189,380 |
| **Facility Condition Index:** | 0.61 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,248 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $56,526 |
| **Building Name:** | Red Lake WMA Norris Blacksmith Shop | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $34,842 |
| **Facility Condition Index:** | 0.62 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900100370 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $69,262 |
| **Building Name:** | Red Lake WMA Norris Pump House | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $20,043 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 400 |
| **Building Code:** | R2900100380 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $166,565 |
| **Building Name:** | Red Lake WMA Norris Old CCC shop | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $124,212 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,976 |
| **Building Code:** | R2900100390 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $240,841 |
| **Building Name:** | Red Lake WMA Norris Wolf Shack | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $48,757 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,000 |
| **Building Code:** | R2900100420 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $124,460 |
| **Building Name:** | Red Lake WMA Norris Cabin | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $78,816 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 480 |
| **Building Code:** | R2900100430 | **Cost Model Name:** | Single-story Hotel/Dorm | **Current Replacement Value:** | $467,019 |
| **Building Name:** | Red Lake WMA Norris Duplex | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $58,192 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,684 |
| **Building Code:** | R2900100440 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,802 |
| **Building Name:** | Red Lake WMA Norris Oil House | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $7,358 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 84 |
| **Building Code:** | R2900100450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $75,122 |
| **Building Name:** | Red Lake WMA Norris NW Garage | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $36,090 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,000 |
| **Building Code:** | R2900100460 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $242,629 |
| **Building Name:** | Red Lake WMA Norris Asst Mgr Garage | **Address:** | 2879 N ROOSEVELT RD | **Deferred Maintenance:** | $24,263 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,580 |
| **Building Code:** | R2900100830 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $457,656 |
| **Building Name:** | Red Lake WMA Norris CCC Rec Hall | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $128,406 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 2,220 |
| **Building Code:** | R2900100840 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $275,855 |
| **Building Name:** | Red Lake WMA Norris Tool House | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $97,394 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 1,480 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100990 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $8,034 |
| **Building Name:** | Red Lake WMA Oaks Cabin | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $8,034 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 252 |
| **Building Code:** | R2900101060 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $14,932 |
| **Building Name:** | Red Lake WMA Gates Corner Cabin | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $10,015 |
| **Facility Condition Index:** | 0.67 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 196 |
| **Building Code:** | R2900101080 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $21,914 |
| **Building Name:** | Red Lake WMA Blue Kettle Trl Cabin | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $13,055 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 182 |
| **Building Code:** | R2900104370 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $148,249 |
| **Building Name:** | Red Lake WMA Norris Metal Building | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $40,027 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 2,048 |
| **Building Code:** | R2900105210 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $30,796 |
| **Building Name:** | Red Lake WMA Norris Picnic Shel 1 | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $3,080 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 800 |
| **Building Code:** | R2900106570 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $60,330 |
| **Building Name:** | Red Lake WMA Norris Gas Building | **Address:** | 11536 FAUNCE BUTTERFIELD RD | **Deferred Maintenance:** | $7,508 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 156 |

### *Site: R290107 - Roseau River WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100080 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,969 |
| **Building Name:** | Roseau River WMA Wildlife Shed | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $13,477 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ROSEAU | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900100470 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $45,530 |
| **Building Name:** | Roseau River WMA HQ Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $911 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROSEAU | **Ext. Gross Area:** | 254 |
| **Building Code:** | R2900100520 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $611,381 |
| **Building Name:** | Roseau River WMA Double Quonset | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $266,685 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 3,296 |
| **Building Code:** | R2900100530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $639,035 |
| **Building Name:** | Roseau River WMA Metal Storage Shed | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $70,167 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 4,000 |
| **Building Code:** | R2900100540 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $574,146 |
| **Building Name:** | Roseau River WMA Office | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $141,399 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 2,393 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100550 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $732,960 |
| **Building Name:** | Roseau River WMA Shop | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $133,148 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 2,800 |
| **Building Code:** | R2900100560 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $962,851 |
| **Building Name:** | Roseau River WMA Residence Near Ofc | **Address:** | 39943 280TH AVE | **Deferred Maintenance:** | $212,954 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 3,672 |
| **Building Code:** | R2900100570 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $45,530 |
| **Building Name:** | Roseau River WMA Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $4,553 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 254 |
| **Building Code:** | R2900101100 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,541 |
| **Building Name:** | Roseau River WMA Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $15,406 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ROSEAU | **Ext. Gross Area:** | 152 |
| **Building Code:** | R2900103800 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $893,543 |
| **Building Name:** | Roseau River WMA Residence | **Address:** | 27909 400TH ST | **Deferred Maintenance:** | $117,875 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 2,912 |
| **Building Code:** | R2900104460 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,907 |
| **Building Name:** | Roseau River WMA Office Pump House | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $2,595 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900105200 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,715 |
| **Building Name:** | Roseau River WMA Pump House | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $3,615 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900105300 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,672 |
| **Building Name:** | Roseau River WMA Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $4,967 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 176 |
| **Building Code:** | R2900105310 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,836 |
| **Building Name:** | Roseau River WMA Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $2,484 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 122 |
| **Building Code:** | R2900105320 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $250,504 |
| **Building Name:** | Roseau River WMA Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $82,666 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900107670 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,930 |
| **Building Name:** | Roseau River WMA Granary Storage | **Address:** | 27952 400TH ST | **Deferred Maintenance:** | $6,247 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ROSEAU | **Ext. Gross Area:** | 143 |

***Site: R290108 - Thief Lake WMA***

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100260 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,062 |
| **Building Name:** | Thief Lake WMA Office Picnic Shel 1 | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $2,419 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 288 |
| **Building Code:** | R2900100670 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $642,530 |
| **Building Name:** | Thief Lake WMA Barracks Office | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $119,724 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 3,091 |
| **Building Code:** | R2900100680 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $825,726 |
| **Building Name:** | Thief Lake WMA Office Log Residence | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $93,063 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 2,906 |
| **Building Code:** | R2900100690 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $397,618 |
| **Building Name:** | Thief Lake WMA Residence Near Dam | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $66,142 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 2,448 |
| **Building Code:** | R2900100710 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $41,913 |
| **Building Name:** | Thief Lake WMA Office Area Garage | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $31,434 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 252 |
| **Building Code:** | R2900100730 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,799 |
| **Building Name:** | Thief Lake WMA Office Granary Stor | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $1,780 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 154 |
| **Building Code:** | R2900100740 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,799 |
| **Building Name:** | Thief Lake WMA Office Granary Stor | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $1,780 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 154 |
| **Building Code:** | R2900100750 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,599 |
| **Building Name:** | Thief Lake WMA Office Granary Stor | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $3,560 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 255 |
| **Building Code:** | R2900100760 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,882 |
| **Building Name:** | Thief Lake WMA Office Area Garage | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $23,161 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 240 |
| **Building Code:** | R2900100810 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $338,688 |
| **Building Name:** | Thief Lake WMA Office | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $58,762 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 1,535 |
| **Building Code:** | R2900100820 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $64,104 |
| **Building Name:** | Thief Lake WMA Office Pump House | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $12,016 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 170 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104610 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $940,063 |
| **Building Name:** | Thief Lake WMA Shop | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $117,577 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 6,900 |
| **Building Code:** | R2900105070 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $12,150 |
| **Building Name:** | Thief Lake WMA Office Cold Storage | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $9,113 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 156 |
| **Building Code:** | R2900105080 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,599 |
| **Building Name:** | Thief Lake WMA Office Granary Stor | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $3,560 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 255 |
| **Building Code:** | R2900107420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $58,676 |
| **Building Name:** | Thief Lake WMA Farm Residnce Garage | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $43,031 |
| **Facility Condition Index:** | 0.73 - Crisis | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 625 |
| **Building Code:** | R2900107430 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $610,198 |
| **Building Name:** | Thief Lake WMA Farm Residence | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $171,932 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 3,780 |
| **Building Code:** | R2900107490 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $373,206 |
| **Building Name:** | Thief Lake WMA Farm Barn | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $159,422 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 2,501 |
| **Building Code:** | R2900107500 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $159,693 |
| **Building Name:** | Thief Lake WMA Farm Quonset | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $73,192 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 2,100 |
| **Building Code:** | R2900107510 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,037 |
| **Building Name:** | Thief Lake WMA Farm Oil House | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $4,711 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 99 |
| **Building Code:** | R2900107520 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $40,949 |
| **Building Name:** | Thief Lake WMA Farm Barn Silo | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $13,513 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 230 |
| **Building Code:** | R2900107530 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $309,281 |
| **Building Name:** | Thief Lake WMA Farm Metal Shop | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $46,160 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 2,597 |
| **Building Code:** | R2900107540 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $35,599 |
| **Building Name:** | Thief Lake WMA Granary Storage | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $3,560 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 255 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107580 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $32,036 |
| **Building Name:** | Thief Lake WMA Granary Storage | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $3,204 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 200 |
| **Building Code:** | R2900108830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,722 |
| **Building Name:** | Thief Lake WMA North Vault Toilet | **Address:** | 42280 240TH AVE NE | **Deferred Maintenance:** | $3,902 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MIDDLE RIVER | **Ext. Gross Area:** | 48 |

### *Site: R290109 - Heartland State Trail*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106740 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $13,273 |
| **Building Name:** | Heartland ST Nevis Picnic Shelter | **Address:** | 603 1ST ST W | **Deferred Maintenance:** | $1,688 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900106750 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $42,472 |
| **Building Name:** | Heartland ST Dorset Picnic Shelter | **Address:** | 603 1ST ST W | **Deferred Maintenance:** | $14,016 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 512 |
| **Building Code:** | R2900106760 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $42,472 |
| **Building Name:** | Heartland ST Kabakona Picnic Shel | **Address:** | 603 1ST ST W | **Deferred Maintenance:** | $17,682 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 512 |
| **Building Code:** | R2900106770 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $42,472 |
| **Building Name:** | Heartland ST Akeley Picnic Shelter | **Address:** | ACKLEY | **Deferred Maintenance:** | $15,272 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | NEVIS | **Ext. Gross Area:** | 512 |

### *Site: R290110 - R J Dorer State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502700 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,792 |
| **Building Name:** | RJDorer Zumbro Btm M Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,223 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502710 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,792 |
| **Building Name:** | RJDorer Zumbro Btm F Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,223 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502720 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,792 |
| **Building Name:** | RJDorer Zumbro Btm U Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,223 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502730 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,370 |
| **Building Name:** | RJDorer Zumbro Btm M Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,759 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502740 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $21,245 |
| **Building Name:** | RJDorer SF Snake Crk Vault Toilet | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $4,297 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900502750 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,194 |
| **Building Name:** | RJDorer SF Kruger Vault Concrete | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $24,895 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502760 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,194 |
| **Building Name:** | RJDorer SF Kruger Vault Concrete | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $24,895 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502770 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $21,104 |
| **Building Name:** | RJDorer SF Kruger Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,912 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502780 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,370 |
| **Building Name:** | RJDorer SF Kruger Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,204 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,672 |
| **Building Name:** | RJDorer SF Wet Bark Vault Concrete | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $14,004 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900502810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,672 |
| **Building Name:** | RJDorer SF Reno Unit Low Vault Conc | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $14,004 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900503350 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $30,409 |
| **Building Name:** | RJDorer SF Zumbro Btm Picnic Shel 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $10,722 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900503360 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $43,570 |
| **Building Name:** | RJDorer SF Kruger Picnic Shelter 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $11,441 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 527 |
| **Building Code:** | R2900503370 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $30,409 |
| **Building Name:** | RJDorer SF Kruger Picnic Shelter 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $10,035 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900503660 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $26,813 |
| **Building Name:** | RJDorer SF Kruger Picnic Shelter 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $9,963 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 384 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $21,124 |
| **Building Name:** | RJDorer Zumbro Btm U Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,302 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,412 |
| **Building Name:** | RJDorer SF Kruger Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,381 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,412 |
| **Building Name:** | RJDorer SF Kruger Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $4,218 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503850 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $76,429 |
| **Building Name:** | RJDorer SF Zumbro Btm Picnic Shel 1 | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $5,636 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 816 |
| **Building Code:** | R2900504790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,194 |
| **Building Name:** | RJDorer SF Vinegar Rdg Vault Concr | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $10,954 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504810 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $8,471 |
| **Building Name:** | RJDorer SF Hay Crk Picnic Shelter 1 | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $1,905 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 430 |
| **Building Code:** | R2900504870 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $26,451 |
| **Building Name:** | RJDorer SF Reno Unit Low Vault Conc | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $529 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900504880 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $15,203 |
| **Building Name:** | RJDorer SF Reno Unit Low Adirondack | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $1,755 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900504890 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $13,314 |
| **Building Name:** | RJDorer SF Reno Unit Up Adirondack | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $2,282 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 115 |
| **Building Code:** | R2900504900 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $25,563 |
| **Building Name:** | RJDorer SF Wet Bark Adirondack | **Address:** | 15954 CO RD 1 | **Deferred Maintenance:** | $3,081 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 210 |
| **Building Code:** | R2900504940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $20,370 |
| **Building Name:** | RJDorer Zumbro Btm W F Vault Toilet | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,227 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504950 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,194 |
| **Building Name:** | RJDorer SF Zumbro Btm W Vault Concr | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,319 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504960 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $33,194 |
| **Building Name:** | RJDorer SF Zumbro Btm W Vault Concr | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $3,319 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900505370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,978 |
| **Building Name:** | RJDorer SF Zumbro Btm Cold Storage | **Address:** | 29223 CO 28 BLVD | **Deferred Maintenance:** | $260 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900505480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,113 |
| **Building Name:** | RJDorer SF Hay Crk Vault Concrete | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $2,511 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900505500 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,729 |
| **Building Name:** | RJDorer SF Snake Crk Vault Concrete | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $2,773 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 53 |

### *Site: R290111 - Crow Wing State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305480 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $19,921 |
| **Building Name:** | CWSF Greer Lk CG Fish Cleaning Hse | **Address:** | 17447 GREER LAKE RD | **Deferred Maintenance:** | $12,759 |
| **Facility Condition Index:** | 0.64 - Crisis | **City Code:** | CROSBY | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900305490 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,078 |
| **Building Name:** | CWSF Greer Lake CG Cold Storage | **Address:** | 17447 GREER LAKE RD | **Deferred Maintenance:** | $959 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | CROSBY | **Ext. Gross Area:** | 48 |
| **Building Code:** | R2900308330 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,929 |
| **Building Name:** | CWSF Greer Lake CG Vault Concrete | **Address:** | 17447 GREER LAKE RD | **Deferred Maintenance:** | $359 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CROSBY | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900308340 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,709 |
| **Building Name:** | CWSF Greer Lake CG Vault Concrete | **Address:** | 17447 GREER LAKE RD | **Deferred Maintenance:** | $554 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CROSBY | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900308350 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,929 |
| **Building Name:** | CWSF Greer Lake CG 6 Vault Concrete | **Address:** | 17447 GREER LAKE RD | **Deferred Maintenance:** | $359 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CROSBY | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900308360 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,929 |
| **Building Name:** | CWSF Greer Lake CG 24 Vault Concret | **Address:** | 17447 GREER LAKE RD | **Deferred Maintenance:** | $359 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CROSBY | **Ext. Gross Area:** | 33 |

### *Site: R290112 - Bowstring State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206310 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,756 |
| **Building Name:** | Bowstring Moose Lk CG Vault Toilet | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $2,438 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206320 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,756 |
| **Building Name:** | Bowstring Moose Lk CG Vault Toilet | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $2,438 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900208300 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,617 |
| **Building Name:** | Bowstring Cottonwd Lk CG Vault Toil | **Address:** | 880 GARY ST | **Deferred Maintenance:** | $2,397 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CALUMET | **Ext. Gross Area:** | 30 |

### *Site: R290114 - Grand Portage State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207800 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | GPort SF Esther Lk CG Vault Toilet | **Address:** | 1127 ESTER LAKE RD | **Deferred Maintenance:** | $3,869 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HOVLAND | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900207810 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | GPort SF McFarl Lk CG Vault Toilet | **Address:** | 3505 ARROWHEAD TRAIL | **Deferred Maintenance:** | $3,358 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | HOVLAND | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900207820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,582 |
| **Building Name:** | GPort SF Devilfish CG Vault Toilet | **Address:** | 951 ESTER LAKE RD | **Deferred Maintenance:** | $1,533 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HOVLAND | **Ext. Gross Area:** | 42 |

### *Site: R290115 - R1 HQ Bemidji*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100010 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $2,375,829 |
| **Building Name:** | Bemidji R1 HQ Main Office | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $433,918 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 8,883 |
| **Building Code:** | R2900100020 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $55,581 |
| **Building Name:** | Bemidji R1 HQ Enforcement Garage | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $4,970 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 885 |
| **Building Code:** | R2900104350 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $1,962,488 |
| **Building Name:** | Bemidji R1 HQ Shop | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $307,472 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 13,029 |
| **Building Code:** | R2900105250 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $46,020 |
| **Building Name:** | Bemidji R1 HQ HazMat Storage | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $4,602 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 217 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105260 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,004 |
| **Building Name:** | Bemidji R1 HQ HazMat Storage | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $800 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900105270 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $237,035 |
| **Building Name:** | Bemidji R1 HQ CCM Office | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $38,247 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,846 |
| **Building Code:** | R2900107240 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $969,902 |
| **Building Name:** | Bemidji R1 HQ Annex Office | **Address:** | 2115 BIRCHMONT BEACH RD NE | **Deferred Maintenance:** | $82,664 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 5,741 |

### *Site: R290116 - Whitewater WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $170,470 |
| **Building Name:** | Whitewater WMA HQ Cold Storage | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $31,173 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900500150 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $512,118 |
| **Building Name:** | Whitewater WMA Shop | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $136,046 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 2,246 |
| **Building Code:** | R2900500160 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $578,332 |
| **Building Name:** | Whitewater WMA Main Office | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $121,195 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 3,829 |
| **Building Code:** | R2900500190 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,694 |
| **Building Name:** | Whitewater WMA Oil House | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $9,451 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | ALTURA | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900502010 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $126,019 |
| **Building Name:** | Whitewater WMA HQ Cold Storage | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $46,890 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,792 |
| **Building Code:** | R2900502130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $61,857 |
| **Building Name:** | Whitewater WMA HQ Cold Storage | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $22,969 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 936 |
| **Building Code:** | R2900503190 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,729 |
| **Building Name:** | Whitewater WMA Granary Storage | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $5,191 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 176 |
| **Building Code:** | R2900503200 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $1,236,441 |
| **Building Name:** | Whitewater WMA Marnach House | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $498,467 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,200 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503340 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $21,758 |
| **Building Name:** | Whitewater WMA Elba Fire Tower | **Address:** | 19041 HWY 74 | **Deferred Maintenance:** | $6,618 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504750 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $478,989 |
| **Building Name:** | Whitewater WMA Heated Storage | **Address:** | 15035 HWY 74 | **Deferred Maintenance:** | $34,524 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 5,025 |

### *Site: R290117 - Twin Lakes WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $277,721 |
| **Building Name:** | Twin Lakes WMA Heated Storage | **Address:** | 1&1/2 mi. E. of Karlstad Hwy. 11 | **Deferred Maintenance:** | $45,579 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | KARLSTAD | **Ext. Gross Area:** | 1,920 |

### *Site: R290118 - Franz Jevne State Park*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107050 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,460 |
| **Building Name:** | Franz Jevne SP Entry Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $3,593 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107060 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,460 |
| **Building Name:** | Franz Jevne SP Rapid Trail Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $3,593 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107070 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,460 |
| **Building Name:** | Franz Jevne SP CG Site 8 Vault | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $3,593 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900107080 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,558 |
| **Building Name:** | Franz Jevne SP CG Picnic Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900107090 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,558 |
| **Building Name:** | Franz Jevne SP CG Site 7 Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900107100 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,558 |
| **Building Name:** | Franz Jevne SP CG Site 8 Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900107110 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,558 |
| **Building Name:** | Franz Jevne SP CG Site 9 Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 96 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107120 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,558 |
| **Building Name:** | Franz Jevne SP CG Site 10 Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900107130 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $4,558 |
| **Building Name:** | Franz Jevne SP CG Site 12 Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $456 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900107140 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $25,775 |
| **Building Name:** | Franz Jevne SP CG Picnic Shelter | **Address:** | 3684 54TH AVE NW | **Deferred Maintenance:** | $2,578 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 460 |

### *Site: R290119 - Elysian*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402930 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $328,225 |
| **Building Name:** | Elysian Trails Center | **Address:** | 101 4TH ST SW | **Deferred Maintenance:** | $74,262 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ELYSIAN | **Ext. Gross Area:** | 448 |
| **Building Code:** | R2900404060 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $355,045 |
| **Building Name:** | Elysian Office | **Address:** | 101 4TH ST SW | **Deferred Maintenance:** | $41,480 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ELYSIAN | **Ext. Gross Area:** | 1,890 |

### *Site: R290120 - Spicer*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401760 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,626 |
| **Building Name:** | Spicer Pump House | **Address:** | 10590 CO RD 8 NE | **Deferred Maintenance:** | $5,394 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | SPICER | **Ext. Gross Area:** | 67 |
| **Building Code:** | R2900401780 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $906,568 |
| **Building Name:** | Spicer Office | **Address:** | 164 CTY RD 8 NE | **Deferred Maintenance:** | $188,310 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | SPICER | **Ext. Gross Area:** | 4,608 |

### *Site: R290122 - Floodwood*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202620 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $294,270 |
| **Building Name:** | Floodwood Office | **Address:** | 11809 FLOODWOOD RD | **Deferred Maintenance:** | $81,795 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 1,845 |
| **Building Code:** | R2900202630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $89,340 |
| **Building Name:** | Floodwood River Garage | **Address:** | 307 RAILROAD ST | **Deferred Maintenance:** | $22,023 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 1,040 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207120 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $18,190 |
| **Building Name:** | Floodwood Fire Tower | **Address:** | 306 RAILROAD AVE | **Deferred Maintenance:** | $18,190 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 64 |

### *Site: R290123 - International Wolf Center*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207050 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $5,007,882 |
| **Building Name:** | International Wolf Center | **Address:** | 1396 HWY 169 | **Deferred Maintenance:** | $899,163 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 19,649 |
| **Building Code:** | R2900208590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $66,343 |
| **Building Name:** | International Wolf Ctr Cold Storage | **Address:** | 1396 HWY 169 | **Deferred Maintenance:** | $5,751 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 1,056 |

### *Site: R290124 - State Fairgrounds*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601890 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $87,404 |
| **Building Name:** | State Fairgrounds Nature Bldg | **Address:** | 1265 NELSON ST | **Deferred Maintenance:** | $7,337 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 640 |
| **Building Code:** | R2900601900 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $56,673 |
| **Building Name:** | State Fairgrounds DNR Outdoor Stage | **Address:** | 1251 NELSON ST | **Deferred Maintenance:** | $5,511 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 317 |
| **Building Code:** | R2900602040 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $55,841 |
| **Building Name:** | State Fairgrounds Fire Tower | **Address:** | 1765 CARNES AVE | **Deferred Maintenance:** | $4,643 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 121 |
| **Building Code:** | R2900602220 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $55,207 |
| **Building Name:** | State Fairgrnd Fire Prevention Bldg | **Address:** | 1265 SNELLING AVE N | **Deferred Maintenance:** | $3,165 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 301 |
| **Building Code:** | R2900602380 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $49,502 |
| **Building Name:** | State Fairgrounds Cabin Display | **Address:** | 1265 SNELLING AVE N | **Deferred Maintenance:** | $990 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 334 |

### *Site: R290127 - Hutchinson*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401810 | **Cost Model Name:** | Recreation Center | **Current Replacement Value:** | $3,375,696 |
| **Building Name:** | Hutchinson Office | **Address:** | 20596 HWY 7 | **Deferred Maintenance:** | $550,056 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HUTCHINSON | **Ext. Gross Area:** | 17,485 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402850 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,160 |
| **Building Name:** | Hutchinson Cold Storage | **Address:** | 20596 HWY 7 | **Deferred Maintenance:** | $4,479 |
| **Facility Condition Index:** | 0.55 - Crisis | **City Code:** | HUTCHINSON | **Ext. Gross Area:** | 83 |

### *Site: R290128 - Brainerd*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303720 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $316,961 |
| **Building Name:** | Brainerd HeatColdStorage | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $63,777 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,700 |
| **Building Code:** | R2900304020 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $9,146,204 |
| **Building Name:** | Brainerd Office | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $1,199,906 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 38,027 |
| **Building Code:** | R2900304040 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,103,161 |
| **Building Name:** | Brainerd Shop | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $189,461 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 6,529 |
| **Building Code:** | R2900304050 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,193,504 |
| **Building Name:** | Brainerd Heated Storage | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $171,585 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 13,351 |
| **Building Code:** | R2900304060 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,078,105 |
| **Building Name:** | Brainerd Cold Storage | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $126,254 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 19,878 |
| **Building Code:** | R2900304070 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $121,995 |
| **Building Name:** | Brainerd Central Heat Plant | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $10,856 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 798 |
| **Building Code:** | R2900305090 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $49,942 |
| **Building Name:** | Brainerd Hazardous Mat Storage | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $37,456 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | BRAINERD | **Ext. Gross Area:** | 209 |
| **Building Code:** | R2900305100 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,043 |
| **Building Name:** | Brainerd Hazardous Mat Storage | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $5,282 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | BRAINERD | **Ext. Gross Area:** | 34 |
| **Building Code:** | R2900307650 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $372,266 |
| **Building Name:** | Brainerd Cold Storage | **Address:** | 1601 MINNESOTA DR | **Deferred Maintenance:** | $7,445 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BRAINERD | **Ext. Gross Area:** | 3,566 |

### *Site: R290129 - Pine River*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300760 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,152 |
| **Building Name:** | Pine River Cold Storage | **Address:** | 36765 PIN KNOLLS CR | **Deferred Maintenance:** | $9,254 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | JENKINS | **Ext. Gross Area:** | 539 |
| **Building Code:** | R2900305070 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $24,818 |
| **Building Name:** | Pine River Contact Station | **Address:** | 36765 PIN KNOLLS CR | **Deferred Maintenance:** | $7,828 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | JENKINS | **Ext. Gross Area:** | 180 |
| **Building Code:** | R2900305080 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,374 |
| **Building Name:** | Pine River Cold Storage | **Address:** | 36765 PIN KNOLLS CR | **Deferred Maintenance:** | $2,104 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JENKINS | **Ext. Gross Area:** | 122 |

### *Site: R290130 - Gull Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306260 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $87,851 |
| **Building Name:** | Gull Lake East WAS Sanitation | **Address:** | 5056 NASHWAY RD | **Deferred Maintenance:** | $8,828 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NISSWA | **Ext. Gross Area:** | 272 |

### *Site: R290131 - Badoura State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105580 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $16,935 |
| **Building Name:** | Badoura SF Fire Tower | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $12,702 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900108160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $60,297 |
| **Building Name:** | Badoura SF Residence Garage | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $1,677 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | AKELEY | **Ext. Gross Area:** | 768 |
| **Building Code:** | R2900300010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,735,678 |
| **Building Name:** | Badoura SF Old Seedling Pack House | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $912,709 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 6,732 |
| **Building Code:** | R2900300020 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $284,908 |
| **Building Name:** | Badoura SF Residence | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $33,058 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | AKELEY | **Ext. Gross Area:** | 971 |
| **Building Code:** | R2900300060 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $114,010 |
| **Building Name:** | Badoura SF Old Carpenters Shop | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $38,017 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 1,536 |
| **Building Code:** | R2900300070 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $53,051 |
| **Building Name:** | Badoura SF Oil House | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $23,243 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 286 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300080 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $472,102 |
| **Building Name:** | Badoura SF Office | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $35,293 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | AKELEY | **Ext. Gross Area:** | 2,240 |
| **Building Code:** | R2900300100 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,080,427 |
| **Building Name:** | Badoura SF Shop | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $342,081 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 6,043 |
| **Building Code:** | R2900300110 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $138,934 |
| **Building Name:** | Badoura SF Two Stall Garage | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $30,365 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | AKELEY | **Ext. Gross Area:** | 1,059 |
| **Building Code:** | R2900300120 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $486,688 |
| **Building Name:** | Badoura SF Cold Storage Ike's Bldg | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $191,371 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 4,473 |
| **Building Code:** | R2900300130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $117,984 |
| **Building Name:** | Badoura SF Fertilizer Building | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $33,015 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | AKELEY | **Ext. Gross Area:** | 1,319 |
| **Building Code:** | R2900300150 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $654,494 |
| **Building Name:** | Badoura SF Pine Cone Storage | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $196,411 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 5,084 |
| **Building Code:** | R2900300360 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $227,311 |
| **Building Name:** | Badoura SF Mamie's Building | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $89,797 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 1,612 |
| **Building Code:** | R2900300400 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $65,166 |
| **Building Name:** | Badoura SF Quonset | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $21,880 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | R2900303640 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $257,385 |
| **Building Name:** | Badoura SF Open Cold Storage | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $84,937 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 2,703 |
| **Building Code:** | R2900304770 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,093,216 |
| **Building Name:** | Badoura SF Seed Extractory | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $183,413 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | AKELEY | **Ext. Gross Area:** | 10,118 |
| **Building Code:** | R2900305800 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,404,190 |
| **Building Name:** | Badoura SF New Seedling Pack House | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $47,363 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | AKELEY | **Ext. Gross Area:** | 6,294 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,588 |
| **Building Name:** | Badoura SF Radio Shelter | **Address:** | 13885 STATE HWY 64 | **Deferred Maintenance:** | $3,502 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | AKELEY | **Ext. Gross Area:** | 39 |

### *Site: R290133 - Cambridge*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305190 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $970,064 |
| **Building Name:** | Cambridge Office | **Address:** | 800 OAK SAVANNA LN SW | **Deferred Maintenance:** | $212,359 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 5,000 |
| **Building Code:** | R2900305200 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $539,206 |
| **Building Name:** | Cambridge Shop | **Address:** | 800 OAK SAVANNA LN SW | **Deferred Maintenance:** | $190,008 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 3,270 |
| **Building Code:** | R2900305210 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $163,948 |
| **Building Name:** | Cambridge Cold Storage | **Address:** | 800 OAK SAVANNA LN SW | **Deferred Maintenance:** | $30,689 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 2,715 |

### *Site: R290134 - Dalbo WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306760 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $391,581 |
| **Building Name:** | Dalbo WMA Cold Storage | **Address:** | 421ST AVE NW | **Deferred Maintenance:** | $218,040 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 3,431 |
| **Building Code:** | R2900306930 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,076,376 |
| **Building Name:** | Dalbo WMA HeatColdStorage | **Address:** | 421ST AVE NW | **Deferred Maintenance:** | $1,617,534 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 18,937 |
| **Building Code:** | R2900306950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $358,188 |
| **Building Name:** | Dalbo WMA Cold Storage | **Address:** | 421ST AVE NW | **Deferred Maintenance:** | $173,234 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 3,655 |

### *Site: R290135 - Ruff-Nik WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $198,062 |
| **Building Name:** | Ruff-Nik WMA Lrg Pole Cold Storage | **Address:** | 16543 HAVEN RD | **Deferred Maintenance:** | $41,907 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 2,268 |
| **Building Code:** | R2900307460 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $108,499 |
| **Building Name:** | Ruff-Nik WMA Sm Steel Cold Storage | **Address:** | 16543 HAVEN RD | **Deferred Maintenance:** | $13,940 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 1,080 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307470 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $129,478 |
| **Building Name:** | Ruff-Nik WMA Concrete Cold Storage | **Address:** | 16543 HAVEN RD | **Deferred Maintenance:** | $74,945 |
| **Facility Condition Index:** | 0.58 - Crisis | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 1,248 |

### *Site: R290136 - Cook*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203140 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $256,121 |
| **Building Name:** | Cook Office | **Address:** | 310 2ND ST SE | **Deferred Maintenance:** | $63,026 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 1,344 |
| **Building Code:** | R2900203150 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $228,401 |
| **Building Name:** | Cook HeatColdStorage | **Address:** | 310 2ND ST SE | **Deferred Maintenance:** | $33,203 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | COOK | **Ext. Gross Area:** | 1,449 |

### *Site: R290138 - Mentor Prairie WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $273,030 |
| **Building Name:** | Mentor Prairie WMA Cold Storage | **Address:** | .3 mile E. of intersection of 295th St | **Deferred Maintenance:** | $82,604 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 2,952 |

### *Site: R290139 - Deer River City*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201790 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $171,141 |
| **Building Name:** | Deer River City Cold Storage | **Address:** | 403 DIVISION ST | **Deferred Maintenance:** | $36,374 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 1,560 |
| **Building Code:** | R2900201800 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $498,254 |
| **Building Name:** | Deer River City Office | **Address:** | 403 DIVISION ST | **Deferred Maintenance:** | $101,924 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 2,576 |
| **Building Code:** | R2900201810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,407 |
| **Building Name:** | Deer River City Oil House | **Address:** | 403 DIVISION ST | **Deferred Maintenance:** | $6,279 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900203560 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $373,916 |
| **Building Name:** | Deer River City Shop | **Address:** | 403 DIVISION ST | **Deferred Maintenance:** | $119,708 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 2,141 |

### *Site: R290140 - Detroit Lakes*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100910 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $261,837 |
| **Building Name:** | Detroit Lakes Cold Storage | **Address:** | 14583 CTY HWY 19 | **Deferred Maintenance:** | $81,492 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 2,881 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100930 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $25,981 |
| **Building Name:** | Detroit Lakes Sign Shed | **Address:** | 14583 CTY HWY 19 | **Deferred Maintenance:** | $7,939 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 220 |
| **Building Code:** | R2900105240 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,142,460 |
| **Building Name:** | Detroit Lakes Office | **Address:** | 14583 CTY HWY 19 | **Deferred Maintenance:** | $135,984 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 5,013 |
| **Building Code:** | R2900105690 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,534,308 |
| **Building Name:** | Detroit Lakes Fish Hatchery | **Address:** | 14583 CTY HWY 19 | **Deferred Maintenance:** | $350,427 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 20,114 |
| **Building Code:** | R2900106350 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $50,036 |
| **Building Name:** | Detroit Lakes Tree Storage | **Address:** | 14583 CTY HWY 19 | **Deferred Maintenance:** | $7,424 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 515 |

### *Site: R290141 - Sedan Pond WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101210 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,903 |
| **Building Name:** | Sedan Pond WMA Pump House | **Address:** | 23070 N LAKESHORE DR | **Deferred Maintenance:** | $4,730 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 144 |

### *Site: R290142 - Finland*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $319,552 |
| **Building Name:** | Finland Shop | **Address:** | 6686 HWY 1 | **Deferred Maintenance:** | $141,361 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | FINLAND | **Ext. Gross Area:** | 1,860 |
| **Building Code:** | R2900201930 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $239,898 |
| **Building Name:** | Finland Cold Storage | **Address:** | 6686 HWY 1 | **Deferred Maintenance:** | $112,680 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | FINLAND | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900201950 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $725,763 |
| **Building Name:** | Finland Office | **Address:** | 6686 HWY 1 | **Deferred Maintenance:** | $64,278 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | FINLAND | **Ext. Gross Area:** | 3,654 |
| **Building Code:** | R2900204140 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,411 |
| **Building Name:** | Finland Oil House | **Address:** | 6686 HWY 1 | **Deferred Maintenance:** | $9,958 |
| **Facility Condition Index:** | 0.61 - Crisis | **City Code:** | FINLAND | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900204290 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $397,727 |
| **Building Name:** | Finland Cold Storage | **Address:** | 6686 HWY 1 | **Deferred Maintenance:** | $71,356 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | FINLAND | **Ext. Gross Area:** | 2,880 |

### *Site: R290143 - Grand Marais*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $466,204 |
| **Building Name:** | Grand Marais 6-Stall Cold Storage | **Address:** | 1356 E HWY 61 | **Deferred Maintenance:** | $64,762 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 2,821 |
| **Building Code:** | R2900202030 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $945,426 |
| **Building Name:** | Grand Marais Office | **Address:** | 1356 E HWY 61 | **Deferred Maintenance:** | $52,752 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 3,685 |
| **Building Code:** | R2900203810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,463 |
| **Building Name:** | Grand Marais Oil House | **Address:** | 1356 E HWY 61 | **Deferred Maintenance:** | $2,167 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 300 |
| **Building Code:** | R2900204170 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $11,528 |
| **Building Name:** | Grand Marais Cold Storage | **Address:** | 1356 E HWY 61 | **Deferred Maintenance:** | $6,112 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 96 |

### *Site: R290144 - Hibbing Minerals*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204640 | **Cost Model Name:** | Single-story Educational Facility | **Current Replacement Value:** | $3,112,227 |
| **Building Name:** | Hibbing Minerals Office | **Address:** | 1525 3RD AVE E | **Deferred Maintenance:** | $861,445 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | HIBBING | **Ext. Gross Area:** | 22,513 |
| **Building Code:** | R2900204650 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,024 |
| **Building Name:** | Hibbing Minerals Cold Storage | **Address:** | 1525 3RD AVE E | **Deferred Maintenance:** | $18,265 |
| **Facility Condition Index:** | 0.61 - Crisis | **City Code:** | HIBBING | **Ext. Gross Area:** | 121 |
| **Building Code:** | R2900204660 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $812,209 |
| **Building Name:** | Hibbing Minerals Cold Storage | **Address:** | 1525 3RD AVE E | **Deferred Maintenance:** | $91,750 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 5,000 |
| **Building Code:** | R2900204680 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,046,100 |
| **Building Name:** | Hibbing Minerals Cold Storage | **Address:** | 1525 3RD AVE E | **Deferred Maintenance:** | $121,478 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 8,010 |
| **Building Code:** | R2900206580 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,699,251 |
| **Building Name:** | Hibbing Minerals Cold Storage | **Address:** | 1525 3RD AVE E | **Deferred Maintenance:** | $145,949 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 16,000 |
| **Building Code:** | R2900207530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $130,042 |
| **Building Name:** | Hibbing Minerals Laboratory | **Address:** | 1525 3RD AVE E | **Deferred Maintenance:** | $13,426 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 864 |

### *Site: R290145 - Hill City*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303840 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $467,387 |
| **Building Name:** | Hill City Office | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $116,126 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HILL CITY | **Ext. Gross Area:** | 1,472 |
| **Building Code:** | R2900303850 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $489,441 |
| **Building Name:** | Hill City Shop | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $110,397 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HILL CITY | **Ext. Gross Area:** | 2,992 |
| **Building Code:** | R2900303970 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,826 |
| **Building Name:** | Hill City Oil House | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $1,610 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HILL CITY | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900303990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $390,454 |
| **Building Name:** | Hill City Cold Storage | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $101,958 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HILL CITY | **Ext. Gross Area:** | 2,051 |
| **Building Code:** | R2900304000 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,139 |
| **Building Name:** | Hill City Radio Shelter | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $2,857 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | HILL CITY | **Ext. Gross Area:** | 120 |

### *Site: R290146 - International Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200310 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $480,499 |
| **Building Name:** | International Falls Repair Shop | **Address:** | 392 HWY 11 E | **Deferred Maintenance:** | $54,458 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 3,003 |
| **Building Code:** | R2900202720 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $606,736 |
| **Building Name:** | International Falls Office | **Address:** | 392 HWY 11 E | **Deferred Maintenance:** | $156,581 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 3,045 |
| **Building Code:** | R2900203720 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,650 |
| **Building Name:** | International Falls Oil House | **Address:** | 392 HWY 11 E | **Deferred Maintenance:** | $6,096 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900207550 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $212,083 |
| **Building Name:** | International Falls Modular Off | **Address:** | 392 HWY 11 E | **Deferred Maintenance:** | $36,591 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 984 |
| **Building Code:** | R2900209480 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,657 |
| **Building Name:** | International Falls Storage Shed | **Address:** | 392 HWY 11 E | **Deferred Maintenance:** | $5,213 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 200 |

### *Site: R290147 - Iron Range OHVRA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208310 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $306,288 |
| **Building Name:** | Iron Range OHVRA Contact Sta | **Address:** | 7196 PETTIT RD | **Deferred Maintenance:** | $41,012 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | GILBERT | **Ext. Gross Area:** | 1,104 |
| **Building Code:** | R2900208320 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $273,866 |
| **Building Name:** | Iron Range OHVRA Cold Storage | **Address:** | 7196 PETTIT RD | **Deferred Maintenance:** | $5,750 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GILBERT | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | R2900208330 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $320,424 |
| **Building Name:** | Iron Range OHVRA Office | **Address:** | 7196 PETTIT RD | **Deferred Maintenance:** | $27,104 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GILBERT | **Ext. Gross Area:** | 1,169 |
| **Building Code:** | R2900208500 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $121,502 |
| **Building Name:** | Iron Range OHVRA Wash Building | **Address:** | 7196 PETTIT RD | **Deferred Maintenance:** | $9,311 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GILBERT | **Ext. Gross Area:** | 1,840 |
| **Building Code:** | R2900208570 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,719 |
| **Building Name:** | Iron Range OHVRA Pump House | **Address:** | 7196 PETTIT RD | **Deferred Maintenance:** | $747 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | GILBERT | **Ext. Gross Area:** | 64 |

### *Site: R290149 - Lewiston*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501820 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $398,519 |
| **Building Name:** | Lewiston Office | **Address:** | Hwy 14 & Fremont St | **Deferred Maintenance:** | $77,357 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LEWISTON | **Ext. Gross Area:** | 2,384 |
| **Building Code:** | R2900501970 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $36,662 |
| **Building Name:** | Lewiston Oil House | **Address:** | Hwy 14 & Fremont St | **Deferred Maintenance:** | $11,534 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LEWISTON | **Ext. Gross Area:** | 216 |

### *Site: R290151 - Baudette Fairgrounds*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103830 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $82,610 |
| **Building Name:** | Baudette Fairgrnd Interp Unoccupied | **Address:** | FAIRGOUNDS | **Deferred Maintenance:** | $10,478 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 355 |

### *Site: R290152 - Brainerd-Crow Wing County Airport*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306740 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $44,648 |
| **Building Name:** | Brainerd Airport Shed | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $4,013 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 204 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306750 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $280,691 |
| **Building Name:** | Brainerd Airport Office | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $31,126 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 1,727 |
| **Building Code:** | R2900308370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,471 |
| **Building Name:** | Brainerd Airport Cold Storage | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $865 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BRAINERD | **Ext. Gross Area:** | 42 |
| **Building Code:** | R2900308380 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,282 |
| **Building Name:** | Brainerd Airport Cold Storage 2 | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $1,893 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 128 |
| **Building Code:** | R2900308390 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $32,022 |
| **Building Name:** | Brainerd Airport Cold Storage 3 | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $741 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BRAINERD | **Ext. Gross Area:** | 128 |
| **Building Code:** | R2900308400 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,979 |
| **Building Name:** | Brainerd Airport Cold Storage 4 | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $1,132 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | BRAINERD | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900308410 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,023 |
| **Building Name:** | Brainerd Airport Cold Storage 5 | **Address:** | 12834 HWY 210 E | **Deferred Maintenance:** | $1,459 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 120 |

### *Site: R290154 - Foot Hills State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900301160 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,305 |
| **Building Name:** | Foot Hills Spider Lake Vault Toilet | **Address:** | Spider Lake Rec. Area | **Deferred Maintenance:** | $1,115 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 38 |
| **Building Code:** | R2900301420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,305 |
| **Building Name:** | Foot Hills Spider Lake Vault Toilet | **Address:** | Spider Lake Rec. Area | **Deferred Maintenance:** | $1,115 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 38 |

### *Site: R290155 - Chisholm-Hibbing Airport*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207680 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $386,900 |
| **Building Name:** | Hibbing Airport Main Office | **Address:** | 10956 HWY 37 | **Deferred Maintenance:** | $49,326 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 1,717 |
| **Building Code:** | R2900208400 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $70,268 |
| **Building Name:** | Hibbing Airport Spring House | **Address:** | 10956 HWY 37 | **Deferred Maintenance:** | $1,405 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HIBBING | **Ext. Gross Area:** | 432 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209030 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $183,639 |
| **Building Name:** | Hibbing Airport Dispatch Office | **Address:** | 10956 HWY 37 | **Deferred Maintenance:** | $13,993 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 840 |

### *Site: R290156 - Hibbing Forestry*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201550 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $478,784 |
| **Building Name:** | Hibbing Forestry Office | **Address:** | 1208 E HOWARD ST | **Deferred Maintenance:** | $122,729 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HIBBING | **Ext. Gross Area:** | 2,447 |
| **Building Code:** | R2900201570 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $362,028 |
| **Building Name:** | Hibbing Forestry Shop | **Address:** | 1208 E HOWARD ST | **Deferred Maintenance:** | $95,456 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HIBBING | **Ext. Gross Area:** | 2,460 |
| **Building Code:** | R2900201590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $190,058 |
| **Building Name:** | Hibbing Forestry Cold Storage | **Address:** | 1208 E HOWARD ST | **Deferred Maintenance:** | $49,781 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | HIBBING | **Ext. Gross Area:** | 1,040 |
| **Building Code:** | R2900204280 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,752 |
| **Building Name:** | Hibbing Forestry Oil House | **Address:** | 1208 E HOWARD ST | **Deferred Maintenance:** | $1,718 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900209900 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $326,063 |
| **Building Name:** | Hibbing Forestry Fire Truck Storage | **Address:** | 1208 E HOWARD ST | **Deferred Maintenance:** | $6,521 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HIBBING | **Ext. Gross Area:** | 2,992 |

### *Site: R290157 - Munson Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104540 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,119 |
| **Building Name:** | Munson Lake Spring House | **Address:** | 14583 CTY HWY 19 | **Deferred Maintenance:** | $15,117 |
| **Facility Condition Index:** | 0.83 - Crisis | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 128 |

### *Site: R290158 - Littlefork*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202670 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $632,223 |
| **Building Name:** | Littlefork Office | **Address:** | 421 3RD AVE | **Deferred Maintenance:** | $134,736 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 3,436 |
| **Building Code:** | R2900202680 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $43,983 |
| **Building Name:** | Littlefork Oil House | **Address:** | 421 3RD AVE | **Deferred Maintenance:** | $4,398 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 168 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202690 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $262,009 |
| **Building Name:** | Littlefork Cold Storage | **Address:** | 421 3RD AVE | **Deferred Maintenance:** | $62,556 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 1,300 |
| **Building Code:** | R2900202700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $449,538 |
| **Building Name:** | Littlefork Heat/Cold Storage | **Address:** | 421 3RD AVE | **Deferred Maintenance:** | $144,003 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 1,345 |
| **Building Code:** | R2900204300 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $321,485 |
| **Building Name:** | Littlefork Shop | **Address:** | 421 3RD AVE | **Deferred Maintenance:** | $34,970 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 2,237 |

### *Site: R290160 - McGrath*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303950 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $374,526 |
| **Building Name:** | McGrath Shop | **Address:** | 16082 STATE HWY 65 | **Deferred Maintenance:** | $97,623 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | MCGRATH | **Ext. Gross Area:** | 1,860 |
| **Building Code:** | R2900303960 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $319,622 |
| **Building Name:** | McGrath Office | **Address:** | 16082 STATE HWY 65 | **Deferred Maintenance:** | $76,466 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | MCGRATH | **Ext. Gross Area:** | 2,141 |
| **Building Code:** | R2900304110 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,882 |
| **Building Name:** | McGrath Oil House | **Address:** | 16082 STATE HWY 65 | **Deferred Maintenance:** | $2,401 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | MCGRATH | **Ext. Gross Area:** | 96 |

### *Site: R290161 - Otter Tail Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900102750 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $65,874 |
| **Building Name:** | Otter Tail Lk Pleasure Park Storage | **Address:** | 42911 Pleasure Park Rd., Ottertail M | **Deferred Maintenance:** | $8,484 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 644 |

### *Site: R290162 - Dead River-Walker Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101110 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $716,065 |
| **Building Name:** | Dead River-Walker Lake Hatchery | **Address:** | 32870 HWY 14 | **Deferred Maintenance:** | $93,496 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | RICHVILLE | **Ext. Gross Area:** | 1,787 |
| **Building Code:** | R2900104630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,715 |
| **Building Name:** | Dead River-Walker Lake Garage | **Address:** | 32870 CO HWY 14 | **Deferred Maintenance:** | $6,741 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | RICHVILLE | **Ext. Gross Area:** | 583 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107020 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $102,450 |
| **Building Name:** | Dead River-Walker Lake Cold Storage | **Address:** | 32870 CO HWY 14 | **Deferred Maintenance:** | $10,245 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RICHVILLE | **Ext. Gross Area:** | 1,179 |

### *Site: R290163 - Birchdale*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101120 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,426 |
| **Building Name:** | Birchdale Fire Tower | **Address:** | HWY 11 BIRCHDALE | **Deferred Maintenance:** | $289 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900103940 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $336,039 |
| **Building Name:** | Birchdale Office | **Address:** | HWY 11 BIRCHDALE | **Deferred Maintenance:** | $53,522 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 3,618 |
| **Building Code:** | R2900104250 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,057 |
| **Building Name:** | Birchdale Oil House | **Address:** | HWY 11 BIRCHDALE | **Deferred Maintenance:** | $4,035 |
| **Facility Condition Index:** | 0.67 - Crisis | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 60 |

### *Site: R290164 - Lake of the Woods State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105570 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $8,468 |
| **Building Name:** | LOTW SF Rapid River Fire Tower | **Address:** | RAPID RIVER | **Deferred Maintenance:** | $2,794 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 36 |

### *Site: R290165 - Smoky Hills State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105600 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $13,548 |
| **Building Name:** | Smoky Hills SF Fire Tower | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $4,471 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 176 |

### *Site: R290166 - Two Inlets State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107380 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Two Inlets SF Hungryman CG Vault | **Address:** | 36750 MAIN PARK DRIVE | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900107390 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,788 |
| **Building Name:** | Two Inlets SF Hungryman CG S2 Vault | **Address:** | 36750 MAIN PARK DRIVE | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 35 |
| **Building Code:** | R2900107400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $14,834 |
| **Building Name:** | Two Inlets SF Hungrymn CG S11 Vault | **Address:** | 36750 MAIN PARK DRIVE | **Deferred Maintenance:** | $2,311 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 48 |

### *Site: R290167 - Park Rapids Area*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100030 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $518,258 |
| **Building Name:** | Park Rapids Wildlife Office | **Address:** | 603 1ST ST W | **Deferred Maintenance:** | $105,095 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,593 |
| **Building Code:** | R2900103510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $453,893 |
| **Building Name:** | Park Rapids Forestry Office | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $100,621 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,416 |
| **Building Code:** | R2900103520 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $140,896 |
| **Building Name:** | Park Rapids Second Garage | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $27,850 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,367 |
| **Building Code:** | R2900103530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $219,085 |
| **Building Name:** | Park Rapids First Garage | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $45,916 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,622 |
| **Building Code:** | R2900103540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $105,343 |
| **Building Name:** | Park Rapids Ice House | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $24,535 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,062 |
| **Building Code:** | R2900103550 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $75,775 |
| **Building Name:** | Park Rapids Oil House | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $7,855 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 195 |
| **Building Code:** | R2900103570 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $34,104 |
| **Building Name:** | Park Rapids 1-Stall Garage | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $11,254 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 306 |
| **Building Code:** | R2900103580 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $514,049 |
| **Building Name:** | Park Rapids Forestry Shop | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $95,276 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,027 |
| **Building Code:** | R2900104560 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,474 |
| **Building Name:** | Park Rapids Trails Shed | **Address:** | 115 BUNYAN TRAILS DR | **Deferred Maintenance:** | $3,502 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEVIS | **Ext. Gross Area:** | 144 |
| **Building Code:** | R2900106160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,844 |
| **Building Name:** | Park Rapids Deer Hunters Assn | **Address:** | 607 W 1ST ST | **Deferred Maintenance:** | $13,057 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 646 |
| **Building Code:** | R2900106730 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,157 |
| **Building Name:** | Park Rapids Trails Shed 2 | **Address:** | 603 W 1ST | **Deferred Maintenance:** | $3,404 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 96 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900107250 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $286,635 |
| **Building Name:** | Park Rapids Wildlife Metal Building | **Address:** | 603 1ST ST W | **Deferred Maintenance:** | $28,663 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,562 |
| **Building Code:** | R2900109440 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,561 |
| **Building Name:** | Park Rapids Trails Shed | **Address:** | 603 1ST ST W | **Deferred Maintenance:** | $956 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 120 |

### *Site: R290168 - Whitewater WMA Crystal Springs*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502140 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $66,949 |
| **Building Name:** | Whitewater WMA Spring House | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $2,596 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,656 |
| **Building Code:** | R2900503240 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $298,094 |
| **Building Name:** | Whitewater WMA Raceway Shelter 4 | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $62,930 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 3,192 |
| **Building Code:** | R2900503250 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $298,094 |
| **Building Name:** | Whitewater WMA Raceway Shelter 6 | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $58,004 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 3,192 |
| **Building Code:** | R2900503260 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $298,094 |
| **Building Name:** | Whitewater WMA Raceway Shelter 8 | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $54,898 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 3,192 |
| **Building Code:** | R2900503270 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $339,765 |
| **Building Name:** | Whitewater WMA Raceway Shelter 9 | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $61,983 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ALTURA | **Ext. Gross Area:** | 3,192 |
| **Building Code:** | R2900503280 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $541,765 |
| **Building Name:** | Whitewater WMA Raceway Shelter 2 | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $58,313 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 6,300 |
| **Building Code:** | R2900503290 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $116,701 |
| **Building Name:** | Whitewater WMA Raceway Shelter 12 | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $55,412 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,500 |
| **Building Code:** | R2900503720 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $1,574,206 |
| **Building Name:** | WW WMA Crystal Springs Fish Hatchry | **Address:** | 14674 Crystal Springs Drive | **Deferred Maintenance:** | $207,752 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 8,102 |
| **Building Code:** | R2900504150 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $672,891 |
| **Building Name:** | Whitewater WMA Intermediate Hatchry | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $93,509 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ALTURA | **Ext. Gross Area:** | 6,006 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505530 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $592,293 |
| **Building Name:** | Whitewater WMA Residence | **Address:** | 14672 CO RD 112 | **Deferred Maintenance:** | $11,846 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 1,900 |
| **Building Code:** | R2900505610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $22,986 |
| **Building Name:** | Whitewater WMA Cold Storage | **Address:** | 14674 CO RD 112 | **Deferred Maintenance:** | $460 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALTURA | **Ext. Gross Area:** | 100 |

### *Site: R290169 - Woman Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900106410 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $88,984 |
| **Building Name:** | Woman Lake Bungey Bay Heated Stor | **Address:** | 07316 STATE 371 NW | **Deferred Maintenance:** | $14,967 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WALKER | **Ext. Gross Area:** | 520 |

### *Site: R290170 - Walker*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103370 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $378,735 |
| **Building Name:** | Walker Office | **Address:** | 7316 STATE 371 NW | **Deferred Maintenance:** | $109,000 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | WALKER | **Ext. Gross Area:** | 2,019 |
| **Building Code:** | R2900104660 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,356 |
| **Building Name:** | Walker Cold Storage Shed | **Address:** | 07316 STATE 371 NW | **Deferred Maintenance:** | $3,195 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | WALKER | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900105220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $206,331 |
| **Building Name:** | Walker Cold Storage | **Address:** | 07316 STATE 371 NW | **Deferred Maintenance:** | $20,633 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WALKER | **Ext. Gross Area:** | 2,340 |

### *Site: R290171 - Longville Fire Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305600 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $7,642 |
| **Building Name:** | Longville Fire Tower | **Address:** | LONGVILLE | **Deferred Maintenance:** | $2,522 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BRAINERD | **Ext. Gross Area:** | 64 |

### *Site: R290172 - Linder Fire Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105680 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $8,115 |
| **Building Name:** | Linder Fire Tower | **Address:** | LINDER | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | GRYGLA | **Ext. Gross Area:** | 36 |

### *Site: R290173 - Lawson Fire Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105480 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $8,115 |
| **Building Name:** | Lawson Fire Tower | **Address:** | LAWSON | **Deferred Maintenance:** | $2,678 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WANNASKA | **Ext. Gross Area:** | 64 |

### *Site: R290174 - Prosper Fire Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105560 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $8,468 |
| **Building Name:** | Prosper Fire Tower | **Address:** | PROSPER | **Deferred Maintenance:** | $2,794 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WILLIAMS | **Ext. Gross Area:** | 36 |

### *Site: R290175 - Moose Lake City*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300300 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $510,613 |
| **Building Name:** | Moose Lake City Shop | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $146,095 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 2,952 |
| **Building Code:** | R2900300310 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $626,769 |
| **Building Name:** | Moose Lake City Office | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $136,024 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 4,386 |
| **Building Code:** | R2900304130 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $10,863 |
| **Building Name:** | Moose Lake City Oil House | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $1,264 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900304580 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,792 |
| **Building Name:** | Moose Lake City Oil House | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $2,626 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 160 |

### *Site: R290176 - Waskish*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101030 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,111,119 |
| **Building Name:** | Waskish Fish Hatchery | **Address:** | 55478 TAMARAC RIVER ACCESS | **Deferred Maintenance:** | $394,883 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | WASKISH | **Ext. Gross Area:** | 3,672 |
| **Building Code:** | R2900101040 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $315,350 |
| **Building Name:** | Waskish Garage | **Address:** | 55478 TAMARAC RIVER ACCESS | **Deferred Maintenance:** | $75,881 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | WASKISH | **Ext. Gross Area:** | 3,060 |
| **Building Code:** | R2900101070 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,168 |
| **Building Name:** | Waskish Cold Storage | **Address:** | 55478 TAMARAC RIVER ACCESS | **Deferred Maintenance:** | $14,578 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | WASKISH | **Ext. Gross Area:** | 192 |

### *Site: R290177 - Bemidji-Beltrami County Airport*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900104510 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,168 |
| **Building Name:** | Bemidji Airport Cold Storage | **Address:** | 2823 GILLETT DR NW | **Deferred Maintenance:** | $3,651 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900106180 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $516,854 |
| **Building Name:** | Bemidji Airport Office | **Address:** | 3219 GILLETT NW | **Deferred Maintenance:** | $51,685 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | R2900106560 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,993 |
| **Building Name:** | Bemidji Airport Cold Storage | **Address:** | 2823 GILLETT DR NW | **Deferred Maintenance:** | $5,608 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 195 |
| **Building Code:** | R2900108590 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,957 |
| **Building Name:** | Bemidji Airport Cold Storage | **Address:** | 2823 GILLETT DR NW | **Deferred Maintenance:** | $6,256 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 122 |
| **Building Code:** | R2900109500 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $57,079 |
| **Building Name:** | Bemidji Airport Cold Storage Shed | **Address:** | 2823 GILLETT DR NW | **Deferred Maintenance:** | $1,142 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 320 |

### *Site: R290178 - Mora*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300340 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $341,717 |
| **Building Name:** | Mora Office | **Address:** | 460 W MAPLE | **Deferred Maintenance:** | $87,232 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | MORA | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900300350 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $161,571 |
| **Building Name:** | Mora Cold Storage | **Address:** | 460 W MAPLE | **Deferred Maintenance:** | $45,965 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | MORA | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900304190 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,272 |
| **Building Name:** | Mora Oil House | **Address:** | 460 W MAPLE | **Deferred Maintenance:** | $2,215 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | MORA | **Ext. Gross Area:** | 96 |

### *Site: R290179 - Big Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202770 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $211,913 |
| **Building Name:** | Big Falls Cold Storage | **Address:** | 7754 TOWN RD 293 | **Deferred Maintenance:** | $20,974 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 2,309 |
| **Building Code:** | R2900202780 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $24,829 |
| **Building Name:** | Big Falls Garage | **Address:** | 7754 TOWN RD 293 | **Deferred Maintenance:** | $1,468 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 600 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202800 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $301,311 |
| **Building Name:** | Big Falls Cold Storage | **Address:** | 7754 TOWN RD 293 | **Deferred Maintenance:** | $63,383 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 1,747 |
| **Building Code:** | R2900202810 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $369,987 |
| **Building Name:** | Big Falls Office | **Address:** | 7754 TOWN RD 293 | **Deferred Maintenance:** | $79,716 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 1,651 |
| **Building Code:** | R2900203790 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,650 |
| **Building Name:** | Big Falls Oil House | **Address:** | 7754 TOWN RD 293 | **Deferred Maintenance:** | $3,127 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900209490 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $2,680 |
| **Building Name:** | Big Falls Vault Toilet | **Address:** | 7754 TOWN RD 293 | **Deferred Maintenance:** | $1,912 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 17 |

### *Site: R290180 - Big Fork River*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,199 |
| **Building Name:** | Big Fork R Johnson's Lnd Vault Toil | **Address:** | CO RD VT 83 | **Deferred Maintenance:** | $2,548 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,199 |
| **Building Name:** | Big Fork R Sturgeon R Vault Toilet | **Address:** | STATE FOREST RD 0852 | **Deferred Maintenance:** | $1,634 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900206470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,199 |
| **Building Name:** | Big Fork R Benn Lynn Vault Toilet | **Address:** | STATE FOREST RD 0948 | **Deferred Maintenance:** | $1,634 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 30 |

### *Site: R290181 - Cloquet*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200080 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $248,527 |
| **Building Name:** | Cloquet Wildlife Cold Storage | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $24,853 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CLOQUET | **Ext. Gross Area:** | 2,232 |
| **Building Code:** | R2900202510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $710,077 |
| **Building Name:** | Cloquet Office | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $154,386 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | CLOQUET | **Ext. Gross Area:** | 3,600 |
| **Building Code:** | R2900202520 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $390,263 |
| **Building Name:** | Cloquet Shop | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $98,830 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | CLOQUET | **Ext. Gross Area:** | 2,428 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $127,299 |
| **Building Name:** | Cloquet Cold Storage | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $66,801 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | CLOQUET | **Ext. Gross Area:** | 1,223 |
| **Building Code:** | R2900202540 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,684 |
| **Building Name:** | Cloquet Oil House | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $9,575 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CLOQUET | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900206920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $124,942 |
| **Building Name:** | Cloquet STS Cold Storage | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $21,099 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CLOQUET | **Ext. Gross Area:** | 1,753 |
| **Building Code:** | R2900210170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,766 |
| **Building Name:** | Cloquet Sign Storage | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $6,856 |
| **Facility Condition Index:** | 0.50 - Poor | **City Code:** | CLOQUET | **Ext. Gross Area:** | 87 |
| **Building Code:** | R2900210180 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $18,029 |
| **Building Name:** | Cloquet Smoking Shelter | **Address:** | 1604 S HWY 33 | **Deferred Maintenance:** | $1,803 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | CLOQUET | **Ext. Gross Area:** | 230 |

### *Site: R290182 - Effie*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201730 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $294,533 |
| **Building Name:** | Effie East Garage Cold Storage | **Address:** | 205 1/2 SE HWY 1 | **Deferred Maintenance:** | $28,159 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EFFIE | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | R2900201830 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $424,136 |
| **Building Name:** | Effie Main Office | **Address:** | 205 1/2 SE HWY 1 | **Deferred Maintenance:** | $84,863 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | EFFIE | **Ext. Gross Area:** | 2,197 |
| **Building Code:** | R2900201840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,310 |
| **Building Name:** | Effie Oil House | **Address:** | 205 1/2 SE HWY 1 | **Deferred Maintenance:** | $2,385 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | EFFIE | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900201850 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $44,724 |
| **Building Name:** | Effie South Garage | **Address:** | 205 1/2 SE HWY 1 | **Deferred Maintenance:** | $23,771 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | EFFIE | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900201870 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $222,380 |
| **Building Name:** | Effie West Garage Shop | **Address:** | 205 1/2 SE HWY 1 | **Deferred Maintenance:** | $49,945 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | EFFIE | **Ext. Gross Area:** | 1,920 |
| **Building Code:** | R2900207510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $118,077 |
| **Building Name:** | Effie Modular Office | **Address:** | 205 1/2 SE HWY 1 | **Deferred Maintenance:** | $13,180 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | EFFIE | **Ext. Gross Area:** | 588 |

### *Site: R290183 - Madelia WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402400 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $276,938 |
| **Building Name:** | Madelia WMA Cold Storage Barn | **Address:** | 35365 800TH AVE | **Deferred Maintenance:** | $120,630 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | MADELIA | **Ext. Gross Area:** | 1,920 |
| **Building Code:** | R2900402410 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $1,706,820 |
| **Building Name:** | Madelia WMA Office | **Address:** | 35365 800TH AVE | **Deferred Maintenance:** | $271,497 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MADELIA | **Ext. Gross Area:** | 9,653 |
| **Building Code:** | R2900402430 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $313,124 |
| **Building Name:** | Madelia WMA Cold Storage | **Address:** | 35365 800TH AVE | **Deferred Maintenance:** | $103,331 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MADELIA | **Ext. Gross Area:** | 2,160 |
| **Building Code:** | R2900402480 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $37,966 |
| **Building Name:** | Madelia WMA Cold Storage by Barn | **Address:** | 35365 800TH AVE | **Deferred Maintenance:** | $13,148 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | MADELIA | **Ext. Gross Area:** | 160 |

### *Site: R290184 - Mille Lacs WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300650 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $181,300 |
| **Building Name:** | Mille Lacs WMA Cold Storage Barn | **Address:** | 29172 100TH AVE | **Deferred Maintenance:** | $127,229 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | ONAMIA | **Ext. Gross Area:** | 2,010 |
| **Building Code:** | R2900300670 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $808,812 |
| **Building Name:** | Mille Lacs WMA Office/Shop | **Address:** | 29172 100TH AVE | **Deferred Maintenance:** | $231,490 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 4,502 |
| **Building Code:** | R2900300700 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $247,987 |
| **Building Name:** | Mille Lacs WMA Cold Storage | **Address:** | 29172 100TH AVE | **Deferred Maintenance:** | $156,923 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | ONAMIA | **Ext. Gross Area:** | 2,312 |

### *Site: R290185 - New London*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $806,602 |
| **Building Name:** | New London Office | **Address:** | 500 1st Ave NW, Box 508 | **Deferred Maintenance:** | $113,373 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 4,704 |

### *Site: R290186 - Woodland WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300770 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $281,775 |
| **Building Name:** | Woodland WMA Montrose Shop | **Address:** | 7372 STATE HWY 25 SW | **Deferred Maintenance:** | $137,849 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | MONTROSE | **Ext. Gross Area:** | 2,400 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300790 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $304,268 |
| **Building Name:** | Woodland WMA Montrose Cold Storage | **Address:** | 7372 STATE HWY 25 SW | **Deferred Maintenance:** | $111,065 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | MONTROSE | **Ext. Gross Area:** | 3,000 |
| **Building Code:** | R2900300800 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $202,019 |
| **Building Name:** | Woodland WMA Montrose Office | **Address:** | 7372 STATE HWY 25 SW | **Deferred Maintenance:** | $71,213 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | MONTROSE | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900303200 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $61,659 |
| **Building Name:** | Woodland WMA Montrose Shed | **Address:** | 7372 STATE HWY 25 SW | **Deferred Maintenance:** | $38,631 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | MONTROSE | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | R2900303580 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,705 |
| **Building Name:** | Woodland WMA Montrose Pump House | **Address:** | 7372 STATE HWY 25 SW | **Deferred Maintenance:** | $15,320 |
| **Facility Condition Index:** | 0.52 - Crisis | **City Code:** | MONTROSE | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900304140 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,587 |
| **Building Name:** | Woodland WMA Montrose Oil House | **Address:** | 7372 STATE HWY 25 SW | **Deferred Maintenance:** | $3,854 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MONTROSE | **Ext. Gross Area:** | 96 |

### *Site: R290187 - Nickerson*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300330 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $359,785 |
| **Building Name:** | Nickerson Cold Storage | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $204,507 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 2,064 |
| **Building Code:** | R2900305570 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $10,183 |
| **Building Name:** | Nickerson Fire Tower | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $7,201 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 64 |

### *Site: R290188 - Nicollet*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $428,164 |
| **Building Name:** | Nicollet Cold Storage | **Address:** | 501 9TH ST | **Deferred Maintenance:** | $169,982 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | NICOLLET | **Ext. Gross Area:** | 3,212 |

### *Site: R290189 - Ortonville*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900405470 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,195 |
| **Building Name:** | Ortonville Shed | **Address:** | 811 PINE AVE | **Deferred Maintenance:** | $404 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 160 |

### *Site: R290190 - Orr*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900202870 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $395,549 |
| **Building Name:** | Orr Main Office | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $93,901 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 2,429 |
| **Building Code:** | R2900202880 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $114,202 |
| **Building Name:** | Orr 1-Stall FOR Garage | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $27,419 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900202890 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $18,559 |
| **Building Name:** | Orr Oil House | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $5,200 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900202900 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $166,157 |
| **Building Name:** | Orr Shop | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $17,540 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ORR | **Ext. Gross Area:** | 1,040 |
| **Building Code:** | R2900202910 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,606 |
| **Building Name:** | Orr Pine Cone Storage | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $5,035 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | ORR | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900202930 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $47,164 |
| **Building Name:** | Orr 1-Stall FOR Garage | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $13,310 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900202940 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $384,374 |
| **Building Name:** | Orr 5-Stall Garage | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $66,050 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 1,920 |
| **Building Code:** | R2900202950 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $378,294 |
| **Building Name:** | Orr Hilltop Office | **Address:** | 4656 HWY 53 | **Deferred Maintenance:** | $65,378 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 2,121 |
| **Building Code:** | R2900203340 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $51,261 |
| **Building Name:** | Orr 2-Stall Garage | **Address:** | | **Deferred Maintenance:** | $4,347 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ORR | **Ext. Gross Area:** | 624 |
| **Building Code:** | R2900204260 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $12,394 |
| **Building Name:** | Orr 1-Stall ENF Garage | **Address:** | | **Deferred Maintenance:** | $2,135 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ORR | **Ext. Gross Area:** | 264 |

### *Site: R290191 - Pelican Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305220 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $50,558 |
| **Building Name:** | Pelican Lake Beach Day-Use Area San | **Address:** | 30483 STATE HWY 371 | **Deferred Maintenance:** | $10,598 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PEQUOT LAKES | **Ext. Gross Area:** | 288 |

### *Site: R290192 - Pequot Fire Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305310 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $10,183 |
| **Building Name:** | Pequot Fire Tower | **Address:** | 30483 STATE HWY 371 | **Deferred Maintenance:** | $7,201 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | PEQUOT LAKES | **Ext. Gross Area:** | 64 |

### *Site: R290194 - Peterson Hatchery*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502160 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $1,284,572 |
| **Building Name:** | Peterson Hatchery Office/Residence | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $218,229 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PETERSON | **Ext. Gross Area:** | 7,347 |
| **Building Code:** | R2900502170 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $317,474 |
| **Building Name:** | Peterson Hatchery Shop | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $53,482 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PETERSON | **Ext. Gross Area:** | 2,496 |
| **Building Code:** | R2900502200 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $134,127 |
| **Building Name:** | Peterson Hatchery Raceway Shel W1-3 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $17,862 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PETERSON | **Ext. Gross Area:** | 1,280 |
| **Building Code:** | R2900502210 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $269,912 |
| **Building Name:** | Peterson Hatchery Raceway Shel W8-9 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $23,877 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PETERSON | **Ext. Gross Area:** | 2,560 |
| **Building Code:** | R2900502250 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $63,463 |
| **Building Name:** | Peterson Hatchery Cold Storage W7 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $5,758 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PETERSON | **Ext. Gross Area:** | 704 |
| **Building Code:** | R2900504050 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $12,131 |
| **Building Name:** | Peterson Hatchery Raceway Shel 20-1 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PETERSON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900504060 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $12,131 |
| **Building Name:** | Peterson Hatchery Raceway Shel 20-2 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PETERSON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900504070 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $12,131 |
| **Building Name:** | Peterson Hatchery Raceway Shel 20-3 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PETERSON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900504080 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $12,131 |
| **Building Name:** | Peterson Hatchery Raceway Shel 20-4 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PETERSON | **Ext. Gross Area:** | 314 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504090 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $12,131 |
| **Building Name:** | Peterson Hatchery Raceway Shel 20-5 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PETERSON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900504100 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $12,131 |
| **Building Name:** | Peterson Hatchery Raceway Shel 20-6 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | PETERSON | **Ext. Gross Area:** | 314 |
| **Building Code:** | R2900504110 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatch Raceway Shel 30-1-3 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900504120 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatch Raceway Shel 30-4-6 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900504130 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 7 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 2,421 |
| **Building Code:** | R2900504760 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,032,249 |
| **Building Name:** | Peterson Main Fish Hatchery | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $74,796 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | PETERSON | **Ext. Gross Area:** | 5,513 |
| **Building Code:** | R2900505080 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $54,330 |
| **Building Name:** | Peterson Hatchery Vault Concrete | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $5,433 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PETERSON | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900505300 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 2 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900505310 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 5 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900505320 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 8 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900505330 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 3 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505340 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 6 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900505350 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $27,277 |
| **Building Name:** | Peterson Hatchery Raceway Shelter 9 | **Address:** | 28376 CO RD S | **Deferred Maintenance:** | $9,001 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | PETERSON | **Ext. Gross Area:** | 706 |
| **Building Code:** | R2900505840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,095 |
| **Building Name:** | Peterson Hatchery Shed | **Address:** | 28376 CO HWY 25 | **Deferred Maintenance:** | $302 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | RUSHFORD VILLAGE | **Ext. Gross Area:** | 128 |

### *Site: R290196 - Grand Rapids Resource Assessment*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207560 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $3,753,010 |
| **Building Name:** | Grand Rapids Res Assesmt Office | **Address:** | 483 PETERSON RD | **Deferred Maintenance:** | $426,256 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 19,340 |
| **Building Code:** | R2900208340 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $71,760 |
| **Building Name:** | Grand Rapids Res Asses Cold Storage | **Address:** | 483 PETERSON RD | **Deferred Maintenance:** | $5,399 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 847 |

### *Site: R290197 - R4 HQ New Ulm*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900400010 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,995,542 |
| **Building Name:** | New Ulm R4 HQ Office | **Address:** | 21371 STATE HWY 15 | **Deferred Maintenance:** | $1,112,800 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 16,550 |
| **Building Code:** | R2900402980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,064,062 |
| **Building Name:** | New Ulm R4 HQ Shop | **Address:** | 21371 STATE HWY 15 | **Deferred Maintenance:** | $222,979 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | NEW ULM | **Ext. Gross Area:** | 5,808 |
| **Building Code:** | R2900402990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $280,944 |
| **Building Name:** | New Ulm R4 HQ Cold Storage | **Address:** | 21371 STATE HWY 15 | **Deferred Maintenance:** | $86,226 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 2,728 |
| **Building Code:** | R2900403780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $94,354 |
| **Building Name:** | New Ulm R4 HQ HazMat Storage | **Address:** | 21371 STATE HWY 15 | **Deferred Maintenance:** | $34,967 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | NEW ULM | **Ext. Gross Area:** | 209 |

### *Site: R290200 - Rochester*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500010 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,268,019 |
| **Building Name:** | Rochester Shop | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $816,203 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 8,890 |
| **Building Code:** | R2900500080 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $240,500 |
| **Building Name:** | Rochester Heated Storage Barn | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $46,420 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 1,128 |
| **Building Code:** | R2900502050 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $491,455 |
| **Building Name:** | Rochester Cold Storage | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $102,264 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 5,225 |
| **Building Code:** | R2900504740 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,823 |
| **Building Name:** | Rochester Cave Shed | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $2,912 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 108 |
| **Building Code:** | R2900505550 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $55,491 |
| **Building Name:** | Rochester HazMat Storage | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $1,110 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 207 |

### *Site: R290202 - Savanna State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303890 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $265,836 |
| **Building Name:** | Savanna SF Sandy Lake Shop | **Address:** | 49928 LAKE AVENUE | **Deferred Maintenance:** | $55,042 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 1,860 |
| **Building Code:** | R2900303900 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $400,968 |
| **Building Name:** | Savanna SF Sandy Lake Office | **Address:** | 49928 LAKE AVENUE | **Deferred Maintenance:** | $124,151 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 2,236 |
| **Building Code:** | R2900303920 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,283 |
| **Building Name:** | Savanna SF Sandy Lake Shed | **Address:** | 49928 LAKE AVENUE | **Deferred Maintenance:** | $3,393 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 92 |
| **Building Code:** | R2900304010 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,311 |
| **Building Name:** | Savanna SF Sandy Lake Oil House | **Address:** | 49928 LAKE AVENUE | **Deferred Maintenance:** | $509 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 96 |
| **Building Code:** | R2900305120 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $149,186 |
| **Building Name:** | Savanna SF Sandy Lake Cold Storage | **Address:** | 49928 LAKE AVENUE | **Deferred Maintenance:** | $5,384 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 1,764 |
| **Building Code:** | R2900305540 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $20,078 |
| **Building Name:** | Savanna SF Sandy Lake Fire Tower | **Address:** | 49928 LAKE AVENUE | **Deferred Maintenance:** | $2,008 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308450 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,713 |
| **Building Name:** | Savanna SF Hay Lk CG M Vault Concr | **Address:** | 64893 170TH PLACE | **Deferred Maintenance:** | $354 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900308460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,713 |
| **Building Name:** | Savanna SF Hay Lk CG W Vault Concr | **Address:** | 64893 170TH PLACE | **Deferred Maintenance:** | $354 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 33 |
| **Building Code:** | R2900308470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,176 |
| **Building Name:** | Savanna SF Hay Lk CG S4 Vault Concr | **Address:** | 64893 170TH PLACE | **Deferred Maintenance:** | $344 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 32 |
| **Building Code:** | R2900308480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $17,713 |
| **Building Name:** | Savanna SF HayLk CG S14 Vault Concr | **Address:** | 64893 170TH PLACE | **Deferred Maintenance:** | $354 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 33 |

### *Site: R290204 - Side Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $446,440 |
| **Building Name:** | Side Lake Shop | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $103,845 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 2,366 |
| **Building Code:** | R2900201650 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $562,817 |
| **Building Name:** | Side Lake Office | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $143,550 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 2,427 |
| **Building Code:** | R2900201660 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $87,859 |
| **Building Name:** | Side Lake Shed | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $13,368 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 1,320 |
| **Building Code:** | R2900201670 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $101,158 |
| **Building Name:** | Side Lake Garage | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $24,592 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900201680 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,134 |
| **Building Name:** | Side Lake Cold Storage | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $8,364 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 384 |
| **Building Code:** | R2900201690 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $21,922 |
| **Building Name:** | Side Lake Oil House | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $2,192 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900204230 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,191 |
| **Building Name:** | Side Lake Radio Shelter | **Address:** | 7711 HWY % | **Deferred Maintenance:** | $2,031 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 16 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207200 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $18,190 |
| **Building Name:** | Side Lake Fire Tower | **Address:** | 7711 HWY 5 | **Deferred Maintenance:** | $1,819 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SIDE LAKE | **Ext. Gross Area:** | 64 |

### *Site: R290206 - Albion WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307590 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $125,480 |
| **Building Name:** | Albion WMA Quonset | **Address:** | 940 INDUSTRIAL DR S #103 | **Deferred Maintenance:** | $76,694 |
| **Facility Condition Index:** | 0.61 - Crisis | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 2,100 |

### *Site: R290207 - Talcot Lake WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900402260 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $565,285 |
| **Building Name:** | Talcot Lake WMA Dormitory | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $162,029 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 2,660 |
| **Building Code:** | R2900402330 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $397,925 |
| **Building Name:** | Talcot Lake WMA Office | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $115,799 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 2,366 |
| **Building Code:** | R2900402340 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,254 |
| **Building Name:** | Talcot Lake WMA Cold Storage | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $3,537 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | DUNDEE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900402350 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $251,052 |
| **Building Name:** | Talcot Lake WMA Shop | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $74,238 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 1,680 |
| **Building Code:** | R2900402390 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $120,355 |
| **Building Name:** | Talcot Lake WMA In-Ground Cold Stor | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $39,717 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DUNDEE | **Ext. Gross Area:** | 640 |
| **Building Code:** | R2900402750 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $19,427 |
| **Building Name:** | Talcot Lake WMA Trailer Cold Stor | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $6,411 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DUNDEE | **Ext. Gross Area:** | 320 |
| **Building Code:** | R2900402760 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $15,231 |
| **Building Name:** | Talcot Lake WMA 1-Stall Cold Stor | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $4,183 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 336 |
| **Building Code:** | R2900403080 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $24,403 |
| **Building Name:** | Talcot Lake WMA Garage | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $2,440 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DUNDEE | **Ext. Gross Area:** | 384 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900403090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $273,828 |
| **Building Name:** | Talcot Lake WMA Cold Storage | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $90,363 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DUNDEE | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | R2900404010 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $330,514 |
| **Building Name:** | Talcot Lake WMA Cold Storage | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $109,070 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DUNDEE | **Ext. Gross Area:** | 3,600 |
| **Building Code:** | R2900404210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $7,349 |
| **Building Name:** | Talcot Lake WMA Vault Toilet | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $1,597 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 24 |
| **Building Code:** | R2900404460 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $128,192 |
| **Building Name:** | Talcot Lake WMA Cold Storage | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $2,564 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | DUNDEE | **Ext. Gross Area:** | 1,728 |
| **Building Code:** | R2900404530 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $249,612 |
| **Building Name:** | Talcot Lake WMA Bennett Shed | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $33,327 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | DUNDEE | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | R2900404540 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $264,411 |
| **Building Name:** | Talcot Lake WMA HQ Shed | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $5,288 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | DUNDEE | **Ext. Gross Area:** | 2,880 |
| **Building Code:** | R2900405040 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,043 |
| **Building Name:** | Talcot Lake WMA Shed | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $3,129 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900405050 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,106 |
| **Building Name:** | Talcot Lake WMA Shed | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $5,814 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | DUNDEE | **Ext. Gross Area:** | 192 |
| **Building Code:** | R2900405060 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,958 |
| **Building Name:** | Talcot Lake WMA Granary Storage | **Address:** | 40249 CO RD 7 | **Deferred Maintenance:** | $3,616 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DUNDEE | **Ext. Gross Area:** | 155 |

### *Site: R290208 - Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207720 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $2,349,456 |
| **Building Name:** | Tower Office | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $180,639 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | TOWER | **Ext. Gross Area:** | 10,590 |
| **Building Code:** | R2900207730 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $2,308,006 |
| **Building Name:** | Tower Heated Storage | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $94,637 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 10,430 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207740 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $765,290 |
| **Building Name:** | Tower Cold Storage Bldg A | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $20,506 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 7,794 |
| **Building Code:** | R2900207750 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $726,399 |
| **Building Name:** | Tower Cold Storage Bldg B | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $25,942 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 7,378 |
| **Building Code:** | R2900207760 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,556 |
| **Building Name:** | Tower HazMat Storage | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $2,656 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TOWER | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900208560 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $72,546 |
| **Building Name:** | Tower Refrigerated Storage | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $7,255 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TOWER | **Ext. Gross Area:** | 186 |
| **Building Code:** | R2900208820 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,909 |
| **Building Name:** | Tower Recycling Shed | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $644 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 140 |
| **Building Code:** | R2900210360 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $52,162 |
| **Building Name:** | Tower Wood Pellet Boiler Enclosure | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $1,043 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900210370 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $25,229 |
| **Building Name:** | Tower Wood Pellet Storage | **Address:** | 650 HWY 169 | **Deferred Maintenance:** | $505 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 196 |

### *Site: R290209 - Pike River Hatchery*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203620 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $531,164 |
| **Building Name:** | Pike River Fish Hatchery | **Address:** | 9380 ANGUS RD VERMILION LK T | **Deferred Maintenance:** | $80,366 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | TOWER | **Ext. Gross Area:** | 3,037 |
| **Building Code:** | R2900203730 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,578 |
| **Building Name:** | Pike River Hatchery Ice House | **Address:** | 9380 ANGUS RD VERMILION LK T | **Deferred Maintenance:** | $3,802 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | TOWER | **Ext. Gross Area:** | 98 |
| **Building Code:** | R2900208190 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $9,994 |
| **Building Name:** | Pike River Hatchery Vault Toilet | **Address:** | 9380 ANGUS RD VERMILION LK T | **Deferred Maintenance:** | $2,178 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | TOWER | **Ext. Gross Area:** | 30 |
| **Building Code:** | R2900208460 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,400 |
| **Building Name:** | Pike River Hatchery Cold Storage | **Address:** | 9380 ANGUS RD VERMILION LK T | **Deferred Maintenance:** | $1,352 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TOWER | **Ext. Gross Area:** | 578 |

### *Site: R290211 - Lake Vermilion*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203310 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $384,842 |
| **Building Name:** | Lake Vermillion Cook Boathouse | **Address:** | 2505 Pederson Landing | **Deferred Maintenance:** | $246,884 |
| **Facility Condition Index:** | 0.64 - Crisis | **City Code:** | COOK | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900207830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $3,272 |
| **Building Name:** | Lake Vermillion Peterson Vault | **Address:** | PEDERSON RD | **Deferred Maintenance:** | $2,116 |
| **Facility Condition Index:** | 0.65 - Crisis | **City Code:** | TOWER | **Ext. Gross Area:** | 36 |

### *Site: R290212 - Jasper Peak Fire Tower*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207150 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $13,097 |
| **Building Name:** | Jasper Peak Fire Tower | **Address:** | 5080 HWY169 | **Deferred Maintenance:** | $4,322 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | TOWER | **Ext. Gross Area:** | 64 |

### *Site: R290213 - Two Harbors*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207060 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,694,733 |
| **Building Name:** | Two Harbors Office | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $217,541 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 7,505 |
| **Building Code:** | R2900207070 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,309,673 |
| **Building Name:** | Two Harbors Heated Storage | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $188,674 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 4,284 |
| **Building Code:** | R2900207590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,072,624 |
| **Building Name:** | Two Harbors Cold Storage | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $176,711 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 9,296 |

### *Site: R290214 - Silver Bay Marina*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208240 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $683,653 |
| **Building Name:** | Silver Bay Marina Interp Center | **Address:** | 99 BEACH DR. | **Deferred Maintenance:** | $15,263 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 2,736 |
| **Building Code:** | R2900208250 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $327,870 |
| **Building Name:** | Silver Bay Marina Picnic Shelter 2 | **Address:** | 156 MARINA DRIVE | **Deferred Maintenance:** | $6,557 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 256 |
| **Building Code:** | R2900208410 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $5,125 |
| **Building Name:** | Silver Bay Marina Spring House | **Address:** | 156 MARINA DRIVE | **Deferred Maintenance:** | $785 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 16 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208860 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $7,589 |
| **Building Name:** | Silver Bay Marina Picnic Shelter 1 | **Address:** | 156 MARINA DRIVE | **Deferred Maintenance:** | $152 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 289 |
| **Building Code:** | R2900208900 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $42,240 |
| **Building Name:** | Silver Bay Marina Fish Cleaning Hse | **Address:** | 156 MARINA DRIVE | **Deferred Maintenance:** | $845 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 305 |
| **Building Code:** | R2900210330 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $64,140 |
| **Building Name:** | Silver Bay Marina Vault Concrete | **Address:** | 156 MARINA DRIVE | **Deferred Maintenance:** | $1,283 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 102 |

### *Site: R290215 - Knife River Marina*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208510 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $458,741 |
| **Building Name:** | Knife River Marina Shop | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $75,861 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 2,800 |
| **Building Code:** | R2900208520 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $118,408 |
| **Building Name:** | Knife River Marina Office | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $18,871 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 576 |
| **Building Code:** | R2900208530 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $306,140 |
| **Building Name:** | Knife River Marina Sanitation | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $75,143 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 864 |
| **Building Code:** | R2900208540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $97,904 |
| **Building Name:** | Knife River Marina Yacht Club Bldg | **Address:** | 1568 HWY 2 | **Deferred Maintenance:** | $21,568 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 660 |

### *Site: R290216 - McQuade Road Harbor*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208910 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $253,948 |
| **Building Name:** | McQuade Road Harbor Sanitation | **Address:** | 5107 McQUADE RD | **Deferred Maintenance:** | $19,264 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 640 |
| **Building Code:** | R2900209430 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,864 |
| **Building Name:** | McQuade Road Harbor Cold Storage | **Address:** | 5107 McQUADE RD | **Deferred Maintenance:** | $7,315 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 384 |

### *Site: R290218 - Winona*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500100 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,303 |
| **Building Name:** | Winona Boat House | **Address:** | | **Deferred Maintenance:** | $4,968 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WINONA | **Ext. Gross Area:** | 504 |

### *Site: R290219 - Wood-Rill SNA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $142,307 |
| **Building Name:** | Wood-Rill SNA Garage | **Address:** | 845 OLD LONG LAKE RD | **Deferred Maintenance:** | $37,062 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ORONO | **Ext. Gross Area:** | 1,440 |

### *Site: R290220 - Zimmerman*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $266,435 |
| **Building Name:** | Zimmerman Heated Storage | **Address:** | 12969 FREMONT AVE | **Deferred Maintenance:** | $94,768 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | ZIMMERMAN | **Ext. Gross Area:** | 1,860 |
| **Building Code:** | R2900300430 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $468,965 |
| **Building Name:** | Zimmerman Office | **Address:** | 12969 FREMONT AVE | **Deferred Maintenance:** | $269,415 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | ZIMMERMAN | **Ext. Gross Area:** | 2,296 |
| **Building Code:** | R2900303260 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $133,291 |
| **Building Name:** | Zimmerman Cold Storage | **Address:** | 12969 FREMONT AVE | **Deferred Maintenance:** | $70,905 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | ZIMMERMAN | **Ext. Gross Area:** | 1,260 |
| **Building Code:** | R2900304080 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,045 |
| **Building Name:** | Zimmerman Oil House | **Address:** | 12969 FREMONT AVE | **Deferred Maintenance:** | $2,862 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ZIMMERMAN | **Ext. Gross Area:** | 128 |
| **Building Code:** | R2900308510 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $110,023 |
| **Building Name:** | Zimmerman Fire Truck Storage | **Address:** | 12969 FREMONT AVE | **Deferred Maintenance:** | $2,200 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ZIMMERMAN | **Ext. Gross Area:** | 1,120 |

### *Site: R290222 - Douglas State Trail*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502460 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,835 |
| **Building Name:** | Douglas ST Co 4 Vault Concrete | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $14,126 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900502470 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,835 |
| **Building Name:** | Douglas ST Co 4 Vault Concrete | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $14,126 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 36 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502550 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $12,559 |
| **Building Name:** | Douglas ST Co 4 Adirondack | **Address:** | 2300 SILVER CREEK RD NE | **Deferred Maintenance:** | $2,405 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 126 |
| **Building Code:** | R2900504590 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $12,559 |
| **Building Name:** | Douglas ST Pine Island Adirondack | **Address:** | | **Deferred Maintenance:** | $2,276 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PINE ISLAND | **Ext. Gross Area:** | 128 |

### *Site: R290226 - Park Rapids Fisheries*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900101000 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $235,665 |
| **Building Name:** | Park Rapids Fisheries Hatchery | **Address:** | 301 S GROVE AVE | **Deferred Maintenance:** | $40,642 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,948 |
| **Building Code:** | R2900101010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $78,801 |
| **Building Name:** | Park Rapids Fisheries Garage | **Address:** | 301 S GROVE AVE | **Deferred Maintenance:** | $10,258 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 635 |
| **Building Code:** | R2900101020 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $655,723 |
| **Building Name:** | Park Rapids Fisheries Office | **Address:** | 301 S GROVE AVE | **Deferred Maintenance:** | $144,402 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 2,921 |

### *Site: R290227 - Bemidji Area Forestry*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103290 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $137,116 |
| **Building Name:** | Bemidji Area Forestry Cold Storage | **Address:** | 2220 BEMIDJI AVE | **Deferred Maintenance:** | $24,380 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,001 |
| **Building Code:** | R2900103300 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $99,897 |
| **Building Name:** | Bemidji Area Forestry Cold Storage | **Address:** | 2220 BEMIDJI AVE | **Deferred Maintenance:** | $17,631 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 890 |
| **Building Code:** | R2900103310 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $519,065 |
| **Building Name:** | Bemidji Area Forestry Office | **Address:** | 2220 BEMIDJI AVE | **Deferred Maintenance:** | $94,903 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,338 |
| **Building Code:** | R2900103320 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $479,144 |
| **Building Name:** | Bemidji Area Forestry Shop | **Address:** | 2220 BEMIDJI AVE | **Deferred Maintenance:** | $144,527 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 6,638 |

### *Site: R290230 - Carlos Avery WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600480 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $904,210 |
| **Building Name:** | Carlos Avery WMA Zodiac Shop | **Address:** | 18310 ZODIAC ST | **Deferred Maintenance:** | $227,271 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 5,600 |
| **Building Code:** | R2900600490 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $349,516 |
| **Building Name:** | Carlos Avery WMA Zodiac Residence | **Address:** | 18306 ZODIAC ST NE | **Deferred Maintenance:** | $100,970 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 2,021 |
| **Building Code:** | R2900600510 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $633,486 |
| **Building Name:** | Carlos Avery WMA Zodiac Office | **Address:** | 18310 ZODIAC ST | **Deferred Maintenance:** | $275,852 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 3,967 |
| **Building Code:** | R2900600530 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $140,524 |
| **Building Name:** | Carlos Avery WMA Zodiac Garage | **Address:** | 18310 ZODIAC ST | **Deferred Maintenance:** | $53,899 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,025 |
| **Building Code:** | R2900600540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $120,369 |
| **Building Name:** | Carlos Avery WMA Zodiac Hanger | **Address:** | 18310 ZODIAC ST | **Deferred Maintenance:** | $107,703 |
| **Facility Condition Index:** | 0.89 - Crisis | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,163 |
| **Building Code:** | R2900600560 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $884,667 |
| **Building Name:** | Carlos Avery Zodiac Cold Storage | **Address:** | 18310 ZODIAC ST | **Deferred Maintenance:** | $348,983 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 6,534 |
| **Building Code:** | R2900600570 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $726,063 |
| **Building Name:** | Carlos Av Game Farm Research Office | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $247,579 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 3,574 |
| **Building Code:** | R2900600580 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $619,346 |
| **Building Name:** | Carlos Avery Game Farm Residence | **Address:** | 5463-A WEST BROADWAY | **Deferred Maintenance:** | $141,979 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 3,386 |
| **Building Code:** | R2900600590 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $145,622 |
| **Building Name:** | Carlos Avery Game Farm Garage | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $38,024 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,267 |
| **Building Code:** | R2900600630 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,310,535 |
| **Building Name:** | Carlos Avery Game Farm Office | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $293,222 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 5,916 |
| **Building Code:** | R2900600640 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $404,419 |
| **Building Name:** | Carlos Avery Game Farm Cold Storage | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $82,526 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 2,880 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600770 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $95,706 |
| **Building Name:** | Carlos Av Game Farm Brooder House | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $23,221 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,032 |
| **Building Code:** | R2900600840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $76,425 |
| **Building Name:** | Carlos Avery Game Farm Spring House | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $23,509 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 210 |
| **Building Code:** | R2900600870 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $247,592 |
| **Building Name:** | Carlos Avery Game Farm Cold Storage | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $61,551 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 2,425 |
| **Building Code:** | R2900600890 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $397,299 |
| **Building Name:** | Carlos Avery Game Farm Garage | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $125,970 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 3,467 |
| **Building Code:** | R2900601950 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $217,354 |
| **Building Name:** | Carlos Avry Wildlife Science Center | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $109,244 |
| **Facility Condition Index:** | 0.50 - Crisis | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,080 |
| **Building Code:** | R2900602030 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $37,026 |
| **Building Name:** | Carlos Avery Zodiac Picnic Shelter | **Address:** | 18310 ZODIAC ST | **Deferred Maintenance:** | $4,896 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 98 |
| **Building Code:** | R2900602060 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $151,486 |
| **Building Name:** | Carlos Avery Game Farm Cold Storage | **Address:** | 5463-C WEST BROADWAY | **Deferred Maintenance:** | $11,896 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,736 |

### *Site: R290231 - Eveleth*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900205150 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $233,962 |
| **Building Name:** | Eveleth Main Office | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $23,823 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EVELETH | **Ext. Gross Area:** | 1,056 |
| **Building Code:** | R2900205160 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,277 |
| **Building Name:** | Eveleth Garage | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $10,731 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | EVELETH | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900205170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,693 |
| **Building Name:** | Eveleth Oil House | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $5,698 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | EVELETH | **Ext. Gross Area:** | 123 |
| **Building Code:** | R2900205180 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $146,761 |
| **Building Name:** | Eveleth Spring House | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $4,667 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | EVELETH | **Ext. Gross Area:** | 98 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900205190 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $474,820 |
| **Building Name:** | Eveleth 5-Stall Garage Shop | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $231,681 |
| **Facility Condition Index:** | 0.49 - Poor | **City Code:** | EVELETH | **Ext. Gross Area:** | 2,411 |
| **Building Code:** | R2900205200 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $546,231 |
| **Building Name:** | Eveleth Wildlife 5-Stall Gar Shop | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $108,214 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | EVELETH | **Ext. Gross Area:** | 2,302 |
| **Building Code:** | R2900205210 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $647,462 |
| **Building Name:** | Eveleth Pine Cone Storage | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $363,001 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | EVELETH | **Ext. Gross Area:** | 5,145 |
| **Building Code:** | R2900205220 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,337,451 |
| **Building Name:** | Eveleth Main Office/Shop | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $445,210 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | EVELETH | **Ext. Gross Area:** | 9,602 |
| **Building Code:** | R2900205230 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $60,670 |
| **Building Name:** | Eveleth Block Cold Storage | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $25,639 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | EVELETH | **Ext. Gross Area:** | 583 |
| **Building Code:** | R2900205240 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $211,325 |
| **Building Name:** | Eveleth ENF 4-Stall Cold Storage | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $38,954 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | EVELETH | **Ext. Gross Area:** | 1,964 |
| **Building Code:** | R2900205270 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,023 |
| **Building Name:** | Eveleth Cold Storage | **Address:** | 7979 HWY 37 | **Deferred Maintenance:** | $31,023 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | EVELETH | **Ext. Gross Area:** | 392 |

### *Site: R290233 - Warroad Boathouse*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108610 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $79,896 |
| **Building Name:** | Warroad Boathouse | **Address:** | 1101 LAKE ST NE | **Deferred Maintenance:** | $1,598 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WARROAD | **Ext. Gross Area:** | 524 |

### *Site: R290234 - R3 HQ St Paul*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601080 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $126,544 |
| **Building Name:** | St Paul R3 HQ 4-Stall Garage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $39,204 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,170 |
| **Building Code:** | R2900601260 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,137,867 |
| **Building Name:** | St Paul R3 HQ Warehouse | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $239,091 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 6,211 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900601290 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,580 |
| **Building Name:** | St Paul R3 HQ Garage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $6,062 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 250 |
| **Building Code:** | R2900601300 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $178,402 |
| **Building Name:** | St Paul R3 HQ 4-Stall Cold Storage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $28,884 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 2,079 |
| **Building Code:** | R2900601310 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $229,374 |
| **Building Name:** | St Paul R3 HQ 3-Stall Cold Storage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $41,740 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 2,663 |
| **Building Code:** | R2900601320 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $8,391,357 |
| **Building Name:** | St Paul R3 HQ Main Office | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $1,204,045 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 35,179 |
| **Building Code:** | R2900601330 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $424,443 |
| **Building Name:** | St Paul R3 HQ Cold Storage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $135,199 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 4,430 |
| **Building Code:** | R2900601770 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,485 |
| **Building Name:** | St Paul R3 HQ West HazMat Storage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $21,364 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 142 |
| **Building Code:** | R2900601780 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,485 |
| **Building Name:** | St Paul R3 HQ East HazMat Storage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $21,364 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 142 |
| **Building Code:** | R2900601840 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $124,736 |
| **Building Name:** | St Paul R3 HQ EWR Cold Storage | **Address:** | 1200 WARNER ROAD | **Deferred Maintenance:** | $19,129 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 885 |

### *Site: R290235 - R2 HQ Grand Rapids*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200020 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $258,065 |
| **Building Name:** | Grand Rapids R2 HQ Wildlife Warehse | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $54,440 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 2,230 |
| **Building Code:** | R2900203860 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $96,906 |
| **Building Name:** | Grand Rapids R2 HQ Oil House | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $27,888 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900203880 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $216,512 |
| **Building Name:** | Grand Rapids R2 HQ Carpenter Shop | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $77,266 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,515 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203930 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,598,043 |
| **Building Name:** | Grand Rapids R2 HQ G1 Shop | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $400,231 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 9,478 |
| **Building Code:** | R2900203940 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $772,237 |
| **Building Name:** | Grand Rapids R2 HQ Cold Storage W1 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $126,755 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 6,395 |
| **Building Code:** | R2900203980 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $15,301,943 |
| **Building Name:** | Grand Rapids R2 HQ Main Office | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $3,288,520 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 26,262 |
| **Building Code:** | R2900204540 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $133,376 |
| **Building Name:** | Grand Rapids R2 HQ Cold Storage N5 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $67,626 |
| **Facility Condition Index:** | 0.51 - Crisis | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 976 |
| **Building Code:** | R2900204550 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $210,230 |
| **Building Name:** | Grand Rapids R2 HQ Cold Storage N7 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $82,294 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,712 |
| **Building Code:** | R2900204570 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $185,415 |
| **Building Name:** | Grand Rapids R2 HQ Cold Storage N15 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $79,967 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,352 |
| **Building Code:** | R2900204580 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $201,336 |
| **Building Name:** | Grand Rapids R2 HQ Fire Control Ctr | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $65,897 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,905 |
| **Building Code:** | R2900204600 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $363,499 |
| **Building Name:** | Grand Rapids R2 HQ Sign Shop | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $104,796 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 2,312 |
| **Building Code:** | R2900204630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $78,406 |
| **Building Name:** | Grand Rapids R2 HQ Cold Storage N1 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $37,385 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 570 |
| **Building Code:** | R2900204690 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $860,213 |
| **Building Name:** | Grand Rapids R2 HQ N9 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $264,592 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 4,798 |
| **Building Code:** | R2900204730 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $291,657 |
| **Building Name:** | Grand Rapids R2 HQ Cntrl Heat Plant | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $80,877 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,430 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206830 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $44,998 |
| **Building Name:** | Grand Rapids R2 HQ HazMat Storage | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $33,748 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 209 |
| **Building Code:** | R2900206840 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $44,998 |
| **Building Name:** | Grand Rapids R2 HQ HazMat Storage | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $33,748 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 209 |
| **Building Code:** | R2900206870 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,165 |
| **Building Name:** | Grand Rapids R2 HQ Engineering Shed | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $1,224 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 181 |
| **Building Code:** | R2900207080 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,112,444 |
| **Building Name:** | Grand Rapids R2 HQ Fish Hatchery | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $209,058 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 6,230 |
| **Building Code:** | R2900207700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $173,693 |
| **Building Name:** | Grand Rapids R2 HQ Cold Storage N13 | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $11,512 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,432 |
| **Building Code:** | R2900208580 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,113 |
| **Building Name:** | Grand Rapids R2 HQ Explosives Shed | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $262 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 134 |
| **Building Code:** | R2900210600 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $34,806 |
| **Building Name:** | Grand Rapids R2 HQ Wild Resrch Stor | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $696 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 441 |

### *Site: R290236 - Lake City*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501790 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $577,403 |
| **Building Name:** | Lake City Shop | **Address:** | 1801 S OAK ST | **Deferred Maintenance:** | $46,095 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 4,577 |
| **Building Code:** | R2900501800 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,420 |
| **Building Name:** | Lake City Oil House | **Address:** | 1801 S OAK ST | **Deferred Maintenance:** | $7,216 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900501810 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $591,461 |
| **Building Name:** | Lake City Office | **Address:** | 1801 S OAK ST | **Deferred Maintenance:** | $112,306 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 6,386 |
| **Building Code:** | R2900503810 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $394,715 |
| **Building Name:** | Lake City EWR Shop | **Address:** | 1801 S OAK ST | **Deferred Maintenance:** | $29,564 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 3,296 |

### *Site: R290237 - Waterville*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401870 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $36,091 |
| **Building Name:** | Waterville Duck Lake Pump House | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $2,785 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 63 |
| **Building Code:** | R2900401880 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $2,374,867 |
| **Building Name:** | Waterville Office | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $604,336 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 10,174 |
| **Building Code:** | R2900401900 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $501,896 |
| **Building Name:** | Waterville Cold Storage | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $107,462 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 4,200 |
| **Building Code:** | R2900401910 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $360,110 |
| **Building Name:** | Waterville Residence | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $72,289 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 2,016 |
| **Building Code:** | R2900401920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $37,431 |
| **Building Name:** | Waterville Residence Garage | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $8,197 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 308 |
| **Building Code:** | R2900401930 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $23,262 |
| **Building Name:** | Waterville Hatchery Area Pump House | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $3,108 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 78 |
| **Building Code:** | R2900401940 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,925 |
| **Building Name:** | Waterville Hatchery Area Pump House | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $868 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 36 |
| **Building Code:** | R2900401950 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $32,110 |
| **Building Name:** | Waterville Pike Pond Pump House | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $2,476 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900401960 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $32,110 |
| **Building Name:** | Waterville Cedar Lake Pump House | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $7,357 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 56 |
| **Building Code:** | R2900404330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,844 |
| **Building Name:** | Waterville Hatchery Area Shed | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $2,470 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 128 |
| **Building Code:** | R2900404340 | **Cost Model Name:** | Bunker | **Current Replacement Value:** | $35,679 |
| **Building Name:** | Waterville Clear Lake Pump House | **Address:** | 50317 FISH HATCHERY RD | **Deferred Maintenance:** | $8,268 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 63 |

### *Site: R290238 - Minnesota Interagency Fire Center*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208470 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $179,351 |
| **Building Name:** | MIFC Modular Office | **Address:** | 402 11TH ST SE | **Deferred Maintenance:** | $28,280 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 1,068 |

### *Site: R290240 - Duluth Area*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900201880 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $444,530 |
| **Building Name:** | Duluth Office | **Address:** | 4805 RICE LAKE RD | **Deferred Maintenance:** | $125,890 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 1,834 |
| **Building Code:** | R2900201890 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $429,033 |
| **Building Name:** | Duluth Shop | **Address:** | 4805 RICE LAKE RD | **Deferred Maintenance:** | $97,638 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 3,115 |
| **Building Code:** | R2900201900 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,543 |
| **Building Name:** | Duluth Area Fuel Shed | **Address:** | 4805 RICE LAKE RD | **Deferred Maintenance:** | $14,167 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | DULUTH | **Ext. Gross Area:** | 168 |
| **Building Code:** | R2900201910 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,230 |
| **Building Name:** | Duluth Area Fire Cache | **Address:** | 4805 RICE LAKE RD | **Deferred Maintenance:** | $9,070 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 299 |
| **Building Code:** | R2900202010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,225 |
| **Building Name:** | Duluth Area Lower Garage | **Address:** | 4805 RICE LAKE RD | **Deferred Maintenance:** | $7,119 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 582 |

### *Site: R290242 - Lanesboro Area*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501580 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,312 |
| **Building Name:** | Lanesboro Area Cold Storage Garage | **Address:** | 23785 GROSBEAK LN | **Deferred Maintenance:** | $8,655 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 294 |
| **Building Code:** | R2900501720 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $999,198 |
| **Building Name:** | Lanesboro Area Office | **Address:** | 23785 GROSBEAK LN | **Deferred Maintenance:** | $136,687 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 5,600 |
| **Building Code:** | R2900504640 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,196 |
| **Building Name:** | Lanesboro Area Oil House | **Address:** | 23785 GROSBEAK LN | **Deferred Maintenance:** | $2,963 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900505290 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $288,406 |
| **Building Name:** | Lanesboro Area Cold Storage | **Address:** | 23785 GROSBEAK LN | **Deferred Maintenance:** | $17,979 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 4,620 |

### *Site: R290243 - Onamia*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900300460 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $326,220 |
| **Building Name:** | Onamia Office | **Address:** | 303 ROOSEVELT RD | **Deferred Maintenance:** | $73,683 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | R2900300480 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $97,219 |
| **Building Name:** | Onamia Cold Storage | **Address:** | 303 ROOSEVELT RD | **Deferred Maintenance:** | $23,975 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ONAMIA | **Ext. Gross Area:** | 960 |
| **Building Code:** | R2900304090 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,952 |
| **Building Name:** | Onamia Oil House | **Address:** | 303 ROOSEVELT RD | **Deferred Maintenance:** | $1,447 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ONAMIA | **Ext. Gross Area:** | 96 |

### *Site: R290263 - Crane Lake - St Louis*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $336,481 |
| **Building Name:** | Crane Lake Boat House | **Address:** | 7144 COUNTY RD 425 | **Deferred Maintenance:** | $66,168 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CRANE LAKE | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | R2900210930 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $10,089 |
| **Building Name:** | Crane Lake Handberg Sanitation | **Address:** | 7128 Handberg Rd | **Deferred Maintenance:** | $202 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CRANE LAKE | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900210940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,165 |
| **Building Name:** | Crane Lake Handberg Vault Concrete | **Address:** | 7128 Handberg Vault Concrete | **Deferred Maintenance:** | $543 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CRANE LAKE | **Ext. Gross Area:** | 54 |

### *Site: R290264 - Namakan Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203330 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $161,180 |
| **Building Name:** | Namakan Lake Cabin | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $21,369 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 600 |
| **Building Code:** | R2900204210 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $1,825 |
| **Building Name:** | Namakan Lake Oil House | **Address:** | Namakan Island | **Deferred Maintenance:** | $602 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | | **Ext. Gross Area:** | 20 |
| **Building Code:** | R2900204220 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $4,713 |
| **Building Name:** | Namakan Lake Cold Storage | **Address:** | | **Deferred Maintenance:** | $1,488 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 30 |

### *Site: R290265 - Sauk Centre*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900307440 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $179,803 |
| **Building Name:** | Sauk Centre Cold Storage | **Address:** | | **Deferred Maintenance:** | $18,323 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SAUK CENTRE | **Ext. Gross Area:** | 2,016 |

### *Site: R290267 - Mille Lacs Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900303070 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $82,013 |
| **Building Name:** | Mille Lacs Lake Isle Boat House | **Address:** | 41294 HENNEPIN PK RD | **Deferred Maintenance:** | $22,243 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 720 |

### *Site: R290268 - Hastings*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900602180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,976 |
| **Building Name:** | Hastings Boat House | **Address:** | 1350 DAM RD | **Deferred Maintenance:** | $3,198 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 320 |

### *Site: R290269 - Lake Minnetonka*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900600010 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $72,799 |
| **Building Name:** | Lake Minnetonka Boat House | **Address:** | | **Deferred Maintenance:** | $25,404 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | MINNETONKA | **Ext. Gross Area:** | 616 |

### *Site: R290270 - Lake Saganaga*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203390 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $41,091 |
| **Building Name:** | Lake Saganga Cabin | **Address:** | | **Deferred Maintenance:** | $9,808 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | UNASSIGNED | **Ext. Gross Area:** | 240 |

### *Site: R290271 - Nemadji State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305560 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $15,087 |
| **Building Name:** | Nemadji SF Askov Fire Tower | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $4,979 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900306620 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,996 |
| **Building Name:** | Nemadji SF Garfvert CG Site 1 Vault | **Address:** | 67491 STATE FOREST RD | **Deferred Maintenance:** | $2,215 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 40 |
| **Building Code:** | R2900308210 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $11,996 |
| **Building Name:** | Nemadji SF Garfvert CG Ste6/7 Vault | **Address:** | 67491 STATE FOREST RD | **Deferred Maintenance:** | $859 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 40 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308220 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,439 |
| **Building Name:** | Nemadji SF Garfvert CG Site14 Vault | **Address:** | 67491 STATE FOREST RD | **Deferred Maintenance:** | $2,235 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 51 |

### *Site: R290272 - Cross Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900306610 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $12,062 |
| **Building Name:** | Cross Lake Vault Toilet | **Address:** | 701 S KENWOOD RR 2 | **Deferred Maintenance:** | $2,998 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 40 |

### *Site: R290274 - McCarthy Lake WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308160 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $218,058 |
| **Building Name:** | McCarthy Lake WMA Cold Storage | **Address:** | HWY 61 | **Deferred Maintenance:** | $19,888 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | KELLOGG | **Ext. Gross Area:** | 2,560 |

### *Site: R290275 - New London Hatchery*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900403710 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $969,750 |
| **Building Name:** | New London Fish Hatchery | **Address:** | 308 1st Ave NW | **Deferred Maintenance:** | $178,086 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 3,276 |
| **Building Code:** | R2900403720 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $168,488 |
| **Building Name:** | New London Hatchery Pump House | **Address:** | 308 1st Ave NW | **Deferred Maintenance:** | $49,352 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 1,094 |
| **Building Code:** | R2900403730 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $25,858 |
| **Building Name:** | New London Hatchery Pump House | **Address:** | 308 1st Ave NW | **Deferred Maintenance:** | $9,941 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 282 |
| **Building Code:** | R2900404730 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $185,390 |
| **Building Name:** | New London Hatchery Raceway Shelter | **Address:** | 308 1st Ave NW | **Deferred Maintenance:** | $13,564 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 2,106 |
| **Building Code:** | R2900405280 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,995 |
| **Building Name:** | New London Hatchery Shed | **Address:** | 308 1st Ave NW | **Deferred Maintenance:** | $4,441 |
| **Facility Condition Index:** | 0.63 - Crisis | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 64 |

### *Site: R290276 - Red Wing*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500090 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $43,440 |
| **Building Name:** | Red Wing Boat House | **Address:** | | **Deferred Maintenance:** | $2,225 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | RED WING | **Ext. Gross Area:** | 504 |

### *Site: R290277 - Wabasha*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900500120 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $63,621 |
| **Building Name:** | Wabasha Boat House | **Address:** | | **Deferred Maintenance:** | $6,362 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WABASHA | **Ext. Gross Area:** | 528 |

### *Site: R290278 - La Crescent*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503700 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $80,434 |
| **Building Name:** | La Crescent Boat House | **Address:** | | **Deferred Maintenance:** | $8,510 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LA CRESCENT | **Ext. Gross Area:** | 864 |

### *Site: R290281 - Rainy Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207250 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,426 |
| **Building Name:** | Rainy Lake Black Bay Fire Tower | **Address:** | 392 HWY 11 E | **Deferred Maintenance:** | $1,443 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 64 |

### *Site: R290282 - Lake Winnibigoshish*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900208450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $20,477 |
| **Building Name:** | Lake Winnibigoshish Boat House | **Address:** | 1201 E HWY 2 | **Deferred Maintenance:** | $566 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 250 |

### *Site: R290283 - Coleraine*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900203870 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $7,774 |
| **Building Name:** | Coleraine Radio Shelter | **Address:** | 403 DIVISION ST | **Deferred Maintenance:** | $3,144 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207210 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $9,935 |
| **Building Name:** | Coleraine Fire Tower | **Address:** | 403 DIVISION ST | **Deferred Maintenance:** | $7,452 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 64 |

### *Site: R290284 - Devil Track Hatchery*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204510 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $372,255 |
| **Building Name:** | Devil Track Hatchery | **Address:** | 137 SOUTH SHORE DRIVE | **Deferred Maintenance:** | $83,820 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 1,400 |

### *Site: R290285 - Cromwell*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900207090 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $27,798 |
| **Building Name:** | Cromwell Fire Tower | **Address:** | CO RD 5 | **Deferred Maintenance:** | $16,002 |
| **Facility Condition Index:** | 0.58 - Crisis | **City Code:** | CROMWELL | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900207110 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $28,571 |
| **Building Name:** | Cromwell City Fire Tower | **Address:** | 824 CO RD 120 | **Deferred Maintenance:** | $9,429 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CROMWELL | **Ext. Gross Area:** | 64 |

### *Site: R290286 - Hill River State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900305510 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $16,732 |
| **Building Name:** | Hill River SF Ball Bluff Fire Tower | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $1,673 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HILL CITY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900305530 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $14,055 |
| **Building Name:** | Hill River SF Quadna Fire Tower | **Address:** | 454 N HWY 169 | **Deferred Maintenance:** | $1,405 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HILL CITY | **Ext. Gross Area:** | 64 |

### *Site: R290287 - Cannon Falls*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504980 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $54,635 |
| **Building Name:** | Cannon Falls Picnic Shelter 1 | **Address:** | | **Deferred Maintenance:** | $6,882 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | CANNON FALLS | **Ext. Gross Area:** | 360 |
| **Building Code:** | R2900504990 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $81,222 |
| **Building Name:** | Cannon Falls Cold Storage | **Address:** | | **Deferred Maintenance:** | $14,164 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CANNON FALLS | **Ext. Gross Area:** | 1,650 |

### *Site: R290289 - Vermillion Highlands WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308170 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $133,109 |
| **Building Name:** | Vermillion Highlands WMA Cold Stor | **Address:** | 15325 BABCOCK AVE | **Deferred Maintenance:** | $21,741 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ROSEMOUNT | **Ext. Gross Area:** | 1,563 |

### *Site: R290290 - Sand Prairie WMA & Environmental Ed*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308150 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $19,948 |
| **Building Name:** | Sand Prairie WMA Info Center | **Address:** | East side of Hwy 10, South of Hwy 2 | **Deferred Maintenance:** | $1,346 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SAUK RAPIDS | **Ext. Gross Area:** | 192 |

### *Site: R290291 - Bemidji Hatchery*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $334,571 |
| **Building Name:** | Bemidji Hatchery | **Address:** | 10307 POWER DAM RD NE | **Deferred Maintenance:** | $79,540 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,016 |

### *Site: R290292 - Bemidji Area Fish & Wildlife*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900100200 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $573,146 |
| **Building Name:** | Bemidji FAW Office | **Address:** | 2114 BEMIDJI AVE | **Deferred Maintenance:** | $94,809 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 3,002 |

### *Site: R290293 - Bemidji Area Wildlife Research*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103270 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $409,441 |
| **Building Name:** | Bemidji Wildlife Research Office | **Address:** | 102 23RD ST NE | **Deferred Maintenance:** | $127,976 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,088 |
| **Building Code:** | R2900103280 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,227 |
| **Building Name:** | Bemidji Wild Research Cold Storage | **Address:** | 102 23RD ST NE | **Deferred Maintenance:** | $7,269 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 278 |
| **Building Code:** | R2900106150 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $487,111 |
| **Building Name:** | Bemidji Wild Research Modular Ofc | **Address:** | 102 23RD ST NE | **Deferred Maintenance:** | $64,413 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 2,010 |

### *Site: R290294 - Duluth French River*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200320 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $3,076,662 |
| **Building Name:** | Duluth French River Hatchery | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $854,595 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 12,016 |
| **Building Code:** | R2900200330 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $72,029 |
| **Building Name:** | Duluth French River Clarifier | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $21,656 |
| **Facility Condition Index:** | 0.30 - Poor | **City Code:** | DULUTH | **Ext. Gross Area:** | 217 |
| **Building Code:** | R2900200340 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $5,081,122 |
| **Building Name:** | Duluth French R Burrows/Biofilters | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $3,374,594 |
| **Facility Condition Index:** | 0.66 - Crisis | **City Code:** | DULUTH | **Ext. Gross Area:** | 16,946 |
| **Building Code:** | R2900200350 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,394 |
| **Building Name:** | Duluth F Sump Pump Pipe-Lk Superior | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $3,888 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | DULUTH | **Ext. Gross Area:** | 26 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200370 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $430,532 |
| **Building Name:** | Duluth French River Residence | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $84,002 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 2,342 |
| **Building Code:** | R2900200400 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $70,121 |
| **Building Name:** | Duluth French River Pump House | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $22,227 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | DULUTH | **Ext. Gross Area:** | 606 |
| **Building Code:** | R2900203630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $262,433 |
| **Building Name:** | Duluth French River Shop | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $55,292 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 1,930 |
| **Building Code:** | R2900206970 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $119,268 |
| **Building Name:** | Duluth French River Cold Storage | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $17,031 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 957 |
| **Building Code:** | R2900208430 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $351,465 |
| **Building Name:** | Duluth Fra R Bruder Stock-Pole Shed | **Address:** | 5357 NORTH SHORE DR | **Deferred Maintenance:** | $184,679 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | DULUTH | **Ext. Gross Area:** | 3,293 |

### *Site: R290295 - Duluth Area Fisheries*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900200380 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $518,348 |
| **Building Name:** | Duluth Fisheries Garage | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $124,273 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,240 |
| **Building Code:** | R2900200390 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $2,313,987 |
| **Building Name:** | Duluth Fisheries Office | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $745,101 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | DULUTH | **Ext. Gross Area:** | 8,499 |
| **Building Code:** | R2900200410 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $131,726 |
| **Building Name:** | Duluth Fisheries 2-Stall Garage | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $18,535 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 673 |
| **Building Code:** | R2900200420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $30,937 |
| **Building Name:** | Duluth Fisheries Net Shed | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $6,092 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 331 |
| **Building Code:** | R2900200430 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $524,981 |
| **Building Name:** | Duluth Fisheries Shop | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $95,358 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,480 |
| **Building Code:** | R2900206140 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,047 |
| **Building Name:** | Duluth Fisheries Cold Storage | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $8,449 |
| **Facility Condition Index:** | 0.70 - Crisis | **City Code:** | DULUTH | **Ext. Gross Area:** | 96 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206150 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,359 |
| **Building Name:** | Duluth Fisheries Wood Shed | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $10,359 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | DULUTH | **Ext. Gross Area:** | 146 |
| **Building Code:** | R2900206850 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $40,192 |
| **Building Name:** | Duluth Fish Walk-In Freezer Bldg | **Address:** | 5351 NORTH SHORE DR | **Deferred Maintenance:** | $13,263 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DULUTH | **Ext. Gross Area:** | 131 |

### *Site: R290296 - Baudette Fish & Wildlife*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900103860 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,556 |
| **Building Name:** | Baudette FAW Garage | **Address:** | 204 MAIN ST E | **Deferred Maintenance:** | $9,769 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 331 |
| **Building Code:** | R2900103890 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $424,989 |
| **Building Name:** | Baudette FAW Office | **Address:** | 204 MAIN ST E | **Deferred Maintenance:** | $57,985 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 1,057 |
| **Building Code:** | R2900104520 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $480,985 |
| **Building Name:** | Baudette FAW Shop | **Address:** | 204 MAIN ST E | **Deferred Maintenance:** | $66,967 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 4,284 |

### *Site: R290297 - Lanesboro Hatchery*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501550 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $904,248 |
| **Building Name:** | Lanesboro Fish Hatchery Office | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $66,594 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 7,190 |
| **Building Code:** | R2900501560 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $235,438 |
| **Building Name:** | Lanesboro Hatchery Shop | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $16,353 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 2,000 |
| **Building Code:** | R2900501570 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $331,119 |
| **Building Name:** | Lanesboro Hatchery Residence | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $186,445 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 1,826 |
| **Building Code:** | R2900501600 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $204,013 |
| **Building Name:** | Lanesboro Hatchery Spring House | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $68,043 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 2,480 |
| **Building Code:** | R2900501610 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,922 |
| **Building Name:** | Lanesboro Hatchery Cold Storage | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $2,656 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900501940 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $10,542 |
| **Building Name:** | Lanesboro Hatchery Cold Storage | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $6,845 |
| **Facility Condition Index:** | 0.65 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 80 |
| **Building Code:** | R2900502110 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,154,282 |
| **Building Name:** | Lanesboro Hatch Pole Shed Raceway | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $213,925 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 29,785 |
| **Building Code:** | R2900502410 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $335,443 |
| **Building Name:** | Lanesboro Hatchery Raceway Shel 1 | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $303,914 |
| **Facility Condition Index:** | 0.91 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 1,032 |
| **Building Code:** | R2900502420 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $325,931 |
| **Building Name:** | Lanesboro Hatchery Raceway Shel 2 | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $294,402 |
| **Facility Condition Index:** | 0.90 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 1,032 |
| **Building Code:** | R2900502430 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $74,366 |
| **Building Name:** | Lanesboro Hatch Brood Stock Raceway | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $7,872 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 1,025 |
| **Building Code:** | R2900504650 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $28,859 |
| **Building Name:** | Lanesboro Hatch Gazebo Spring House | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $3,808 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 254 |
| **Building Code:** | R2900504710 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $69,758 |
| **Building Name:** | Lanesboro Hatchery Generator Shed | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $21,286 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 200 |
| **Building Code:** | R2900505000 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $63,748 |
| **Building Name:** | Lanesboro Hatchery Coverall Shelter | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $21,037 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 1,650 |
| **Building Code:** | R2900505360 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $266,350 |
| **Building Name:** | Lanesboro Hatch Fingerlings Raceway | **Address:** | 23789 GROSBEAK LN | **Deferred Maintenance:** | $16,094 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 4,200 |

### *Site: R290318 - Agate Bay*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210650 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $68,706 |
| **Building Name:** | Agate Bay Vault Concrete | **Address:** | | **Deferred Maintenance:** | $6,871 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | | **Ext. Gross Area:** | 128 |

### *Site: R290322 - LaSalle Lake SRA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900108890 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $454,691 |
| **Building Name:** | LaSalle Lake SRA Black Bear Cabin | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $16,502 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | SOLWAY | **Ext. Gross Area:** | 1,264 |
| **Building Code:** | R2900108910 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $36,900 |
| **Building Name:** | LaSalle Lake SRA CG Fish Cleang Hse | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $5,007 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 120 |
| **Building Code:** | R2900108920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $206,792 |
| **Building Name:** | LaSalle Lake SRA Shop | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $21,982 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 1,789 |
| **Building Code:** | R2900108930 | **Cost Model Name:** | Single-story Restroom Facility | **Current Replacement Value:** | $331,532 |
| **Building Name:** | LaSalle Lake SRA CG Sanitation | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $33,153 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 1,216 |
| **Building Code:** | R2900108960 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $109,055 |
| **Building Name:** | LaSalle Lake SRA Lone Wolf Cabin | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $10,905 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 616 |
| **Building Code:** | R2900108980 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,408 |
| **Building Name:** | LaSalle Lake SRA Black Bear Garage | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $5,341 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 720 |
| **Building Code:** | R2900109400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,709 |
| **Building Name:** | LaSalle Lake SRA Day Vault Concr | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $2,771 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900109410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $55,417 |
| **Building Name:** | LaSalle Lake SRA Day Vault Concr | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $5,542 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 102 |
| **Building Code:** | R2900109420 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $177,764 |
| **Building Name:** | LaSalle Lake SRA Day Picnic Shel 2 | **Address:** | 9887 CO RD 9 | **Deferred Maintenance:** | $17,776 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | SOLWAY | **Ext. Gross Area:** | 1,280 |

### *Site: R290323 - McDougall WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900308260 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,210 |
| **Building Name:** | McDougall WMA Brooder House | **Address:** | 5815 HILTON RD | **Deferred Maintenance:** | $32,222 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | ROYALTON | **Ext. Gross Area:** | 480 |
| **Building Code:** | R2900308270 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $306,799 |
| **Building Name:** | McDougall WMA Barn | **Address:** | 5815 HILTON RD | **Deferred Maintenance:** | $230,099 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ROYALTON | **Ext. Gross Area:** | 3,223 |

### *Site: R290324 - Lake Christina WAS - Grant*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900109040 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,749 |
| **Building Name:** | Lake Christina-Grant Pump House | **Address:** | | **Deferred Maintenance:** | $4,075 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ASHBY | **Ext. Gross Area:** | 352 |
| **Building Code:** | R2900109480 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,072 |
| **Building Name:** | Lake Christina-Grant Fish Cntrl Bld | **Address:** | | **Deferred Maintenance:** | $1,207 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ASHBY | **Ext. Gross Area:** | 120 |

### *Site: R290325 - Moose Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900206480 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $10,199 |
| **Building Name:** | Moose Lake South Shore WAS Vault | **Address:** | CO RD 217 | **Deferred Maintenance:** | $1,957 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 30 |

### *Site: R290357 - Root River State Trail*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900502790 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Trout Valley Trl Vault Toilet | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Gribbon Valley Vault Toilet | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502830 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Isinour Women's Vault Toilet | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900502840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Isinour Men's Vault Toilet | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503030 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $18,830 |
| **Building Name:** | Root River ST Fountain Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $7,178 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900503040 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $14,829 |
| **Building Name:** | RR ST Upper Isinour Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $4,894 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 126 |
| **Building Code:** | R2900503910 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Petersn/Lanesb Riv Acc Vault | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900503920 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Peterson River Access Vault | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503930 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Whalan Trail Men's Vault | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900503940 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Whalan Trail Women's Vault | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $26,079 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504660 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $18,300 |
| **Building Name:** | RR ST South Branch Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $3,208 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900504680 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,694 |
| **Building Name:** | RR ST Vinegar Ridge CG Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $3,901 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900504820 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Brightdale Mgmt Unit Vault | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $11,475 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504830 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,694 |
| **Building Name:** | Root River ST Whalen Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $13,271 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900504840 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $34,771 |
| **Building Name:** | RR ST Eagle Bluff Center Vault | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $11,475 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900504850 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $11,769 |
| **Building Name:** | Root River ST Preston Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $1,507 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 100 |
| **Building Code:** | R2900504860 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,694 |
| **Building Name:** | RR ST Isonaurs Low Parkg Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $2,523 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |
| **Building Code:** | R2900504910 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $16,374 |
| **Building Name:** | RR ST Wet Bark/Oak Ridge Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $1,877 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 144 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504920 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $15,925 |
| **Building Name:** | RR ST Wet Bark Unit Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $1,832 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LANESBORO | **Ext. Gross Area:** | 144 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900505520 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $9,732 |
| **Building Name:** | RR ST North of Peterson Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $2,145 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | LANESBORO | **Ext. Gross Area:** | 88 |

### *Site: R290358 - Harmony-Preston State Trail*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504670 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $17,694 |
| **Building Name:** | Harmony-Preston ST Adirondack | **Address:** | 100 MILWAUKEE RD | **Deferred Maintenance:** | $6,417 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | LANESBORO | **Ext. Gross Area:** | 160 |

### *Site: R290362 - Round-Rice Bed WMA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209390 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,663 |
| **Building Name:** | Round-Rice Bed WMA Heated Storage | **Address:** | STATE HWY 17 & CROW WING C( | **Deferred Maintenance:** | $241 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GARRISON | **Ext. Gross Area:** | 64 |

### *Site: R290363 - Oak Lake WAS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209400 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $18,487 |
| **Building Name:** | Oak Lake WAS Vault Toilet Concrete | **Address:** | 89999 OAK LAKE RD S | **Deferred Maintenance:** | $1,849 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | KERRICK | **Ext. Gross Area:** | 35 |

### *Site: R290364 - Sturgeon Lake WAS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209410 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $15,472 |
| **Building Name:** | Sturgeon Lake WAS Vault Toilet | **Address:** | 38714 LAUNCH DR | **Deferred Maintenance:** | $1,582 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | STURGEON LAKE | **Ext. Gross Area:** | 51 |

### *Site: R290367 - Ray Berglund State Wayside*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900209500 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $120,263 |
| **Building Name:** | Ray Berglund State Wayside San Bldg | **Address:** | | **Deferred Maintenance:** | $11,670 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TOFTE | **Ext. Gross Area:** | 320 |

### *Site: R290453 - White Earth State Forest*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900105510 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $7,762 |
| **Building Name:** | White Earth SF Tulaby Fire Tower | **Address:** | TULBAY | **Deferred Maintenance:** | $2,561 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 64 |
| **Building Code:** | R2900105610 | **Cost Model Name:** | Tower | **Current Replacement Value:** | $7,762 |
| **Building Name:** | White Earth SF HeightO'L Fire Tower | **Address:** | Height of Land | **Deferred Maintenance:** | $2,561 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 64 |

### *Site: R290605 - C J Ramstad State Trail*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900210620 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,736 |
| **Building Name:** | CJRamstad ST Finland Vault Concrete | **Address:** | 6866 Cramer Rd | **Deferred Maintenance:** | $1,055 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | Finland | **Ext. Gross Area:** | 105 |
| **Building Code:** | R2900210630 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $25,656 |
| **Building Name:** | CJRamstad ST Martin Vault Concrete | **Address:** | Martin Rd. | **Deferred Maintenance:** | $513 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | DULUTH | **Ext. Gross Area:** | 51 |
| **Building Code:** | R2900210640 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $52,736 |
| **Building Name:** | CJRamstad ST Normanna Vault Concret | **Address:** | Normanna Rd | **Deferred Maintenance:** | $1,055 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | DULUTH | **Ext. Gross Area:** | 105 |

### *Site: R290635 - Peterson*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900504770 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $545,439 |
| **Building Name:** | Peterson T&W Storage | **Address:** | 416 PARK ST | **Deferred Maintenance:** | $45,000 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | PETERSON | **Ext. Gross Area:** | 3,520 |

### *Site: R290643 - Sea Gull Lake*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900204200 | **Cost Model Name:** | Single-family Residence | **Current Replacement Value:** | $89,103 |
| **Building Name:** | Sea Gull River Cabin | **Address:** | 92 Gull Lake Lane | **Deferred Maintenance:** | $17,837 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | Grand Marais | **Ext. Gross Area:** | 436 |

### *Site: R290644 - Windom*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900401860 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $338,788 |
| **Building Name:** | Windom Cold Storage | **Address:** | 175 CTY RD 26 | **Deferred Maintenance:** | $129,282 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | WINDOM | **Ext. Gross Area:** | 2,877 |
| **Building Code:** | R2900404300 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $4,769,561 |
| **Building Name:** | Windom Office | **Address:** | 175 CTY RD 26 | **Deferred Maintenance:** | $899,252 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WINDOM | **Ext. Gross Area:** | 22,145 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R2900404810 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,576 |
| **Building Name:** | Windom Shed | **Address:** | 175 CTY RD 26 | **Deferred Maintenance:** | $2,095 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | WINDOM | **Ext. Gross Area:** | 197 |

# Agency: R32 - Pollution Control Agency

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $10,523,744 | **Ext. Gross Area:** | 25,198 |
| **Facility Condition Index:** | 0.12 | **Deferred Maintenance:** | $1,303,785 | **Building Count:** | 18 |

## *Site: R32B30 - BECKER COUNTY LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32B30B3001 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,644,458 |
| **Building Name:** | Groundwater Treatment Building | **Address:** | 24413 County Road 144 | **Deferred Maintenance:** | $364,446 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 100 |

## *Site: R32E10 - EAST BETHEL LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32E10E1001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $198,004 |
| **Building Name:** | GroundwateTreatment Building | **Address:** | 217th Avenue Northeast | **Deferred Maintenance:** | $22,872 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | EAST BETHEL | **Ext. Gross Area:** | 1,456 |

## *Site: R32F40 - FLYING CLOUD LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32F40F4001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $978,584 |
| **Building Name:** | Former Gas to Energy Building | **Address:** | 9813 Flying Cloud Drive | **Deferred Maintenance:** | $196,452 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | EDEN PRAIRIE | **Ext. Gross Area:** | 6,730 |

## *Site: R32I20 - IRONWOOD LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32I20I2001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $19,949 |
| **Building Name:** | Manifold Building | **Address:** | Sec. 22, Bloomfield Twp. | **Deferred Maintenance:** | $1,995 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Spring Valley | **Ext. Gross Area:** | 100 |

## *Site: R32K40 - KOOCHICHING COUNTY LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32K40K4001 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $3,910,402 |
| **Building Name:** | Leachate Pump Control Building | **Address:** | 4100 Highway 11 West | **Deferred Maintenance:** | $391,040 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 120 |

## *Site: R32L80 - LINDENFELSER LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32L80L8001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $921,126 |
| **Building Name:** | Garage | **Address:** | 1890 Kadler Avenue | **Deferred Maintenance:** | $226,254 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | St. Michael | **Ext. Gross Area:** | 8,107 |

## *Site: R32L90 - LONG PRAIRIE LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32L90L9002 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $196,813 |
| **Building Name:** | Pole Barn | **Address:** | 28824 State Highway 27 | **Deferred Maintenance:** | $35,307 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | Long Prairie | **Ext. Gross Area:** | 2,600 |

### *Site: R32W40 - WASHINGTON COUNTY LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32W40W4001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $62,895 |
| **Building Name:** | Storage Building | **Address:** | 3855 Jamaca Avenue | **Deferred Maintenance:** | $6,290 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Lake Elmo | **Ext. Gross Area:** | 675 |
| **Building Code:** | R32W40W4003 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $9,468 |
| **Building Name:** | Leachate Pump Control Building | **Address:** | 3855 Jamaca Avenue | **Deferred Maintenance:** | $189 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LAKE ELMO | **Ext. Gross Area:** | 100 |

### *Site: R32W50 - ANOKA-RAMSEY LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32W50W5001 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $72,960 |
| **Building Name:** | Equipment Storage Bldg | **Address:** | 14730 Sunfish Lake Blvd. | **Deferred Maintenance:** | $7,296 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RAMSEY | **Ext. Gross Area:** | 720 |
| **Building Code:** | R32W50W5002 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $138,721 |
| **Building Name:** | Former Air Stripper Blower Bldg | **Address:** | 14730 Sunfish Lake Blvd. | **Deferred Maintenance:** | $13,872 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RAMSEY | **Ext. Gross Area:** | 1,140 |
| **Building Code:** | R32W50W5003 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $46,655 |
| **Building Name:** | Former Flare Blower Bldg | **Address:** | 14730 Sunfish Lake Blvd. | **Deferred Maintenance:** | $4,666 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RAMSEY | **Ext. Gross Area:** | 528 |
| **Building Code:** | R32W50W5004 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $6,179 |
| **Building Name:** | Emergency Blower Building | **Address:** | 14730 Sunfish Lake Blvd. | **Deferred Maintenance:** | $1,275 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | RAMSEY | **Ext. Gross Area:** | 64 |
| **Building Code:** | R32W50W5005 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $9,228 |
| **Building Name:** | Control Panel Building | **Address:** | 14730 Sunfish Lake Blvd. | **Deferred Maintenance:** | $923 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RAMSEY | **Ext. Gross Area:** | 100 |

### *Site: R32W70 - WASTE DISPOSAL ENGINEERING LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32W70W7001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $34,462 |
| **Building Name:** | Groundwater Treatment Bldg | **Address:** | 14437 Crosstown Blvd. | **Deferred Maintenance:** | $3,941 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | Andover | **Ext. Gross Area:** | 300 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32W70W7002 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $122,495 |
| **Building Name:** | Former Turbine Building | **Address:** | 14437 Crosstown Blvd. | **Deferred Maintenance:** | $10,200 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ANDOVER | **Ext. Gross Area:** | 1,134 |

### *Site: R32W90 - WOODLAKE LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32W90W9003 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $92,864 |
| **Building Name:** | Former Blower Building | **Address:** | 4000 Hamel Road | **Deferred Maintenance:** | $9,578 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | Medina | **Ext. Gross Area:** | 648 |

### *Site: R32X20 - OLMSTED COUNTY LANDFILL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | R32X20X2001 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $58,481 |
| **Building Name:** | Garage | **Address:** | 2683 - 85th Street NW | **Deferred Maintenance:** | $7,190 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ORONOCO | **Ext. Gross Area:** | 576 |

# Agency: T79 - Department of Transportation

| | | | | | |
|---|---|---|---|---|---|
| **FCI Rating:** | Good | **Current Replacement Value:** | $1,277,119,540 | **Ext. Gross Area:** | 6,617,735 |
| **Facility Condition Index:** | 0.15 | **Deferred Maintenance:** | $186,323,637 | **Building Count:** | 886 |

## *Site: T791092020 - MAPLEWOOD - MATERIALS LAB*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7907792020 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $22,847,282 |
| **Building Name:** | MATERIALS LAB - OFFICE/LAB | **Address:** | 1400 GERVAIS AVE | **Deferred Maintenance:** | $2,897,146 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 80,340 |
| **Building Code:** | T7907792050 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,277,899 |
| **Building Name:** | MATERIALS LAB - POLE STORAGE | **Address:** | 1400 GERVAIS AVE | **Deferred Maintenance:** | $153,425 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 11,776 |

## *Site: T791092026 - ST PAUL - CENTRAL SERVICES*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7909192026 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $20,289,880 |
| **Building Name:** | CENTRAL SERVICES - MAIN BLDG | **Address:** | 6000 MINNEHAHA AVE | **Deferred Maintenance:** | $3,298,075 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 93,704 |
| **Building Code:** | T7909192027 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $650,205 |
| **Building Name:** | CENTRAL SERVICES - POLE STORAGE | **Address:** | 6000 MINNEHAHA AVE | **Deferred Maintenance:** | $103,063 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 6,080 |
| **Building Code:** | T7909192059 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $563,322 |
| **Building Name:** | CENTRAL SERVICES - POLE STORAGE | **Address:** | 6000 MINNEHAHA AVE | **Deferred Maintenance:** | $28,316 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 5,163 |

## *Site: T791092036 - ARDEN HILLS - TRAINING CENTER*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7900092034 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $86,777 |
| **Building Name:** | ARDEN HILLS - MISC STORAGE | **Address:** | 1900 W CO RD I | **Deferred Maintenance:** | $7,786 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 888 |
| **Building Code:** | T7900092036 | **Cost Model Name:** | Low-rise Office Building, 2 to 4 story | **Current Replacement Value:** | $8,822,665 |
| **Building Name:** | ARDEN HILLS - TRAINING CENTER | **Address:** | 1900 W CO RD I | **Deferred Maintenance:** | $1,155,461 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 40,992 |
| **Building Code:** | T7900092057 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $109,908 |
| **Building Name:** | ARDEN HILLS TC - MISC STORAGE | **Address:** | 1900 W CO RD I | **Deferred Maintenance:** | $6,136 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 1,081 |

## *Site: T791092043 - PLYMOUTH - DRIVERS EXAM*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7900092043 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,748,792 |
| **Building Name:** | PLYMOUTH - DRIVERS EXAM | **Address:** | 2455 FERNBROOK LN | **Deferred Maintenance:** | $246,820 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 6,633 |
| **Building Code:** | T7900092047 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $6,008 |
| **Building Name:** | PLYMOUTH - EXAM MISC STORAGE | **Address:** | 2455 FERNBROOK LN | **Deferred Maintenance:** | $3,417 |
| **Facility Condition Index:** | 0.57 - Crisis | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 199 |

### *Site: T791092051 - MONTICELLO - MnROAD RESEARCH*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7907792051 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $966,469 |
| **Building Name:** | MNROAD RESEARCH - OFFICE | **Address:** | 907 77TH ST NE | **Deferred Maintenance:** | $122,776 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 4,724 |
| **Building Code:** | T7907792053 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,134,416 |
| **Building Name:** | MNROAD RESEARCH - POLE STORAGE | **Address:** | 907 77TH ST NE | **Deferred Maintenance:** | $76,598 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 6,400 |
| **Building Code:** | T7907792066 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,943 |
| **Building Name:** | MNROAD RESEARCH - WIM BUILDING | **Address:** | 907 77TH ST NE | **Deferred Maintenance:** | $2,794 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ALBERTVILLE | **Ext. Gross Area:** | 250 |

### *Site: T791092055 - ST PAUL - AERONAUTICS OFFICE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7906092055 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $4,891,379 |
| **Building Name:** | ST PAUL - AERONAUTICS OFFICE | **Address:** | 222 EAST PLATO BLVD | **Deferred Maintenance:** | $1,333,036 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 20,301 |

### *Site: T791092063 - MINNEAPOLIS - NIT EQUIPMENT*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990092063 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $35,529 |
| **Building Name:** | NIT EQUIPMENT BUILDING - SERVICE BU | **Address:** | I394 AND PENN AVENUE | **Deferred Maintenance:** | $6,857 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 288 |

### *Site: T791092067 - PINEY/PINE CREEK - AIRPORT*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7906092067 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $163,374 |
| **Building Name:** | PINEY/PINE CREEK - AIRPORT BLDG | **Address:** | 41937 MN HWY 89 | **Deferred Maintenance:** | $44,953 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ROSEAU | **Ext. Gross Area:** | 1,380 |

### *Site: T791A20210 - CROMWELL - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020210 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $88,402 |
| **Building Name:** | CROMWELL - SALT/SAND STORAGE | **Address:** | 1353 Hwy 73 | **Deferred Maintenance:** | $13,205 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CROMWELL | **Ext. Gross Area:** | 1,218 |

### *Site: T791A20211 - FOND DU LAC - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020211 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $81,190 |
| **Building Name:** | FOND DU LAC - SALT/SAND STORAGE | **Address:** | 2923 Fon Du Lac Road | **Deferred Maintenance:** | $9,706 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SUPERIOR | **Ext. Gross Area:** | 1,068 |
| **Building Code:** | T7910090220 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $101,821 |
| **Building Name:** | FOND DU LAC - MISC STORAGE | **Address:** | 2923 Fon Du Lac Road | **Deferred Maintenance:** | $6,872 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | SUPERIOR | **Ext. Gross Area:** | 780 |

### *Site: T791A20212 - SAGINAW - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020212 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $141,320 |
| **Building Name:** | SAGINAW - SALT/SAND STORAGE | **Address:** | 6886 US Hwy 2 | **Deferred Maintenance:** | $23,324 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SAGINAW | **Ext. Gross Area:** | 1,852 |
| **Building Code:** | T7910090282 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $73,102 |
| **Building Name:** | SAGINAW - LOADER STORAGE | **Address:** | 6886 US Hwy 2 | **Deferred Maintenance:** | $3,400 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | SAGINAW | **Ext. Gross Area:** | 560 |

### *Site: T791A20214 - JACOBSON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020214 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $62,889 |
| **Building Name:** | JACOBSON - SALT/SAND STORAGE | **Address:** | 18907 HWY200 | **Deferred Maintenance:** | $24,064 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | JACOBSON | **Ext. Gross Area:** | 1,054 |
| **Building Code:** | T7910090264 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $51,872 |
| **Building Name:** | JACOBSON - MISC STORAGE | **Address:** | 18907 HWY200 | **Deferred Maintenance:** | $4,393 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | JACOBSON | **Ext. Gross Area:** | 580 |

### *Site: T791A20218 - THOMPSON HILL - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020218 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $230,751 |
| **Building Name:** | THOMPSON HILL - SALT/SAND STORAGE | **Address:** | I35 At US 2 | **Deferred Maintenance:** | $41,189 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 3,024 |
| **Building Code:** | T7910090279 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $70,650 |
| **Building Name:** | THOMPSON HILL - MISC STORAGE | **Address:** | I 35 At US 2 | **Deferred Maintenance:** | $8,576 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 606 |

### *Site: T791A20219 - MCGRATH - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020219 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $54,667 |
| **Building Name:** | MCGRATH - SALT/SAND STORAGE | **Address:** | 1/2 Mile South of McGrath Hwy 65 | **Deferred Maintenance:** | $12,102 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MCGRATH | **Ext. Gross Area:** | 798 |
| **Building Code:** | T7910090255 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $75,647 |
| **Building Name:** | MCGRATH - MISC STORAGE | **Address:** | 1/2 Mile South of McGrath Hwy 65 | **Deferred Maintenance:** | $8,781 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MCGRATH | **Ext. Gross Area:** | 630 |

### *Site: T791A20221 - ISABELLA - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020221 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $45,289 |
| **Building Name:** | ISABELLA - SALT/SAND STORAGE | **Address:** | 2111 Minn Hwy 1 | **Deferred Maintenance:** | $5,058 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ISABELLA | **Ext. Gross Area:** | 459 |
| **Building Code:** | T7910090275 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $82,292 |
| **Building Name:** | ISABELLA - MISC STORAGE | **Address:** | 2111 Minn Hwy 1 | **Deferred Maintenance:** | $9,086 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ISABELLA | **Ext. Gross Area:** | 582 |

### *Site: T791A20222 - LESTER RIVER - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020222 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $97,700 |
| **Building Name:** | LESTER RIVER - SALT/SAND STORAGE | **Address:** | 6831 East Superior Street | **Deferred Maintenance:** | $24,476 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 1,067 |
| **Building Code:** | T7910090274 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $55,865 |
| **Building Name:** | LESTER RIVER - MISC STORAGE | **Address:** | 6831 East Superior Street | **Deferred Maintenance:** | $15,812 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 513 |

### *Site: T791A20225 - LIBBY - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020225 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $50,860 |
| **Building Name:** | LIBBY - SALT/SAND STORAGE | **Address:** | 59420 MN-65 | **Deferred Maintenance:** | $5,789 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LIBBY | **Ext. Gross Area:** | 635 |
| **Building Code:** | T7910090283 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $67,241 |
| **Building Name:** | LIBBY - LOADER STORAGE | **Address:** | 59420 MN-65 | **Deferred Maintenance:** | $5,694 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LIBBY | **Ext. Gross Area:** | 560 |

### *Site: T791A20228 - GOOSEBERRY FALLS - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020228 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $190,136 |
| **Building Name:** | GOOSEBERRY FALLS-SALT/SAND STORAGE | **Address:** | | **Deferred Maintenance:** | $15,155 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BEAVER BAY | **Ext. Gross Area:** | 1,597 |

### *Site: T791A20230 - TEMPERANCE RIVER - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020230 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $94,792 |
| **Building Name:** | TEMPERANCE RIVER - SALT/SAND STRG | **Address:** | 7631 HIGHWAY 61 | **Deferred Maintenance:** | $18,486 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | TOFTE | **Ext. Gross Area:** | 798 |
| **Building Code:** | T7910090270 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $75,313 |
| **Building Name:** | TEMPERANCE RIVER - MISC STORAGE | **Address:** | 7631 HIGHWAY 61 | **Deferred Maintenance:** | $19,635 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | TOFTE | **Ext. Gross Area:** | 240 |

### *Site: T791A20231 - RESERVATION RIVER - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020217 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $5,849 |
| **Building Name:** | RESERVATION RIVER - SALT/SAND STRG | **Address:** | 6081 MN HWY 61 | **Deferred Maintenance:** | $2,319 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | HOVLAND | **Ext. Gross Area:** | 80 |
| **Building Code:** | T7910020231 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $126,864 |
| **Building Name:** | RESERVATION RIVER - SALT/SAND STRG | **Address:** | 6081 MN HWY 61 | **Deferred Maintenance:** | $26,975 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | HOVLAND | **Ext. Gross Area:** | 1,068 |
| **Building Code:** | T7910090265 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $94,814 |
| **Building Name:** | RESERVATION RIVER - MISC STORAGE | **Address:** | 6081 MN HWY 61 | **Deferred Maintenance:** | $11,805 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | HOVLAND | **Ext. Gross Area:** | 705 |

### *Site: T791A90209 - DUXBURY - TOWER SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090209 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $369,972 |
| **Building Name:** | DUXBURY - MISC STORAGE | **Address:** | 60449 Duxbury Road | **Deferred Maintenance:** | $78,320 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 624 |
| **Building Code:** | T7910090210 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $244,613 |
| **Building Name:** | DUXBURY - POLE STORAGE | **Address:** | 60449 Duxbury Road | **Deferred Maintenance:** | $29,258 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 1,760 |

### *Site: T791A90211 - GRAND MARAIS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020239 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $619,914 |
| **Building Name:** | GRAND MARAIS - SALT/SAND STORAGE | **Address:** | 1361 East US Hwy 61 | **Deferred Maintenance:** | $12,398 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 8,000 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090211 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,199,134 |
| **Building Name:** | GRAND MARAIS - TRUCK STATION | **Address:** | 1361 East US Hwy 61 | **Deferred Maintenance:** | $284,762 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 5,286 |
| **Building Code:** | T7910090287 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $39,219 |
| **Building Name:** | GRAND MARAIS - BRINE BUILDING | **Address:** | 1361 East US Hwy 61 | **Deferred Maintenance:** | $3,744 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 117 |
| **Building Code:** | T7910090291 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $298,619 |
| **Building Name:** | GRAND MARAIS - POLE STORAGE BLDG | **Address:** | 1361 East US Hwy 61 | **Deferred Maintenance:** | $37,682 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 2,560 |

### *Site: T791A90221 - DULUTH - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020223 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $795,969 |
| **Building Name:** | DULUTH - SALT/SAND STORAGE | **Address:** | 1123 Mesaba Avenue | **Deferred Maintenance:** | $73,282 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 6,104 |
| **Building Code:** | T7910090208 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $432,997 |
| **Building Name:** | DULUTH - POLE STORAGE | **Address:** | 1123 Mesaba Avenue | **Deferred Maintenance:** | $66,472 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,160 |
| **Building Code:** | T7910090221 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $37,898,451 |
| **Building Name:** | DULUTH - HEADQUARTERS | **Address:** | 1123 Mesaba Avenue | **Deferred Maintenance:** | $10,124,073 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 125,938 |
| **Building Code:** | T7910090289 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $545,831 |
| **Building Name:** | DULUTH - POLE STORAGE BLDG | **Address:** | 1123 Mesaba Avenue | **Deferred Maintenance:** | $68,829 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,160 |

### *Site: T791A90222 - FLOODWOOD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020209 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $164,651 |
| **Building Name:** | FLOODWOOD - SALT/SAND STORAGE | **Address:** | 106 WEST HWY 2 | **Deferred Maintenance:** | $24,594 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 1,852 |
| **Building Code:** | T7910090222 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,153,453 |
| **Building Name:** | FLOODWOOD - TRUCK STATION | **Address:** | 106 WEST HWY 2 | **Deferred Maintenance:** | $252,014 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 6,508 |
| **Building Code:** | T7910090225 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $262,282 |
| **Building Name:** | FLOODWOOD - MISC STORAGE | **Address:** | 106 WEST HWY 2 | **Deferred Maintenance:** | $39,288 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 1,590 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090252 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,915 |
| **Building Name:** | FLOODWOOD - MISC STORAGE | **Address:** | 106 WEST HWY 2 | **Deferred Maintenance:** | $10,651 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 400 |
| **Building Code:** | T7910090288 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $34,996 |
| **Building Name:** | FLOODWOOD - BRINE BUILDING | **Address:** | 106 WEST HWY 2 | **Deferred Maintenance:** | $700 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 117 |

### *Site: T791A90223 - SILVER CLIFF - TUNNEL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090223 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $5,591,135 |
| **Building Name:** | SILVER CLIFF - TUNNEL SERVICE | **Address:** | TH 61 5 MI NE of Two Harbors | **Deferred Maintenance:** | $1,798,311 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 1,113 |

### *Site: T791A90224 - SILVER BAY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020235 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $441,787 |
| **Building Name:** | SILVER BAY - SALT/SAND STORAGE | **Address:** | 5163 Highway 61 | **Deferred Maintenance:** | $75,374 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 4,800 |
| **Building Code:** | T7910090224 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,459,243 |
| **Building Name:** | SILVER BAY - TRUCK STATION | **Address:** | 5163 Highway 61 | **Deferred Maintenance:** | $38,807 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 7,187 |
| **Building Code:** | T7910090232 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $450,547 |
| **Building Name:** | SILVER BAY - POLE STORAGE | **Address:** | 5163 Highway 61 | **Deferred Maintenance:** | $9,751 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 4,032 |
| **Building Code:** | T7910090240 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $36,013 |
| **Building Name:** | SILVER BAY - BRINE BUILDING | **Address:** | 5163 Highway 61 | **Deferred Maintenance:** | $720 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 117 |

### *Site: T791A90227 - LAFAYETTE BLUFF - TUNNEL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090227 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $3,512,344 |
| **Building Name:** | LAFAYETTE BLUFF - TUNNEL SERVICE | **Address:** | TH 61-7.5 MI NE of Two Harbors | **Deferred Maintenance:** | $347,453 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 654 |

### *Site: T791A90229 - PINE CITY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020229 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $647,430 |
| **Building Name:** | PINE CITY - SALT/SAND STORAGE | **Address:** | 905 Hillside SW | **Deferred Maintenance:** | $128,462 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | PINE CITY | **Ext. Gross Area:** | 8,297 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090229 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,483,042 |
| **Building Name:** | PINE CITY - TRUCK STATION | **Address:** | 905 Hillside SW | **Deferred Maintenance:** | $393,141 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | PINE CITY | **Ext. Gross Area:** | 8,598 |
| **Building Code:** | T7910090244 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,677 |
| **Building Name:** | PINE CITY - BRINE BUILDING | **Address:** | 905 Hillside SW | **Deferred Maintenance:** | $634 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PINE CITY | **Ext. Gross Area:** | 117 |

### *Site: T791A90230 - SANDSTONE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020202 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $256,744 |
| **Building Name:** | SANDSTONE - SALT/SAND STORAGE | **Address:** | 1618 HWY 23 N | **Deferred Maintenance:** | $29,222 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 2,676 |
| **Building Code:** | T7910090202 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $405,575 |
| **Building Name:** | SANDSTONE - EQUIP STORAGE | **Address:** | 1618 Hwy 23 N | **Deferred Maintenance:** | $88,124 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 2,889 |
| **Building Code:** | T7910090230 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,650,135 |
| **Building Name:** | SANDSTONE - TRUCK STATION | **Address:** | 1618 Hwy 23 N | **Deferred Maintenance:** | $62,157 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 11,012 |
| **Building Code:** | T7910090243 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,677 |
| **Building Name:** | SANDSTONE - BRINE BUILDING | **Address:** | 1618 Hwy 23 N | **Deferred Maintenance:** | $634 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 117 |
| **Building Code:** | T7910090277 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $236,841 |
| **Building Name:** | SANDSTONE - MISC STORAGE | **Address:** | 1618 Hwy 23 N | **Deferred Maintenance:** | $28,735 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 2,058 |

### *Site: T791A90245 - TWO HARBORS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020240 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $745,516 |
| **Building Name:** | TWO HARBORS - SALT/SAND STORAGE | **Address:** | 1561 Hwy 2 | **Deferred Maintenance:** | $14,910 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 8,100 |
| **Building Code:** | T7910090204 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $37,711 |
| **Building Name:** | TWO HARBORS - BRINE BUILDING | **Address:** | 1561 Hwy 2 | **Deferred Maintenance:** | $3,600 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 117 |
| **Building Code:** | T7910090235 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $366,250 |
| **Building Name:** | TWO HARBORS-COLD STORAGE | **Address:** | 1561 Hwy 2 | **Deferred Maintenance:** | $7,325 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 4,032 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090245 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,706,476 |
| **Building Name:** | TWO HARBORS - TRUCK STATION | **Address:** | 1561 Hwy 2 | **Deferred Maintenance:** | $350,350 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 8,705 |

### *Site: T791A90246 - CARLTON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020233 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,449,840 |
| **Building Name:** | CARLTON - SALT/SAND STORAGE | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $218,959 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 14,950 |
| **Building Code:** | T7910090207 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $92,504 |
| **Building Name:** | CARLTON - MISC STORAGE | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $23,671 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 720 |
| **Building Code:** | T7910090217 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $973,175 |
| **Building Name:** | CARLTON - OLD BRIDGE CREW | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $142,061 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 5,288 |
| **Building Code:** | T7910090218 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $245,116 |
| **Building Name:** | CARLTON - MISC STORAGE | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $47,483 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 2,100 |
| **Building Code:** | T7910090234 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,175,699 |
| **Building Name:** | CARLTON - BRIDGE CREW BLDG | **Address:** | 1515 HWY 210 | **Deferred Maintenance:** | $23,514 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CARLTON | **Ext. Gross Area:** | 6,571 |
| **Building Code:** | T7910090246 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,352,667 |
| **Building Name:** | CARLTON - TRUCK STATION | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $404,919 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 12,333 |
| **Building Code:** | T7910090253 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $84,442 |
| **Building Name:** | CARLTON - MISC STORAGE | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $24,597 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 796 |
| **Building Code:** | T7910090296 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $281,814 |
| **Building Name:** | CARLTON - BRIDGE CREW STORAGE | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $20,284 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 2,586 |
| **Building Code:** | T7910090297 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $100,308 |
| **Building Name:** | CARLTON - LOADER STORAGE BLDG | **Address:** | 1515 Hwy 210 | **Deferred Maintenance:** | $6,640 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 847 |

### *Site: T791A90256 - NOPEMING - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020236 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,448,271 |
| **Building Name:** | NOPEMING - SALT/SAND STORAGE | **Address:** | 2650 Midway Road | **Deferred Maintenance:** | $28,965 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NOPEMING | **Ext. Gross Area:** | 16,800 |
| **Building Code:** | T7910090231 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $143,280 |
| **Building Name:** | NOPEMING - BRINE BUILDING | **Address:** | 2650 Midway Road | **Deferred Maintenance:** | $2,866 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NOPEMING | **Ext. Gross Area:** | 1,012 |
| **Building Code:** | T7910090256 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,137,049 |
| **Building Name:** | NOPEMING - TRUCK STATION | **Address:** | 2650 Midway Road | **Deferred Maintenance:** | $462,044 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | NOPEMING | **Ext. Gross Area:** | 16,023 |
| **Building Code:** | T7910090276 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $313,251 |
| **Building Name:** | NOPEMING - MISC STORAGE | **Address:** | 2650 Midway Road | **Deferred Maintenance:** | $51,395 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | NOPEMING | **Ext. Gross Area:** | 2,184 |
| **Building Code:** | T7910090286 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $88,027 |
| **Building Name:** | NOPEMING - HAZ MAT BLDG | **Address:** | 2650 Midway Road | **Deferred Maintenance:** | $29,049 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | NOPEMING | **Ext. Gross Area:** | 80 |
| **Building Code:** | T7910090290 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $451,594 |
| **Building Name:** | NOPEMING - POLE STORAGE BLDG | **Address:** | 2650 Midway Road | **Deferred Maintenance:** | $75,579 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | NOPEMING | **Ext. Gross Area:** | 4,232 |

### *Site: T791A90257 - MOOSE LAKE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020241 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $508,939 |
| **Building Name:** | MOOSE LAKE - SALT/SAND STORAGE | **Address:** | 975 Hwy 73 | **Deferred Maintenance:** | $10,179 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 6,400 |
| **Building Code:** | T7910090237 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,828 |
| **Building Name:** | MOOSE LAKE - MISC STORAGE | **Address:** | 975 Hwy 73 | **Deferred Maintenance:** | $10,652 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 421 |
| **Building Code:** | T7910090238 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,415 |
| **Building Name:** | MOOSE LAKE - BRINE BUILDING | **Address:** | 975 Hwy 73 | **Deferred Maintenance:** | $588 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 130 |
| **Building Code:** | T7910090257 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $948,151 |
| **Building Name:** | MOOSE LAKE - TRUCK STATION | **Address:** | 975 Hwy 73 | **Deferred Maintenance:** | $196,553 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 5,520 |
| **Building Code:** | T7910090295 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $417,109 |
| **Building Name:** | MOOSE LAKE - POLE STORAGE BLDG | **Address:** | 975 Hwy 73 | **Deferred Maintenance:** | $8,899 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MOOSE LAKE | **Ext. Gross Area:** | 3,513 |

### *Site: T791A90260 - DULUTH ERICKSON - TUNNEL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090260 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,856,910 |
| **Building Name:** | DULUTH - ERICKSON TUNNEL - SVC BLDG | **Address:** | Lief Erickson Tunnel | **Deferred Maintenance:** | $1,083,658 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 6,403 |

### *Site: T791A90266 - MCGREGOR - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020238 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $565,664 |
| **Building Name:** | McGREGOR - SALT/SAND STORAGE | **Address:** | 38182 Mn Hwy 65 | **Deferred Maintenance:** | $11,313 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 7,200 |
| **Building Code:** | T7910090273 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,493,833 |
| **Building Name:** | MCGREGOR- TRUCK STATION(NEW) | **Address:** | 38182 Mn Hwy 65 | **Deferred Maintenance:** | $29,877 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 7,460 |
| **Building Code:** | T7910090292 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $245,097 |
| **Building Name:** | MCGREGOR - POLE STORAGE BLDG | **Address:** | 38182 Mn Hwy 65 | **Deferred Maintenance:** | $15,726 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 2,560 |

### *Site: T791A90281 - BLACK BEAR - SCALE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090281 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $136,607 |
| **Building Name:** | CARLTON - HAZARD MATL STORAGE | **Address:** | 1369 Interstate 35 | **Deferred Maintenance:** | $19,165 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | CARLTON | **Ext. Gross Area:** | 1,124 |
| **Building Code:** | T7910090284 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $302,347 |
| **Building Name:** | CARLTON SB35 - OFFICE BUILDING | **Address:** | 1369 Interstate 35 | **Deferred Maintenance:** | $57,126 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | CARLTON | **Ext. Gross Area:** | 1,352 |

### *Site: T791A90294 - DULUTH - AIR QUALITY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090294 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $49,733 |
| **Building Name:** | DULUTH - AIR QUALITY - SVC BLDG | **Address:** | Superior Street Near Lief Erickson T | **Deferred Maintenance:** | $4,911 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 312 |

### *Site: T791A90298 - PIKE LAKE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910020237 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $822,584 |
| **Building Name:** | PIKE LAKE - SALT/SAND STORAGE | **Address:** | 4787 Midway Road | **Deferred Maintenance:** | $16,452 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | DULUTH | **Ext. Gross Area:** | 9,542 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090285 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $108,103 |
| **Building Name:** | PIKE LAKE - BRINE BUILDING | **Address:** | 4787 Midway Road | **Deferred Maintenance:** | $13,761 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 784 |
| **Building Code:** | T7910090299 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $631,693 |
| **Building Name:** | PIKE LAKE - POLE STORAGE | **Address:** | 4787 Midway Road | **Deferred Maintenance:** | $39,081 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,664 |

### *Site: T791A92125 - SAGINAW - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910090216 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $100,747 |
| **Building Name:** | SAGINAW - WS MISC STORAGE | **Address:** | Junction US 2 and TH 33 | **Deferred Maintenance:** | $17,997 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | SAGINAW | **Ext. Gross Area:** | 624 |
| **Building Code:** | T7910092125 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $665,389 |
| **Building Name:** | SAGINAW - WEIGH SCALE | **Address:** | Junction US 2 and TH 33 | **Deferred Maintenance:** | $78,620 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | SAGINAW | **Ext. Gross Area:** | 3,065 |

### *Site: T791AR035880 - KETTLE RIVER - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095105 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $925,880 |
| **Building Name:** | KETTLE RIVER - REST AREA | **Address:** | I-35 North Bound | **Deferred Maintenance:** | $86,490 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 3,182 |
| **Building Code:** | T7910095130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $16,645 |
| **Building Name:** | KETTLE RIVER - RA MISC STORAGE | **Address:** | I-35 Northbound | **Deferred Maintenance:** | $1,850 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SANDSTONE | **Ext. Gross Area:** | 144 |

### *Site: T791AR045880 - GENERAL ANDREWS - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095106 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $925,880 |
| **Building Name:** | GENERAL ANDREWS - REST AREA | **Address:** | I-35 Southbound | **Deferred Maintenance:** | $80,961 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 3,182 |
| **Building Code:** | T7910095131 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $14,312 |
| **Building Name:** | GENERAL ANDREWS - RA MISC STORAGE | **Address:** | I-35 Southbound | **Deferred Maintenance:** | $1,803 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WILLOW RIVER | **Ext. Gross Area:** | 157 |

### *Site: T791AR216982 - THOMPSON HILL - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910092141 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $760,873 |
| **Building Name:** | THOMPSON HILL- PATROL OFFICE | **Address:** | 8525 West Skyline Drive | **Deferred Maintenance:** | $123,679 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 2,731 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095104 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,286,981 |
| **Building Name:** | THOMPSON HILL - REST AREA TIC | **Address:** | 8525 West Skyline Drive | **Deferred Maintenance:** | $299,687 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 4,185 |
| **Building Code:** | T7910095132 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,882 |
| **Building Name:** | THOMPSON HILL - RA MISC STORAGE | **Address:** | 8525 West Skyline Drive | **Deferred Maintenance:** | $1,354 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | DULUTH | **Ext. Gross Area:** | 120 |

### *Site: T791AR340980 - CULKIN - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095103 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $435,934 |
| **Building Name:** | CULKIN - REST AREA | **Address:** | I-35 Northbound | **Deferred Maintenance:** | $55,965 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MAHTOWA | **Ext. Gross Area:** | 1,964 |
| **Building Code:** | T7910095133 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $29,441 |
| **Building Name:** | CULKIN - RA MISC STORAGE | **Address:** | I-35 Northbound | **Deferred Maintenance:** | $3,836 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MAHTOWA | **Ext. Gross Area:** | 384 |

### *Site: T791AR356917 - INDEPENDANCE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095117 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $103,942 |
| **Building Name:** | INDEPENDENCE - REST AREA | **Address:** | Junction TH 53 and TH 33 | **Deferred Maintenance:** | $12,345 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | INDEPENDENCE | **Ext. Gross Area:** | 154 |

### *Site: T791AR363880 - KNIFE RIVER - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095116 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $109,339 |
| **Building Name:** | KNIFE RIVER - REST AREA | **Address:** | TH 61 | **Deferred Maintenance:** | $24,996 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | DULUTH | **Ext. Gross Area:** | 322 |

### *Site: T791AR371604 - MOUNT JOSEPHINE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095126 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $142,170 |
| **Building Name:** | MOUNT JOSEPHINE: RA | **Address:** | Hwy 61 | **Deferred Maintenance:** | $2,843 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRAND PORTAGE | **Ext. Gross Area:** | 392 |

### *Site: T791AR380121 - MCGREGOR - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095122 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $95,608 |
| **Building Name:** | McGREGOR - REST AREA | **Address:** | TH 210 | **Deferred Maintenance:** | $16,464 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MCGREGOR | **Ext. Gross Area:** | 492 |

### *Site: T791AR743806 - TETTEGOUCHE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095127 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,712,700 |
| **Building Name:** | TETTEGOUCHE - REST AREA | **Address:** | 474 HIGHWAY 61 E | **Deferred Maintenance:** | $87,466 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | SILVER BAY | **Ext. Gross Area:** | 4,154 |

### *Site: T791AR876906 - FLOODWOOD RA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095135 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $392,022 |
| **Building Name:** | FLOODWOOD - REST AREA | **Address:** | 223 W HIGHWAY 2 | **Deferred Maintenance:** | $103,945 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | FLOODWOOD | **Ext. Gross Area:** | 1,600 |

### *Site: T791AR883805 - GOOSEBERRY FALLS - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095121 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,115,883 |
| **Building Name:** | GOOSEBERRY FALLS - REST AREA | **Address:** | 3206 Highway 61 | **Deferred Maintenance:** | $112,223 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | TWO HARBORS | **Ext. Gross Area:** | 3,137 |

### *Site: T791AR921602 - CUT FACE CREEK - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095119 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $102,390 |
| **Building Name:** | CUT FACE CREEK - REST AREA | **Address:** | Highway 61 | **Deferred Maintenance:** | $8,032 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GRAND MARAIS | **Ext. Gross Area:** | 492 |

### *Site: T791AR931601 - CROSS RIVER - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095123 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $102,390 |
| **Building Name:** | CROSS RIVER - REST AREA | **Address:** | Highway 61 | **Deferred Maintenance:** | $8,032 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | SCHROEDER | **Ext. Gross Area:** | 492 |

### *Site: T791AR940102 - BIG SANDY LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7910095124 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $27,886 |
| **Building Name:** | BIG SANDY LAKE - REST AREA | **Address:** | Trunk Highway 65 | **Deferred Maintenance:** | $1,331 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | PALISADE | **Ext. Gross Area:** | 154 |

### *Site: T791B20107 - MELRUDE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020107 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $46,410 |
| **Building Name:** | MELRUDE - SALT/SAND STORAGE | **Address:** | TH53(SB) 0.1 MILE N OF CO RD 5 | **Deferred Maintenance:** | $5,379 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | COTTON | **Ext. Gross Area:** | 533 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915090164 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $86,156 |
| **Building Name:** | MELRUDE - MISC STORAGE | **Address:** | TH53(SB) 0.1 MILE N OF CO RD 5 | **Deferred Maintenance:** | $5,814 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | COTTON | **Ext. Gross Area:** | 660 |

### *Site: T791B20111 - CANYON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020111 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $85,082 |
| **Building Name:** | CANYON - SALT/SAND STORAGE | **Address:** | 7285 Hwy 53 | **Deferred Maintenance:** | $6,510 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | CANYON | **Ext. Gross Area:** | 957 |
| **Building Code:** | T7915090163 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $56,393 |
| **Building Name:** | CANYON - MISC STORAGE | **Address:** | 7285 Hwy 53 | **Deferred Maintenance:** | $3,806 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CANYON | **Ext. Gross Area:** | 432 |

### *Site: T791B20112 - BUCK LAKE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020112 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $48,103 |
| **Building Name:** | BUCK LAKE - SALT/SAND STORAGE | **Address:** | 49256 MN HWY 65 | **Deferred Maintenance:** | $3,833 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | NASHWAUK | **Ext. Gross Area:** | 554 |
| **Building Code:** | T7915090167 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $69,321 |
| **Building Name:** | BUCK LAKE - MISC STORAGE | **Address:** | 49256 MN HWY 65 | **Deferred Maintenance:** | $1,801 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | NASHWAUK | **Ext. Gross Area:** | 560 |

### *Site: T791B20116 - TALMOON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020116 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $44,009 |
| **Building Name:** | TALMOON - SALT/SAND STORAGE | **Address:** | TH 6 - 1.75 MI So of TH286 | **Deferred Maintenance:** | $3,346 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | TALMOON | **Ext. Gross Area:** | 533 |
| **Building Code:** | T7915090161 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $69,321 |
| **Building Name:** | TALMOON - MISC STORAGE | **Address:** | TH 6 - 1.75 MI So of TH286 | **Deferred Maintenance:** | $4,678 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | TALMOON | **Ext. Gross Area:** | 560 |

### *Site: T791B20120 - BIG FALLS - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020120 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $277,117 |
| **Building Name:** | BIG FALLS - SALT/SAND STORAGE | **Address:** | 7515 COUNTY ROAD 13 | **Deferred Maintenance:** | $27,721 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BIG FALLS | **Ext. Gross Area:** | 2,528 |

### *Site: T791B20121 - KINMOUNT - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020121 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $275,988 |
| **Building Name:** | KINMOUNT - SALT/SAND STORAGE | **Address:** | TH 53 & Sheep Ranch Road | **Deferred Maintenance:** | $26,716 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ORR | **Ext. Gross Area:** | 2,496 |

### *Site: T791B20122 - BIWABIK - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020122 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $168,291 |
| **Building Name:** | BIWABIK - SALT/SAND STORAGE | **Address:** | 600 1st St So | **Deferred Maintenance:** | $36,103 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BIWABIK | **Ext. Gross Area:** | 1,522 |

### *Site: T791B20125 - LINDEN GROVE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020125 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $72,271 |
| **Building Name:** | LINDEN GROVE - SALT/SAND STORAGE | **Address:** | 11193 Hwy 1 | **Deferred Maintenance:** | $4,492 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LINDEN GROVE | **Ext. Gross Area:** | 830 |

### *Site: T791B20132 - ELY - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020132 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $141,320 |
| **Building Name:** | ELY - SALT/SAND STORAGE | **Address:** | 1389 Hidden Valley Trail | **Deferred Maintenance:** | $5,132 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ELY | **Ext. Gross Area:** | 12,000 |

### *Site: T791B90110 - HIBBING - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020113 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $236,106 |
| **Building Name:** | HIBBING - SALT/SAND STORAGE | **Address:** | 3801 Marksmanship Center Road | **Deferred Maintenance:** | $90,015 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | HIBBING | **Ext. Gross Area:** | 2,528 |
| **Building Code:** | T7915090110 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,514,422 |
| **Building Name:** | HIBBING - STORAGE FACILITY | **Address:** | 3801 Marksmanship Center Road | **Deferred Maintenance:** | $347,234 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HIBBING | **Ext. Gross Area:** | 10,353 |
| **Building Code:** | T7915090139 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $357,260 |
| **Building Name:** | HIBBING - MISC STORAGE | **Address:** | 3801 Marksmanship Center Road | **Deferred Maintenance:** | $91,078 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HIBBING | **Ext. Gross Area:** | 2,721 |

### *Site: T791B90112 - COOK - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020109 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $267,953 |
| **Building Name:** | COOK - SALT/SAND STORAGE | **Address:** | 305 River Street | **Deferred Maintenance:** | $84,102 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | COOK | **Ext. Gross Area:** | 2,528 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915090112 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,057,778 |
| **Building Name:** | COOK - TRUCK STATION | **Address:** | 305 South River Street | **Deferred Maintenance:** | $181,234 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 6,658 |
| **Building Code:** | T7915090145 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $228,681 |
| **Building Name:** | COOK - POLE STORAGE BLDG | **Address:** | 305 South River Street | **Deferred Maintenance:** | $38,464 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | COOK | **Ext. Gross Area:** | 1,590 |

### *Site: T791B90122 - ELY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020123 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $164,651 |
| **Building Name:** | ELY - SALT/SAND STORAGE | **Address:** | 2100 East Sheridan Street | **Deferred Maintenance:** | $13,379 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 1,852 |
| **Building Code:** | T7915090122 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $783,781 |
| **Building Name:** | ELY - TRUCK STATION | **Address:** | 2100 East Sheridan Street | **Deferred Maintenance:** | $85,894 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ELY | **Ext. Gross Area:** | 3,778 |
| **Building Code:** | T7915090146 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $115,339 |
| **Building Name:** | ELY - MISC STORAGE | **Address:** | 2100 East Sheridan Street | **Deferred Maintenance:** | $19,666 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ELY | **Ext. Gross Area:** | 1,003 |

### *Site: T791B90123 - VIRGINIA - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020118 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $564,771 |
| **Building Name:** | VIRGINIA - SALT/SAND STORAGE | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $186,039 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 5,011 |
| **Building Code:** | T7915090102 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $55,439 |
| **Building Name:** | VIRGINIA - MISC STORAGE | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $7,104 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 540 |
| **Building Code:** | T7915090123 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $21,873,936 |
| **Building Name:** | VIRGINIA - MAINTENANCE HEADQUARTERS | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $5,920,556 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 81,823 |
| **Building Code:** | T7915090127 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $122,134 |
| **Building Name:** | VIRGINIA - EQUIP STORAGE | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $68,085 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 1,537 |
| **Building Code:** | T7915090134 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $32,034 |
| **Building Name:** | VIRGINIA - MISC STORAGE | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $16,886 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 502 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915090138 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $317,085 |
| **Building Name:** | VIRGINIA - MISC STORAGE | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $108,660 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 2,875 |
| **Building Code:** | T7915090142 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $55,099 |
| **Building Name:** | VIRGINIA - MISC STORAGE | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $29,044 |
| **Facility Condition Index:** | 0.53 - Crisis | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 780 |
| **Building Code:** | T7915090149 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $912,268 |
| **Building Name:** | VIRGINIA - POLE STORAGE BLDG | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $38,967 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 7,414 |
| **Building Code:** | T7915090159 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $87,936 |
| **Building Name:** | VIRGINIA - BRINE BUILDING | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $4,872 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 619 |
| **Building Code:** | T7915090160 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $566,986 |
| **Building Name:** | VIRGINIA - POLE STORAGE BLDG | **Address:** | 101 N Hoover Road | **Deferred Maintenance:** | $14,387 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | VIRGINIA | **Ext. Gross Area:** | 5,261 |

### *Site: T791B90133 - LITTLEFORK - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020124 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $324,990 |
| **Building Name:** | LITTLEFORK - SALT/SAND STORAGE | **Address:** | 4892 Co Rd 22 | **Deferred Maintenance:** | $27,185 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 2,568 |
| **Building Code:** | T7915090133 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,349,593 |
| **Building Name:** | LITTLEFORK - TRUCK STATION | **Address:** | 4892 Co Rd 22 | **Deferred Maintenance:** | $317,758 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 6,637 |
| **Building Code:** | T7915090154 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $197,821 |
| **Building Name:** | LITTLEFORK - MISC STORAGE | **Address:** | 4892 Co Rd 22 | **Deferred Maintenance:** | $37,171 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LITTLEFORK | **Ext. Gross Area:** | 1,360 |

### *Site: T791B90140 - INTERNATIONAL FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020115 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $194,609 |
| **Building Name:** | INTERNATIONAL FALLS - SALT/SAND STO | **Address:** | 2407 Highway 332 South | **Deferred Maintenance:** | $23,618 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 1,852 |
| **Building Code:** | T7915020129 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $590,980 |
| **Building Name:** | INTERNATIONAL FALLS - SALT/SAND STO | **Address:** | 2407 Highway 332 South | **Deferred Maintenance:** | $111,596 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 6,915 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915090144 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $139,950 |
| **Building Name:** | INTERNATIONAL FALLS - MISC STORAGE | **Address:** | 2407 Highway 332 South | **Deferred Maintenance:** | $16,461 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 1,070 |
| **Building Code:** | T7915090148 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $135,939 |
| **Building Name:** | INTERNATIONAL FALLS - MISC STORAGE | **Address:** | 2407 Highway 332 South | **Deferred Maintenance:** | $19,308 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 893 |
| **Building Code:** | T7915090168 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,723,701 |
| **Building Name:** | INTERNATIONAL FALLS-TRUCK STATION | **Address:** | 2407 Highway 332 South | **Deferred Maintenance:** | $35,317 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 8,862 |
| **Building Code:** | T7915090170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $34,694 |
| **Building Name:** | INTERNATIONAL FALLS-BRINE BLDG | **Address:** | 2407 Highway 332 South | **Deferred Maintenance:** | $694 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | INTL. FALLS | **Ext. Gross Area:** | 117 |

### *Site: T791B90143 - GRAND RAPIDS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020119 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $254,094 |
| **Building Name:** | GRAND RAPIDS - SALT/SAND STORAGE | **Address:** | 2606 Hwy 2 East | **Deferred Maintenance:** | $45,354 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 2,528 |
| **Building Code:** | T7915020131 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,030,102 |
| **Building Name:** | GRAND RAPIDS - SALT/SAND STORAGE | **Address:** | 2606 Hwy 2 East | **Deferred Maintenance:** | $194,517 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 12,601 |
| **Building Code:** | T7915090130 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $41,320 |
| **Building Name:** | GRAND RAPIDS - MISC STORAGE | **Address:** | 2606 Hwy 2 East | **Deferred Maintenance:** | $11,574 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 432 |
| **Building Code:** | T7915090143 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,291,373 |
| **Building Name:** | GRAND RAPIDS - TRUCK STATION | **Address:** | 2606 Hwy 2 East | **Deferred Maintenance:** | $451,929 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 17,668 |
| **Building Code:** | T7915090152 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $74,109 |
| **Building Name:** | GRAND RAPIDS - MISC STORAGE | **Address:** | 2606 Hwy 2 East | **Deferred Maintenance:** | $6,964 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 576 |
| **Building Code:** | T7915090153 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $492,721 |
| **Building Name:** | GRAND RAPIDS - POLE STORAGE BLDG | **Address:** | 2606 Hwy 2 East | **Deferred Maintenance:** | $33,509 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GRAND RAPIDS | **Ext. Gross Area:** | 4,992 |

### *Site: T791B90155 - HIBBING - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020127 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $999,818 |
| **Building Name:** | HIBBING - SALT/SAND STORAGE | **Address:** | 1425 East 23rd Street | **Deferred Maintenance:** | $134,673 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 5,163 |
| **Building Code:** | T7915020128 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $299,209 |
| **Building Name:** | HIBBING - SALT/SAND STORAGE | **Address:** | 1425 East 23rd Street | **Deferred Maintenance:** | $23,854 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 2,706 |
| **Building Code:** | T7915090155 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,659,209 |
| **Building Name:** | HIBBING - TRUCK STATION | **Address:** | 1425 East 23rd Street | **Deferred Maintenance:** | $401,245 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HIBBING | **Ext. Gross Area:** | 51,214 |
| **Building Code:** | T7915090162 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $459,643 |
| **Building Name:** | HIBBING - POLE STORAGE BLDG | **Address:** | 1425 East 23rd Street | **Deferred Maintenance:** | $22,242 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | HIBBING | **Ext. Gross Area:** | 4,416 |

### *Site: T791B90156 - DEER LAKE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915020126 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $670,590 |
| **Building Name:** | DEER LAKE - SALT/SAND STORAGE | **Address:** | 27267 State Highway 1 | **Deferred Maintenance:** | $43,576 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | EFFIE | **Ext. Gross Area:** | 5,417 |
| **Building Code:** | T7915090156 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,238,099 |
| **Building Name:** | DEER LAKE - TRUCK STATION | **Address:** | 27267 State Hwy 1 | **Deferred Maintenance:** | $66,999 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | EFFIE | **Ext. Gross Area:** | 6,823 |
| **Building Code:** | T7915090157 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $326,058 |
| **Building Name:** | DEER LAKE - POLE STORAGE BLDG | **Address:** | 27267 State Highway 1 | **Deferred Maintenance:** | $11,127 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | EFFIE | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | T7915090171 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,186 |
| **Building Name:** | DEER LAKE - BRINE BUILDING | **Address:** | 27267 State Hwy 1 | **Deferred Maintenance:** | $664 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | EFFIE | **Ext. Gross Area:** | 117 |

### *Site: T791BR406917 - ANCHOR LAKE - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7915095161 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $822,560 |
| **Building Name:** | ANCHOR LAKE - REST AREA TIC | **Address:** | 2702 Highway 53 | **Deferred Maintenance:** | $176,409 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | EVELETH | **Ext. Gross Area:** | 3,867 |
| **Building Code:** | T7915095180 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,857 |
| **Building Name:** | ANCHOR LAKE - RA MISC STORAGE | **Address:** | 2702 Highway 53 | **Deferred Maintenance:** | $6,404 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | EVELETH | **Ext. Gross Area:** | 256 |

### *Site: T792A20311 - WASKISH - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020311 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $223,969 |
| **Building Name:** | WASHKISH - SALT/SAND STORAGE | **Address:** | 51701 MN 72 | **Deferred Maintenance:** | $49,856 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WASKISH | **Ext. Gross Area:** | 4,985 |

### *Site: T792A20317 - LOMAN PIT - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020317 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $120,423 |
| **Building Name:** | LOMAN PIT - SALT/SAND STORAGE | **Address:** | 7602 MN-11 | **Deferred Maintenance:** | $9,802 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LOMAN | **Ext. Gross Area:** | 1,008 |

### *Site: T792A20318 - LAKE ITASCA - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020318 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $393,933 |
| **Building Name:** | LAKE ITASCA - SALT/SAND STORAGE | **Address:** | 16379 CR 108 | **Deferred Maintenance:** | $34,010 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LAKE ITASCA | **Ext. Gross Area:** | 3,757 |

### *Site: T792A20518 - WARROAD - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020518 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $151,132 |
| **Building Name:** | WARROAD - SALT/SAND STORAGE | **Address:** | 210 EAST GARFIELD | **Deferred Maintenance:** | $14,586 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WARROAD | **Ext. Gross Area:** | 1,852 |

### *Site: T792A20521 - GREENBUSH - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020521 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $151,132 |
| **Building Name:** | GREENBUSH - SALT/SAND STORAGE | **Address:** | 234 Co Rd 4 | **Deferred Maintenance:** | $11,119 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GREENBUSH | **Ext. Gross Area:** | 1,852 |

### *Site: T792A90308 - BAUDETTE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020304 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $119,298 |
| **Building Name:** | BAUDETTE - SALT/SAND STORAGE | **Address:** | 504 Main Street E | **Deferred Maintenance:** | $14,478 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 1,037 |
| **Building Code:** | T7920020312 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $161,404 |
| **Building Name:** | BAUDETTE - SALT/SAND STORAGE | **Address:** | 504 Main Street E | **Deferred Maintenance:** | $13,603 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 1,037 |
| **Building Code:** | T7920020321 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $508,956 |
| **Building Name:** | BAUDETTE - SALT/SAND STORAGE | **Address:** | 504 Main Street E | **Deferred Maintenance:** | $27,585 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 5,589 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920090312 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $104,025 |
| **Building Name:** | BAUDETTE - MISC STORAGE | **Address:** | 504 Main Street E | **Deferred Maintenance:** | $16,386 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 532 |
| **Building Code:** | T7920090332 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $277,408 |
| **Building Name:** | BAUDETTE - POLE STORAGE | **Address:** | 504 Main Street E | **Deferred Maintenance:** | $35,032 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 2,586 |
| **Building Code:** | T7920090339 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,626,821 |
| **Building Name:** | BAUDETTE - TRUCK STATION | **Address:** | 504 Main Street E | **Deferred Maintenance:** | $42,050 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | BAUDETTE | **Ext. Gross Area:** | 8,017 |

### *Site: T792A90316 - WALKER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020308 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $86,074 |
| **Building Name:** | WALKER - SALT/SAND STORAGE | **Address:** | 8005 Sautbine Road NW | **Deferred Maintenance:** | $6,994 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WALKER | **Ext. Gross Area:** | 1,037 |
| **Building Code:** | T7920020316 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $462,037 |
| **Building Name:** | WALKER - SALT/SAND STORAGE | **Address:** | 8005 Sautbine Road NW | **Deferred Maintenance:** | $71,207 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | WALKER | **Ext. Gross Area:** | 4,669 |
| **Building Code:** | T7920090316 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,767,011 |
| **Building Name:** | WALKER - TRUCK STATION | **Address:** | 8005 Sautbine Road NW | **Deferred Maintenance:** | $306,131 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WALKER | **Ext. Gross Area:** | 7,184 |
| **Building Code:** | T7920090333 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $377,158 |
| **Building Name:** | WALKER - POLE STORAGE | **Address:** | 8005 Sautbine Road NW | **Deferred Maintenance:** | $26,172 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WALKER | **Ext. Gross Area:** | 3,098 |

### *Site: T792A90317 - BAGLEY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020307 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $104,231 |
| **Building Name:** | BAGLEY - SALT/SAND STORAGE | **Address:** | 20602 US 2 | **Deferred Maintenance:** | $12,650 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BAGLEY | **Ext. Gross Area:** | 1,037 |
| **Building Code:** | T7920020315 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $307,518 |
| **Building Name:** | BAGLEY - SALT/SAND STORAGE | **Address:** | 20602 US 2 | **Deferred Maintenance:** | $24,388 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BAGLEY | **Ext. Gross Area:** | 3,424 |
| **Building Code:** | T7920090317 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $985,490 |
| **Building Name:** | BAGLEY - STORAGE FACILITY | **Address:** | 20602 US 2 | **Deferred Maintenance:** | $174,698 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | BAGLEY | **Ext. Gross Area:** | 4,944 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920090324 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $211,589 |
| **Building Name:** | BAGLEY - MISC STORAGE | **Address:** | 20602 US 2 | **Deferred Maintenance:** | $32,282 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | BAGLEY | **Ext. Gross Area:** | 1,793 |
| **Building Code:** | T7920090340 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,596,580 |
| **Building Name:** | BAGLEY TRUCK STATION | **Address:** | 20602 US 2 | **Deferred Maintenance:** | $40,211 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | BAGLEY | **Ext. Gross Area:** | 8,798 |

### *Site: T792A90319 - DEER RIVER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020309 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $402,798 |
| **Building Name:** | DEER RIVER - SALT/SAND STORAGE | **Address:** | 44703 Chase Lake Road | **Deferred Maintenance:** | $53,254 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 5,497 |
| **Building Code:** | T7920090319 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $977,975 |
| **Building Name:** | DEER RIVER - TRUCK STATION | **Address:** | 44703 Chase Lake Road | **Deferred Maintenance:** | $232,748 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 5,144 |
| **Building Code:** | T7920090334 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $252,678 |
| **Building Name:** | DEER RIVER - POLE STORAGE | **Address:** | 44703 Chase Lake Road | **Deferred Maintenance:** | $28,017 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | DEER RIVER | **Ext. Gross Area:** | 266 |

### *Site: T792A90323 - NORTHOME - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020319 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,050,033 |
| **Building Name:** | NORTHOME - SALT/SAND STORAGE | **Address:** | 12080 Town Road 299 | **Deferred Maintenance:** | $135,503 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | NORTHOME | **Ext. Gross Area:** | 10,106 |
| **Building Code:** | T7920090322 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $606,858 |
| **Building Name:** | NORTHOME - UNHEATED STORAGE | **Address:** | 12080 Town Road 299 | **Deferred Maintenance:** | $149,465 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | NORTHOME | **Ext. Gross Area:** | 4,800 |
| **Building Code:** | T7920090323 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $768,828 |
| **Building Name:** | NORTHOME - TRUCK STATION | **Address:** | 12080 Town Road 299 | **Deferred Maintenance:** | $180,691 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | NORTHOME | **Ext. Gross Area:** | 4,283 |

### *Site: T792A90329 - PARK RAPIDS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020302 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $105,395 |
| **Building Name:** | PARK RAPIDS - SALT/SAND STORAGE | **Address:** | 505 Industrial Park Road | **Deferred Maintenance:** | $12,791 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 1,068 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020313 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $329,734 |
| **Building Name:** | PARK RAPIDS - SALT/SAND STORAGE | **Address:** | 505 Industrial Park Road | **Deferred Maintenance:** | $33,278 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 3,008 |
| **Building Code:** | T7920090329 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,264,874 |
| **Building Name:** | PARK RAPIDS - TRUCK STATION | **Address:** | 505 Industrial Park Road | **Deferred Maintenance:** | $181,889 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 7,618 |
| **Building Code:** | T7920090331 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $463,420 |
| **Building Name:** | PARK RAPIDS - POLE STORAGE | **Address:** | 505 Industrial Park Road | **Deferred Maintenance:** | $66,839 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | PARK RAPIDS | **Ext. Gross Area:** | 4,800 |

### *Site: T792A90330 - BEMIDJI - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920020320 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,055,747 |
| **Building Name:** | BEMIDJI - SALT/SAND STORAGE | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $129,448 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 9,382 |
| **Building Code:** | T7920090330 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $32,918,008 |
| **Building Name:** | BEMIDJI - HEADQUARTERS | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $3,180,577 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 113,625 |
| **Building Code:** | T7920090335 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $936,813 |
| **Building Name:** | BEMIDJI - POLE STORAGE | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $118,045 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 8,064 |
| **Building Code:** | T7920090336 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,086,008 |
| **Building Name:** | BEMIDJI - POLE STORAGE | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $149,096 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 8,064 |
| **Building Code:** | T7920090337 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $82,021 |
| **Building Name:** | BEMIDJI - HAZARD MATL STORAGE | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $7,830 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 384 |
| **Building Code:** | T7920090338 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $394,584 |
| **Building Name:** | BEMIDJI - MISC STORAGE | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $31,551 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 3,906 |
| **Building Code:** | T7920090341 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,057,979 |
| **Building Name:** | BEMIDJI - POLE STORAGE | **Address:** | 3920 Hwy 2 West | **Deferred Maintenance:** | $21,160 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BEMIDJI | **Ext. Gross Area:** | 7,300 |

### *Site: T792A90511 - WARREN - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020502 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $207,510 |
| **Building Name:** | WARREN - SALT/SAND STORAGE | **Address:** | 417 South Main Street | **Deferred Maintenance:** | $16,248 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WARREN | **Ext. Gross Area:** | 2,100 |
| **Building Code:** | T7925020526 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $307,668 |
| **Building Name:** | WARREN - SALT/SAND STORAGE | **Address:** | 417 South Main Street | **Deferred Maintenance:** | $24,034 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WARREN | **Ext. Gross Area:** | 3,615 |
| **Building Code:** | T7925090514 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,058 |
| **Building Name:** | WARREN - MISC STORAGE | **Address:** | 417 South Main Street | **Deferred Maintenance:** | $19,906 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | WARREN | **Ext. Gross Area:** | 280 |
| **Building Code:** | T7925090544 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,331,866 |
| **Building Name:** | WARREN - TRUCK STATION | **Address:** | 417 South Main Street | **Deferred Maintenance:** | $47,520 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | WARREN | **Ext. Gross Area:** | 7,260 |

### *Site: T792A90516 - HALLOCK - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020520 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $483,714 |
| **Building Name:** | HALLOCK - SALT/SAND STORAGE | **Address:** | 307 SOUTH COLUMBUS AVENUE | **Deferred Maintenance:** | $32,313 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HALLOCK | **Ext. Gross Area:** | 3,162 |
| **Building Code:** | T7925090516 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,007,224 |
| **Building Name:** | HALLOCK - TRUCK STATION | **Address:** | 307 SOUTH COLUMBUS AVENUE | **Deferred Maintenance:** | $128,076 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | HALLOCK | **Ext. Gross Area:** | 6,056 |
| **Building Code:** | T7925090542 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $261,461 |
| **Building Name:** | HALLOCK - POLE STORAGE | **Address:** | 307 SOUTH COLUMBUS AVENUE | **Deferred Maintenance:** | $16,452 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | HALLOCK | **Ext. Gross Area:** | 2,560 |

### *Site: T792A90517 - ADA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020505 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $76,889 |
| **Building Name:** | ADA - SALT/SAND STORAGE | **Address:** | 508 Fourth Street East | **Deferred Maintenance:** | $7,538 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ADA | **Ext. Gross Area:** | 1,190 |
| **Building Code:** | T7925020515 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $188,152 |
| **Building Name:** | ADA - SALT/SAND STORAGE | **Address:** | 508 Fourth Street East | **Deferred Maintenance:** | $12,079 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ADA | **Ext. Gross Area:** | 1,855 |
| **Building Code:** | T7925020525 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $392,389 |
| **Building Name:** | ADA-SALT/SAND STORAGE | **Address:** | 508 Fourth Street East | **Deferred Maintenance:** | $7,848 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ADA | **Ext. Gross Area:** | 4,800 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925090517 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $977,385 |
| **Building Name:** | ADA - TRUCK STATION | **Address:** | 508 Fourth Street East | **Deferred Maintenance:** | $87,352 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ADA | **Ext. Gross Area:** | 6,132 |
| **Building Code:** | T7925090534 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $300,921 |
| **Building Name:** | ADA - POLE STORAGE BLDG | **Address:** | 508 Fourth Street East | **Deferred Maintenance:** | $23,405 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ADA | **Ext. Gross Area:** | 2,586 |

### *Site: T792A90524 - ERSKINE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020504 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $131,237 |
| **Building Name:** | ERSKINE - SALT/SAND STORAGE | **Address:** | 34659 Hwy 59 SE | **Deferred Maintenance:** | $14,436 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ERSKINE | **Ext. Gross Area:** | 1,852 |
| **Building Code:** | T7925020512 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $360,741 |
| **Building Name:** | ERSKINE - SALT/SAND STORAGE | **Address:** | 34659 Hwy 59 SE | **Deferred Maintenance:** | $57,571 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ERSKINE | **Ext. Gross Area:** | 1,020 |
| **Building Code:** | T7925090519 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $63,468 |
| **Building Name:** | ERSKINE - MISC STORAGE | **Address:** | 34659 Hwy 59 SE | **Deferred Maintenance:** | $14,492 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ERSKINE | **Ext. Gross Area:** | 616 |
| **Building Code:** | T7925090524 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,296,492 |
| **Building Name:** | ERSKINE - TRUCK STATION | **Address:** | 34659 Hwy 59 SE | **Deferred Maintenance:** | $226,899 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ERSKINE | **Ext. Gross Area:** | 8,871 |
| **Building Code:** | T7925090541 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $329,015 |
| **Building Name:** | ERSKINE - POLE STORAGE | **Address:** | 34659 Hwy 59 SE | **Deferred Maintenance:** | $40,173 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ERSKINE | **Ext. Gross Area:** | 2,560 |

### *Site: T792A90525 - DELORME - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925090525 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $326,797 |
| **Building Name:** | DELORME - MISC STORAGE | **Address:** | TH 2, 16 Mi East of Crookston | **Deferred Maintenance:** | $94,697 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 3,648 |

### *Site: T792A90526 - KARLSTAD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020509 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $104,770 |
| **Building Name:** | KARLSTAD - SALT/SAND STORAGE | **Address:** | 312 Harding Street South | **Deferred Maintenance:** | $7,270 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | KARLSTAD | **Ext. Gross Area:** | 1,336 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020516 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $235,738 |
| **Building Name:** | KARLSTAD - SALT/SAND STORAGE | **Address:** | 312 Harding Street South | **Deferred Maintenance:** | $15,848 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | KARLSTAD | **Ext. Gross Area:** | 2,472 |
| **Building Code:** | T7925090526 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $629,555 |
| **Building Name:** | KARLSTAD - TRUCK STATION | **Address:** | 312 Harding Street South | **Deferred Maintenance:** | $117,880 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | KARLSTAD | **Ext. Gross Area:** | 3,699 |
| **Building Code:** | T7925090535 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $264,163 |
| **Building Name:** | KARLSTAD - POLE STORAGE | **Address:** | 312 Harding Street South | **Deferred Maintenance:** | $17,965 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | KARLSTAD | **Ext. Gross Area:** | 2,586 |

### *Site: T792A90527 - GRYGLA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020507 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $108,081 |
| **Building Name:** | GRYGLA - SALT/SAND STORAGE | **Address:** | 410 South Marshall Ave | **Deferred Maintenance:** | $6,339 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | GRYGLA | **Ext. Gross Area:** | 1,190 |
| **Building Code:** | T7925020517 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $231,243 |
| **Building Name:** | GRYGLA - SALT/SAND STORAGE | **Address:** | 410 South Marshall Ave | **Deferred Maintenance:** | $27,625 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | GRYGLA | **Ext. Gross Area:** | 2,367 |
| **Building Code:** | T7925090523 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $169,475 |
| **Building Name:** | GRYGLA - MISC STORAGE | **Address:** | 410 South Marshall Ave | **Deferred Maintenance:** | $59,519 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | GRYGLA | **Ext. Gross Area:** | 1,200 |
| **Building Code:** | T7925090527 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $586,391 |
| **Building Name:** | GRYGLA - TRUCK STATION | **Address:** | 410 South Marshall Ave | **Deferred Maintenance:** | $131,671 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | GRYGLA | **Ext. Gross Area:** | 4,303 |

### *Site: T792A90528 - EAST GRAND FORKS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020510 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $341,302 |
| **Building Name:** | EAST GRAND FORKS - SALT/SAND STRG | **Address:** | 2512 10th Street NE | **Deferred Maintenance:** | $33,163 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 2,496 |
| **Building Code:** | T7925020524 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $295,094 |
| **Building Name:** | EAST GRAND FORKS - SALT/SAND STRG | **Address:** | 2512 10th Street NE | **Deferred Maintenance:** | $18,392 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 3,615 |
| **Building Code:** | T7925090528 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $648,883 |
| **Building Name:** | EAST GRAND FORKS - TRUCK STATION | **Address:** | 2512 10th Street NE | **Deferred Maintenance:** | $93,378 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 4,281 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925090532 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $710,356 |
| **Building Name:** | EAST GRAND FORKS - POLE STORAGE | **Address:** | 2512 10th Street NE | **Deferred Maintenance:** | $80,873 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | EAST GRAND FORKS | **Ext. Gross Area:** | 5,632 |

### *Site: T792A90530 - CROOKSTON - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020511 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $329,776 |
| **Building Name:** | CROOKSTON - SALT/SAND STORAGE | **Address:** | 1320 Sunflower | **Deferred Maintenance:** | $55,832 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 2,816 |
| **Building Code:** | T7925020519 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $216,279 |
| **Building Name:** | CROOKSTON - SALT/SAND STORAGE | **Address:** | 1320 Sunflower | **Deferred Maintenance:** | $15,900 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 2,176 |
| **Building Code:** | T7925020522 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $721,491 |
| **Building Name:** | CROOKSTON - SALT/SAND | **Address:** | 319 3RD AVENUE SOUTH | **Deferred Maintenance:** | $42,331 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 10,000 |
| **Building Code:** | T7925090500 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,616,664 |
| **Building Name:** | CROOKSTON - EQUIP STORAGE | **Address:** | 1320 Sunflower | **Deferred Maintenance:** | $365,742 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 10,275 |
| **Building Code:** | T7925090501 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $905,792 |
| **Building Name:** | CROOKSTON - EQUIP STORAGE | **Address:** | 1320 Sunflower | **Deferred Maintenance:** | $186,377 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 7,284 |
| **Building Code:** | T7925090530 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $5,120,167 |
| **Building Name:** | CROOKSTON - MAINT HEADQUARTERS | **Address:** | 1320 Sunflower | **Deferred Maintenance:** | $414,463 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 25,225 |
| **Building Code:** | T7925090531 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $906,610 |
| **Building Name:** | CROOKSTON - POLE STORAGE | **Address:** | 1320 Sunflower | **Deferred Maintenance:** | $108,296 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | CROOKSTON | **Ext. Gross Area:** | 4,480 |

### *Site: T792A90533 - THIEF RIVER FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020514 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $577,229 |
| **Building Name:** | THIEF RIVER FALLS - SALT/SAND STRG | **Address:** | 248 125th Ave NE | **Deferred Maintenance:** | $53,133 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 5,238 |
| **Building Code:** | T7925020523 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $665,872 |
| **Building Name:** | THIEF RIVER FALLS - SAND/SALT STRG | **Address:** | 248 125th Ave NE | **Deferred Maintenance:** | $52,016 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 8,403 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925090533 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $16,580,980 |
| **Building Name:** | THIEF RIVER FALLS - TRUCK STATION | **Address:** | 248 125th Ave NE | **Deferred Maintenance:** | $1,702,733 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 68,400 |
| **Building Code:** | T7925090540 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $565,031 |
| **Building Name:** | THIEF RIVER FALLS - POLE STORGE | **Address:** | 248 125th Ave NE | **Deferred Maintenance:** | $81,825 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 4,800 |
| **Building Code:** | T7925090543 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $685,622 |
| **Building Name:** | THIEF RIVER FALLS - UNHEATED STRG | **Address:** | 248 125th Ave NE | **Deferred Maintenance:** | $22,818 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 5,760 |

### *Site: T792A90536 - ROSEAU - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925020513 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $585,772 |
| **Building Name:** | ROSEAU - SALT/SAND STORAGE | **Address:** | 1190 Center Street West | **Deferred Maintenance:** | $35,170 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 4,697 |
| **Building Code:** | T7925090536 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,706,925 |
| **Building Name:** | ROSEAU - TRUCK STATION | **Address:** | 1190 Center Street West | **Deferred Maintenance:** | $86,185 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 11,415 |
| **Building Code:** | T7925090539 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $515,358 |
| **Building Name:** | ROSEAU - POLE STORAGE | **Address:** | 1190 Center Street West | **Deferred Maintenance:** | $36,103 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ROSEAU | **Ext. Gross Area:** | 3,072 |

### *Site: T792A90547 - THIEF RIVER FALLS 6TH ST - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925090547 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $106,168 |
| **Building Name:** | THIEF RIVER FALLS - MISC STRG | **Address:** | 1090 6TH ST W | **Deferred Maintenance:** | $25,056 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | THIEF RIVER FALL | **Ext. Gross Area:** | 1,360 |

### *Site: T792A92042 - ERSKINE - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925090537 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,587 |
| **Building Name:** | ERSKINE - SCALE - MISC STORAGE | **Address:** | 23647 US HWY 2 SE | **Deferred Maintenance:** | $334 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ERSKINE | **Ext. Gross Area:** | 96 |
| **Building Code:** | T7925092042 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $921,968 |
| **Building Name:** | ERSKINE - WEIGH SCALE | **Address:** | 23647 US HWY 2 SE | **Deferred Maintenance:** | $39,675 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ERSKINE | **Ext. Gross Area:** | 2,587 |

### *Site: T792AR141102 - CASS LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7920095211 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,410,458 |
| **Building Name:** | CASS LAKE - REST AREA TIC | **Address:** | 2 MILES EAST CASS LAKE ON US | **Deferred Maintenance:** | $105,538 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | CASS LAKE | **Ext. Gross Area:** | 4,566 |
| **Building Code:** | T7920095231 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $35,100 |
| **Building Name:** | CASS LAKE - RA MISC STORAGE | **Address:** | 2 MILES EAST CASS LAKE ON US | **Deferred Maintenance:** | $912 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | CASS LAKE | **Ext. Gross Area:** | 192 |

### *Site: T792AR256005 - OAK LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925095261 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $195,049 |
| **Building Name:** | OAK LAKE - REST AREA | **Address:** | US2, MP59, 1 Mi E of Jct TH59 | **Deferred Maintenance:** | $22,577 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MCINTOSH | **Ext. Gross Area:** | 924 |
| **Building Code:** | T7925095280 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,168 |
| **Building Name:** | OAK LAKE - RA MISC STORAGE | **Address:** | US2, MP59, 1 Mi E of Jct TH59 | **Deferred Maintenance:** | $8,749 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | MCINTOSH | **Ext. Gross Area:** | 196 |

### *Site: T792AR436005 - LENGBY - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925095260 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $67,774 |
| **Building Name:** | LENGBY - REST AREA | **Address:** | TH 2 - 2 Mi No of Lengby | **Deferred Maintenance:** | $8,001 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LENGBY | **Ext. Gross Area:** | 193 |

### *Site: T792AR446001 - FISHERS LANDING - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7925095262 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $633,441 |
| **Building Name:** | FISHERS LANDING - REST AREA TIC | **Address:** | US 2  9 Mi West of Crookston | **Deferred Maintenance:** | $188,872 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | FISHER | **Ext. Gross Area:** | 2,270 |
| **Building Code:** | T7925095281 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,168 |
| **Building Name:** | FISHERS LANDING - RA MISC STORAGE | **Address:** | US 2  9 Mi West of Crookston | **Deferred Maintenance:** | $6,500 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | FISHER | **Ext. Gross Area:** | 192 |

### *Site: T793A90413 - REMER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020419 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $568,369 |
| **Building Name:** | REMER - SALT/SAND STORAGE | **Address:** | 112 Eagle Ave NE | **Deferred Maintenance:** | $45,557 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | REMER | **Ext. Gross Area:** | 5,788 |
| **Building Code:** | T7930090413 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $974,976 |
| **Building Name:** | REMER - TRUCK STATION | **Address:** | 112 Eagle Ave. NE | **Deferred Maintenance:** | $80,290 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | REMER | **Ext. Gross Area:** | 5,888 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930090463 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $176,261 |
| **Building Name:** | REMER - MISC STORAGE | **Address:** | 112 Eagle Ave NE | **Deferred Maintenance:** | $15,457 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | REMER | **Ext. Gross Area:** | 1,384 |

### *Site: T793A90415 - MOTLEY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020417 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $659,964 |
| **Building Name:** | MOTLEY - SALT/SAND STORAGE | **Address:** | 149 River Front Lane | **Deferred Maintenance:** | $54,206 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | MOTLEY | **Ext. Gross Area:** | 6,240 |
| **Building Code:** | T7930090415 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,452,574 |
| **Building Name:** | MOTLEY - TRUCK STATION | **Address:** | 149 River Front Lane | **Deferred Maintenance:** | $195,968 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MOTLEY | **Ext. Gross Area:** | 8,549 |
| **Building Code:** | T7930090435 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $300,786 |
| **Building Name:** | MOTLEY - MISC STORAGE | **Address:** | 149 River Front Lane | **Deferred Maintenance:** | $65,845 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MOTLEY | **Ext. Gross Area:** | 1,889 |
| **Building Code:** | T7930090456 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $139,772 |
| **Building Name:** | MOTLEY - MISC STORAGE | **Address:** | 149 River Front Lane | **Deferred Maintenance:** | $11,333 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | MOTLEY | **Ext. Gross Area:** | 1,384 |

### *Site: T793A90419 - LITTLE FALLS - OLD SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020411 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $752,060 |
| **Building Name:** | LITTLE FALLS - SALT/SAND STORAGE | **Address:** | 207 13th Street Northwest | **Deferred Maintenance:** | $140,170 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 7,224 |
| **Building Code:** | T7930090419 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,091,108 |
| **Building Name:** | LITTLE FALLS - TRUCK STATION | **Address:** | 207 13th Street Northwest | **Deferred Maintenance:** | $551,850 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 10,527 |
| **Building Code:** | T7930090422 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $412,724 |
| **Building Name:** | LITTLE FALLS - MISC STORAGE | **Address:** | 207 13th Street Northwest | **Deferred Maintenance:** | $47,863 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 4,140 |
| **Building Code:** | T7930090440 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $250,872 |
| **Building Name:** | LITTLE FALLS - POLE STORAGE | **Address:** | 207 13th Street Northwest | **Deferred Maintenance:** | $52,759 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 2,080 |
| **Building Code:** | T7930090454 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $210,770 |
| **Building Name:** | LITTLE FALLS - MISC STORAGE | **Address:** | 207 13th Street Northwest | **Deferred Maintenance:** | $38,171 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 2,087 |

### *Site: T793A90438 - AITKIN - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020423 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $575,683 |
| **Building Name:** | AITKIN - SALT/SAND STORAGE | **Address:** | 1158 Air Park Drive | **Deferred Maintenance:** | $97,844 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | AITKIN | **Ext. Gross Area:** | 7,260 |
| **Building Code:** | T7930090438 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,028,192 |
| **Building Name:** | AITKIN - TRUCK STATION | **Address:** | 1158 Air Park Drive | **Deferred Maintenance:** | $204,587 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | AITKIN | **Ext. Gross Area:** | 5,306 |
| **Building Code:** | T7930090449 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $278,213 |
| **Building Name:** | AITKIN - POLE STORAGE BLDG | **Address:** | 1158 Air Park Drive | **Deferred Maintenance:** | $28,178 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | AITKIN | **Ext. Gross Area:** | 2,560 |
| **Building Code:** | T7930090466 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $147,679 |
| **Building Name:** | AITKIN - MISC STORAGE | **Address:** | 1158 Air Park Drive | **Deferred Maintenance:** | $10,714 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | AITKIN | **Ext. Gross Area:** | 1,424 |

### *Site: T793A90442 - PINE RIVER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020421 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $851,527 |
| **Building Name:** | PINE RIVER - SALT/SAND STORAGE | **Address:** | 3019 MN Hwy 371 SW | **Deferred Maintenance:** | $129,541 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | PINE RIVER | **Ext. Gross Area:** | 8,424 |
| **Building Code:** | T7930090442 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $819,191 |
| **Building Name:** | PINE RIVER - TRUCK STATION | **Address:** | 3019 MN Hwy 371 SW | **Deferred Maintenance:** | $178,517 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | PINE RIVER | **Ext. Gross Area:** | 4,927 |
| **Building Code:** | T7930090461 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $299,494 |
| **Building Name:** | PINE RIVER - POLE STORAGE | **Address:** | 3019 MN Hwy 371 SW | **Deferred Maintenance:** | $19,250 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | PINE RIVER | **Ext. Gross Area:** | 3,072 |

### *Site: T793A90443 - BAXTER - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020412 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,254,822 |
| **Building Name:** | BAXTER - SALT/SAND STORAGE | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $200,894 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BAXTER | **Ext. Gross Area:** | 10,354 |
| **Building Code:** | T7930020422 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,103,125 |
| **Building Name:** | BAXTER - SALT/SAND STORAGE | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $22,062 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BAXTER | **Ext. Gross Area:** | 13,872 |
| **Building Code:** | T7930090439 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $745,390 |
| **Building Name:** | BAXTER - POLE STORAGE | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $126,725 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BAXTER | **Ext. Gross Area:** | 3,200 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930090443 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $30,301,756 |
| **Building Name:** | BAXTER - DISTRICT HEADQUARTERS | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $4,797,019 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BAXTER | **Ext. Gross Area:** | 104,845 |
| **Building Code:** | T7930090444 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,044,035 |
| **Building Name:** | BAXTER - POLE STORAGE BLDG | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $165,086 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | BAXTER | **Ext. Gross Area:** | 9,600 |
| **Building Code:** | T7930090451 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $123,164 |
| **Building Name:** | BAXTER - PATROL POLE STORAGE | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $9,427 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BAXTER | **Ext. Gross Area:** | 1,040 |
| **Building Code:** | T7930090452 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $441,797 |
| **Building Name:** | BAXTER - POLE STORAGE | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $73,240 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | BAXTER | **Ext. Gross Area:** | 3,837 |
| **Building Code:** | T7930090464 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,587 |
| **Building Name:** | BAXTER - HAZ MAT STORAGE | **Address:** | 1991 Industrial Park Road S | **Deferred Maintenance:** | $3,159 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BAXTER | **Ext. Gross Area:** | 190 |

### *Site: T793A90445 - ISLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020418 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $570,784 |
| **Building Name:** | ISLE - SALT/SAND STORAGE | **Address:** | 1100 MN Hwy 47 | **Deferred Maintenance:** | $47,839 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 4,980 |
| **Building Code:** | T7930090447 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $58,011 |
| **Building Name:** | ISLE - MISC STORAGE | **Address:** | 1100 MN Hwy 47 | **Deferred Maintenance:** | $6,733 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ISLE | **Ext. Gross Area:** | 500 |
| **Building Code:** | T7930090460 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $129,945 |
| **Building Name:** | ISLE - MISC STORAGE | **Address:** | 1100 Mn Hwy 47 | **Deferred Maintenance:** | $26,510 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ISLE | **Ext. Gross Area:** | 1,120 |
| **Building Code:** | T7930090471 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $834,161 |
| **Building Name:** | ISLE - TRUCK STATION | **Address:** | 1100 Mn Hwy 47 | **Deferred Maintenance:** | $16,683 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ISLE | **Ext. Gross Area:** | 4,695 |

### *Site: T793A90450 - WADENA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020416 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $654,670 |
| **Building Name:** | WADENA - SALT/SAND STORAGE | **Address:** | 1701 Industrial Drive | **Deferred Maintenance:** | $143,155 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WADENA | **Ext. Gross Area:** | 3,951 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930090450 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,117,332 |
| **Building Name:** | WADENA - TRUCK STATION | **Address:** | 1701 Industrial Drive | **Deferred Maintenance:** | $42,040 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | WADENA | **Ext. Gross Area:** | 7,073 |
| **Building Code:** | T7930090453 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $52,765 |
| **Building Name:** | WADENA - MISC STORAGE | **Address:** | 1701 Industrial Drive | **Deferred Maintenance:** | $7,340 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WADENA | **Ext. Gross Area:** | 448 |
| **Building Code:** | T7930090457 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $372,125 |
| **Building Name:** | WADENA - POLE STORAGE BLDG | **Address:** | 1701 Industrial Drive | **Deferred Maintenance:** | $25,307 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WADENA | **Ext. Gross Area:** | 3,840 |

### *Site: T793A90458 - LONG PRAIRIE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020420 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $559,627 |
| **Building Name:** | LONG PRAIRIE - SALT/SAND STORAGE | **Address:** | 24291 STATE HWY 71 | **Deferred Maintenance:** | $37,713 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | LONG PRAIRIE | **Ext. Gross Area:** | 5,788 |
| **Building Code:** | T7930090458 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,079,356 |
| **Building Name:** | LONG PRAIRIE - TRUCK STATION | **Address:** | 24291 STATE HWY 71 | **Deferred Maintenance:** | $213,735 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | LONG PRAIRIE | **Ext. Gross Area:** | 6,852 |
| **Building Code:** | T7930090459 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $291,660 |
| **Building Name:** | LONG PRAIRIE - POLE STORAGE | **Address:** | 24291 STATE HWY 71 | **Deferred Maintenance:** | $32,526 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LONG PRAIRIE | **Ext. Gross Area:** | 3,072 |

### *Site: T793A90462 - GARRISON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020415 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $541,750 |
| **Building Name:** | GARRISON - SALT/SAND STORAGE | **Address:** | 27365 MN Hwy 18 | **Deferred Maintenance:** | $96,265 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | GARRISON | **Ext. Gross Area:** | 4,954 |
| **Building Code:** | T7930090441 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $546,578 |
| **Building Name:** | GARRISON - STORAGE FACILITY | **Address:** | 27365 MN Hwy 18 | **Deferred Maintenance:** | $173,814 |
| **Facility Condition Index:** | 0.32 - Poor | **City Code:** | GARRISON | **Ext. Gross Area:** | 3,229 |
| **Building Code:** | T7930090455 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $159,127 |
| **Building Name:** | GARRISON - MISC STORAGE | **Address:** | 27365 MN Hwy 18 | **Deferred Maintenance:** | $37,445 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | GARRISON | **Ext. Gross Area:** | 1,652 |
| **Building Code:** | T7930090462 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,304,869 |
| **Building Name:** | GARRISON - TRUCK STATION | **Address:** | 27365 MN HWY 18 | **Deferred Maintenance:** | $129,238 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | GARRISON | **Ext. Gross Area:** | 8,383 |

### *Site: T793A90468 - LITTLE FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930020424 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $500,600 |
| **Building Name:** | LITTLE FALLS - SALT/SAND STORAGE | **Address:** | 15038 PINE AVENUE | **Deferred Maintenance:** | $10,012 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 6,660 |
| **Building Code:** | T7930090468 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $5,634,244 |
| **Building Name:** | LITTLE FALLS - TRUCK STATION | **Address:** | 15038 PINE AVENUE | **Deferred Maintenance:** | $112,685 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 21,290 |
| **Building Code:** | T7930090469 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $711,207 |
| **Building Name:** | LITTLE FALLS - UNHEATED STORAGE | **Address:** | 15038 PINE AVENUE | **Deferred Maintenance:** | $14,224 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 6,120 |
| **Building Code:** | T7930090470 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $109,010 |
| **Building Name:** | LITTLE FALLS - STORAGE BINS | **Address:** | 15038 PINE AVENUE | **Deferred Maintenance:** | $2,180 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | LITTLE FALLS | **Ext. Gross Area:** | 1,861 |

### *Site: T793AR961806 - BRAINERD LAKES - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7930095312 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,781,307 |
| **Building Name:** | BRAINERD LAKES - REST AREA TIC | **Address:** | 7393 STATE HIGHWAY 371 | **Deferred Maintenance:** | $197,199 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BRAINERD | **Ext. Gross Area:** | 5,550 |

### *Site: T793B20718 - CLEARWATER - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020718 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $83,601 |
| **Building Name:** | CLEARWATER - SALT/SAND STORAGE | **Address:** | County Rd 75  1 Mi S TH 24 | **Deferred Maintenance:** | $6,793 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | CLEARWATER | **Ext. Gross Area:** | 1,080 |

### *Site: T793B90713 - MORA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020702 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $416,589 |
| **Building Name:** | MORA - SALT/SAND STORAGE | **Address:** | 807 Howe Street | **Deferred Maintenance:** | $79,812 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MORA | **Ext. Gross Area:** | 5,054 |
| **Building Code:** | T7935090713 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,002,647 |
| **Building Name:** | MORA - TRUCK STATION | **Address:** | 807 Howe Street | **Deferred Maintenance:** | $187,487 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MORA | **Ext. Gross Area:** | 6,176 |
| **Building Code:** | T7935090780 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $353,519 |
| **Building Name:** | MORA - UNHEATED STORAGE | **Address:** | 807 Howe Street | **Deferred Maintenance:** | $7,649 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MORA | **Ext. Gross Area:** | 3,840 |

### *Site: T793B90714 - FOLEY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020712 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $120,353 |
| **Building Name:** | FOLEY - SALT/SAND STORAGE | **Address:** | 531 Norman Ave No | **Deferred Maintenance:** | $19,216 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | FOLEY | **Ext. Gross Area:** | 1,852 |
| **Building Code:** | T7935090714 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $445,379 |
| **Building Name:** | FOLEY - TRUCK STATION | **Address:** | 531 Norman Ave No | **Deferred Maintenance:** | $79,908 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | FOLEY | **Ext. Gross Area:** | 2,963 |

### *Site: T793B90735 - SAINT CLOUD - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020711 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $127,658 |
| **Building Name:** | ST CLOUD - SALT STRG - WOOD SHED | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $31,675 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 1,867 |
| **Building Code:** | T7935020724 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,254,009 |
| **Building Name:** | ST CLOUD - SALT/SAND STRG COVERALL | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $490,327 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 17,282 |
| **Building Code:** | T7935090725 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $153,957 |
| **Building Name:** | ST CLOUD - BRINE BLDG | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $28,221 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 1,523 |
| **Building Code:** | T7935090726 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,280 |
| **Building Name:** | ST CLOUD - MISC STORAGE | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $5,464 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 156 |
| **Building Code:** | T7935090735 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $43,883,851 |
| **Building Name:** | ST CLOUD - MAINTENANCE HEADQUARTERS | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $5,458,116 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 169,970 |
| **Building Code:** | T7935090736 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $148,706 |
| **Building Name:** | ST CLOUD - SIGN STORAGE | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $16,152 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 1,610 |
| **Building Code:** | T7935090745 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $416,810 |
| **Building Name:** | ST CLOUD - BRIDGE HEATED SHOP | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $39,100 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 2,712 |
| **Building Code:** | T7935090748 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $34,448 |
| **Building Name:** | ST CLOUD - ESS/TRAFFIC STORAGE | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $13,892 |
| **Facility Condition Index:** | 0.40 - Poor | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 289 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935090754 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $120,188 |
| **Building Name:** | ST CLOUD - GRANITE CHIP STORAGE | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $29,579 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 1,800 |
| **Building Code:** | T7935090756 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $774,704 |
| **Building Name:** | ST CLOUD - MAINT STRG BARNES BARN | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $47,001 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 7,184 |
| **Building Code:** | T7935090771 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,430,080 |
| **Building Name:** | ST CLOUD - SHARED POLE STRG INVENT | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $105,286 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 9,222 |
| **Building Code:** | T7935090775 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $263,570 |
| **Building Name:** | ST CLOUD - POLE STRG PATROL IMPOUND | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $17,893 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 2,836 |
| **Building Code:** | T7935090777 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $501,680 |
| **Building Name:** | ST CLOUD - NEW SHARED POLE STRG | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $31,757 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 5,376 |
| **Building Code:** | T7935090778 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $119,627 |
| **Building Name:** | ST CLOUD - EMULSION STORAGE | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $7,761 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 1,050 |
| **Building Code:** | T7935090786 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $129,535 |
| **Building Name:** | ST CLOUD - PATROL STRG OLD DNR | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $16,284 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 1,363 |
| **Building Code:** | T7935090787 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $40,979 |
| **Building Name:** | ST CLOUD - PATROL POST BLDG | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $5,683 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 231 |
| **Building Code:** | T7935090788 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $42,588 |
| **Building Name:** | ST CLOUD - TRASH COMPACTOR BLDG | **Address:** | 3725 12th Street North | **Deferred Maintenance:** | $5,327 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 401 |

### *Site: T793B90740 - ALBANY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020710 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $18,249 |
| **Building Name:** | ALBANY - SALT/SAND STORAGE | **Address:** | 34916 County Road 10 | **Deferred Maintenance:** | $5,043 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | ALBANY | **Ext. Gross Area:** | 290 |
| **Building Code:** | T7935020719 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $280,160 |
| **Building Name:** | ALBANY - SALT/SAND STORAGE | **Address:** | 34916 County Road 10 | **Deferred Maintenance:** | $36,467 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ALBANY | **Ext. Gross Area:** | 2,360 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935090740 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $721,585 |
| **Building Name:** | ALBANY - TRUCK STATION | **Address:** | 34916 County Road 10 | **Deferred Maintenance:** | $79,915 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ALBANY | **Ext. Gross Area:** | 4,904 |
| **Building Code:** | T7935090763 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $89,905 |
| **Building Name:** | ALBANY - MISC STORAGE | **Address:** | 34916 County Road 10 | **Deferred Maintenance:** | $7,810 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ALBANY | **Ext. Gross Area:** | 800 |
| **Building Code:** | T7935090773 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $283,742 |
| **Building Name:** | ALBANY - POLE STORAGE BLDG | **Address:** | 34916 County Road 10 | **Deferred Maintenance:** | $18,100 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ALBANY | **Ext. Gross Area:** | 3,072 |

### *Site: T793B90741 - ELK RIVER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020713 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $85,333 |
| **Building Name:** | ELK RIVER - SALT/SAND STORAGE | **Address:** | 18938 Dodge Avenue Northwest | **Deferred Maintenance:** | $16,761 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 1,425 |
| **Building Code:** | T7935020720 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $186,923 |
| **Building Name:** | ELK RIVER - SALT/SAND STORAGE | **Address:** | 18938 Dodge Avenue Northwest | **Deferred Maintenance:** | $13,779 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 4,373 |
| **Building Code:** | T7935090741 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,403,059 |
| **Building Name:** | ELK RIVER - TRUCK STATION | **Address:** | 18938 Dodge Avenue Northwest | **Deferred Maintenance:** | $314,271 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 11,406 |
| **Building Code:** | T7935090764 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $757,544 |
| **Building Name:** | ELK RIVER - POLE STORAGE BLDG | **Address:** | 18938 Dodge Avenue Northwest | **Deferred Maintenance:** | $85,765 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 5,375 |

### *Site: T793B90742 - MONTICELLO - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020721 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $475,099 |
| **Building Name:** | MONTICELLO - SALT/SAND STORAGE | **Address:** | 112 Chelsea Road | **Deferred Maintenance:** | $59,789 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 5,227 |
| **Building Code:** | T7935090742 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,072,891 |
| **Building Name:** | MONTICELLO - TRUCK STATION | **Address:** | 112 Chelsea Road | **Deferred Maintenance:** | $382,429 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 11,221 |
| **Building Code:** | T7935090762 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $44,832 |
| **Building Name:** | MONTICELLO - MISC STORAGE | **Address:** | 112 Chelsea Road | **Deferred Maintenance:** | $11,155 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 444 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935090779 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,754,409 |
| **Building Name:** | MONTICELLO - EQUIP STORAGE | **Address:** | 112 Chelsea Road | **Deferred Maintenance:** | $96,155 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 11,289 |
| **Building Code:** | T7935090789 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $26,310 |
| **Building Name:** | MONTICELLO - BRINE BUILDING | **Address:** | 112 Chelsea Road | **Deferred Maintenance:** | $4,686 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 318 |

### *Site: T793B90749 - MILACA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020714 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $365,296 |
| **Building Name:** | MILACA - SALT/SAND STORAGE | **Address:** | 605 8th Street Northeast | **Deferred Maintenance:** | $44,447 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MILACA | **Ext. Gross Area:** | 4,558 |
| **Building Code:** | T7935090749 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,311,403 |
| **Building Name:** | MILACA - STORAGE FACILITY | **Address:** | 605 8th Street Northeast | **Deferred Maintenance:** | $215,287 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MILACA | **Ext. Gross Area:** | 5,543 |
| **Building Code:** | T7935090770 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $266,123 |
| **Building Name:** | MILACA - POLE STORAGE BLDG | **Address:** | 605 8th Street Northeast | **Deferred Maintenance:** | $36,037 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MILACA | **Ext. Gross Area:** | 2,560 |
| **Building Code:** | T7935090784 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,543,959 |
| **Building Name:** | MILACA - TRUCK STATION | **Address:** | 605 8th Street Northeast | **Deferred Maintenance:** | $37,347 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MILACA | **Ext. Gross Area:** | 8,845 |
| **Building Code:** | T7935090791 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $45,639 |
| **Building Name:** | MILACA - BRINE BUILDING | **Address:** | 605 8th Street Northeast | **Deferred Maintenance:** | $5,141 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | MILACA | **Ext. Gross Area:** | 318 |

### *Site: T793B90753 - BUFFALO - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020705 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $125,570 |
| **Building Name:** | BUFFALO - SALT/SAND STORAGE | **Address:** | 1137 TH 25 SE | **Deferred Maintenance:** | $15,522 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BUFFALO | **Ext. Gross Area:** | 1,890 |
| **Building Code:** | T7935020726 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $587,694 |
| **Building Name:** | BUFFALO - SALT/SAND STORAGE | **Address:** | 1137 TH 25 SE | **Deferred Maintenance:** | $109,711 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BUFFALO | **Ext. Gross Area:** | 6,513 |
| **Building Code:** | T7935090753 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $930,371 |
| **Building Name:** | BUFFALO - TRUCK STATION | **Address:** | 1137 TH 25 SE | **Deferred Maintenance:** | $114,019 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | BUFFALO | **Ext. Gross Area:** | 7,628 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935090757 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $334,983 |
| **Building Name:** | BUFFALO - POLE STORAGE | **Address:** | 1137 TH 25 SE | **Deferred Maintenance:** | $36,638 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | BUFFALO | **Ext. Gross Area:** | 2,586 |
| **Building Code:** | T7935090792 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $46,835 |
| **Building Name:** | BUFFALO - BRINE BUILDING | **Address:** | 1137 TH 25 SE | **Deferred Maintenance:** | $3,232 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BUFFALO | **Ext. Gross Area:** | 318 |

### *Site: T793B90769 - LAKE GEORGE - LIFT STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935090769 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $104,173 |
| **Building Name:** | ST CLOUD - LAKE GEORGE - LIFT STAT | **Address:** | TH 23 at Lake George | **Deferred Maintenance:** | $55,979 |
| **Facility Condition Index:** | 0.54 - Crisis | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 636 |

### *Site: T793B90772 - SAUK CENTRE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020723 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $551,269 |
| **Building Name:** | SAUK CENTRE - SALT/SAND STORAGE | **Address:** | 1218 Beltline Road | **Deferred Maintenance:** | $24,597 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | SAUK CENTRE | **Ext. Gross Area:** | 4,160 |
| **Building Code:** | T7935090772 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,416,117 |
| **Building Name:** | SAUK CENTRE - TRUCK STATION | **Address:** | 1218 Beltline Road | **Deferred Maintenance:** | $187,021 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | SAUK CENTRE | **Ext. Gross Area:** | 11,086 |
| **Building Code:** | T7935090774 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $421,648 |
| **Building Name:** | SAUK CENTRE - POLE STORAGE | **Address:** | 1218 Beltine Road | **Deferred Maintenance:** | $85,344 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | SAUK CENTRE | **Ext. Gross Area:** | 4,480 |

### *Site: T793B90781 - CAMBRIDGE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020728 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $420,715 |
| **Building Name:** | CAMBRIDGE - SALT/SAND STORAGE | **Address:** | 1620 KENNEDY STREET NORTH | **Deferred Maintenance:** | $8,414 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 7,200 |
| **Building Code:** | T7935090781 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,281,168 |
| **Building Name:** | CAMBRIDGE - TRUCK STATION | **Address:** | 1620 KENNEDY STREET NORTH | **Deferred Maintenance:** | $68,986 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 13,949 |
| **Building Code:** | T7935090785 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $389,038 |
| **Building Name:** | CAMBRIDGE - UNHEATED STORAGE | **Address:** | 1620 KENNEDY STREET NORTH | **Deferred Maintenance:** | $7,781 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 4,199 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935090790 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $64,008 |
| **Building Name:** | CAMBRIDGE - CVRD STRG BIN | **Address:** | 1620 KENNEDY STREET NORTH | **Deferred Maintenance:** | $1,280 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CAMBRIDGE | **Ext. Gross Area:** | 1,153 |

### *Site: T793B90782 - PAYNESVILLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935020727 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $494,648 |
| **Building Name:** | PAYNESVILLE- SALT/SAND STORAGE | **Address:** | 223 Industrial Loop W | **Deferred Maintenance:** | $23,787 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | PAYNESVILLE | **Ext. Gross Area:** | 6,403 |
| **Building Code:** | T7935090782 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,742,561 |
| **Building Name:** | PAYNESVILLE - TRUCK STATION | **Address:** | 223 Industrial Loop W | **Deferred Maintenance:** | $95,793 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | PAYNESVILLE | **Ext. Gross Area:** | 9,441 |
| **Building Code:** | T7935090783 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $404,029 |
| **Building Name:** | PAYNESVILLE - UNHEATED STORAGE | **Address:** | 223 Industrial Loop W | **Deferred Maintenance:** | $8,081 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PAYNESVILLE | **Ext. Gross Area:** | 4,043 |

### *Site: T793BR307380 - FULLER LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095351 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $450,840 |
| **Building Name:** | FULLER LAKE - REST AREA | **Address:** | I94 WB N of Jct TH 24 Clearwater | **Deferred Maintenance:** | $66,089 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | CLEARWATER | **Ext. Gross Area:** | 1,722 |
| **Building Code:** | T7935095380 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,439 |
| **Building Name:** | FULLER LAKE - RA MISC STORAGE | **Address:** | I94 WB N of Jct TH 24 Clearwater | **Deferred Maintenance:** | $8,022 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | CLEARWATER | **Ext. Gross Area:** | 123 |

### *Site: T793BR317380 - MIDDLE SPUNK CREEK - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095352 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $562,261 |
| **Building Name:** | MIDDLE SPUNK CREEK - REST AREA | **Address:** | I94WB 1 MI W of Avon Interchan | **Deferred Maintenance:** | $42,682 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | AVON | **Ext. Gross Area:** | 2,423 |
| **Building Code:** | T7935095381 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $77,045 |
| **Building Name:** | MIDDLE SPUNK CREEK - RA MISC STRG | **Address:** | I94WB 1 Mi W of Avon Interchan | **Deferred Maintenance:** | $7,816 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | AVON | **Ext. Gross Area:** | 473 |

### *Site: T793BR327380 - BIG SPUNK LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095353 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $546,517 |
| **Building Name:** | BIG SPUNK LAKE - REST AREA | **Address:** | I94 EB 1.5 Mi W of Avon | **Deferred Maintenance:** | $35,026 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | AVON | **Ext. Gross Area:** | 2,550 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095382 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $113,673 |
| **Building Name:** | BIG SPUNK LAKE - RA MISC STORAGE | **Address:** | I94 EB 1.5 Mi W of Avon | **Deferred Maintenance:** | $12,517 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | AVON | **Ext. Gross Area:** | 473 |

### *Site: T793BR498680 - ENFIELD - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095354 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $840,337 |
| **Building Name:** | ENFIELD - REST AREA | **Address:** | I94 EB 6 Mi W of Jct TH 25 | **Deferred Maintenance:** | $77,717 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 2,892 |
| **Building Code:** | T7935095383 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $55,057 |
| **Building Name:** | ENFIELD - RA MISC STORAGE | **Address:** | I94 EB 6 Mi W of Jct TH 25 | **Deferred Maintenance:** | $14,300 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | MONTICELLO | **Ext. Gross Area:** | 266 |

### *Site: T793BR734812 - RUM RIVER - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095361 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $414,877 |
| **Building Name:** | RUM RIVER - REST AREA | **Address:** | TH 169, 11.0 Mi N of Milaca | **Deferred Maintenance:** | $87,286 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MILACA | **Ext. Gross Area:** | 1,637 |

### *Site: T793BR837103 - CENTRAL MINNESOTA - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7935095360 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $926,729 |
| **Building Name:** | CENTRAL MINNESOTA - REST AREA TIC | **Address:** | TH 10 .2 Miles East of TH 23 | **Deferred Maintenance:** | $120,770 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | ST. CLOUD | **Ext. Gross Area:** | 3,367 |

### *Site: T794A20613 - PELICAN RAPIDS - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020613 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $281,964 |
| **Building Name:** | PELICAN RAPIDS - SALT/SAND STORAGE | **Address:** | TH 59 N Edge of Town | **Deferred Maintenance:** | $100,824 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | PELICAN RAPIDS | **Ext. Gross Area:** | 3,564 |

### *Site: T794A90611 - BRECKENRIDGE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020611 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $238,772 |
| **Building Name:** | BRECKENRIDGE - SALT/SAND STORAGE | **Address:** | 401 South 8th Street | **Deferred Maintenance:** | $64,703 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | BRECKENRIDGE | **Ext. Gross Area:** | 2,696 |
| **Building Code:** | T7940090611 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,063,756 |
| **Building Name:** | BRECKENRIDGE - TRUCK STATION | **Address:** | 401 South 8th Street | **Deferred Maintenance:** | $362,217 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | BRECKENRIDGE | **Ext. Gross Area:** | 5,713 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090641 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $143,469 |
| **Building Name:** | BRECKENRIDGE - POLE STORAGE | **Address:** | 401 South 8th Street | **Deferred Maintenance:** | $33,198 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | BRECKENRIDGE | **Ext. Gross Area:** | 1,459 |
| **Building Code:** | T7940090669 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,231 |
| **Building Name:** | BRECKENRIDGE - BRINE BUILDING | **Address:** | 401 South 8th Street | **Deferred Maintenance:** | $5,956 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | BRECKENRIDGE | **Ext. Gross Area:** | 144 |

### *Site: T794A90615 - FERGUS FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020615 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,008,609 |
| **Building Name:** | FERGUS FALLS - SALT/SAND STORAGE | **Address:** | 1205 East Douglas Avenue | **Deferred Maintenance:** | $282,171 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 12,684 |
| **Building Code:** | T7940090615 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $5,975,577 |
| **Building Name:** | FERGUS FALLS - TRUCK STATION | **Address:** | 1205 East Douglas Avenue | **Deferred Maintenance:** | $966,442 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 20,069 |
| **Building Code:** | T7940090645 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $432,623 |
| **Building Name:** | FERGUS FALLS - POLE STORAGE BLDG | **Address:** | 1205 East Douglas Avenue | **Deferred Maintenance:** | $105,471 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | T7940090660 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $645,189 |
| **Building Name:** | FERGUS FALLS - POLE STORAGE BLDG | **Address:** | 1205 East Douglas Avenue | **Deferred Maintenance:** | $98,288 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 6,720 |
| **Building Code:** | T7940090670 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,164 |
| **Building Name:** | FERGUS FALLS - BRINE BUILDING | **Address:** | 1205 East Douglas Avenue | **Deferred Maintenance:** | $2,446 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | FERGUS FALLS | **Ext. Gross Area:** | 120 |

### *Site: T794A90616 - DETROIT LAKES - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020614 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,093,732 |
| **Building Name:** | DETROIT LAKES - SALT/SAND STORAGE | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $116,417 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 14,120 |
| **Building Code:** | T7940090616 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $43,137,747 |
| **Building Name:** | DETROIT LAKES - HEADQUARTERS | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $9,657,760 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 144,828 |
| **Building Code:** | T7940090627 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,140,237 |
| **Building Name:** | DETROIT LAKES - MISC STORAGE | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $381,576 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 7,508 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090638 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,150,637 |
| **Building Name:** | DETROIT LAKES - POLE STORAGE | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $837,354 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 15,271 |
| **Building Code:** | T7940090639 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,238 |
| **Building Name:** | DETROIT LAKES - MISC STORAGE | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $4,820 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 192 |
| **Building Code:** | T7940090651 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $714,950 |
| **Building Name:** | DETROIT LAKES - POLE STORAGE BLDG | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $70,112 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 7,200 |
| **Building Code:** | T7940090656 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $793,487 |
| **Building Name:** | DETROIT LAKES - EMERGENCY GENERATO | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $79,890 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 413 |
| **Building Code:** | T7940090661 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $20,394 |
| **Building Name:** | DETROIT LAKES - HAZ MATRL BLDG | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $2,039 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 720 |
| **Building Code:** | T7940090676 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $521,801 |
| **Building Name:** | DETROIT LAKES - UNHEATED STORAGE | **Address:** | 1000 West TH 10 | **Deferred Maintenance:** | $10,436 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 5,000 |

### *Site: T794A90624 - BARNESVILLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020619 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $656,054 |
| **Building Name:** | BARNESVILLE - SALT/SAND STORAGE | **Address:** | 1201 Hwy 34 | **Deferred Maintenance:** | $13,121 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BARNESVILLE | **Ext. Gross Area:** | 8,100 |
| **Building Code:** | T7940090624 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,737,818 |
| **Building Name:** | BARNESVILLE - TRUCK STATION | **Address:** | 1201 Hwy 34 | **Deferred Maintenance:** | $486,531 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | BARNESVILLE | **Ext. Gross Area:** | 8,880 |
| **Building Code:** | T7940090630 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $86,846 |
| **Building Name:** | BARNESVILLE - MISC STORAGE | **Address:** | 1201 Hwy 34 | **Deferred Maintenance:** | $6,896 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BARNESVILLE | **Ext. Gross Area:** | 625 |
| **Building Code:** | T7940090644 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $314,668 |
| **Building Name:** | BARNESVILLE - POLE STORAGE BLDG | **Address:** | 1201 Hwy 34 | **Deferred Maintenance:** | $30,838 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | BARNESVILLE | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | T7940090668 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,925 |
| **Building Name:** | BARNESVILLE - BRINE BUILDING | **Address:** | 1201 Hwy 34 | **Deferred Maintenance:** | $6,348 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | BARNESVILLE | **Ext. Gross Area:** | 120 |

### *Site: T794A90625 - PERHAM - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020618 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $506,928 |
| **Building Name:** | PERHAM - SALT/SAND STORAGE | **Address:** | RR 3 Box 10 | **Deferred Maintenance:** | $45,834 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PERHAM | **Ext. Gross Area:** | 6,375 |
| **Building Code:** | T7940090655 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $307,233 |
| **Building Name:** | PERHAM - POLE STORAGE BLDG | **Address:** | 711 3rd Avenue SE | **Deferred Maintenance:** | $46,540 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | PERHAM | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | T7940090665 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,395,397 |
| **Building Name:** | PERHAM - TRUCK STATION | **Address:** | 711 3RD AVENUE SE | **Deferred Maintenance:** | $45,488 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | PERHAM | **Ext. Gross Area:** | 8,842 |
| **Building Code:** | T7940090667 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,311 |
| **Building Name:** | PERHAM - BRINE BUILDING | **Address:** | 711 3RD AVENUE SE | **Deferred Maintenance:** | $1,027 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | PERHAM | **Ext. Gross Area:** | 576 |

### *Site: T794A90629 - HAWLEY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020605 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $238,772 |
| **Building Name:** | HAWLEY - SALT/SAND STORAGE | **Address:** | 500 US Hwy 10 East | **Deferred Maintenance:** | $109,402 |
| **Facility Condition Index:** | 0.46 - Poor | **City Code:** | HAWLEY | **Ext. Gross Area:** | 2,696 |
| **Building Code:** | T7940090629 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $724,752 |
| **Building Name:** | HAWLEY - TRUCK STATION | **Address:** | 500 US Hwy 10 East | **Deferred Maintenance:** | $345,690 |
| **Facility Condition Index:** | 0.48 - Poor | **City Code:** | HAWLEY | **Ext. Gross Area:** | 4,261 |
| **Building Code:** | T7940090654 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $315,847 |
| **Building Name:** | HAWLEY - POLE STORAGE BLDG | **Address:** | 500 US Hwy 10 East | **Deferred Maintenance:** | $44,768 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | HAWLEY | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | T7940090671 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,925 |
| **Building Name:** | HAWLEY - BRINE BUILDING | **Address:** | 500 US Hwy 10 East | **Deferred Maintenance:** | $4,771 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | HAWLEY | **Ext. Gross Area:** | 120 |

### *Site: T794A90636 - HENNING - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020607 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $264,176 |
| **Building Name:** | HENNING - SALT/SAND STORAGE | **Address:** | 100 Douglas Avenue | **Deferred Maintenance:** | $42,535 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | HENNING | **Ext. Gross Area:** | 2,702 |
| **Building Code:** | T7940090636 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,043,550 |
| **Building Name:** | HENNING - TRUCK STATION | **Address:** | 100 Douglas Avenue | **Deferred Maintenance:** | $242,117 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | HENNING | **Ext. Gross Area:** | 5,337 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090653 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $307,233 |
| **Building Name:** | HENNING - POLE STORAGE BLDG | **Address:** | 100 Douglas Avenue | **Deferred Maintenance:** | $30,111 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | HENNING | **Ext. Gross Area:** | 3,200 |
| **Building Code:** | T7940090672 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,164 |
| **Building Name:** | HENNING - BRINE BUILDING | **Address:** | 100 Douglas Avenue | **Deferred Maintenance:** | $2,946 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | HENNING | **Ext. Gross Area:** | 120 |

### *Site: T794A90640 - MAHNOMEN - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020612 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $659,739 |
| **Building Name:** | MAHNOMEN - SALT/SAND STORAGE | **Address:** | 311 East Jefferson | **Deferred Maintenance:** | $172,325 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 6,621 |
| **Building Code:** | T7940090640 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,238,382 |
| **Building Name:** | MAHNOMEN - TRUCK STATION | **Address:** | 311 East Jefferson | **Deferred Maintenance:** | $333,728 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 6,309 |
| **Building Code:** | T7940090642 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $304,245 |
| **Building Name:** | MAHNOMEN - POLE STORAGE BLDG | **Address:** | 311 East Jefferson | **Deferred Maintenance:** | $37,900 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 3,094 |
| **Building Code:** | T7940090673 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,073 |
| **Building Name:** | MAHNOMEN - BRINE BUILDING | **Address:** | 311 East Jefferson | **Deferred Maintenance:** | $2,529 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MAHNOMEN | **Ext. Gross Area:** | 120 |

### *Site: T794A90646 - HAWLEY - LIFT STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090646 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $44,066 |
| **Building Name:** | HAWLEY - LIFT STATION | **Address:** | 500 Hwy 10 | **Deferred Maintenance:** | $6,392 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | HAWLEY | **Ext. Gross Area:** | 152 |
| **Building Code:** | T7940090650 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,612 |
| **Building Name:** | HAWLEY - EMERGENCY GENERATOR | **Address:** | 500 Hwy 10 | **Deferred Maintenance:** | $7,079 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | HAWLEY | **Ext. Gross Area:** | 266 |

### *Site: T794A90647 - MOORHEAD I94 - LIFT STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090647 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $96,346 |
| **Building Name:** | MOORHEAD I94&TH231 - LIFT STATION | **Address:** | I94/TH231 | **Deferred Maintenance:** | $42,729 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 480 |

### *Site: T794A90657 - MOORHEAD HWY 10 - LIFT STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090663 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $523,157 |
| **Building Name:** | MOORHEAD - LIFT STATION | **Address:** | TRUNK HIGHWAY 10 | **Deferred Maintenance:** | $52,316 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 340 |

### *Site: T794A90658 - MOORHEAD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940020617 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,036,887 |
| **Building Name:** | MOORHEAD - SALT/SAND STORAGE | **Address:** | 4150 30th Avenue South | **Deferred Maintenance:** | $443,460 |
| **Facility Condition Index:** | 0.43 - Poor | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 12,684 |
| **Building Code:** | T7940090658 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $17,783,066 |
| **Building Name:** | MOORHEAD - TRUCK STATION | **Address:** | 4150 30th Avenue South | **Deferred Maintenance:** | $3,219,947 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 62,943 |
| **Building Code:** | T7940090659 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,163,057 |
| **Building Name:** | MOORHEAD - UNHEATED STORAGE BLDG | **Address:** | 4150 30th Avenue South | **Deferred Maintenance:** | $423,574 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 12,013 |
| **Building Code:** | T7940090674 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,925 |
| **Building Name:** | MOORHEAD - BRINE BUILDING | **Address:** | 4150 30th Avenue South | **Deferred Maintenance:** | $2,445 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 144 |
| **Building Code:** | T7940090675 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $398,630 |
| **Building Name:** | MOORHEAD - EMERGENGY GEN BLDG | **Address:** | 4150 30th Avenue South | **Deferred Maintenance:** | $40,180 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 486 |

### *Site: T794A90662 - DILWORTH - ANTI-ICING BUILDING*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090662 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $63,911 |
| **Building Name:** | DILWORTH ANTI-ICING BLDG | **Address:** | | **Deferred Maintenance:** | $5,731 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | DILWORTH | **Ext. Gross Area:** | 168 |

### *Site: T794A90664 - GLYNDON TH10-TH336 - ANTI-ICING BUILDING*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090664 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $40,901 |
| **Building Name:** | TH10-TH336 ANTI-ICING | **Address:** | 22 HWY 336 | **Deferred Maintenance:** | $6,496 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | GLYNDON | **Ext. Gross Area:** | 168 |

### *Site: T794A90802 - APPLETON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020808 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $102,336 |
| **Building Name:** | APPLETON - SALT/SAND STORAGE | **Address:** | 838 N Hering St | **Deferred Maintenance:** | $21,371 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | APPLETON | **Ext. Gross Area:** | 1,037 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020814 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $177,628 |
| **Building Name:** | APPLETON - SALT/SAND STORAGE | **Address:** | 838 N Hering St | **Deferred Maintenance:** | $30,254 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | APPLETON | **Ext. Gross Area:** | 2,696 |

### *Site: T794A90806 - WHEATON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020806 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $161,898 |
| **Building Name:** | WHEATON - SALT/SAND STORAGE | **Address:** | 505 2nd Avenue South | **Deferred Maintenance:** | $49,950 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | WHEATON | **Ext. Gross Area:** | 1,828 |
| **Building Code:** | T7945090806 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $866,519 |
| **Building Name:** | WHEATON - TRUCK STATION | **Address:** | 505 2nd Avenue South | **Deferred Maintenance:** | $192,595 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | WHEATON | **Ext. Gross Area:** | 3,770 |
| **Building Code:** | T7945090814 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $24,574 |
| **Building Name:** | WHEATON - MISC STORAGE | **Address:** | 505 2nd Avenue South | **Deferred Maintenance:** | $4,321 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | WHEATON | **Ext. Gross Area:** | 224 |
| **Building Code:** | T7945090840 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $27,925 |
| **Building Name:** | WHEATON - BRINE BUILDING | **Address:** | 505 2nd Avenue South | **Deferred Maintenance:** | $1,613 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | WHEATON | **Ext. Gross Area:** | 120 |

### *Site: T794A90808 - GLENWOOD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020816 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $779,981 |
| **Building Name:** | GLENWOOD - SALT/SAND STORAGE | **Address:** | 70 MN Hwy 55 | **Deferred Maintenance:** | $149,907 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 9,197 |
| **Building Code:** | T7945090808 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,420,848 |
| **Building Name:** | GLENWOOD - TRUCK STATION | **Address:** | 70 MN Hwy 55 | **Deferred Maintenance:** | $294,304 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 6,475 |
| **Building Code:** | T7945090829 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $310,104 |
| **Building Name:** | GLENWOOD - POLE STORAGE BLDG | **Address:** | 70 MN Hwy 55 | **Deferred Maintenance:** | $21,089 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GLENWOOD | **Ext. Gross Area:** | 3,200 |

### *Site: T794A90816 - EVANSVILLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020803 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $392,309 |
| **Building Name:** | EVANSVILLE - SALT/SAND STORAGE | **Address:** | 20874 CO Rd 82 NW | **Deferred Maintenance:** | $164,590 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | EVANSVILLE | **Ext. Gross Area:** | 4,341 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945090816 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,498,624 |
| **Building Name:** | EVANSVILLE - TRUCK STATION | **Address:** | 20874 CO Rd 82 NW | **Deferred Maintenance:** | $504,942 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | EVANSVILLE | **Ext. Gross Area:** | 6,108 |
| **Building Code:** | T7945090838 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $17,659 |
| **Building Name:** | EVANSVILLE - BRINE BUILDING | **Address:** | 20874 CO Rd 82 NW | **Deferred Maintenance:** | $1,761 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | EVANSVILLE | **Ext. Gross Area:** | 120 |

### *Site: T794A90818 - ALEXANDRIA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020813 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $918,750 |
| **Building Name:** | ALEXANDRIA - SALT/SAND STORAGE | **Address:** | 1405 Hwy 27 W | **Deferred Maintenance:** | $222,467 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 9,080 |
| **Building Code:** | T7945090818 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,551,443 |
| **Building Name:** | ALEXANDRIA - TRUCK STATION | **Address:** | 1405 Hwy 27 W | **Deferred Maintenance:** | $1,033,518 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 20,278 |
| **Building Code:** | T7945090835 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $683,125 |
| **Building Name:** | ALEXANDRIA-UNHEATED STORAGE | **Address:** | 1405 Hwy 27 W | **Deferred Maintenance:** | $13,663 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 5,100 |
| **Building Code:** | T7945090836 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $276,193 |
| **Building Name:** | ALEXANDRIA - UNHEATED STORAGE | **Address:** | 1405 Hwy 27 W | **Deferred Maintenance:** | $58,992 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 2,240 |

### *Site: T794A90819 - ORTONVILLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020815 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $395,641 |
| **Building Name:** | ORTONVILLE - SALT/SAND STORAGE | **Address:** | Ingersoll Ave TH 12 | **Deferred Maintenance:** | $66,411 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 3,584 |
| **Building Code:** | T7945090819 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,160,152 |
| **Building Name:** | ORTONVILLE - TRUCK STATION | **Address:** | Ingersoll Ave TH 12 | **Deferred Maintenance:** | $269,278 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 4,946 |
| **Building Code:** | T7945090831 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $330,204 |
| **Building Name:** | ORTONVILLE - POLE STORAGE BLDG | **Address:** | Ingersoll Ave TH 12 | **Deferred Maintenance:** | $22,456 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | ORTONVILLE | **Ext. Gross Area:** | 3,200 |

### *Site: T794A90820 - MORRIS - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020820 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $513,913 |
| **Building Name:** | MORRIS - SALT/SAND STORAGE | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $86,967 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MORRIS | **Ext. Gross Area:** | 6,403 |
| **Building Code:** | T7945090820 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $10,260,664 |
| **Building Name:** | MORRIS - HEADQUARTERS | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $2,965,470 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | MORRIS | **Ext. Gross Area:** | 46,727 |
| **Building Code:** | T7945090821 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $674,122 |
| **Building Name:** | MORRIS - POLE STORAGE BLDG | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $108,204 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MORRIS | **Ext. Gross Area:** | 5,050 |
| **Building Code:** | T7945090827 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,367 |
| **Building Name:** | MORRIS - HAZARD MATL STORAGE | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $5,071 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MORRIS | **Ext. Gross Area:** | 72 |
| **Building Code:** | T7945090828 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,005,716 |
| **Building Name:** | MORRIS - POLE STORAGE BLDG | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $74,868 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MORRIS | **Ext. Gross Area:** | 9,408 |
| **Building Code:** | T7945090832 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $119,369 |
| **Building Name:** | MORRIS - WELLNESS BLDG | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $15,474 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MORRIS | **Ext. Gross Area:** | 816 |
| **Building Code:** | T7945090839 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $21,024 |
| **Building Name:** | MORRIS - MISC STORAGE | **Address:** | 610 MN Hwy 9 South | **Deferred Maintenance:** | $3,808 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MORRIS | **Ext. Gross Area:** | 100 |

### *Site: T794A90822 - BENSON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945020811 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $200,345 |
| **Building Name:** | BENSON - SALT/SAND STORAGE | **Address:** | 500 22nd Street South | **Deferred Maintenance:** | $52,585 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | BENSON | **Ext. Gross Area:** | 2,696 |
| **Building Code:** | T7945090822 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,224,644 |
| **Building Name:** | BENSON - TRUCK STATION | **Address:** | 500 22nd Street South | **Deferred Maintenance:** | $227,486 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | BENSON | **Ext. Gross Area:** | 6,195 |
| **Building Code:** | T7945090825 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $150,901 |
| **Building Name:** | BENSON - POLE STORAGE BLDG | **Address:** | 500 22nd Street South | **Deferred Maintenance:** | $20,358 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BENSON | **Ext. Gross Area:** | 1,563 |
| **Building Code:** | T7945090837 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,736 |
| **Building Name:** | BENSON - BRINE BUILDING | **Address:** | 500 22nd Street South | **Deferred Maintenance:** | $1,359 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | BENSON | **Ext. Gross Area:** | 120 |

### *Site: T794A92054 - RED RIVER - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940092054 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,608,408 |
| **Building Name:** | RED RIVER - WEIGH SCALE | **Address:** | I94 EB 2 mi west of 34th ave. | **Deferred Maintenance:** | $58,592 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | DILWORTH | **Ext. Gross Area:** | 6,764 |

### *Site: T794AR015680 - HANSEL LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940095400 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $226,717 |
| **Building Name:** | HANSEL LAKE - REST AREA | **Address:** | 11822 I94 WB | **Deferred Maintenance:** | $79,205 |
| **Facility Condition Index:** | 0.35 - Poor | **City Code:** | DALTON | **Ext. Gross Area:** | 859 |
| **Building Code:** | T7940095430 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $21,637 |
| **Building Name:** | HANSEL LAKE - RA MISC STORAGE | **Address:** | 11822 I94 WB | **Deferred Maintenance:** | $2,164 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DALTON | **Ext. Gross Area:** | 174 |

### *Site: T794AR022180 - LAKE LATOKA - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945095452 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $490,938 |
| **Building Name:** | LAKE LATOKA - REST AREA | **Address:** | I94 EB - 1 MI NW Jct 94/29 | **Deferred Maintenance:** | $53,827 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 1,652 |
| **Building Code:** | T7945095481 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,579 |
| **Building Name:** | LAKE LATOKA REST AREA - MISC STRG | **Address:** | I94 EB - 1 MI NW Jct 94/29 | **Deferred Maintenance:** | $352 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 163 |

### *Site: T794AR051480 - MOORHEAD - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940090648 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $75,814 |
| **Building Name:** | MOORHEAD REST AREA - LIFT STATION | **Address:** | 2951 11 1/2 ST SOUTH | **Deferred Maintenance:** | $9,989 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 520 |
| **Building Code:** | T7940095402 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,334,101 |
| **Building Name:** | MOORHEAD - REST AREA TIC | **Address:** | 2951 11 1/2 ST SOUTH | **Deferred Maintenance:** | $192,587 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 4,031 |
| **Building Code:** | T7940095434 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $12,581 |
| **Building Name:** | MOORHEAD - REST AREA MISC STRG | **Address:** | 2951 11 1/2 ST SOUTH | **Deferred Maintenance:** | $1,258 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MOORHEAD | **Ext. Gross Area:** | 120 |

### *Site: T794AR085607 - FRAZEE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940095411 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $663,074 |
| **Building Name:** | FRAZEE - REST AREA | **Address:** | US 10, MP 55.25 | **Deferred Maintenance:** | $112,343 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | FRAZEE | **Ext. Gross Area:** | 2,067 |

### *Site: T794AR152180 - BURGEN LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7945095450 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $242,629 |
| **Building Name:** | BURGEN LAKE - REST AREA | **Address:** | I-94 WB - 2 MI SW Alex | **Deferred Maintenance:** | $62,548 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 912 |
| **Building Code:** | T7945095480 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,579 |
| **Building Name:** | BURGEN LAKE - RA MISC STRG OLD | **Address:** | I-94 WB - 2 MI SW Alex | **Deferred Maintenance:** | $352 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 163 |
| **Building Code:** | T7945095482 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $27,843 |
| **Building Name:** | BURGEN LAKE - MISC STRG NEW | **Address:** | I-94 WB - 2 MI SW Alex | **Deferred Maintenance:** | $6,397 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ALEXANDRIA | **Ext. Gross Area:** | 192 |

### *Site: T794AR535620 - OTTER TAIL LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940095420 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $95,877 |
| **Building Name:** | OTTER TAIL LAKE - REST AREA | **Address:** | TH78 | **Deferred Maintenance:** | $13,864 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 154 |
| **Building Code:** | T7940095431 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,303 |
| **Building Name:** | OTTER TAIL LAKE - RA MISC STORAGE | **Address:** | TH 78 | **Deferred Maintenance:** | $326 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BATTLE LAKE | **Ext. Gross Area:** | 96 |

### *Site: T794AR540304 - SAURER'S LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7940095421 | **Cost Model Name:** | Vault Toilet | **Current Replacement Value:** | $96,325 |
| **Building Name:** | SAUER'S LAKE - REST AREA | **Address:** | TH59 | **Deferred Maintenance:** | $13,394 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 154 |
| **Building Code:** | T7940095433 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,303 |
| **Building Name:** | SAUERS LAKE - MISC STORAGE | **Address:** | TH59 | **Deferred Maintenance:** | $1,630 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DETROIT LAKES | **Ext. Gross Area:** | 96 |

### *Site: T795C91194 - ROSEVILLE - WATERSEDGE HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091194 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $28,428,694 |
| **Building Name:** | ROSEVILLE - WATERSEDGE - DIVISION | **Address:** | 1500 County Rd B2 W | **Deferred Maintenance:** | $4,477,643 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ROSEVILLE | **Ext. Gross Area:** | 162,759 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091195 | **Cost Model Name:** | Mid-rise Office Building, 5 to 10 story | **Current Replacement Value:** | $11,955,576 |
| **Building Name:** | ROSEVILLE - WATERSEDGE - TRAFFIC M | **Address:** | 1500 County Rd B2 W | **Deferred Maintenance:** | $1,017,116 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ROSEVILLE | **Ext. Gross Area:** | 56,223 |
| **Building Code:** | T7990091196 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $361,808 |
| **Building Name:** | ROSEVILLE - EMERG GEN BLDG | **Address:** | 1500 County Rd B2 W | **Deferred Maintenance:** | $10,262 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ROSEVILLE | **Ext. Gross Area:** | 840 |

### *Site: T795E91111 - HASTINGS ANTI-ICING BLDG*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091111 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $160,167 |
| **Building Name:** | HASTINGS HWY 61 - ANTI-ICING BLDG | **Address:** | | **Deferred Maintenance:** | $3,203 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | HASTINGS | **Ext. Gross Area:** | 952 |

### *Site: T795E91117 - MAPLEWOOD - METRO FLEET*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090918 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $24,301 |
| **Building Name:** | MAPLEWOOD - MISC STRG | **Address:** | 1771 MC MENEMY | **Deferred Maintenance:** | $4,305 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 2,400 |
| **Building Code:** | T7990090925 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $13,833 |
| **Building Name:** | MAPLEWOOD - HAZMAT STORAGE | **Address:** | 1771 MC MENEMY | **Deferred Maintenance:** | $10,375 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 60 |
| **Building Code:** | T7990091117 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,488,325 |
| **Building Name:** | MAPLEWOOD - METRO FLEET BUILDING | **Address:** | 1779 McMenemy | **Deferred Maintenance:** | $487,528 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 15,913 |
| **Building Code:** | T7990091161 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,124,661 |
| **Building Name:** | MAPLEWOOD - POLE STORAGE BLDG | **Address:** | 1779 McMenemy | **Deferred Maintenance:** | $93,112 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 9,032 |
| **Building Code:** | T7990091182 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,165,396 |
| **Building Name:** | MAPLEWOOD - BRIDGE CREW BLDG | **Address:** | 1771 MC MENEMY | **Deferred Maintenance:** | $175,224 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | MAPLEWOOD | **Ext. Gross Area:** | 18,717 |

### *Site: T795E91118 - ARDEN HILLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021116 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $647,175 |
| **Building Name:** | ARDEN HILLS - SALT/SAND STORAGE | **Address:** | 1905 W County Rd I | **Deferred Maintenance:** | $60,230 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 6,513 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091118 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,431,976 |
| **Building Name:** | ARDEN HILLS - TRUCK STATION | **Address:** | 1905 W County Rd I | **Deferred Maintenance:** | $1,460,117 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 27,467 |
| **Building Code:** | T7990091162 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $627,527 |
| **Building Name:** | ARDEN HILLS - POLE STORAGE BLDG | **Address:** | 1905 W County Rd I | **Deferred Maintenance:** | $96,643 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 6,779 |
| **Building Code:** | T7990091181 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $219,150 |
| **Building Name:** | ARDEN HILLS - BRINE BUILDING | **Address:** | 1905 W. COUNTY RD. I | **Deferred Maintenance:** | $10,034 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | ARDEN HILLS | **Ext. Gross Area:** | 1,581 |

### *Site: T795E91138 - OAKDALE - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021124 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,592,024 |
| **Building Name:** | OAKDALE - SALT/SAND STORAGE | **Address:** | 3485 Hadley Avenue North | **Deferred Maintenance:** | $93,719 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | OAKDALE | **Ext. Gross Area:** | 21,600 |
| **Building Code:** | T7990091119 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $323,944 |
| **Building Name:** | OAKDALE - COVERED STRG BINS | **Address:** | 3485 Hadley Avenue North | **Deferred Maintenance:** | $10,992 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | OAKDALE | **Ext. Gross Area:** | 5,889 |
| **Building Code:** | T7990091138 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $32,302,637 |
| **Building Name:** | OAKDALE - HEADQUARTERS | **Address:** | 3485 Hadley Avenue North | **Deferred Maintenance:** | $7,930,783 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | OAKDALE | **Ext. Gross Area:** | 150,918 |
| **Building Code:** | T7990091150 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,825 |
| **Building Name:** | OAKDALE - HAZMAT STORAGE | **Address:** | 3485 Hadley Avenue North | **Deferred Maintenance:** | $11,869 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | OAKDALE | **Ext. Gross Area:** | 168 |
| **Building Code:** | T7990091155 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,836,635 |
| **Building Name:** | OAKDALE - SIGN SHOP | **Address:** | 3485 Hadley Avenue North | **Deferred Maintenance:** | $629,799 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | OAKDALE | **Ext. Gross Area:** | 26,528 |
| **Building Code:** | T7990091166 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,095,735 |
| **Building Name:** | OAKDALE - EQUIP STORAGE | **Address:** | 3485 Hadley Avenue North | **Deferred Maintenance:** | $787,197 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | OAKDALE | **Ext. Gross Area:** | 24,036 |
| **Building Code:** | T7990091180 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,995,819 |
| **Building Name:** | OAKDALE - EQUIP/SIGN STORAGE | **Address:** | 3485 HADLEY AVE NO | **Deferred Maintenance:** | $56,955 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | OAKDALE | **Ext. Gross Area:** | 7,033 |

### *Site: T795E91139 - FOREST LAKE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021120 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $884,458 |
| **Building Name:** | FOREST LAKE - SALT/SAND STORAGE | **Address:** | 22010 Everton Avenue North | **Deferred Maintenance:** | $245,507 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 12,000 |
| **Building Code:** | T7990091139 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,604,229 |
| **Building Name:** | FOREST LAKE - TRUCK STATION | **Address:** | 22010 Everton Avenue North | **Deferred Maintenance:** | $413,741 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 10,912 |
| **Building Code:** | T7990091142 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,924,345 |
| **Building Name:** | FOREST LAKE - EQUIP STORAGE | **Address:** | 22010 Everton Avenue North | **Deferred Maintenance:** | $228,577 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 8,640 |
| **Building Code:** | T7990091154 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $214,159 |
| **Building Name:** | FOREST LAKE - MISC STORAGE | **Address:** | 22010 Everton Avenue North | **Deferred Maintenance:** | $16,114 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,952 |
| **Building Code:** | T7990091163 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,341,487 |
| **Building Name:** | FOREST LAKE - BRIDGE CREW - EQUIP | **Address:** | 22010 Everton Avenue North | **Deferred Maintenance:** | $143,317 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 7,680 |
| **Building Code:** | T7990091177 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $484,152 |
| **Building Name:** | FOREST LAKE - UNHEATED STORAGE BLDG | **Address:** | 22010 Everton Avenue North | **Deferred Maintenance:** | $27,232 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 4,512 |

### *Site: T795E91140 - NORTH BRANCH - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021125 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,160,133 |
| **Building Name:** | NORTH BRANCH-SAND/SALT STORAGE | **Address:** | 4841 Saint Croix Trail | **Deferred Maintenance:** | $78,224 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NORTH BRANCH | **Ext. Gross Area:** | 10,000 |
| **Building Code:** | T7990091140 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $3,055,073 |
| **Building Name:** | NORTH BRANCH - TRUCK STATION | **Address:** | 4841 Saint Croix Trail | **Deferred Maintenance:** | $640,829 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | NORTH BRANCH | **Ext. Gross Area:** | 17,931 |
| **Building Code:** | T7990091158 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $93,682 |
| **Building Name:** | NORTH BRANCH - MISC STORAGE | **Address:** | 4841 Saint Croix Trail | **Deferred Maintenance:** | $6,169 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | NORTH BRANCH | **Ext. Gross Area:** | 960 |
| **Building Code:** | T7990091171 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $10,030 |
| **Building Name:** | NORTH BRANCH - FUEL SYSTEM BLDG | **Address:** | 4841 Saint Croix Trail | **Deferred Maintenance:** | $1,857 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | NORTH BRANCH | **Ext. Gross Area:** | 144 |
| **Building Code:** | T7990091175 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $254,825 |
| **Building Name:** | NORTH BRANCH - POLE STORAGE | **Address:** | 4841 Saint Croix Trail | **Deferred Maintenance:** | $15,226 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | NORTH BRANCH | **Ext. Gross Area:** | 2,531 |

### *Site: T795E91141 - LAKEVILLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021119 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,085,080 |
| **Building Name:** | LAKEVILLE - SALT/SAND STORAGE | **Address:** | 16780 Kenrick Avenue | **Deferred Maintenance:** | $339,706 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LAKEVILLE | **Ext. Gross Area:** | 9,596 |
| **Building Code:** | T7990091141 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $5,688,804 |
| **Building Name:** | LAKEVILLE - TRUCK STATION | **Address:** | 16780 Kenrick Avenue | **Deferred Maintenance:** | $531,003 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LAKEVILLE | **Ext. Gross Area:** | 28,432 |
| **Building Code:** | T7990091164 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $273,838 |
| **Building Name:** | LAKEVILLE - UNHEATED STG | **Address:** | 16780 Kenrick Avenue | **Deferred Maintenance:** | $39,143 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | LAKEVILLE | **Ext. Gross Area:** | 2,560 |

### *Site: T795E91152 - MENDOTA HEIGHTS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021118 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,517,523 |
| **Building Name:** | MENDOTA - SALT/SAND STORAGE | **Address:** | 2229 Pilot Knob Road | **Deferred Maintenance:** | $566,073 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | MENDOTA HEIGHTS | **Ext. Gross Area:** | 13,160 |
| **Building Code:** | T7990091152 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $9,557,643 |
| **Building Name:** | MENDOTA HEIGHTS - TRUCK STATION | **Address:** | 2229 Pilot Knob Road | **Deferred Maintenance:** | $1,825,316 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MENDOTA HEIGHTS | **Ext. Gross Area:** | 44,573 |
| **Building Code:** | T7990091167 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $881,744 |
| **Building Name:** | MENDOTA HEIGHTS - POLE STRG | **Address:** | 2229 Pilot Knob Road | **Deferred Maintenance:** | $65,547 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MENDOTA HEIGHTS | **Ext. Gross Area:** | 8,529 |

### *Site: T795E91153 - HASTINGS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021121 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $796,012 |
| **Building Name:** | HASTINGS - SALT/SAND STORAGE | **Address:** | 951 E. 21st Street | **Deferred Maintenance:** | $157,784 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 10,800 |
| **Building Code:** | T7990091153 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $8,284,496 |
| **Building Name:** | HASTINGS - TRUCK STATION | **Address:** | 951 E. 21st Street | **Deferred Maintenance:** | $1,268,428 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | HASTINGS | **Ext. Gross Area:** | 32,693 |
| **Building Code:** | T7990091174 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $197,192 |
| **Building Name:** | HASTINGS - UNHEATED STORAGE BLDG | **Address:** | | **Deferred Maintenance:** | $10,949 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | HASTINGS | **Ext. Gross Area:** | 1,813 |

### *Site: T795E91159 - INVER GROVE HEIGHTS - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091159 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $785,849 |
| **Building Name:** | INVER GROVE HEIGHTS - MISC STORAGE | **Address:** | Near Jct TH 52 and TH55 | **Deferred Maintenance:** | $244,147 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | INVER GROVE HEIG | **Ext. Gross Area:** | 5,640 |

### *Site: T795E91165 - ST PAUL MARYLAND AVE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021117 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,591,267 |
| **Building Name:** | ST PAUL MARYLAND AVE - SALT/SAND | **Address:** | 244 East Maryland Avenue | **Deferred Maintenance:** | $620,017 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 14,193 |
| **Building Code:** | T7990090919 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $383,897 |
| **Building Name:** | ST PAUL MARYLAND AVE - POLE STRG | **Address:** | 244 East Maryland Avenue | **Deferred Maintenance:** | $28,845 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 3,910 |
| **Building Code:** | T7990091165 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $13,170,424 |
| **Building Name:** | ST PAUL MARYLAND AVE - TRUCK STA | **Address:** | 244 East Maryland Avenue | **Deferred Maintenance:** | $2,392,954 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 67,435 |
| **Building Code:** | T7990091168 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $486,383 |
| **Building Name:** | ST PAUL MARYLAND AVE - POLE STRG | **Address:** | 244 East Maryland Avenue | **Deferred Maintenance:** | $46,968 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 5,120 |
| **Building Code:** | T7990091170 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $15,825 |
| **Building Name:** | ST PAUL MARYLAND AVE - HAZMAT | **Address:** | 244 East Maryland Avenue | **Deferred Maintenance:** | $5,222 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 80 |

### *Site: T795E91178 - MENDOTA 35E - ANTI-ICING*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091178 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $73,250 |
| **Building Name:** | MENDOTA 35E - ANTI-ICING BLDG | **Address:** | I35E And TH13 | **Deferred Maintenance:** | $4,894 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | MENDOTA | **Ext. Gross Area:** | 480 |

### *Site: T795E91179 - TAYLORS FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021123 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $204,236 |
| **Building Name:** | TAYLORS FALLS - SALT/SAND STRG | **Address:** | 776 1ST STREET | **Deferred Maintenance:** | $4,085 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 3,525 |
| **Building Code:** | T7990091179 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $323,518 |
| **Building Name:** | TAYLORS FALLS -TRUCK STATION | **Address:** | 776 1ST STREET | **Deferred Maintenance:** | $14,271 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | TAYLORS FALLS | **Ext. Gross Area:** | 2,080 |

### *Site: T795E91183 - LAFAYETTE TH52 - ANTI-ICING*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091183 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $185,734 |
| **Building Name:** | ST PAUL TH52 - ANTI-ICING | **Address:** | 344 HWY 52 | **Deferred Maintenance:** | $3,715 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ST. PAUL | **Ext. Gross Area:** | 1,056 |

### *Site: T795E92129 - SAINT CROIX - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990092121 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $12,800 |
| **Building Name:** | ST CROIX - WIM BUILDING | **Address:** | 15800 Hudson Blvd | **Deferred Maintenance:** | $1,110 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | WEST LAKELAND TW | **Ext. Gross Area:** | 80 |
| **Building Code:** | T7990092129 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,799,661 |
| **Building Name:** | ST CROIX - WEIGH SCALE | **Address:** | 15800 Hudson Blvd | **Deferred Maintenance:** | $163,528 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | WEST LAKELAND TW | **Ext. Gross Area:** | 5,478 |
| **Building Code:** | T7990092144 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $57,244 |
| **Building Name:** | ST CROIX - WS MISC STORAGE | **Address:** | 15800 Hudson Blvd | **Deferred Maintenance:** | $1,145 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WEST LAKELAND TW | **Ext. Gross Area:** | 768 |

### *Site: T795ER198280 - FOREST LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990095900 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $619,915 |
| **Building Name:** | FOREST LAKE - REST AREA | **Address:** | I-35 SB - 1 MI SO OF FOREST LAK | **Deferred Maintenance:** | $143,445 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 1,871 |
| **Building Code:** | T7990095933 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $41,421 |
| **Building Name:** | FOREST LAKE - RA MISC STORAGE | **Address:** | | **Deferred Maintenance:** | $1,233 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | FOREST LAKE | **Ext. Gross Area:** | 261 |

### *Site: T795ER708203 - SAINT CROIX - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990095903 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,603,646 |
| **Building Name:** | ST CROIX - REST AREA TIC | **Address:** | 15800 Hudson Blvd | **Deferred Maintenance:** | $530,226 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | WEST LAKELAND TW | **Ext. Gross Area:** | 4,981 |
| **Building Code:** | T7990095931 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $67,297 |
| **Building Name:** | ST CROIX - RA MISC STORAGE | **Address:** | PO BOX 305 | **Deferred Maintenance:** | $18,955 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | WEST LAKELAND TW | **Ext. Gross Area:** | 650 |

### *Site: T795W21115 - HAMPTON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990021115 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $217,787 |
| **Building Name:** | HAMPTON - SALT/SAND STORAGE | **Address:** | TH56 at JCT 52 And 50 | **Deferred Maintenance:** | $67,330 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | HAMPTON | **Ext. Gross Area:** | 2,360 |

### *Site: T795W90902 - MAPLE GROVE I94 - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090902 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $48,604 |
| **Building Name:** | MAPLE GROVE - MISC STORAGE | **Address:** | | **Deferred Maintenance:** | $972 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 528 |

### *Site: T795W90910 - CEDAR AVENUE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020921 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $2,870,106 |
| **Building Name:** | CEDAR AVENUE - SALT/SAND STORAGE | **Address:** | 1900 East 66th Street | **Deferred Maintenance:** | $702,602 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 27,197 |
| **Building Code:** | T7990090904 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $14,228 |
| **Building Name:** | CEDAR AVENUE - HAZ MATERIAL STRG | **Address:** | 1900 East 66th Street | **Deferred Maintenance:** | $14,228 |
| **Facility Condition Index:** | 1.00 - Crisis | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 72 |
| **Building Code:** | T7990090906 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,072,614 |
| **Building Name:** | CEDAR AVENUE - FIRST BUILDING | **Address:** | 1900 East 66th Street | **Deferred Maintenance:** | $593,286 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 12,680 |
| **Building Code:** | T7990090910 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $20,199,570 |
| **Building Name:** | CEDAR AVENUE - TRUCK STATION | **Address:** | 1900 East 66th Street | **Deferred Maintenance:** | $3,673,952 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 77,943 |
| **Building Code:** | T7990090917 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,088,386 |
| **Building Name:** | CEDAR AVENUE - POLE STORAGE | **Address:** | 1900 East 66th Street | **Deferred Maintenance:** | $35,014 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | RICHFIELD | **Ext. Gross Area:** | 9,120 |

### *Site: T795W90920 - MINNEAPOLIS LOWRY HILL - TUNNEL*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090920 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $5,591,169 |
| **Building Name:** | MPLS LOWERY HILL - TUNNEL SERVICE | **Address:** | HENNEPIN AVE AT DOUGLAS AV | **Deferred Maintenance:** | $1,038,380 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 1,072 |

### *Site: T795W90926 - CHASKA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020924 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,035,736 |
| **Building Name:** | CHASKA - SALT/SAND STORAGE | **Address:** | 4725 Chaska Blvd | **Deferred Maintenance:** | $53,088 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | CHASKA | **Ext. Gross Area:** | 11,200 |
| **Building Code:** | T7990090926 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $11,469,558 |
| **Building Name:** | CHASKA - TRUCK STATION | **Address:** | 4725 Chaska Blvd | **Deferred Maintenance:** | $386,358 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | CHASKA | **Ext. Gross Area:** | 50,834 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090927 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $228,153 |
| **Building Name:** | CHASKA BRINE BUILDING | **Address:** | 4725 Chaska Blvd | **Deferred Maintenance:** | $5,187 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CHASKA | **Ext. Gross Area:** | 1,581 |
| **Building Code:** | T7990090951 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $900,336 |
| **Building Name:** | CHASKA - POLE STORAGE | **Address:** | 4725 Chaska Blvd | **Deferred Maintenance:** | $18,007 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CHASKA | **Ext. Gross Area:** | 7,620 |

### *Site: T795W90929 - SHAKOPEE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020915 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $529,099 |
| **Building Name:** | SHAKOPEE - SALT/SAND STORAGE | **Address:** | 12550 Chestnut Boulevard | **Deferred Maintenance:** | $131,404 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SHAKOPEE | **Ext. Gross Area:** | 6,272 |
| **Building Code:** | T7990090929 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,544,252 |
| **Building Name:** | SHAKOPEE - TRUCK STATION | **Address:** | 12550 Chestnut Boulevard | **Deferred Maintenance:** | $640,019 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SHAKOPEE | **Ext. Gross Area:** | 16,046 |
| **Building Code:** | T7990090999 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $568,531 |
| **Building Name:** | SHAKOPEE - POLE STORAGE | **Address:** | 12550 Chestnut Boulevard | **Deferred Maintenance:** | $136,458 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | SHAKOPEE | **Ext. Gross Area:** | 6,272 |

### *Site: T795W90930 - CAMDEN - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020912 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $583,047 |
| **Building Name:** | CAMDEN - SALT/SAND STORAGE | **Address:** | 3636 Washington Avenue North | **Deferred Maintenance:** | $52,595 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 6,403 |
| **Building Code:** | T7990090930 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $4,452,195 |
| **Building Name:** | CAMDEN - TRUCK STATION | **Address:** | 3636 Washington Avenue North | **Deferred Maintenance:** | $631,447 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 25,060 |

### *Site: T795W90931 - GOLDEN VALLEY - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020919 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $809,172 |
| **Building Name:** | GOLDEN VALLEY - SALT/SAND STORAGE | **Address:** | 2055 North Lilac Drive | **Deferred Maintenance:** | $290,081 |
| **Facility Condition Index:** | 0.36 - Poor | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 9,007 |
| **Building Code:** | T7990090931 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $29,908,027 |
| **Building Name:** | GOLDEN VALLEY - HEADQUARTERS | **Address:** | 2055 North Lilac Drive | **Deferred Maintenance:** | $7,149,275 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 121,542 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090938 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,244,743 |
| **Building Name:** | GOLDEN VALLEY - PATROL OFFICE | **Address:** | 2055 North Lilac Drive | **Deferred Maintenance:** | $240,190 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 5,333 |
| **Building Code:** | T7990090939 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $29,554 |
| **Building Name:** | GOLDEN VALLEY - FUEL SYSTEM BLDG | **Address:** | 2055 North Lilac Drive | **Deferred Maintenance:** | $1,771 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 208 |
| **Building Code:** | T7990090991 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,270,194 |
| **Building Name:** | GOLDEN VALLEY - POLE STORAGE | **Address:** | 2055 North Lilac Drive | **Deferred Maintenance:** | $244,275 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | GOLDEN VALLEY | **Ext. Gross Area:** | 16,870 |

### *Site: T795W90940 - ANOKA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020923 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $686,486 |
| **Building Name:** | ANOKA - SALT/SAND STORAGE | **Address:** | 3601 - 7TH AVE. N. | **Deferred Maintenance:** | $53,487 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ANOKA | **Ext. Gross Area:** | 9,231 |
| **Building Code:** | T7990090923 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,782 |
| **Building Name:** | ANOKA - MISC STORAGE | **Address:** | 3601 7th Avenue North | **Deferred Maintenance:** | $6,342 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 320 |
| **Building Code:** | T7990090940 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,634,707 |
| **Building Name:** | ANOKA - TRUCK STATION | **Address:** | 3601 7th Avenue North | **Deferred Maintenance:** | $503,073 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ANOKA | **Ext. Gross Area:** | 12,868 |
| **Building Code:** | T7990090997 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $521,252 |
| **Building Name:** | ANOKA - POLE STORAGE | **Address:** | 3601 7th Avenue North | **Deferred Maintenance:** | $29,271 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ANOKA | **Ext. Gross Area:** | 4,664 |

### *Site: T795W90944 - EDEN PRAIRIE TH169/I494 - ANTI-ICING*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090944 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $178,498 |
| **Building Name:** | EDINA 169/494 - ANTI-ICING BLDG | **Address:** | 8300 WEST 78TH STREET | **Deferred Maintenance:** | $3,570 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | EDINA | **Ext. Gross Area:** | 1,056 |

### *Site: T795W90945 - MINNEAPOLIS I35W BRIDGE - ANIT-ICING*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090945 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $161,400 |
| **Building Name:** | MPLS I35W - ANTI-ICING PUMPHOUSE | **Address:** | 921 2nd St SE | **Deferred Maintenance:** | $8,534 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 924 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090946 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $26,212 |
| **Building Name:** | MPLS - 35W ANIT-ICING COMM | **Address:** | 921 2nd St SE | **Deferred Maintenance:** | $2,621 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MINNEAPOLIS | **Ext. Gross Area:** | 120 |

### *Site: T795W90963 - PLYMOUTH - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020920 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,258,062 |
| **Building Name:** | PLYMOUTH - SALT/SAND STORAGE | **Address:** | 2315 Fernbrook Lane | **Deferred Maintenance:** | $312,339 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 17,086 |
| **Building Code:** | T7990090913 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $948,984 |
| **Building Name:** | PLYMOUTH - POLE STORAGE | **Address:** | 2315 Fernbrook Lane | **Deferred Maintenance:** | $119,229 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 8,092 |
| **Building Code:** | T7990090941 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $10,698,299 |
| **Building Name:** | PLYMOUTH - TS ADDITION | **Address:** | 2315 Fernbrook Lane | **Deferred Maintenance:** | $213,966 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 62,080 |
| **Building Code:** | T7990090963 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $5,175,002 |
| **Building Name:** | PLYMOUTH - TRUCK STATION | **Address:** | 2315 Fernbrook Lane | **Deferred Maintenance:** | $1,070,294 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 27,743 |
| **Building Code:** | T7990090989 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $236,638 |
| **Building Name:** | PLYMOUTH - MISC STORAGE | **Address:** | 2315 Fernbrook Lane | **Deferred Maintenance:** | $131,706 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | PLYMOUTH | **Ext. Gross Area:** | 2,400 |

### *Site: T795W90979 - SPRING LAKE PARK - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020917 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,619,105 |
| **Building Name:** | SPRING LAKE PARK - SALT/SAND STORAG | **Address:** | 1530 County Hwy 10 | **Deferred Maintenance:** | $174,494 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | SPRING LAKE PARK | **Ext. Gross Area:** | 9,984 |
| **Building Code:** | T7990090979 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $7,478,403 |
| **Building Name:** | SPRING LAKE PARK - TRUCK STATION | **Address:** | 1530 County Hwy 10 | **Deferred Maintenance:** | $1,396,840 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | SPRING LAKE PARK | **Ext. Gross Area:** | 39,317 |

### *Site: T795W90986 - EDEN PRAIRIE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020922 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $743,086 |
| **Building Name:** | EDEN PRAIRIE - SALT/SAND STORAGE | **Address:** | 7333 Bryant Lake Drive | **Deferred Maintenance:** | $143,155 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | EDEN PRAIRIE | **Ext. Gross Area:** | 9,999 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090903 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $796,499 |
| **Building Name:** | EDEN PRAIRIE - POLE STORAGE BLDG | **Address:** | 7333 Bryant Lake Drive | **Deferred Maintenance:** | $58,177 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | EDEN PRAIRIE | **Ext. Gross Area:** | 8,094 |
| **Building Code:** | T7990090986 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $6,658,198 |
| **Building Name:** | EDEN PRAIRIE - TRUCK STATION | **Address:** | 7333 Bryant Lake Drive | **Deferred Maintenance:** | $1,045,581 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | EDEN PRAIRIE | **Ext. Gross Area:** | 27,593 |

### *Site: T795W90988 - BLOOMINGTON PENN AVE - LIFT STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990090988 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $42,849 |
| **Building Name:** | BLOOMINGTON/PENN - LIFT STATION | **Address:** | I-494 and Penn Avenue | **Deferred Maintenance:** | $6,186 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BLOOMINGTON | **Ext. Gross Area:** | 226 |

### *Site: T795W90992 - MAPLE GROVE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990020925 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $891,793 |
| **Building Name:** | MAPLE GROVE SAND/SALT STORAGE | **Address:** | 9501 Hemlock Lane North | **Deferred Maintenance:** | $52,178 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 12,000 |
| **Building Code:** | T7990090947 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $907,263 |
| **Building Name:** | MAPLE GROVE - POLE STORAGE | **Address:** | 9501 Hemlock Lane North | **Deferred Maintenance:** | $18,349 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 7,620 |
| **Building Code:** | T7990090948 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $892,045 |
| **Building Name:** | MAPLE GROVE - POLE STORAGE | **Address:** | 9501 Hemlock Lane North | **Deferred Maintenance:** | $18,045 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 7,620 |
| **Building Code:** | T7990090949 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $228,153 |
| **Building Name:** | MAPLE GROVE - BRINE BLDG | **Address:** | 9501 Hemlock Lane North | **Deferred Maintenance:** | $4,563 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 1,580 |
| **Building Code:** | T7990090992 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $26,312,326 |
| **Building Name:** | MAPLE GROVE - TRUCK STATION | **Address:** | 9501 Hemlock Lane North | **Deferred Maintenance:** | $850,007 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 105,799 |

### *Site: T795W91148 - DAKOTA COUNTY - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990091176 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $61,468 |
| **Building Name:** | DAKOTA COUNTY - LOADER STORAGE BLDG | **Address:** | HWY 50/61 | **Deferred Maintenance:** | $2,139 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | MIESVILLE | **Ext. Gross Area:** | 560 |

### *Site: T795W92001 - DAYTONPORT - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990092139 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $294,937 |
| **Building Name:** | DAYTONPORT - WEIGH SCALE | **Address:** | US 10 - 6 MI NW OF ANOKA | **Deferred Maintenance:** | $66,025 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | ELK RIVER | **Ext. Gross Area:** | 659 |

### *Site: T795WR090202 - DAYTONPORT - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990095511 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $444,016 |
| **Building Name:** | DAYTONPORT - REST AREA | **Address:** | US 10 | **Deferred Maintenance:** | $50,373 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | RAMSEY | **Ext. Gross Area:** | 1,831 |

### *Site: T795WR232780 - ELM CREEK - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7990095500 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $778,714 |
| **Building Name:** | ELM CREEK - REST AREA | **Address:** | I-94 EB - 2 MI NO I-494 | **Deferred Maintenance:** | $102,564 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MAPLE GROVE | **Ext. Gross Area:** | 3,191 |

### *Site: T796A21208 - ZUMBRO FALLS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021208 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $87,262 |
| **Building Name:** | ZUMBRO FALLS - SALT/SAND STORAGE | **Address:** | NEAR 36527 MN 60 | **Deferred Maintenance:** | $62,194 |
| **Facility Condition Index:** | 0.71 - Crisis | **City Code:** | ZUMBRO FALLS | **Ext. Gross Area:** | 898 |
| **Building Code:** | T7960091245 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $47,368 |
| **Building Name:** | ZUMBRO FALLS - MISC STORAGE | **Address:** | NEAR 36527 MN 60 | **Deferred Maintenance:** | $7,711 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ZUMBRO FALLS | **Ext. Gross Area:** | 395 |

### *Site: T796A21212 - SPRING VALLEY - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021230 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $751,246 |
| **Building Name:** | SPRING VALLEY- SALT/SAND STORAGE | **Address:** | 512 East Guzwold Street | **Deferred Maintenance:** | $69,797 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | SPRING VALLEY | **Ext. Gross Area:** | 9,542 |

### *Site: T796A21219 - MARION - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021219 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $55,507 |
| **Building Name:** | MARION - SALT/SAND STORAGE | **Address:** | Hwy 52 and Co. Rd 19 | **Deferred Maintenance:** | $9,016 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARION | **Ext. Gross Area:** | 644 |
| **Building Code:** | T7960091231 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $41,014 |
| **Building Name:** | MARION - MISC STORAGE | **Address:** | Hwy 52 and Co. Rd 19 | **Deferred Maintenance:** | $6,677 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | MARION | **Ext. Gross Area:** | 384 |

### *Site: T796A21225 - LA CRESCENT - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021225 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,367,055 |
| **Building Name:** | LA CRESENT- SALT/SAND STORAGE | **Address:** | 511 Chestnut Blvd | **Deferred Maintenance:** | $136,705 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LA CRESCENT | **Ext. Gross Area:** | 11,108 |

### *Site: T796A21229 - CHATFIELD - LOADING SITE CNTY*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021229 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $520,689 |
| **Building Name:** | CHATFIELD - SALT/SAND STORAGE | **Address:** | 32647 LOST LOOP ROAD | **Deferred Maintenance:** | $67,627 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | CHATFIELD | **Ext. Gross Area:** | 5,788 |

### *Site: T796A21295 - DEXTER - LOADING SITE(LEASED)*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021295 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $817,715 |
| **Building Name:** | DEXTER - SALT/SAND STORAGE | **Address:** | NEAR 228 INDUSTRIAL PARK DR | **Deferred Maintenance:** | $81,772 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DEXTER | **Ext. Gross Area:** | 7,560 |

### *Site: T796A91206 - LAKE CITY - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960091206 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $258,995 |
| **Building Name:** | LAKE CITY - EQUIP STORAGE | **Address:** | 2101 South Oak | **Deferred Maintenance:** | $176,656 |
| **Facility Condition Index:** | 0.68 - Crisis | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 2,000 |
| **Building Code:** | T7960091207 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $846,992 |
| **Building Name:** | LAKE CITY - EQUIP STORAGE | **Address:** | 2101 South Oak | **Deferred Maintenance:** | $808,605 |
| **Facility Condition Index:** | 0.95 - Crisis | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 3,840 |

### *Site: T796A91216 - PRESTON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021226 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $816,796 |
| **Building Name:** | PRESTON - SALT/SAND STORAGE | **Address:** | TH 52AndTH 16 South | **Deferred Maintenance:** | $148,724 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 8,369 |
| **Building Code:** | T7960091216 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,218,203 |
| **Building Name:** | PRESTON - TRUCK STATION | **Address:** | TH 52 And TH 16 South | **Deferred Maintenance:** | $115,242 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | PRESTON | **Ext. Gross Area:** | 6,642 |
| **Building Code:** | T7960091274 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $131,913 |
| **Building Name:** | PRESTON - UNHEATED STORAGE | **Address:** | TH 52 And TH 16 South | **Deferred Maintenance:** | $20,658 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | PRESTON | **Ext. Gross Area:** | 952 |

### *Site: T796A91218 - WINONA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021220 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $956,394 |
| **Building Name:** | WINONA - SALT/SAND STORAGE | **Address:** | 5420 Highway 61 West | **Deferred Maintenance:** | $80,541 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 7,915 |
| **Building Code:** | T7960091218 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $4,581,156 |
| **Building Name:** | WINONA - TRUCK STATION | **Address:** | 5420 Highway 61 West | **Deferred Maintenance:** | $485,131 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 20,663 |
| **Building Code:** | T7960091219 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $467,884 |
| **Building Name:** | WINONA - EQUIP STORAGE | **Address:** | 5420 Highway 61 West | **Deferred Maintenance:** | $37,269 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 3,306 |
| **Building Code:** | T7960091254 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $408,783 |
| **Building Name:** | WINONA - POLE STORAGE BLDG | **Address:** | 5420 Highway 61 West | **Deferred Maintenance:** | $23,139 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 3,639 |
| **Building Code:** | T7960091261 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $424,824 |
| **Building Name:** | WINONA ( DUNN BLACKTOP) - EQUIP STG | **Address:** | 5420 Highway 61 West | **Deferred Maintenance:** | $110,955 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 2,301 |
| **Building Code:** | T7960091275 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $221,949 |
| **Building Name:** | WINONA- MISC STORAGE | **Address:** | 5420 Highway 61 West | **Deferred Maintenance:** | $11,539 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 1,995 |

### *Site: T796A91220 - STEWARTVILLE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021202 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $80,718 |
| **Building Name:** | STEWARTVILLE - BITUMINOUS STORAGE | **Address:** | 401 10th St NW | **Deferred Maintenance:** | $26,637 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | STEWARTVILLE | **Ext. Gross Area:** | 829 |
| **Building Code:** | T7960021224 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $683,747 |
| **Building Name:** | STEWARTVILLE - SALT/SAND STORAGE | **Address:** | 401 10th St NW | **Deferred Maintenance:** | $63,495 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | STEWARTVILLE | **Ext. Gross Area:** | 6,512 |
| **Building Code:** | T7960091220 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,979,192 |
| **Building Name:** | STEWARTVILLE - TRUCK STATION | **Address:** | 401 10th St NW | **Deferred Maintenance:** | $451,607 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | STEWARTVILLE | **Ext. Gross Area:** | 16,187 |
| **Building Code:** | T7960091267 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $808,186 |
| **Building Name:** | STEWARTVILLE - POLE STG BLDG | **Address:** | 401 10th St NW | **Deferred Maintenance:** | $32,844 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | STEWARTVILLE | **Ext. Gross Area:** | 5,831 |

### *Site: T796A91225 - ROCHESTER - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021235 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,267,535 |
| **Building Name:** | ROCHESTER - SALT/SAND STORAGE | **Address:** | 2900 48TH STREET N.W. | **Deferred Maintenance:** | $25,351 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 16,400 |
| **Building Code:** | T7960091225 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $32,111,284 |
| **Building Name:** | ROCHESTER - DISTRICT HEADQUARTERS | **Address:** | 2900 48th Street NW | **Deferred Maintenance:** | $1,105,092 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 104,561 |
| **Building Code:** | T7960091256 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $360,079 |
| **Building Name:** | ROCHESTER - UNHEATED STG | **Address:** | 2900 48th Street NW | **Deferred Maintenance:** | $13,628 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 3,240 |
| **Building Code:** | T7960091259 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $440,742 |
| **Building Name:** | ROCHESTER - UNHEATED STG | **Address:** | 2900 48th Street NW | **Deferred Maintenance:** | $41,833 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 3,840 |
| **Building Code:** | T7960091260 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $16,442 |
| **Building Name:** | ROCHESTER - HAZARD MATLS | **Address:** | 2900 48th Street NW | **Deferred Maintenance:** | $12,331 |
| **Facility Condition Index:** | 0.75 - Crisis | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 142 |
| **Building Code:** | T7960091266 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,058,505 |
| **Building Name:** | ROCHESTER - POLE STORAGE BLDG | **Address:** | 2900 48th Street NW | **Deferred Maintenance:** | $21,170 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 9,120 |
| **Building Code:** | T7960091270 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $32,048,588 |
| **Building Name:** | ROCHESTER - MAINTENANCE FACILITY | **Address:** | 2900 48TH STREET N.W. | **Deferred Maintenance:** | $640,972 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 114,084 |
| **Building Code:** | T7960091271 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $262,936 |
| **Building Name:** | ROCHESTER - BRINE BLDG | **Address:** | 2900 48th Street NW | **Deferred Maintenance:** | $5,259 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 1,581 |
| **Building Code:** | T7960091272 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,036,970 |
| **Building Name:** | ROCHESTER - UNHEATED STORAGE BLDG | **Address:** | 2900 48TH STREET N.W. | **Deferred Maintenance:** | $20,739 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 9,120 |
| **Building Code:** | T7960091273 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $415,586 |
| **Building Name:** | ROCHESTER - CVRD STORAGE BINS | **Address:** | 2900 48TH STREET N.W. | **Deferred Maintenance:** | $8,312 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ROCHESTER | **Ext. Gross Area:** | 7,068 |

### *Site: T796A91229 - SAINT CHARLES - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021205 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $147,994 |
| **Building Name:** | ST CHARLES - SALT/SAND STORAGE | **Address:** | I-90 And TH74 | **Deferred Maintenance:** | $12,132 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. CHARLES | **Ext. Gross Area:** | 2,010 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021221 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $644,386 |
| **Building Name:** | ST CHARLES - SALT/SAND STORAGE | **Address:** | I-90 And TH74 | **Deferred Maintenance:** | $66,311 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. CHARLES | **Ext. Gross Area:** | 10,399 |
| **Building Code:** | T7960091229 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $2,116,472 |
| **Building Name:** | ST CHARLES - TRUCK STATION | **Address:** | I-90 And TH74 | **Deferred Maintenance:** | $322,723 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | ST. CHARLES | **Ext. Gross Area:** | 11,829 |
| **Building Code:** | T7960091257 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $382,011 |
| **Building Name:** | ST CHARLES - POLE STORAGE BLDG | **Address:** | I-90 And TH74 | **Deferred Maintenance:** | $30,539 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. CHARLES | **Ext. Gross Area:** | 3,200 |

### *Site: T796A91230 - CALEDONIA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021228 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $513,673 |
| **Building Name:** | CALEDONIA - SALT/SAND STORAGE | **Address:** | 174 Bisson Street | **Deferred Maintenance:** | $32,015 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 6,403 |
| **Building Code:** | T7960091265 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $451,869 |
| **Building Name:** | CALEDONIA - POLE STORAGE BLDG | **Address:** | 174 Bisson Street | **Deferred Maintenance:** | $22,705 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 4,020 |
| **Building Code:** | T7960091269 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,686,556 |
| **Building Name:** | CALEDONIA -TRUCK STATION | **Address:** | 174 BISSEN ST N | **Deferred Maintenance:** | $33,731 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | CALEDONIA | **Ext. Gross Area:** | 8,845 |

### *Site: T796A91233 - CHATFIELD - OLD LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960091228 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $57,059 |
| **Building Name:** | CHATFIELD - MISC STORAGE | **Address:** | NEAR 1306 WINONA ST SE | **Deferred Maintenance:** | $24,093 |
| **Facility Condition Index:** | 0.42 - Poor | **City Code:** | CHATFIELD | **Ext. Gross Area:** | 480 |
| **Building Code:** | T7960091233 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $31,296 |
| **Building Name:** | CHATFIELD - SALT/SAND STORAGE | **Address:** | NEAR 1306 WINONA ST SE | **Deferred Maintenance:** | $18,357 |
| **Facility Condition Index:** | 0.59 - Crisis | **City Code:** | CHATFIELD | **Ext. Gross Area:** | 586 |

### *Site: T796A91247 - HOUSTON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021231 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $353,326 |
| **Building Name:** | HOUSTON LS- SALT/SAND STORAGE | **Address:** | 15298 MN 16 | **Deferred Maintenance:** | $21,436 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | HOUSTON | **Ext. Gross Area:** | 3,615 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960091268 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $316,949 |
| **Building Name:** | HOUSTON LS - EQUIP STORAGE | **Address:** | 15298 State Hwy 16 | **Deferred Maintenance:** | $15,985 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | HOUSTON | **Ext. Gross Area:** | 1,728 |

### *Site: T796A91249 - WABASHA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021236 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $269,702 |
| **Building Name:** | WABASHA - SALT/SAND STORAGE | **Address:** | 423 Hiawatha Drive NW | **Deferred Maintenance:** | $6,423 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WABASHA | **Ext. Gross Area:** | 8,640 |
| **Building Code:** | T7960091249 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $1,062,488 |
| **Building Name:** | WABASHA - TRUCK STATION | **Address:** | 423 Hiawatha Drive NW | **Deferred Maintenance:** | $98,067 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | WABASHA | **Ext. Gross Area:** | 5,294 |
| **Building Code:** | T7960091276 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $248,867 |
| **Building Name:** | WABASHA - UNHEATED STORAGE | **Address:** | 423 Hiawatha Drive NW | **Deferred Maintenance:** | $4,977 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WABASHA | **Ext. Gross Area:** | 3,480 |

### *Site: T796A91252 - DRESBACH - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021218 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $642,832 |
| **Building Name:** | DRESBACH - SALT/SAND STORAGE | **Address:** | 201 Riverview Drive | **Deferred Maintenance:** | $64,550 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | DRESBACH | **Ext. Gross Area:** | 5,425 |
| **Building Code:** | T7960091252 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,368,127 |
| **Building Name:** | DRESBACH - TRUCK STATION | **Address:** | 201 Riverview Drive | **Deferred Maintenance:** | $404,072 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | DRESBACH | **Ext. Gross Area:** | 13,323 |

### *Site: T796A91255 - WILSON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021227 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $326,319 |
| **Building Name:** | WILSON - SALT/SAND STORAGE | **Address:** | RR2 Box 180-A1 | **Deferred Maintenance:** | $32,632 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILSON TWP | **Ext. Gross Area:** | 4,013 |
| **Building Code:** | T7960091255 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $576,428 |
| **Building Name:** | WILSON - TRUCK STATION | **Address:** | RR2 Box 180-A1 | **Deferred Maintenance:** | $78,373 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WILSON TWP | **Ext. Gross Area:** | 3,926 |

### *Site: T796A91262 - RUSHFORD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960021223 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $775,260 |
| **Building Name:** | RUSHFORD - SALT/SAND STORAGE | **Address:** | 902 Enterprise Drive | **Deferred Maintenance:** | $55,271 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | RUSHFORD | **Ext. Gross Area:** | 10,000 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960091262 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,537,329 |
| **Building Name:** | RUSHFORD - TRUCK STATION | **Address:** | 902 Enterprise Drive | **Deferred Maintenance:** | $196,235 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | RUSHFORD | **Ext. Gross Area:** | 8,264 |
| **Building Code:** | T7960091263 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $341,115 |
| **Building Name:** | RUSHFORD - POLE STORAGE BLDG | **Address:** | 902 Enterprise Drive | **Deferred Maintenance:** | $12,467 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | RUSHFORD | **Ext. Gross Area:** | 3,211 |

### *Site: T796A92138 - WINONA - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960092138 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $51,873 |
| **Building Name:** | WINONA - WEIGH SCALE | **Address:** | 5420 Hwy 61 West | **Deferred Maintenance:** | $13,990 |
| **Facility Condition Index:** | 0.27 - Fair | **City Code:** | GOODVIEW | **Ext. Gross Area:** | 256 |

### *Site: T796AR075080 - HIGH FOREST - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960095600 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $508,049 |
| **Building Name:** | HIGH FOREST - REST AREA | **Address:** | 95600 East I-90 | **Deferred Maintenance:** | $31,587 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | STEWARTVILLE | **Ext. Gross Area:** | 2,135 |

### *Site: T796AR188580 - DRESBACH - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960095603 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,717,931 |
| **Building Name:** | DRESBACH - REST AREA TIC | **Address:** | I-90 WB/US61 | **Deferred Maintenance:** | $96,593 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LACRESCENT | **Ext. Gross Area:** | 3,723 |
| **Building Code:** | T7960095631 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $8,532 |
| **Building Name:** | DRESBACH - RA MISC STORAGE | **Address:** | I-90 WB/US61 | **Deferred Maintenance:** | $740 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LACRESCENT | **Ext. Gross Area:** | 80 |

### *Site: T796AR225580 - MARION - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960095604 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $550,599 |
| **Building Name:** | MARION - REST AREA | **Address:** | I90 WB,11MI W OF TH74 | **Deferred Maintenance:** | $45,687 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ST. CHARLES | **Ext. Gross Area:** | 2,234 |

### *Site: T796AR278580 - ENTERPRISE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7960095602 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $881,990 |
| **Building Name:** | ENTERPRISE - REST AREA | **Address:** | I-90 10 mi E of St. Charles | **Deferred Maintenance:** | $86,478 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ST. CHARLES | **Ext. Gross Area:** | 3,405 |

### *Site: T796B21303 - ELLENDALE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021334 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $242,869 |
| **Building Name:** | ELLENDALE - SALT/SAND STORAGE | **Address:** | 1/8 Mi E of Jct I-35 And TH 30 | **Deferred Maintenance:** | $21,207 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ELLENDALE | **Ext. Gross Area:** | 2,358 |

### *Site: T796B21309 - BLOOMING PRAIRIE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021333 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $151,669 |
| **Building Name:** | BLOOMING PRAIRIE - SALT/SAND STRG | **Address:** | TH 30-1Mi E of Jct TH 218 | **Deferred Maintenance:** | $19,966 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | BLOOMING PRAIRIE | **Ext. Gross Area:** | 1,925 |
| **Building Code:** | T7965091356 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $48,724 |
| **Building Name:** | BLOOMING PRAIRIE - MISC STORAGE | **Address:** | TH 30 - 1 MI E of Jct TH 218 | **Deferred Maintenance:** | $6,594 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BLOOMING PRAIRIE | **Ext. Gross Area:** | 497 |

### *Site: T796B21313 - KASSON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021332 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $313,797 |
| **Building Name:** | KASSON - SALT/SAND STORAGE | **Address:** | 63767 260th St | **Deferred Maintenance:** | $52,936 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | KASSON | **Ext. Gross Area:** | 2,360 |

### *Site: T796B21317 - ALBERT LEA WEST - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021317 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $218,185 |
| **Building Name:** | ALBERT LEA WEST - SALT/SAND STRG | **Address:** | 72618 225th | **Deferred Maintenance:** | $30,301 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 1,951 |

### *Site: T796B21326 - NORTHFIELD I35 - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021326 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $377,873 |
| **Building Name:** | NORTHFIELD - SALT/SAND STORAGE | **Address:** | 1765 IONSDALE BLVD WEST | **Deferred Maintenance:** | $116,726 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 3,605 |

### *Site: T796B21336 - FILLMORE COUNTY - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021336 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $528,248 |
| **Building Name:** | FILLMORE CNTY - SALT/SAND STORAGE | **Address:** | Jct TH 56 and TH 63 | **Deferred Maintenance:** | $32,046 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | CHESTER | **Ext. Gross Area:** | 4,544 |

### *Site: T796B91317 - NORTHFIELD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021318 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $87,231 |
| **Building Name:** | NORTHFIELD - SALT/SAND STORAGE | **Address:** | 510 West Woodley Street | **Deferred Maintenance:** | $49,238 |
| **Facility Condition Index:** | 0.56 - Crisis | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | T7965091317 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $899,690 |
| **Building Name:** | NORTHFIELD - TRUCK STATION | **Address:** | 510 West Woodley Street | **Deferred Maintenance:** | $328,594 |
| **Facility Condition Index:** | 0.37 - Poor | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 4,678 |
| **Building Code:** | T7965091318 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $259,363 |
| **Building Name:** | NORTHFIELD - MISC STORAGE | **Address:** | 510 West Woodley Street | **Deferred Maintenance:** | $97,543 |
| **Facility Condition Index:** | 0.38 - Poor | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 2,304 |

### *Site: T796B91319 - ALBERT LEA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021321 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $127,111 |
| **Building Name:** | ALBERT LEA - SALT/SAND STORAGE | **Address:** | 22231 - 770th Avenue | **Deferred Maintenance:** | $22,032 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,356 |
| **Building Code:** | T7965021331 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $551,996 |
| **Building Name:** | ALBERT LEA - SALT/SAND STORAGE | **Address:** | 22231 - 770th Avenue | **Deferred Maintenance:** | $66,537 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 7,505 |
| **Building Code:** | T7965091319 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $3,697,764 |
| **Building Name:** | ALBERT LEA - TRUCK STATION | **Address:** | 22231 - 770th Avenue | **Deferred Maintenance:** | $190,110 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 18,999 |
| **Building Code:** | T7965091346 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $52,694 |
| **Building Name:** | ALBERT LEA - MISC STORAGE | **Address:** | 22231 - 770th Avenue | **Deferred Maintenance:** | $7,236 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 680 |
| **Building Code:** | T7965091353 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $247,157 |
| **Building Name:** | ALBERT LEA - POLE STORAGE BLDG | **Address:** | 22231 - 770th Avenue | **Deferred Maintenance:** | $9,049 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 2,560 |

### *Site: T796B91327 - OWATONNA - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021322 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $114,164 |
| **Building Name:** | OWATONNA - SALT/SAND STORAGE | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $53,201 |
| **Facility Condition Index:** | 0.47 - Poor | **City Code:** | OWATONNA | **Ext. Gross Area:** | 1,824 |
| **Building Code:** | T7965021327 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $797,809 |
| **Building Name:** | OWATONNA - SALT/SAND STORAGE | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $220,426 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 6,715 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965091327 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $17,033,727 |
| **Building Name:** | OWATONNA - HEADQUARTERS | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $3,178,863 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 72,924 |
| **Building Code:** | T7965091329 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,320,598 |
| **Building Name:** | OWATONNA - POLE STORAGE BLDG | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $174,771 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 9,041 |
| **Building Code:** | T7965091347 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,015,535 |
| **Building Name:** | OWATONNA - POLE STORAGE BLDG | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $280,882 |
| **Facility Condition Index:** | 0.28 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 10,162 |
| **Building Code:** | T7965091352 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $56,796 |
| **Building Name:** | OWATONNA - MISC STORAGE | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $9,537 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | OWATONNA | **Ext. Gross Area:** | 783 |
| **Building Code:** | T7965091358 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $265,591 |
| **Building Name:** | OWATONNA - POLE STORAGE BLDG | **Address:** | 1010 - 21st Avenue NW | **Deferred Maintenance:** | $20,321 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 2,560 |
| **Building Code:** | T7965091367 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $736,244 |
| **Building Name:** | OWATONNA UNHEATED STORAGE | **Address:** | 1010 21ST AVENUE NW | **Deferred Maintenance:** | $14,725 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | OWATONNA | **Ext. Gross Area:** | 7,560 |

### *Site: T796B91331 - CANNON FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021310 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $71,320 |
| **Building Name:** | CANNON FALLS - SALT/SAND STORAGE | **Address:** | 31664 County Road 24 | **Deferred Maintenance:** | $52,101 |
| **Facility Condition Index:** | 0.73 - Crisis | **City Code:** | CANNON FALLS | **Ext. Gross Area:** | 896 |
| **Building Code:** | T7965021325 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $665,871 |
| **Building Name:** | CANNON FALLS - SALT/SAND STORAGE | **Address:** | 31664 County Road 24 | **Deferred Maintenance:** | $119,907 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | CANNON FALLS | **Ext. Gross Area:** | 5,538 |
| **Building Code:** | T7965091331 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $671,461 |
| **Building Name:** | CANNON FALLS - TRUCK STATION | **Address:** | 31664 County Road 24 | **Deferred Maintenance:** | $135,702 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CANNON FALLS | **Ext. Gross Area:** | 3,707 |
| **Building Code:** | T7965091360 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $359,732 |
| **Building Name:** | CANNON FALLS - POLE STORAGE BLDG | **Address:** | 31664 County Road 24 | **Deferred Maintenance:** | $13,394 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | CANNON FALLS | **Ext. Gross Area:** | 2,560 |

### *Site: T796B91339 - ZUMBROTA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021316 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $134,380 |
| **Building Name:** | ZUMBROTA - SALT/SAND STORAGE | **Address:** | 940 West 8th Street | **Deferred Maintenance:** | $80,899 |
| **Facility Condition Index:** | 0.60 - Crisis | **City Code:** | ZUMBROTA | **Ext. Gross Area:** | 1,280 |
| **Building Code:** | T7965021329 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $308,835 |
| **Building Name:** | ZUMBROTA-SALT/SAND STORAGE | **Address:** | 940 West 8th Street | **Deferred Maintenance:** | $38,055 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ZUMBROTA | **Ext. Gross Area:** | 4,409 |
| **Building Code:** | T7965091324 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $17,370 |
| **Building Name:** | ZUMBROTA - MISC STORAGE | **Address:** | 940 West 8th Street | **Deferred Maintenance:** | $11,311 |
| **Facility Condition Index:** | 0.65 - Crisis | **City Code:** | ZUMBROTA | **Ext. Gross Area:** | 800 |
| **Building Code:** | T7965091339 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $741,612 |
| **Building Name:** | ZUMBROTA - TRUCK STATION | **Address:** | 940 West 8th Street | **Deferred Maintenance:** | $87,378 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ZUMBROTA | **Ext. Gross Area:** | 5,241 |
| **Building Code:** | T7965091355 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $236,403 |
| **Building Name:** | ZUMBROTA - POLE STORAGE BLDG | **Address:** | 940 West 8th Street | **Deferred Maintenance:** | $22,513 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | ZUMBROTA | **Ext. Gross Area:** | 2,560 |

### *Site: T796B91344 - DODGE CENTER - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021319 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $257,263 |
| **Building Name:** | DODGE CENTER - SALT/SAND STORAGE | **Address:** | 61923 MN Hwy 56 | **Deferred Maintenance:** | $43,011 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | DODGE CENTER | **Ext. Gross Area:** | 3,060 |
| **Building Code:** | T7965091344 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $844,286 |
| **Building Name:** | DODGE CENTER - STORAGE FACILITY | **Address:** | 61923 MN Hwy 56 | **Deferred Maintenance:** | $157,973 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | DODGE CENTER | **Ext. Gross Area:** | 5,406 |
| **Building Code:** | T7965091351 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $179,906 |
| **Building Name:** | DODGE CENTER - POLE STORAGE BLDG | **Address:** | 61923 MN Hwy 56 | **Deferred Maintenance:** | $24,596 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | DODGE CENTER | **Ext. Gross Area:** | 1,536 |

### *Site: T796B91349 - AUSTIN - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021323 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,013,029 |
| **Building Name:** | AUSTIN - SALT/SAND STORAGE | **Address:** | 1500 - 11th Drive NE | **Deferred Maintenance:** | $164,796 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | AUSTIN | **Ext. Gross Area:** | 8,261 |
| **Building Code:** | T7965091349 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,730,039 |
| **Building Name:** | AUSTIN - TRUCK STATION | **Address:** | 1500 - 11th Drive NE | **Deferred Maintenance:** | $200,041 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | AUSTIN | **Ext. Gross Area:** | 15,611 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965091350 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $442,194 |
| **Building Name:** | AUSTIN - POLE STORAGE BLDG | **Address:** | 1500 - 11th Drive NE | **Deferred Maintenance:** | $27,576 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | AUSTIN | **Ext. Gross Area:** | 4,177 |

### *Site: T796B91354 - RED WING - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021328 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $727,039 |
| **Building Name:** | RED WING - SALT/SAND STORAGE | **Address:** | 3890 Pepin Avenue | **Deferred Maintenance:** | $73,193 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | RED WING | **Ext. Gross Area:** | 10,198 |
| **Building Code:** | T7965091354 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,301,944 |
| **Building Name:** | RED WING - TRUCK STATION | **Address:** | 3890 Pepin Avenue | **Deferred Maintenance:** | $90,366 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | RED WING | **Ext. Gross Area:** | 7,457 |
| **Building Code:** | T7965091359 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $234,531 |
| **Building Name:** | RED WING - POLE STORAGE BLDG | **Address:** | 3890 Pepin Avenue | **Deferred Maintenance:** | $14,846 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | RED WING | **Ext. Gross Area:** | 2,560 |

### *Site: T796B91361 - DODGE CENTER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021341 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $689,188 |
| **Building Name:** | DODGE CENTER - SALT/SAND STORAGE | **Address:** | 201 Airport Road | **Deferred Maintenance:** | $197,677 |
| **Facility Condition Index:** | 0.29 - Fair | **City Code:** | DODGE CENTER | **Ext. Gross Area:** | 9,000 |
| **Building Code:** | T7965091361 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,695,673 |
| **Building Name:** | DODGE CENTER - TRUCK STATION | **Address:** | 201 Airport Road | **Deferred Maintenance:** | $118,458 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | DODGE CENTER | **Ext. Gross Area:** | 10,170 |
| **Building Code:** | T7965091364 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $78,825 |
| **Building Name:** | DODGE CENTER - BRINE BLDG | **Address:** | 201 Airport Road | **Deferred Maintenance:** | $13,062 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | DODGE CENTER | **Ext. Gross Area:** | 378 |

### *Site: T796B91365 - FARIBAULT - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965021306 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $108,427 |
| **Building Name:** | FARIBAULT - SALT/SAND STORAGE | **Address:** | 555 NW 14th Street | **Deferred Maintenance:** | $62,525 |
| **Facility Condition Index:** | 0.58 - Crisis | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 1,522 |
| **Building Code:** | T7965021324 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $667,687 |
| **Building Name:** | FARIBAULT - SALT/SAND STORAGE | **Address:** | 555 NW 24th Street | **Deferred Maintenance:** | $204,734 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 5,436 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965091328 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,241,857 |
| **Building Name:** | FARIBAULT - EQUIP STORAGE | **Address:** | 555 NW 24th Street | **Deferred Maintenance:** | $301,350 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 8,000 |
| **Building Code:** | T7965091362 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $349,318 |
| **Building Name:** | FARIBAULT - POLE STORAGE BLDG | **Address:** | 555 NW 24th Street | **Deferred Maintenance:** | $11,705 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 3,067 |
| **Building Code:** | T7965091365 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,821,084 |
| **Building Name:** | FARIBAULT - TRUCK STATION | **Address:** | 555 NW 14th Street | **Deferred Maintenance:** | $136,812 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | FARIBAULT | **Ext. Gross Area:** | 9,949 |

### *Site: T796BR242480 - ALBERT LEA - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095662 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,132,589 |
| **Building Name:** | ALBERT LEA - REST AREA TIC | **Address:** | I-35 NB - 1 MI NO IA/MN BORDER | **Deferred Maintenance:** | $106,625 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 4,132 |
| **Building Code:** | T7965095681 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,323 |
| **Building Name:** | ALBERT LEA - RA MISC STRG | **Address:** | I-35 NB - 1 MI NO IA/MN BORDER | **Deferred Maintenance:** | $226 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ALBERT LEA | **Ext. Gross Area:** | 128 |

### *Site: T796BR587480 - STRAIGHT RIVER SOUTH - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095659 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $663,541 |
| **Building Name:** | STRAIGHT RIVER SOUTH - REST AREA | **Address:** | I-35 SB - 6 MI S. OF OWATONNA | **Deferred Maintenance:** | $53,444 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | OWATONNA | **Ext. Gross Area:** | 2,454 |
| **Building Code:** | T7965095685 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $11,371 |
| **Building Name:** | STRAIGHT RIVER SB - RA MISC STORAGE | **Address:** | I-35 SB - 6 MI S. OF OWATONNA | **Deferred Maintenance:** | $227 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | OWATONNA | **Ext. Gross Area:** | 128 |

### *Site: T796BR596680 - HEATH CREEK - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095657 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $742,321 |
| **Building Name:** | HEATH CREEK - REST AREA | **Address:** | I-35 NB - 10 MI NO OF FARIBAUL˙ | **Deferred Maintenance:** | $70,690 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 2,765 |
| **Building Code:** | T7965095688 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $81,974 |
| **Building Name:** | HEATH CREEK - MISC STRG | **Address:** | I-35 NB - 10 MI NO OF FARIBAUL˙ | **Deferred Maintenance:** | $1,639 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NORTHFIELD | **Ext. Gross Area:** | 567 |

### *Site: T796BR607080 - NEW MARKET - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095658 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $832,538 |
| **Building Name:** | NEW MARKET - REST AREA | **Address:** | I-35 SB - SO OF ELKO EXIT | **Deferred Maintenance:** | $79,832 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NEW MARKET | **Ext. Gross Area:** | 2,765 |
| **Building Code:** | T7965095687 | **Cost Model Name:** | Open Air Shelter | **Current Replacement Value:** | $39,801 |
| **Building Name:** | NEW MARKET - RA MISC STORAGE | **Address:** | I-35 SB - SO OF ELKO EXIT | **Deferred Maintenance:** | $796 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | NEW MARKET | **Ext. Gross Area:** | 567 |

### *Site: T796BR612482 - HAYWARD - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095655 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $288,691 |
| **Building Name:** | HAYWARD - REST AREA | **Address:** | I90 EB-2.2 MI E OF I35 | **Deferred Maintenance:** | $24,751 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | HAYWARD | **Ext. Gross Area:** | 1,637 |
| **Building Code:** | T7965095684 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $41,872 |
| **Building Name:** | HAYWARD - RA MISC STORAGE | **Address:** | I90 EB-2.2 MI E OF I35 | **Deferred Maintenance:** | $2,726 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | HAYWARD | **Ext. Gross Area:** | 268 |

### *Site: T796BR622482 - OAKLAND WOODS - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095656 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $322,969 |
| **Building Name:** | OAKLAND WOODS - REST AREA | **Address:** | I-90 WB - 1 MI WEST JCT CO RD | **Deferred Maintenance:** | $31,420 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | OAKLAND WOODS | **Ext. Gross Area:** | 1,648 |
| **Building Code:** | T7965095683 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $34,544 |
| **Building Name:** | OAKLAND WOODS - RA MISC STORAGE | **Address:** | I-90 WB - 1 MI WEST JCT CO RD | **Deferred Maintenance:** | $2,877 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | OAKLAND WOODS | **Ext. Gross Area:** | 268 |

### *Site: T796BR842513 - LAKE PEPIN - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7965095661 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $369,879 |
| **Building Name:** | LAKE PEPIN - REST AREA | **Address:** | US 61 - 5 MI NO OF LAKE CITY | **Deferred Maintenance:** | $31,409 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 1,555 |
| **Building Code:** | T7965095686 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $17,194 |
| **Building Name:** | LAKE PEPIN - RA MISC STORAGE | **Address:** | US 61 - 5 MI NO OF LAKE CITY | **Deferred Maintenance:** | $2,846 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | LAKE CITY | **Ext. Gross Area:** | 128 |

### *Site: T797E21429 - ALDEN - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021429 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $246,316 |
| **Building Name:** | ALDEN - SALT/SAND STORAGE | **Address:** | 64446 CO RD 46 | **Deferred Maintenance:** | $42,987 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ALDEN | **Ext. Gross Area:** | 2,496 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970091440 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $59,553 |
| **Building Name:** | ALDEN - MISC STORAGE | **Address:** | 64446 CO RD 46 | **Deferred Maintenance:** | $5,043 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | ALDEN | **Ext. Gross Area:** | 490 |

### *Site: T797E21431 - WATERVILLE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021431 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $244,035 |
| **Building Name:** | WATERVILLE YARD - SALT/SAND STORAGE | **Address:** | 411 Reed St | **Deferred Maintenance:** | $20,567 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WATERVILLE | **Ext. Gross Area:** | 2,496 |

### *Site: T797E91415 - BLUE EARTH - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021437 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $379,797 |
| **Building Name:** | BLUE EARTH - SAND/SALT STORAGE | **Address:** | 38379 115th STREET | **Deferred Maintenance:** | $7,596 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | BLUE EARTH | **Ext. Gross Area:** | 4,732 |
| **Building Code:** | T7970091415 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,362,074 |
| **Building Name:** | BLUE EARTH - TRUCK STATION | **Address:** | 38379 115TH STREET | **Deferred Maintenance:** | $335,055 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | BLUE EARTH | **Ext. Gross Area:** | 6,983 |
| **Building Code:** | T7970091441 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $294,987 |
| **Building Name:** | BLUE EARTH - POLE STORAGE BLDG | **Address:** | 38379 115TH STREET | **Deferred Maintenance:** | $20,314 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | BLUE EARTH | **Ext. Gross Area:** | 3,044 |

### *Site: T797E91416 - WELLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021438 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $337,405 |
| **Building Name:** | WELLS - SALT/SAND STORAGE | **Address:** | 585 7th Avenue SE | **Deferred Maintenance:** | $6,748 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WELLS | **Ext. Gross Area:** | 5,400 |
| **Building Code:** | T7970091416 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $827,794 |
| **Building Name:** | WELLS - TRUCK STATION | **Address:** | 585 7th Avenue SE | **Deferred Maintenance:** | $159,999 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WELLS | **Ext. Gross Area:** | 4,680 |
| **Building Code:** | T7970091429 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $331,933 |
| **Building Name:** | WELLS - UNHEATED STORAGE | **Address:** | 585 7th Avenue SE | **Deferred Maintenance:** | $30,218 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | WELLS | **Ext. Gross Area:** | 3,072 |
| **Building Code:** | T7970091450 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,768 |
| **Building Name:** | WELLS - BRINE BUILDING | **Address:** | 585 7th Avenue SE | **Deferred Maintenance:** | $3,642 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WELLS | **Ext. Gross Area:** | 402 |

### *Site: T797E91418 - SAINT PETER - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021417 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $384,727 |
| **Building Name:** | ST PETER - SALT/SAND STORAGE | **Address:** | 415 Ritt Street | **Deferred Maintenance:** | $47,197 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 3,935 |
| **Building Code:** | T7970091418 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $894,302 |
| **Building Name:** | ST PETER - TRUCK STATION | **Address:** | 415 Ritt Street | **Deferred Maintenance:** | $169,326 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | ST. PETER | **Ext. Gross Area:** | 5,856 |
| **Building Code:** | T7970091435 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $293,791 |
| **Building Name:** | ST PETER - POLE STORAGE BLDG | **Address:** | 415 Ritt Street | **Deferred Maintenance:** | $18,850 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 3,060 |
| **Building Code:** | T7970091446 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,261 |
| **Building Name:** | ST PETER - BRINE BUILDING | **Address:** | 415 Ritt Street | **Deferred Maintenance:** | $6,601 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | ST. PETER | **Ext. Gross Area:** | 402 |

### *Site: T797E91423 - MAPLETON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021421 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $267,109 |
| **Building Name:** | MAPLETON - SALT/SAND STORAGE | **Address:** | 403 8th Avenue SE | **Deferred Maintenance:** | $54,816 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MAPLETON | **Ext. Gross Area:** | 2,733 |
| **Building Code:** | T7970091423 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,064,357 |
| **Building Name:** | MAPLETON - TRUCK STATION | **Address:** | 403 8th Avenue SE | **Deferred Maintenance:** | $193,389 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MAPLETON | **Ext. Gross Area:** | 5,838 |
| **Building Code:** | T7970091427 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $31,183 |
| **Building Name:** | MAPLETON - MISC STORAGE | **Address:** | 403 8th Avenue SE | **Deferred Maintenance:** | $6,569 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MAPLETON | **Ext. Gross Area:** | 384 |
| **Building Code:** | T7970091428 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $329,096 |
| **Building Name:** | MAPLETON - POLE STORAGE BLDG | **Address:** | 403 8th Avenue SE | **Deferred Maintenance:** | $57,715 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | MAPLETON | **Ext. Gross Area:** | 3,088 |
| **Building Code:** | T7970091447 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $53,029 |
| **Building Name:** | MAPLETON - BRINE BUILDING | **Address:** | 403 8th Avenue SE | **Deferred Maintenance:** | $6,478 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MAPLETON | **Ext. Gross Area:** | 402 |

### *Site: T797E91430 - LE SUEUR - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021427 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $257,723 |
| **Building Name:** | LE SUEUR - SALT/SAND STORAGE | **Address:** | 201 Minnesota Avenue | **Deferred Maintenance:** | $30,254 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LE SUEUR | **Ext. Gross Area:** | 2,635 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970091430 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,395,100 |
| **Building Name:** | LE SUEUR - TRUCK STATION | **Address:** | 201 Minnesota Avenue | **Deferred Maintenance:** | $224,780 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LE SUEUR | **Ext. Gross Area:** | 8,473 |
| **Building Code:** | T7970091433 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $317,884 |
| **Building Name:** | LE SUEUR - POLE STORAGE BLDG | **Address:** | 201 Minnesota Avenue | **Deferred Maintenance:** | $36,594 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | LE SUEUR | **Ext. Gross Area:** | 3,476 |

### *Site: T797E91437 - MONTGOMERY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021428 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $257,723 |
| **Building Name:** | MONTGOMERY - SALT/SAND STORAGE | **Address:** | 201 Boulevard Avenue West | **Deferred Maintenance:** | $31,278 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MONTGOMERY | **Ext. Gross Area:** | 2,636 |
| **Building Code:** | T7970091405 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $382,199 |
| **Building Name:** | MONTGOMERY - EQUIP STORAGE | **Address:** | 201 Boulevard Avenue West | **Deferred Maintenance:** | $85,160 |
| **Facility Condition Index:** | 0.22 - Fair | **City Code:** | MONTGOMERY | **Ext. Gross Area:** | 2,698 |
| **Building Code:** | T7970091437 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $781,142 |
| **Building Name:** | MONTGOMERY - TRUCK STATION | **Address:** | 201 Boulevard Avenue West | **Deferred Maintenance:** | $89,913 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | MONTGOMERY | **Ext. Gross Area:** | 4,722 |

### *Site: T797E91438 - GAYLORD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021434 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $520,168 |
| **Building Name:** | GAYLORD - SALT/SAND STORAGE | **Address:** | 330 Railroad Avenue | **Deferred Maintenance:** | $61,521 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | GAYLORD | **Ext. Gross Area:** | 6,513 |
| **Building Code:** | T7970091438 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,268,323 |
| **Building Name:** | GAYLORD - TRUCK STATION | **Address:** | 330 Railroad Avenue | **Deferred Maintenance:** | $228,759 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | GAYLORD | **Ext. Gross Area:** | 8,366 |
| **Building Code:** | T7970091439 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $282,582 |
| **Building Name:** | GAYLORD - POLE STORAGE BLDG | **Address:** | 330 Railroad Avenue | **Deferred Maintenance:** | $17,984 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | GAYLORD | **Ext. Gross Area:** | 3,072 |

### *Site: T797E91445 - MANKATO - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021435 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $1,224,580 |
| **Building Name:** | MANKATO - SALT/SAND STORAGE | **Address:** | 2151 Bassett Drive | **Deferred Maintenance:** | $24,492 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | MANKATO | **Ext. Gross Area:** | 15,400 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970091442 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,454,595 |
| **Building Name:** | MANKATO - UNHEATED/BRINE STRG | **Address:** | 2151 Bassett Drive | **Deferred Maintenance:** | $60,823 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | MANKATO | **Ext. Gross Area:** | 9,120 |
| **Building Code:** | T7970091445 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $45,212,460 |
| **Building Name:** | MANKATO - HEADQUARTERS | **Address:** | 2151 Bassett Drive | **Deferred Maintenance:** | $2,339,500 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | MANKATO | **Ext. Gross Area:** | 175,808 |
| **Building Code:** | T7970091453 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $33,832 |
| **Building Name:** | MANKATO - HAZ MAT | **Address:** | 2151 Bassett Drive | **Deferred Maintenance:** | $3,383 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MANKATO | **Ext. Gross Area:** | 160 |

### *Site: T797E91452 - WASECA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021436 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $795,182 |
| **Building Name:** | WASECA - SALT/SAND STORAGE | **Address:** | 1500 State Street South | **Deferred Maintenance:** | $134,564 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | WASECA | **Ext. Gross Area:** | 10,000 |
| **Building Code:** | T7970091444 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $383,572 |
| **Building Name:** | WASECA - POLE STORAGE BLDG | **Address:** | 1500 State Street South | **Deferred Maintenance:** | $25,325 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WASECA | **Ext. Gross Area:** | 3,072 |
| **Building Code:** | T7970091452 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,543,704 |
| **Building Name:** | WASECA - TRUCK STATION | **Address:** | 1500 State Street South | **Deferred Maintenance:** | $45,442 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | WASECA | **Ext. Gross Area:** | 8,845 |

### *Site: T797E91456 - COURTLAND - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970021439 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $551,498 |
| **Building Name:** | COURTLAND - SALT/SAND STORAGE | **Address:** | 132 ZIESKE RD | **Deferred Maintenance:** | $11,030 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | COURTLAND | **Ext. Gross Area:** | 7,000 |
| **Building Code:** | T7970091456 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,589,593 |
| **Building Name:** | COURTLAND - TRUCK STATION | **Address:** | 132 ZIESKE RD | **Deferred Maintenance:** | $51,792 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | COURTLAND | **Ext. Gross Area:** | 10,102 |
| **Building Code:** | T7970091457 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $405,200 |
| **Building Name:** | COURTLAND - UNHEATED STORAGE | **Address:** | 132 ZIESKE RD | **Deferred Maintenance:** | $8,104 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | COURTLAND | **Ext. Gross Area:** | 3,400 |
| **Building Code:** | T7970091458 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $145,738 |
| **Building Name:** | COURTLAND - CVRD STORAGE BINS | **Address:** | 132 ZIESKE RD | **Deferred Maintenance:** | $2,915 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | COURTLAND | **Ext. Gross Area:** | 2,208 |

### *Site: T797ER632280 - BLUE EARTH EAST - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970095702 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $526,806 |
| **Building Name:** | BLUE EARTH EAST - REST AREA | **Address:** | I90 EB - BLUE EARTH | **Deferred Maintenance:** | $74,780 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | BLUE EARTH | **Ext. Gross Area:** | 1,736 |

### *Site: T797ER642280 - BLUE EARTH WEST - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970095703 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $520,903 |
| **Building Name:** | BLUE EARTH WEST - REST AREA | **Address:** | I-90 WB - BLUE EARTH | **Deferred Maintenance:** | $48,110 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | BLUE EARTH | **Ext. Gross Area:** | 1,738 |
| **Building Code:** | T7970095730 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $98,686 |
| **Building Name:** | BLUE EARTH WEST - RA MISC STORAGE | **Address:** | I90 WB - BLUE EARTH | **Deferred Maintenance:** | $8,235 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | BLUE EARTH | **Ext. Gross Area:** | 765 |

### *Site: T797ER804013 - MINNESOTA VALLEY - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7970095710 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $550,136 |
| **Building Name:** | MINNESOTA VALLEY - REST AREA | **Address:** | US 169 - NO OF LE SUEUR | **Deferred Maintenance:** | $86,366 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | LE SUEUR | **Ext. Gross Area:** | 1,913 |

### *Site: T797W21633 - MADELIA - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021633 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $275,415 |
| **Building Name:** | MADELIA - SALT/SAND STORAGE | **Address:** | 19 EAGER AV. NE | **Deferred Maintenance:** | $52,007 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MADELIA | **Ext. Gross Area:** | 3,400 |
| **Building Code:** | T7975091644 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $196,913 |
| **Building Name:** | MADELIA - LOADER STORAGE | **Address:** | 19 EAGER AV NE | **Deferred Maintenance:** | $11,775 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | MADELIA | **Ext. Gross Area:** | 560 |

### *Site: T797W91609 - LUVERNE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021622 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $210,469 |
| **Building Name:** | LUVERNE - SALT/SAND STORAGE | **Address:** | 301 W KOEHN AVENUE | **Deferred Maintenance:** | $21,577 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LUVERNE | **Ext. Gross Area:** | 1,462 |
| **Building Code:** | T7975021626 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $97,482 |
| **Building Name:** | LUVERNE - SALT/SAND STORAGE | **Address:** | 301 W KOEHN AVENUE | **Deferred Maintenance:** | $10,343 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | LUVERNE | **Ext. Gross Area:** | 944 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021632 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $336,042 |
| **Building Name:** | LUVERNE - SALT/SAND STORAGE | **Address:** | 301 W KOEHN AVENUE | **Deferred Maintenance:** | $64,738 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 3,932 |
| **Building Code:** | T7975091609 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,273,217 |
| **Building Name:** | LUVERNE - TRUCK STATION | **Address:** | 301 W KOEHN AVENUE | **Deferred Maintenance:** | $419,803 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | LUVERNE | **Ext. Gross Area:** | 10,307 |
| **Building Code:** | T7975091642 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $397,586 |
| **Building Name:** | LUVERNE - POLE STORAGE | **Address:** | 301 W KOEHN AVENUE | **Deferred Maintenance:** | $25,168 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | LUVERNE | **Ext. Gross Area:** | 3,853 |
| **Building Code:** | T7975091646 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $32,726 |
| **Building Name:** | LUVERNE - BRINE BUILDING | **Address:** | 301 W KOEHN AVENUE | **Deferred Maintenance:** | $10,799 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | LUVERNE | **Ext. Gross Area:** | 120 |

### *Site: T797W91613 - WORTHINGTON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021627 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $255,439 |
| **Building Name:** | WORTHINGTON - SALT/SAND STORAGE | **Address:** | 1475 SPRING AVENUE | **Deferred Maintenance:** | $45,594 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | WORTHINGTON | **Ext. Gross Area:** | 2,496 |
| **Building Code:** | T7975091613 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,955,711 |
| **Building Name:** | WORTHINGTON - TRUCK STATION | **Address:** | 1475 SPRING AVENUE | **Deferred Maintenance:** | $412,316 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WORTHINGTON | **Ext. Gross Area:** | 15,414 |
| **Building Code:** | T7975091634 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $317,179 |
| **Building Name:** | WORTHINGTON - POLE STORAGE | **Address:** | 1475 SPRING AVENUE | **Deferred Maintenance:** | $21,793 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WORTHINGTON | **Ext. Gross Area:** | 3,087 |

### *Site: T797W91614 - WINDOM - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021608 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $115,257 |
| **Building Name:** | WINDOM - SALT/SAND STORAGE | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $35,388 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | WINDOM | **Ext. Gross Area:** | 1,595 |
| **Building Code:** | T7975021624 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $250,877 |
| **Building Name:** | WINDOM - SALT/SAND STORAGE | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $34,480 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | WINDOM | **Ext. Gross Area:** | 2,496 |
| **Building Code:** | T7975091614 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $16,677,898 |
| **Building Name:** | WINDOM - HEADQUARTERS | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $3,126,220 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | WINDOM | **Ext. Gross Area:** | 56,213 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975091619 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $32,757 |
| **Building Name:** | WINDOM - MISC STORAGE | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $3,276 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WINDOM | **Ext. Gross Area:** | 227 |
| **Building Code:** | T7975091628 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $687,881 |
| **Building Name:** | WINDOM - POLE STORAGE | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $105,067 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | WINDOM | **Ext. Gross Area:** | 5,877 |
| **Building Code:** | T7975091641 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,162,160 |
| **Building Name:** | WINDOM - POLE STORAGE | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $77,830 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | WINDOM | **Ext. Gross Area:** | 11,520 |
| **Building Code:** | T7975091645 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $502,006 |
| **Building Name:** | WINDOM - BRINE BUILDING | **Address:** | 180 County Road 26 | **Deferred Maintenance:** | $13,304 |
| **Facility Condition Index:** | 0.03 - Excellent | **City Code:** | WINDOM | **Ext. Gross Area:** | 3,460 |

### *Site: T797W91616 - JACKSON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021607 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $99,577 |
| **Building Name:** | JACKSON - SALT/SAND STORAGE | **Address:** | 149 County Road 34 East | **Deferred Maintenance:** | $33,534 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | JACKSON | **Ext. Gross Area:** | 1,335 |
| **Building Code:** | T7975021629 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $275,907 |
| **Building Name:** | JACKSON - SALT/SAND STORAGE | **Address:** | 149 County Road 34 East | **Deferred Maintenance:** | $22,157 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | JACKSON | **Ext. Gross Area:** | 2,696 |
| **Building Code:** | T7975091616 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,919,879 |
| **Building Name:** | JACKSON - TRUCK STATION | **Address:** | 149 County Road 34 East | **Deferred Maintenance:** | $334,321 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | JACKSON | **Ext. Gross Area:** | 8,803 |
| **Building Code:** | T7975091643 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $430,957 |
| **Building Name:** | JACKSON - POLE STORAGE | **Address:** | 149 County Road 34 East | **Deferred Maintenance:** | $21,558 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | JACKSON | **Ext. Gross Area:** | 3,500 |
| **Building Code:** | T7975091649 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,560 |
| **Building Name:** | JACKSON - BRINE BUILDING | **Address:** | 149 County Road 3 East | **Deferred Maintenance:** | $8,765 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | JACKSON | **Ext. Gross Area:** | 120 |

### *Site: T797W91620 - FAIRMONT - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021621 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $251,048 |
| **Building Name:** | FAIRMONT - SALT/SAND STORAGE | **Address:** | 1300 Marcus Street | **Deferred Maintenance:** | $37,515 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | FAIRMONT | **Ext. Gross Area:** | 1,935 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021628 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $136,353 |
| **Building Name:** | FAIRMONT - SALT/SAND STORAGE | **Address:** | 1300 Marcus Street | **Deferred Maintenance:** | $14,133 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | FAIRMONT | **Ext. Gross Area:** | 944 |
| **Building Code:** | T7975091620 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,248,401 |
| **Building Name:** | FAIRMONT - TRUCK STATION | **Address:** | 1300 Marcus Street | **Deferred Maintenance:** | $241,032 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | FAIRMONT | **Ext. Gross Area:** | 6,983 |
| **Building Code:** | T7975091640 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $305,969 |
| **Building Name:** | FAIRMONT - POLE STORAGE | **Address:** | 1300 Marcus Street | **Deferred Maintenance:** | $20,808 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | FAIRMONT | **Ext. Gross Area:** | 3,072 |

### *Site: T797W91627 - SLEEPY EYE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021619 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $90,701 |
| **Building Name:** | SLEEPY EYE - SALT/SAND STORAGE | **Address:** | 900 Cedar Street NE | **Deferred Maintenance:** | $14,897 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | SLEEPY EYE | **Ext. Gross Area:** | 944 |
| **Building Code:** | T7975021630 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $257,723 |
| **Building Name:** | SLEEPY EYE - SALT/SAND STORAGE | **Address:** | 900 Cedar Street NE | **Deferred Maintenance:** | $44,978 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SLEEPY EYE | **Ext. Gross Area:** | 2,636 |
| **Building Code:** | T7975091627 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $717,638 |
| **Building Name:** | SLEEPY EYE - TRUCK STATION | **Address:** | 900 Cedar Street NE | **Deferred Maintenance:** | $177,228 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | SLEEPY EYE | **Ext. Gross Area:** | 4,338 |
| **Building Code:** | T7975091631 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $295,373 |
| **Building Name:** | SLEEPY EYE - POLE STORAGE | **Address:** | 900 Cedar Street NE | **Deferred Maintenance:** | $49,055 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | SLEEPY EYE | **Ext. Gross Area:** | 3,088 |
| **Building Code:** | T7975091647 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $30,449 |
| **Building Name:** | SLEEPY EYE - BRINE BUILDING | **Address:** | 900 Cedar Street NE | **Deferred Maintenance:** | $10,048 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | SLEEPY EYE | **Ext. Gross Area:** | 120 |

### *Site: T797W91629 - ADRIAN - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021623 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $251,026 |
| **Building Name:** | ADRIAN - SALT/SAND STORAGE | **Address:** | 504 County Road 35 | **Deferred Maintenance:** | $40,368 |
| **Facility Condition Index:** | 0.16 - Fair | **City Code:** | ADRIAN | **Ext. Gross Area:** | 2,496 |
| **Building Code:** | T7975091629 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,090,425 |
| **Building Name:** | ADRIAN - TRUCK STATION | **Address:** | 504 County Road 35 | **Deferred Maintenance:** | $197,968 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | ADRIAN | **Ext. Gross Area:** | 6,224 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975091630 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $413,578 |
| **Building Name:** | ADRIAN - POLE STORAGE | **Address:** | 504 County Road 35 | **Deferred Maintenance:** | $69,282 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | ADRIAN | **Ext. Gross Area:** | 4,177 |

### *Site: T797W91632 - SAINT JAMES - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021625 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $474,047 |
| **Building Name:** | ST JAMES - SALT/SAND STORAGE | **Address:** | 1513 - 7th Avenue South | **Deferred Maintenance:** | $41,217 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. JAMES | **Ext. Gross Area:** | 3,952 |
| **Building Code:** | T7975091632 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $2,779,715 |
| **Building Name:** | ST JAMES - TRUCK STATION | **Address:** | 1513 - 7th Avenue South | **Deferred Maintenance:** | $398,675 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | ST. JAMES | **Ext. Gross Area:** | 14,144 |
| **Building Code:** | T7975091633 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $438,479 |
| **Building Name:** | ST JAMES - POLE STORAGE | **Address:** | 1513 - 7th Avenue South | **Deferred Maintenance:** | $37,636 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | ST. JAMES | **Ext. Gross Area:** | 4,500 |
| **Building Code:** | T7975091648 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $31,880 |
| **Building Name:** | ST JAMES - BRINE BUILDING | **Address:** | 1513 - 7th Avenue South | **Deferred Maintenance:** | $10,520 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | ST. JAMES | **Ext. Gross Area:** | 120 |

### *Site: T797W91694 - SHERBURN - TRUCK STATION(LEASED)*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021631 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $106,902 |
| **Building Name:** | SHERBURN - SALT/SAND STORAGE | **Address:** | 221 FAIRMONT AVENUE | **Deferred Maintenance:** | $9,010 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | SHERBURN | **Ext. Gross Area:** | 1,054 |

### *Site: T797W91698 - STORDEN - TRUCK STATION(LEASED*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975021618 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $90,780 |
| **Building Name:** | STORDEN - SALT/SAND STORAGE | **Address:** | 100 MN Hwy 30 | **Deferred Maintenance:** | $15,793 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | STORDEN | **Ext. Gross Area:** | 1,025 |

### *Site: T797W92119 - WORTHINGTON - WEIGH SCALE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975092119 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $486,660 |
| **Building Name:** | WORTHINGTON - WEIGH SCALE | **Address:** | I-90 EAST OF WORTHINGTON | **Deferred Maintenance:** | $54,441 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WORTHINGTON | **Ext. Gross Area:** | 2,747 |
| **Building Code:** | T7975092145 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $98,942 |
| **Building Name:** | WORTHINGTON WS - WS MISC STORAGE | **Address:** | | **Deferred Maintenance:** | $1,979 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WORTHINGTON | **Ext. Gross Area:** | 960 |

### *Site: T797WR136780 - BEAVER CREEK - REST AREA TIC*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095750 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $1,207,840 |
| **Building Name:** | BEAVER CREEK - REST AREA TIC | **Address:** | BOX 90 | **Deferred Maintenance:** | $249,380 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | BEAVER CREEK | **Ext. Gross Area:** | 3,655 |
| **Building Code:** | T7975095782 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $33,749 |
| **Building Name:** | BEAVER CREEK - RA MISC STORAGE | **Address:** | BOX 90 | **Deferred Maintenance:** | $13,016 |
| **Facility Condition Index:** | 0.39 - Poor | **City Code:** | BEAVER CREEK | **Ext. Gross Area:** | 320 |
| **Building Code:** | T7975095787 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $40,637 |
| **Building Name:** | BEAVER CREEK - RA MISC STORAGE | **Address:** | BOX 90 | **Deferred Maintenance:** | $2,216 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | BEAVER CREEK | **Ext. Gross Area:** | 320 |

### *Site: T797WR165380 - ADRIAN WEST - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095751 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $391,105 |
| **Building Name:** | ADRIAN WEST - REST AREA | **Address:** | 14396 I-90 WESTBOUND | **Deferred Maintenance:** | $101,913 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | ADRIAN | **Ext. Gross Area:** | 1,150 |
| **Building Code:** | T7975095785 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $39,577 |
| **Building Name:** | ARIAN WB - RA MISC STORAGE | **Address:** | 14396 I-90 WESTBOUND | **Deferred Maintenance:** | $792 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ADRIAN | **Ext. Gross Area:** | 225 |

### *Site: T797WR175380 - ADRIAN EAST - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095752 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $391,105 |
| **Building Name:** | ADRIAN EAST - REST AREA | **Address:** | 13605 I-90 EASTBOUND | **Deferred Maintenance:** | $96,074 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | ADRIAN | **Ext. Gross Area:** | 1,150 |
| **Building Code:** | T7975095784 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $39,577 |
| **Building Name:** | ADRIAN EAST - RA MISC STORAGE | **Address:** | 13605 I-90 EASTBOUND | **Deferred Maintenance:** | $792 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | ADRIAN | **Ext. Gross Area:** | 225 |

### *Site: T797WR283280 - CLEAR LAKE - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095753 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $399,963 |
| **Building Name:** | CLEAR LAKE - REST AREA | **Address:** | 49567 I-90 EASTBOUND | **Deferred Maintenance:** | $119,034 |
| **Facility Condition Index:** | 0.30 - Fair | **City Code:** | JACKSON | **Ext. Gross Area:** | 1,150 |
| **Building Code:** | T7975095786 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $39,577 |
| **Building Name:** | CLEAR LAKE - RA MISC STORAGE | **Address:** | 49567 I-90 EASTBOUND | **Deferred Maintenance:** | $792 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | JACKSON | **Ext. Gross Area:** | 205 |

### *Site: T797WR293280 - DES MOINES - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095754 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $784,089 |
| **Building Name:** | DES MOINES - REST AREA | **Address:** | 52688 I-90 WESTBOUND | **Deferred Maintenance:** | $141,487 |
| **Facility Condition Index:** | 0.18 - Fair | **City Code:** | JACKSON | **Ext. Gross Area:** | 2,927 |

### *Site: T797WR669723 - WATONWAN - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095771 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $421,854 |
| **Building Name:** | WATONWAN - REST AREA | **Address:** | 77588 MN HWY 60 | **Deferred Maintenance:** | $185,842 |
| **Facility Condition Index:** | 0.44 - Poor | **City Code:** | ST. JAMES | **Ext. Gross Area:** | 1,576 |

### *Site: T797WR795305 - WORTHINGTON - REST AREA*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7975095770 | **Cost Model Name:** | Single-story Office/Public Access Facility | **Current Replacement Value:** | $773,167 |
| **Building Name:** | WORTHINGTON - REST AREA TIC | **Address:** | 29328 MN HWY 59 | **Deferred Maintenance:** | $103,934 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WORTHINGTON | **Ext. Gross Area:** | 2,457 |

### *Site: T798A21016 - NEW LONDON - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021016 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $243,864 |
| **Building Name:** | NEW LONDON - SALT/SAND STORAGE | **Address:** | 9750 187TH AVE NE | **Deferred Maintenance:** | $24,827 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | NEW LONDON | **Ext. Gross Area:** | 2,219 |

### *Site: T798A21516 - FLORENCE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021516 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $172,310 |
| **Building Name:** | FLORENCE - SALT/SAND STORAGE | **Address:** | JCT TH23 And TH14 | **Deferred Maintenance:** | $39,248 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | FLORENCE | **Ext. Gross Area:** | 1,614 |

### *Site: T798A91015 - OLIVIA - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021006 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $104,538 |
| **Building Name:** | OLIVIA - SALT/SAND STORAGE | **Address:** | 1509 LINCOLN ST W | **Deferred Maintenance:** | $17,954 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | OLIVIA | **Ext. Gross Area:** | 1,080 |
| **Building Code:** | T7980021519 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,031,692 |
| **Building Name:** | OLIVIA - SALT/SAND STORAGE | **Address:** | 1509 LINCOLN ST W | **Deferred Maintenance:** | $86,183 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | OLIVIA | **Ext. Gross Area:** | 9,166 |
| **Building Code:** | T7980091015 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,596,845 |
| **Building Name:** | OLIVIA - TRUCK STATION | **Address:** | 1509 W LINCOLN AVE | **Deferred Maintenance:** | $368,474 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | OLIVIA | **Ext. Gross Area:** | 7,619 |

### *Site: T798A91020 - CLARA CITY - STORAGE SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021007 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $91,303 |
| **Building Name:** | CLARA CITY - SALT/SAND STORAGE | **Address:** | 20 1ST AVE NE | **Deferred Maintenance:** | $13,769 |
| **Facility Condition Index:** | 0.15 - Fair | **City Code:** | CHISHOLM | **Ext. Gross Area:** | 1,050 |
| **Building Code:** | T7980091020 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $675,373 |
| **Building Name:** | CLARA CITY - UNHEATED STORAGE | **Address:** | 20 1ST AVE NE | **Deferred Maintenance:** | $134,488 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | CLARA CITY | **Ext. Gross Area:** | 4,320 |

### *Site: T798A91023 - WILLMAR - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021012 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,041,183 |
| **Building Name:** | WILLMAR - SALT/SAND STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $109,431 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 10,923 |
| **Building Code:** | T7980021017 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $272,715 |
| **Building Name:** | WILLMAR - SALT/SAND STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $26,536 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 2,328 |
| **Building Code:** | T7980091023 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $20,231,025 |
| **Building Name:** | WILLMAR - HEADQUARTERS | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $2,578,198 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 106,870 |
| **Building Code:** | T7980091024 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $345,447 |
| **Building Name:** | WILLMAR - POLE STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $39,394 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 8,493 |
| **Building Code:** | T7980091027 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $428,841 |
| **Building Name:** | WILLMAR - POLE STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $55,006 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 4,184 |
| **Building Code:** | T7980091029 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $28,386 |
| **Building Name:** | WILLMAR - HAZMAT STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $568 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WILLMAR | **Ext. Gross Area:** | 133 |
| **Building Code:** | T7980091032 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $28,433 |
| **Building Name:** | WILLMAR - BRINE BUILDING | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $1,480 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 513 |
| **Building Code:** | T7980091034 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $86,070 |
| **Building Name:** | WILLMAR - MISC STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $6,862 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | WILLMAR | **Ext. Gross Area:** | 779 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980091038 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $175,977 |
| **Building Name:** | WILLMAR - MISC STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $3,799 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | WILLMAR | **Ext. Gross Area:** | 768 |
| **Building Code:** | T7980091042 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $268,156 |
| **Building Name:** | WILLMAR - MISC STORAGE | **Address:** | 2505 TRANSPORTATION RD | **Deferred Maintenance:** | $12,286 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | WILLMAR | **Ext. Gross Area:** | 550 |

### *Site: T798A91025 - MILAN - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021019 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $53,339 |
| **Building Name:** | MILAN - SALT/SAND STORAGE | **Address:** | 0.5 MI NW OF MILAN ON HWY 7 | **Deferred Maintenance:** | $2,845 |
| **Facility Condition Index:** | 0.05 - Good | **City Code:** | MILAN | **Ext. Gross Area:** | 550 |
| **Building Code:** | T7980091025 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $91,544 |
| **Building Name:** | MILAN - MISC STORAGE | **Address:** | 0.5 MI NW OF MILAN ON HWY 7 | **Deferred Maintenance:** | $4,132 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | MILAN | **Ext. Gross Area:** | 773 |

### *Site: T798A91028 - MONTEVIDEO - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021009 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,029,085 |
| **Building Name:** | MONTEVIDEO - SALT/SAND STORAGE | **Address:** | 815 N 17TH ST | **Deferred Maintenance:** | $102,017 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | MONTEVIDEO | **Ext. Gross Area:** | 8,794 |
| **Building Code:** | T7980091028 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,277,815 |
| **Building Name:** | MONTEVIDEO - TRUCK STATION | **Address:** | 815 N 17TH ST | **Deferred Maintenance:** | $187,867 |
| **Facility Condition Index:** | 0.15 - Good | **City Code:** | MONTEVIDEO | **Ext. Gross Area:** | 6,457 |

### *Site: T798A91030 - HUTCHINSON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021014 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,531,843 |
| **Building Name:** | HUTCHINSON - SALT/SAND STORAGE | **Address:** | 1400 ADAMS ST SE | **Deferred Maintenance:** | $384,663 |
| **Facility Condition Index:** | 0.25 - Fair | **City Code:** | HUTCHINSON | **Ext. Gross Area:** | 12,497 |
| **Building Code:** | T7980091030 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $13,679,268 |
| **Building Name:** | HUTCHINSON - TRUCK STATION | **Address:** | 1400 ADAMS ST SE | **Deferred Maintenance:** | $2,291,632 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | HUTCHINSON | **Ext. Gross Area:** | 26,161 |
| **Building Code:** | T7980091033 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $978,057 |
| **Building Name:** | HUTCHINSON - POLE STORAGE | **Address:** | 1400 ADAMS ST SE | **Deferred Maintenance:** | $92,460 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | HUTCHINSON | **Ext. Gross Area:** | 8,722 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980091035 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $313,403 |
| **Building Name:** | HUTCHINSON - BRINE BUILDING | **Address:** | 1400 ADAMS ST SE | **Deferred Maintenance:** | $17,985 |
| **Facility Condition Index:** | 0.06 - Good | **City Code:** | HUTCHINSON | **Ext. Gross Area:** | 1,860 |

### *Site: T798A91031 - GLENCOE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021003 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $140,619 |
| **Building Name:** | GLENCOE - OLD SALT/SAND STORAGE | **Address:** | 113 8TH ST E | **Deferred Maintenance:** | $37,012 |
| **Facility Condition Index:** | 0.26 - Fair | **City Code:** | GLENCOE | **Ext. Gross Area:** | 1,050 |
| **Building Code:** | T7980021015 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $825,423 |
| **Building Name:** | GLENCOE - JOINT - SALT/SAND | **Address:** | 310 13TH ST W | **Deferred Maintenance:** | $71,793 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | GLENCOE | **Ext. Gross Area:** | 9,907 |
| **Building Code:** | T7980091003 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $315,977 |
| **Building Name:** | GLENCOE - OLD MISC STORAGE | **Address:** | 113 8TH ST E | **Deferred Maintenance:** | $97,403 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | GLENCOE | **Ext. Gross Area:** | 10,118 |
| **Building Code:** | T7980091031 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,835,293 |
| **Building Name:** | GLENCOE - TRUCK STATION | **Address:** | 310 13TH ST W | **Deferred Maintenance:** | $260,499 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | GLENCOE | **Ext. Gross Area:** | 9,422 |
| **Building Code:** | T7980091039 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $80,456 |
| **Building Name:** | GLENCOE - LOADER STORAGE | **Address:** | 310 13TH ST W | **Deferred Maintenance:** | $5,947 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GLENCOE | **Ext. Gross Area:** | 640 |
| **Building Code:** | T7980091040 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $24,360 |
| **Building Name:** | GLENCOE - BRINE BUILDING | **Address:** | 310 13TH ST W | **Deferred Maintenance:** | $1,954 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | GLENCOE | **Ext. Gross Area:** | 288 |

### *Site: T798A91036 - LITCHFIELD - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021018 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,013,852 |
| **Building Name:** | LITCHFIELD - SALT/SAND STORAGE | **Address:** | 422 S JOHNSON DRIVE | **Deferred Maintenance:** | $93,916 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LITCHFIELD | **Ext. Gross Area:** | 12,120 |
| **Building Code:** | T7980091036 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $9,363,473 |
| **Building Name:** | LITCHFIELD - TRUCK STATION | **Address:** | 422 S JOHNSON DRIVE | **Deferred Maintenance:** | $908,102 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LITCHFIELD | **Ext. Gross Area:** | 35,882 |
| **Building Code:** | T7980091041 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,290,953 |
| **Building Name:** | LITCHFIELD - POLE STORAGE | **Address:** | 422 S JOHNSON DRIVE | **Deferred Maintenance:** | $118,488 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LITCHFIELD | **Ext. Gross Area:** | 10,220 |

### *Site: T798A91514 - IVANHOE - LOADING SITE*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021503 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $92,706 |
| **Building Name:** | IVANHOE - SALT/SAND STORAGE | **Address:** | 513 WEST DIVISION | **Deferred Maintenance:** | $7,856 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | IVANHOE | **Ext. Gross Area:** | 1,080 |
| **Building Code:** | T7980021520 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $824,683 |
| **Building Name:** | IVANHOE - SALT/SAND STORAGE | **Address:** | 513 WEST DIVISION | **Deferred Maintenance:** | $100,823 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | IVANHOE | **Ext. Gross Area:** | 8,200 |
| **Building Code:** | T7980091514 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $528,461 |
| **Building Name:** | IVANHOE - STORAGE FACILITY | **Address:** | 513 WEST DIVISION | **Deferred Maintenance:** | $163,229 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | IVANHOE | **Ext. Gross Area:** | 2,695 |
| **Building Code:** | T7980091549 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $54,543 |
| **Building Name:** | IVANHOE - BRINE BLDG | **Address:** | 513 WEST DIVISION | **Deferred Maintenance:** | $5,766 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | IVANHOE | **Ext. Gross Area:** | 361 |

### *Site: T798A91517 - LAKE BENTON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021505 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $97,390 |
| **Building Name:** | LAKE BENTON - SALT/SAND STORAGE | **Address:** | 308 WEST BENTON ST | **Deferred Maintenance:** | $33,268 |
| **Facility Condition Index:** | 0.34 - Poor | **City Code:** | LAKE BENTON | **Ext. Gross Area:** | 1,080 |
| **Building Code:** | T7980091517 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $358,984 |
| **Building Name:** | LAKE BENTON - STORAGE FACILITY | **Address:** | 308 West Benton | **Deferred Maintenance:** | $110,253 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | LAKE BENTON | **Ext. Gross Area:** | 2,000 |
| **Building Code:** | T7980091551 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $478,002 |
| **Building Name:** | LAKE BENTON - TRUCK STATION | **Address:** | 308 WEST BENTON ST | **Deferred Maintenance:** | $44,313 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | LAKE BENTON | **Ext. Gross Area:** | 3,000 |
| **Building Code:** | T7980091555 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $25,758 |
| **Building Name:** | LAKE BENTON - MISC STORAGE | **Address:** | 308 WEST BENTON ST | **Deferred Maintenance:** | $2,576 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | LAKE BENTON | **Ext. Gross Area:** | 236 |

### *Site: T798A91521 - MADISON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021013 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $957,266 |
| **Building Name:** | MADISON - SALT/SAND STORAGE | **Address:** | 2340 HWY 40 E | **Deferred Maintenance:** | $158,005 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | MADISON | **Ext. Gross Area:** | 8,855 |
| **Building Code:** | T7980091506 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $121,269 |
| **Building Name:** | MADISON - MISC STORAGE | **Address:** | 2340 HWY 40 E | **Deferred Maintenance:** | $16,790 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MADISON | **Ext. Gross Area:** | 1,024 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980091521 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,109,569 |
| **Building Name:** | MADISON - TRUCK STATION | **Address:** | 2340 HWY 40 E | **Deferred Maintenance:** | $146,820 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | MADISON | **Ext. Gross Area:** | 5,818 |
| **Building Code:** | T7980091547 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $65,559 |
| **Building Name:** | MADISON - BRINE BUILDING | **Address:** | 2340 HWY 40 E | **Deferred Maintenance:** | $7,149 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | MADISON | **Ext. Gross Area:** | 440 |

### *Site: T798A91523 - MARSHALL - HEADQUARTERS*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021507 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $170,432 |
| **Building Name:** | MARSHALL - SALT/SAND STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $36,481 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | MARSHALL | **Ext. Gross Area:** | 1,890 |
| **Building Code:** | T7980021523 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,336,164 |
| **Building Name:** | MARSHALL - SALT/SAND STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $116,844 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | MARSHALL | **Ext. Gross Area:** | 14,942 |
| **Building Code:** | T7980091523 | **Cost Model Name:** | Joint Office/Warehouse Facility | **Current Replacement Value:** | $15,896,759 |
| **Building Name:** | MARSHALL - HEADQUARTERS | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $2,987,821 |
| **Facility Condition Index:** | 0.19 - Fair | **City Code:** | MARSHALL | **Ext. Gross Area:** | 63,034 |
| **Building Code:** | T7980091524 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $61,607 |
| **Building Name:** | MARSHALL - MISC STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $19,058 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | MARSHALL | **Ext. Gross Area:** | 560 |
| **Building Code:** | T7980091532 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $384,167 |
| **Building Name:** | MARSHALL - MISC STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $86,543 |
| **Facility Condition Index:** | 0.23 - Fair | **City Code:** | MARSHALL | **Ext. Gross Area:** | 3,120 |
| **Building Code:** | T7980091535 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,494,318 |
| **Building Name:** | MARSHALL - MISC STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $487,542 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MARSHALL | **Ext. Gross Area:** | 8,167 |
| **Building Code:** | T7980091537 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $232,436 |
| **Building Name:** | MARSHALL - MISC STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $25,997 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | MARSHALL | **Ext. Gross Area:** | 1,600 |
| **Building Code:** | T7980091543 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $261,392 |
| **Building Name:** | MARSHALL - POLE STORAGE BLDG | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $36,191 |
| **Facility Condition Index:** | 0.14 - Good | **City Code:** | MARSHALL | **Ext. Gross Area:** | 2,601 |
| **Building Code:** | T7980091548 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $272,257 |
| **Building Name:** | MARSHALL - BRINE BLDG | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $12,962 |
| **Facility Condition Index:** | 0.05 - Excellent | **City Code:** | MARSHALL | **Ext. Gross Area:** | 1,757 |

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980091556 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $29,880 |
| **Building Name:** | MARSHALL - HAZMAT STORAGE | **Address:** | 1800 EAST COLLEGE DRIVE | **Deferred Maintenance:** | $9,860 |
| **Facility Condition Index:** | 0.33 - Poor | **City Code:** | MARSHALL | **Ext. Gross Area:** | 135 |

### *Site: T798A91534 - SLAYTON - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021508 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $524,171 |
| **Building Name:** | SLAYTON - SALT/SAND STORAGE | **Address:** | 891 US Hwy 59 | **Deferred Maintenance:** | $107,073 |
| **Facility Condition Index:** | 0.20 - Fair | **City Code:** | SLAYTON | **Ext. Gross Area:** | 4,284 |
| **Building Code:** | T7980091550 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $170,340 |
| **Building Name:** | SLAYTON - BRINE BUILDING | **Address:** | 891 US Hwy 59 | **Deferred Maintenance:** | $13,973 |
| **Facility Condition Index:** | 0.08 - Good | **City Code:** | SLAYTON | **Ext. Gross Area:** | 1,210 |
| **Building Code:** | T7980091553 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $987,785 |
| **Building Name:** | SLAYTON - TRUCK STATION | **Address:** | 891 US HWY 59 | **Deferred Maintenance:** | $42,894 |
| **Facility Condition Index:** | 0.04 - Excellent | **City Code:** | SLAYTON | **Ext. Gross Area:** | 5,888 |

### *Site: T798A91536 - REDWOOD FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021512 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $254,119 |
| **Building Name:** | REDWOOD FALLS - GRADER STORAGE | **Address:** | 217 QUALITY DRIVE | **Deferred Maintenance:** | $23,001 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 1,440 |
| **Building Code:** | T7980021525 | **Cost Model Name:** | Fabric Structure | **Current Replacement Value:** | $517,244 |
| **Building Name:** | REDWOOD FALLS-SALT/SAND STRG | **Address:** | 217 QUALITY DRIVE | **Deferred Maintenance:** | $46,766 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 6,403 |
| **Building Code:** | T7980091536 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $892,570 |
| **Building Name:** | REDWOOD FALLS - TRUCK STATION | **Address:** | 217 QUALITY DRIVE | **Deferred Maintenance:** | $210,811 |
| **Facility Condition Index:** | 0.24 - Fair | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 5,305 |
| **Building Code:** | T7980091538 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $48,870 |
| **Building Name:** | REDWOOD FALLS - MISC STORAGE | **Address:** | 217 QUALITY DRIVE | **Deferred Maintenance:** | $5,601 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 411 |
| **Building Code:** | T7980091546 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $78,549 |
| **Building Name:** | REDWOOD FALLS - BRINE BUILDING | **Address:** | 217 QUALITY DRIVE | **Deferred Maintenance:** | $7,855 |
| **Facility Condition Index:** | 0.10 - Good | **City Code:** | REDWOOD FALLS | **Ext. Gross Area:** | 610 |

### *Site: T798A91539 - GRANITE FALLS - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021513 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $266,356 |
| **Building Name:** | GRANITE FALLS - SALT/SAND STORAGE | **Address:** | 5530 HWY 67 | **Deferred Maintenance:** | $45,842 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 2,650 |
| **Building Code:** | T7980021521 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $1,181,877 |
| **Building Name:** | GRANITE FALLS - SALT/SAND STORAGE | **Address:** | 5530 HWY 67 | **Deferred Maintenance:** | $131,202 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 9,734 |
| **Building Code:** | T7980091539 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,110,224 |
| **Building Name:** | GRANITE FALLS - TRUCK STATION | **Address:** | 5530 HWY 67 | **Deferred Maintenance:** | $187,493 |
| **Facility Condition Index:** | 0.17 - Fair | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 6,155 |
| **Building Code:** | T7980091544 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $46,988 |
| **Building Name:** | GRANITE FALLS - BRINE BUILDING | **Address:** | 5530 HWY 67 | **Deferred Maintenance:** | $3,255 |
| **Facility Condition Index:** | 0.07 - Good | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 256 |
| **Building Code:** | T7980091557 | **Cost Model Name:** | Utility Shed | **Current Replacement Value:** | $26,488 |
| **Building Name:** | GRANITE FALLS - MISC STORAGE | **Address:** | 5530 HWY 67 | **Deferred Maintenance:** | $530 |
| **Facility Condition Index:** | 0.02 - Excellent | **City Code:** | GRANITE FALLS | **Ext. Gross Area:** | 240 |

### *Site: T798A91541 - TRACY - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021517 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $690,225 |
| **Building Name:** | TRACY - SALT/SAND STORAGE | **Address:** | 1040 4TH ST E | **Deferred Maintenance:** | $143,276 |
| **Facility Condition Index:** | 0.21 - Fair | **City Code:** | TRACY | **Ext. Gross Area:** | 6,905 |
| **Building Code:** | T7980091541 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,001,523 |
| **Building Name:** | TRACY - TRUCK STATION | **Address:** | 1040 4TH ST E | **Deferred Maintenance:** | $309,978 |
| **Facility Condition Index:** | 0.31 - Poor | **City Code:** | TRACY | **Ext. Gross Area:** | 5,111 |

### *Site: T798A91542 - PIPESTONE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980021518 | **Cost Model Name:** | Open Air Storage Structure | **Current Replacement Value:** | $857,203 |
| **Building Name:** | PIPESTONE - SALT/SAND STORAGE | **Address:** | 604 4TH ST NW | **Deferred Maintenance:** | $104,075 |
| **Facility Condition Index:** | 0.12 - Good | **City Code:** | PIPESTONE | **Ext. Gross Area:** | 8,200 |
| **Building Code:** | T7980091542 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,559,149 |
| **Building Name:** | PIPESTONE - TRUCK STATION | **Address:** | 604 4TH ST NW | **Deferred Maintenance:** | $201,851 |
| **Facility Condition Index:** | 0.13 - Good | **City Code:** | PIPESTONE | **Ext. Gross Area:** | 8,808 |
| **Building Code:** | T7980091545 | **Cost Model Name:** | Single-story Work Facility | **Current Replacement Value:** | $86,262 |
| **Building Name:** | PIPESTONE - BRINE BUILDING | **Address:** | 604 4TH ST NW | **Deferred Maintenance:** | $9,079 |
| **Facility Condition Index:** | 0.11 - Good | **City Code:** | PIPESTONE | **Ext. Gross Area:** | 625 |

## *Site: T798A91552 - IVANHOE - TRUCK STATION*

| | | | | | |
|---|---|---|---|---|---|
| **Building Code:** | T7980091552 | **Cost Model Name:** | Butler-style Warehouse Building | **Current Replacement Value:** | $1,403,085 |
| **Building Name:** | IVANHOE - TRUCK STATION | **Address:** | 513 WEST DIVISION | **Deferred Maintenance:** | $128,166 |
| **Facility Condition Index:** | 0.09 - Good | **City Code:** | IVANHOE | **Ext. Gross Area:** | 19,983 |